Total NDT
Non-Destructive Specialist

Address: 1747 Willow Lake Dr. White Oak, TX 75693 Phone: 430-201-2070

Ultrasonic Examination Report

Client:	SAChem	**Location:**	**2311 Pipeline Rd. Cleburne, Tx 76033**	**Report No.**	1 OF 1
Procedure:	TNDT-UT-003 Rev. 3			**Date:**	11/4/2025
Code/Specification:	ASME Sec. V			**P/O No.**	OilPro003
Item Description:	Vessel			**Total NDT SC #**	200-25-487
Scope of Examination:	UT Thickness on Specified Areas			**Dwg:**	54-11-001 Trimethylamine Storage

Testing Parameters

Instrument Mfg.	Olympus	Model:	38DL Plus		S/N:	130715308		Calibration Date		3/3/2026			
Longitudinal Frequency 0°	5MHz	MHz	Size	.375"	Type:	Echo to Echo	S/N:	812283	Ref. dB	65	Scan dB	0	
Angle Beam 70°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Angle Beam 60°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Angle Beam 45°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Calibration Standards:	Type:	Steel	Material:	CS	Mfg.	3E	S/N:	24-2910	Temp.	80°			
Surface Condition:	Painted	Range:	5 Inch	Couplant:	UTX-FE								

Part Details

Location/Type of Joint:	N/A		
Material/Dimensions:	OD: 131.875"		
Welding Process:	N/A		
Part Number:	NB# 5110-9	Heat Number:	N/A
Serial Number:	140435-01-6	Surface Temp.	80°

Results

Performed Ultrasonic Thickness Test on preset areas
Readings on vessel were taken clockwise faceing North
Readings on Nozzels were taken on top of pipe
going clockwise, or on North side working clockwise.
N1 has no readings due to not have a neck on Manway
N3 is a Blank Flange
N5 is a Threaded Pipe
24 & 25 is N/A due to catwalk obstruction

Drawing

Additional Pages ☐

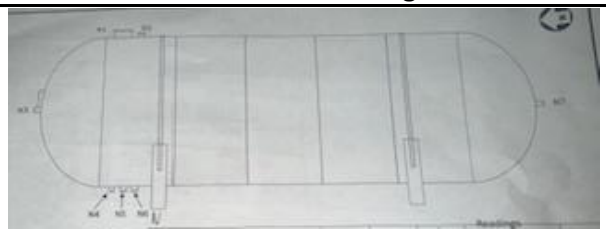

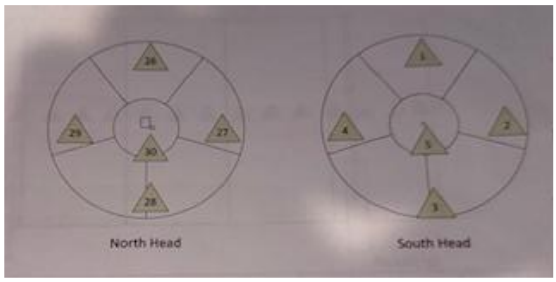

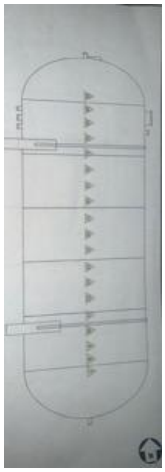

Start Time:	N/A	am / pm	End Time:	N/A	am / pm	Consumables	N/A	Gal/Gel	Number of People	1	
Travel Hours	N/A	Perdiem	Yes ☐	No ☑	Number of Vehicles	N/A	Total Mileage	N/A	Total Hours	See Billing Sheet	

Customer Name: OilPro Consulting

Examiner Name/Level: Damon Crain Lvl. II

Customer Signature:

Examiner Signature: Damon Crain Lvl. II

Total NDT
Non-Destructive Specialist

Address: 1747 Willow Lake Dr. White Oak, TX 75693 Phone: 430-201-2070

Ultrasonic Examination Report

Client:	SAChem	**Location:**	**2311 Pipeline Rd. Cleburne, Tx 76033**	**Report No.**	1 OF 1
Procedure:	TNDT-UT-003 Rev. 3			**Date:**	10/23/2025
Code/Specification:	ASME Sec. V			**P/O No.**	OilProo003
Item Description:	Triethylamine Vessel			**Total NDT SC #**	200-25-467
Scope of Examination:	UT Thickness on Specified Areas			**Dwg:**	57-11-001

Testing Parameters

Instrument Mfg.	Olympus	Model:	38DL Plus		S/N:	130715308		Calibration Date		3/3/2026			
Longitudinal Frequency 0°	5MHz	MHz	Size	.375"	Type:	Echo to Echo	S/N:	812283	Ref. dB	65	Scan dB	0	
Angle Beam 70°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Angle Beam 60°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Angle Beam 45°	N/A	MHz	Size	N/A	Type:	N/A	S/N:	N/A	Ref. dB	N/A	Scan dB	N/A	
Calibration Standards:	Type:	S.S	Material:	S.S	Mfg.	3E	S/N:	150115-24	Temp.	80°			
Surface Condition:	Painted	Range:	5 Inch	Couplant:	UTX-FE								

Part Details

Location/Type of Joint:	N/A		
Material/Dimensions:			
Welding Process:	N/A		
Part Number:	57-11-001	Heat Number:	N/A
Serial Number:	5111	Surface Temp.	80°

Results

Performed Ultrasonic Thickness Test on preset areas
Readings on vessel were taken clockwise faceing North
Readings on Nozzels were taken on top of pipe
going clockwise, or on North side working clockwise.
See attached Thickness Reading

Drawing

Additional Pages ☐

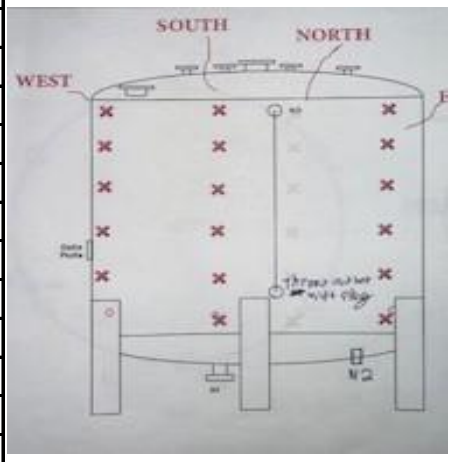

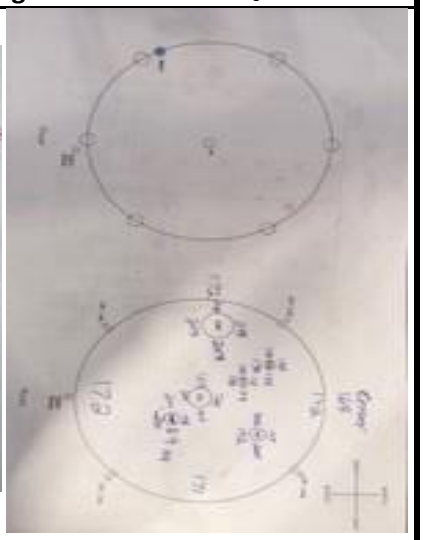

Start Time:	N/A	am / pm	End Time:	N/A	am / pm	Consumables	N/A	Gal/Gel	Number of People		1
Travel Hours	N/A	Perdiem	Yes ☐	No ☑	Number of Vehicles	N/A	Total Mileage	N/A	Total Hours	See Billing Sheet	

Customer Name: OilPro Consulting

Examiner Name/Level: Damon Crain Lvl. II

Customer Signature:

Examiner Signature: Damon Crain Lvl. II

Total NDT
Non-Destructive Specialist

Company Name: SA Chem
Location: 2311 Pipeline Rd Cleburn, Tx 76033
Inspection Date: 11/4/2025
Technician: Damon Crain

ULTRASONIC THICKNESS READINGS ON: 54-11-001 Thrimethylamine Nozzels

CML	Desc.	Size(in)	0°	90°	180°	270°					
N1	Manway	16	N/A	N/A	N/A	N/A					
N2	Vapor Out	2	0.207	0.206	0.206	0.207					
N3	Thermowall	0.75	0.801								
N4	Sight Gauge	2.25	0.132	0.13	0.136	0.131					
N5	Liquid In	3	0.322	0.312	0.314	0.317					
N6	Liquid Out	3	0.188	0.188	0.188	0.19					
N7	Gauge	1	0.104								

Sketch/Drawing

Technician: Damon Crain Assistant: N/A Date: 11/4/2025

Total NDT
Non-Destructive Specialist

Company Name: SA Chem
Location: 2311 Pipeline Rd Cleburn, Tx 76033
Inspection Date: 11/4/2025
Technician: Damon Crain

ULTRASONIC THICKNESS READINGS ON: 54-11-001 Trimethylamine

CML	Desc.	0° or Single	45°	90°	135°	180°	225°	270°	315°		
7	2" from SH Head	0.52	0.523	0.502	0.506	0.522	0.52	0.509	0.524		
8	2" from SH Shell	0.801	0.801	0.802	0.859	0.801	0.801	0.803	0.801		
9	2'	0.801	0.8	0.802	0.861	0.801	0.801	0.802	0.801		
10	4'	0.801	0.801	0.802	0.863	0.801	0.801	0.802	0.8		
11	6'	0.801	0.801	0.803	0.857	0.801	0.8	0.808	0.801		
12	8'	0.802	0.8	0.802	0.865	0.801	0.8	0.802	0.801		
13	10'	0.802	0.8	0.802	0.872	0.801	0.801	0.802	0.801		
14	12'	0.801	0.801	0.802	0.87	0.801	0.801	0.802	0.801		
15	14'	0.801	0.8	0.839	0.864	0.801	0.8	0.802	0.801		
16	16'	0.801	0.802	0.802	0.802	0.801	0.801	0.807	0.801		
17	18'	0.803	0.801	0.802	0.802	0.801	0.801	0.861	0.801		
18	20'	0.801	0.805	0.802	0.802	0.8	0.801	0.864	0.801		
19	22'	0.802	0.801	0.802	0.801	0.801	0.801	0.838	0.803		
20	24'	0.801	0.801	0.802	0.801	0.801	0.8	0.801	0.802		
21	26'	0.801	0.804	0.802	0.802	0.801	0.801	0.802	0.801		
22	28'	0.801	0.806	0.808	0.802	0.801	0.801	0.802	0.801		
23	30'	0.804	0.801	0.802	0.802	0.801	0.802	0.805	0.801		
24	2" from NH Shell	N/A	0.81	0.804	0.802	0.802	0.802	0.802	0.801		
25	2" from NH Head	N/A	0.523	0.523	0.51	0.523	0.517	0.502	0.528		
1	12 O'Clock	0.488									
2	3 O'Clock	0.493									
3	6 O'clock	0.495									
4	9 O'Clock	0.501									
5	South Head Center	0.501									
26	12 O'Clock	0.508									
27	3 O'Clock	0.506									
28	6 O'clock	0.517									
29	9 O'Clock	0.513									
30	North Head Center	0.502									

Sketch/Drawing

Technician: Damon Crain Lvl. II Assistant: N/A Date: 11/4/2025