CLAIMANT'S DESCRIPTION

> *“crack near the slab”*

Claimant's own words, recorded as entered

LENGTH	WIDTH	AREA	SURFACE AFFECTED	SEVERITY
229.3 mm	3.3 mm	7.66 cm²	0.76% of component	SIGNIFICANT
Confirmed	Unverified	Confirmed	Confirmed	area · length · regions
R005	R006	R004	R002	Confirmed
				R007

Width is unverified: no reference width to check it against, so read 3.3 mm as indicative.

Photo evidence



Figure 1a · Captured photo, full frame

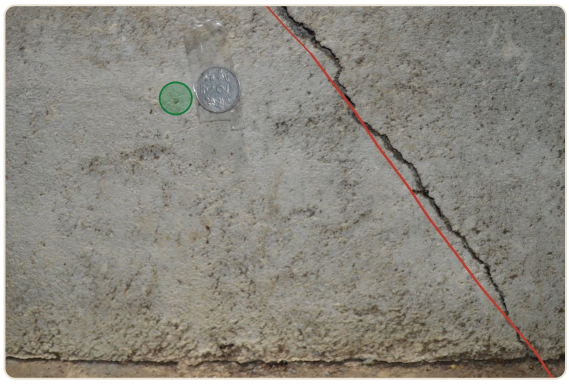


Figure 1b · Measured outlines

Damage Coin scale reference

Method

Outlines are measured from photo pixels and scaled using the coin as a reference of known diameter, with perspective tilt corrected from the coin’s elliptical shape. Every number cites its evidence receipt.

Reference: US quarter · 24.26 mm diameter.

Verification

CHECK	RESULT
Evidence gate	Passed
Independent skeptic	Not run
Mask cross-check	Not run

Annexure: evidence receipts

annexure v0.3.0 · mode ABSOLUTE (calibrated) · generated 2026-11-04 11:55 UTC

Findings (1)

FINDING	AREA	LENGTH	WIDTH	SEVERITY
Crack	7.66 cm²	229.3 mm	3.3 mm Unverified	**Significant**

Near the slab, a significant crack covers 0.76% of the component, extending 229.3 mm.

Receipts (7)

ID	MEASURE	VALUE	FORMULA
R001	Scale calibration	**0.757669 mm/px**	`knownMm / referenceLengthPx`
R002	Area ratio	**0.76%**	`damageAreaPx / componentAreaPx × 100`
R003	Region count	**1**	`count of disconnected mask components`
R004	Calibrated area	**7.66 cm²**	`damageAreaPx × mmPerPx² / 100`
R005	Calibrated length	**229.3 mm**	`skeletonPx × mmPerPx`
R006	Calibrated width	**3.3 mm** Unverified	`damageAreaPx / skeletonPx × mmPerPx`
R007	Severity classification	**Significant**	`area ratio + calibrated length + region count vs printed thresholds`

Computed, not generated.
Computed, not generated. Every number in this report cites a receipt above; if one is missing, the report fails its evidence check. Any receipt can be replayed from the original request to reproduce the same result.