

Pre Purchase Inspection Report

Date completed: 03/10/2023

Hyundai i30 SLX FD







Vehicle Information

VIN

KMHD251ELDU018127

Model Year

2012

Engine Number

G4NBCU149060

Build Date

05 / 2012

Odometer Reading

137392

Compliance Date

10 / 2012

Registration Number

1HWZ064

Registration Expiry

01 / 2024

Standard Tyre Size

205/55 R16 / 205/55 R16

Transmission Type

Manual


Fuel Type

Petrol

Drive Type

FWD

Report Summary

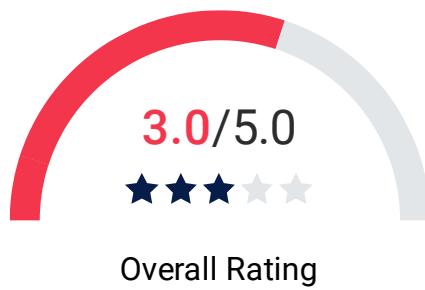

Engine/Motor

★★★☆☆ 3.0

[View more](#)

Interior

★★★☆☆ 3.0

[View more](#)

Exterior

★★★☆☆ 3.0

[View more](#)

Tyres

★★★☆☆ 3.0

[View more](#)

Road Test

★★★☆☆ 3.0

[View more](#)

Overall, this vehicle has been rated 3 stars taking into consideration of age & kilometres travelled. Vehicle presents well at time of inspection. Excessive smoke emitted from the vehicle on road test, repairs required for roadworthiness: further diagnosis and investigation required. NOTE VERY LARGE AMOUNT OF SMOKE COMING FROM EXHAUST POSSIBLE DUE TO ENGINE OIL LEVEL? ROAD TEST WAS NOT PROPERLY CARRIED OUT



Jack M
Inspector

A handwritten signature in black ink, appearing to read "JM".

Attention Required

Engine/Motor Cooling System

★★★★★ 2.0


General wear and visible aging to the cooling system components consistent with age and mileage. Acceptable at time of inspection. No visible leaks detected at the time of inspection. NOTE Coolant reservoir slightly low, requires slight top up



Ignition and Fuel Systems

★★★★★ 2.0


Fuel and ignition systems functioning at the time of inspection. General wear evident to the fuel system components consistent with the age and mileage. NOTE EVIDENCE OF RODENT 🐀 ACTIVITY AROUND ROCKER COVER/COIL AREA NO EVIDENCE OF DAMAGE TO WIRING

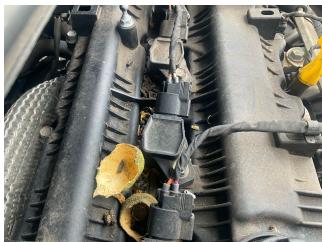

Engine Oil Leaks and Residue

★★★★★ 2.0

No obvious engine leaks from the engine bay or underneath the vehicle at the time of inspection. Restricted visibility due to engine top covers and lower trays fitted, unable to be removed during this inspection. NOTE OIL ENGINE LEVEL POSSIBLY OVER FILLED

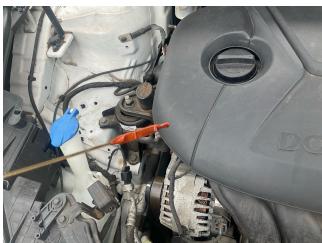

Frames, Members, and Underbody Parts

★★★★★ 2.0

Light surface rust present, and/or scuffs to the vehicles underbody components (front bumper bar, under trays) consistent with the age and mileage. NOTE FRONT LIP AND UNDERTRAY MISSING/BROKEN



External Lights

★★★★★ 2.0

Passengers tail light cracked/broken lens, investigate further.



Exhaust Smoke / Emissions

★★★★★ 1.0

Excessive smoke emitted from the vehicle on road test, repairs required for roadworthiness: further diagnosis and investigation required. NOTE VERY LARGE AMOUNT OF SMOKE COMING FROM EXHAUST POSSIBLE DUE TO ENGINE OIL LEVEL? ROAD TEST WAS NOT PROPERLY CARRIED OUT

Full Report

Select category to view results

Engine/Motor (★ 3.0)

Engine/Motor ★ 3.0

Master Cylinder / ABS / Brake Booster

★★★☆☆ 3.0


General wear to the master cylinder and ABS (if fitted) components, brake fluid discoloured consistent with the age and mileage:
Acceptable at the time of inspection.



Engine/Motor Cooling System

★★☆☆☆ 2.0

General wear and visible aging to the cooling system components consistent with age and mileage. Acceptable at time of inspection.
No visible leaks detected at the time of inspection. NOTE Coolant reservoir slightly low, requires slight top up

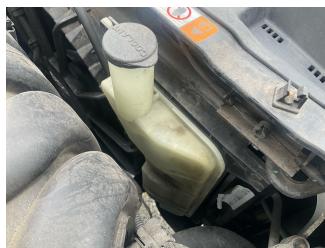

Ignition and Fuel Systems

★★★★★ 2.0


Fuel and ignition systems functioning at the time of inspection. General wear evident to the fuel system components consistent with the age and mileage. NOTE EVIDENCE OF RODENT 🐀 ACTIVITY AROUND ROCKER COVER/COIL AREA NO EVIDENCE OF DAMAGE TO WIRING



Engine Oil Leaks and Residue

★★★★★ 2.0

No obvious engine leaks from the engine bay or underneath the vehicle at the time of inspection. Restricted visibility due to engine top covers and lower trays fitted, unable to be removed during this inspection. NOTE OIL ENGINE LEVEL POSSIBLY OVER FILLED

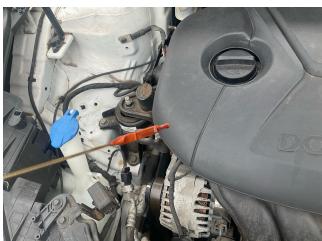

Idle Noise

★★★★★ 3.0

Normal operational noises detected, consistent with age and mileage displayed. No abnormal noises from the engine bay at the time of testing.



Hoses and Pipes

★★★☆☆ 3.0

General wear evident to the visible hoses and pipes consistent with the age and mileage.



Drive Belt & Pulleys

★★★★☆ 4.0

Working well at the time of inspection. Normal wear evident to the components consistent with the age and mileage. View restricted, no abnormal operational noises detected.



Start-up Battery

★★★☆☆ 3.0

Battery test returned "OK" result at the time of inspection. This indicates the battery is working as expected, showing normal wear for age/mileage.



Mountings

★★★☆☆ 3.0

General wear and tear evident to the visible mountings consistent with the age and mileage.



Fluid Level

★★★☆☆ 3.0

All visible fluid levels within range at the time of inspection, some discolouration detected.

Interior ★ 3.0

Horn and Steering Wheel

★★★☆☆ 3.0

Horn in working order and condition at the time of inspection. General wear evident to the steering wheel and other visible components consistent with the age and mileage.



Dash Lights, Gauges and Charging Display

★★★☆☆ 3.0

No abnormal warning lights on in the dash cluster, no faults logged into the vehicle electronics at the time. General wear to the gauges, scuffs and marks to the dashboard trims as expected.



Washers & Wipers

★★★☆☆ 3.0

Working well at the time of inspection. General wear evident to the windscreens washers, wipers and components consistent with the age and mileage.

Window Operation

★★★☆☆ 3.0

All windows and window controls operational at the time of inspection. General wear and tear evident to the window mechanisms, switches and components consistent with the age and mileage.

Interior Trims

★★★☆☆ 3.0

Interior trims, carpet and roof lining showing general wear, including scuffs, marks, minor stains and tears consistent with the age and mileage. Recommend buyer to view prior to purchase.



Infotainment System

★★★☆☆ 3.0

Aftermarket radio fitted, superficial wear to the audio controls consistent with the age and KMs travelled.



Air Conditioning

★★★☆☆ 3.0

Air conditioning cold and working well at the time of inspection. General wear to the air conditioning compressor, switches and components consistent with the age and mileage.



Seats & Seat Belts

★★★☆☆ 3.0

Working well at the time of inspection. General wear and tear as expected to the seats, belts, buckles and components consistent with the age and mileage.



Heater Demister

★★★☆☆ 3.0

Working well at the time of inspection, all functions operational. General wear evident to the vents, heater, demister and components consistent with the age and mileage.

2 Keys Present

No

Exterior ★ 3.0

Rust

★★★★★ 4.0

Minor light surface rust or corrosion to some of the underbody fasteners and components consistent with the age and mileage displayed. The scope of the inspection does not include removal of components, only what is visible at the time. Paint and underbody sealer may inhibit detection of rust and corrosion.

Transmission

★★★★★ 3.0

General wear (ageing) visible to the components consistent with the age and mileage. RedBook Inspect are unable to ascertain the amount of wear to the internal components of the transmission or gearbox: further investigation if needed.

Glass / Mirrors

★★★★★ 4.0

Front windscreen condition consistent with age and mileage. Mirrors working well at the time.

Frames, Members, and Underbody Parts

★★★★★ 2.0

Light surface rust present, and/or scuffs to the vehicles underbody components (front bumper bar, under trays) consistent with the age and mileage. NOTE FRONT LIP AND UNDERTRAY MISSING/BROKEN



Doors, Locks & Hinges


★★★★★ 3.0

General wear evident to the door, locks, hinges and seals consistent with the age and mileage.

Front & Rear Suspension

★★★☆☆ 3.0

General wear (ageing) and light surface corrosion to the front and rear suspension components and visible rubber bushes consistent with the age and mileage.

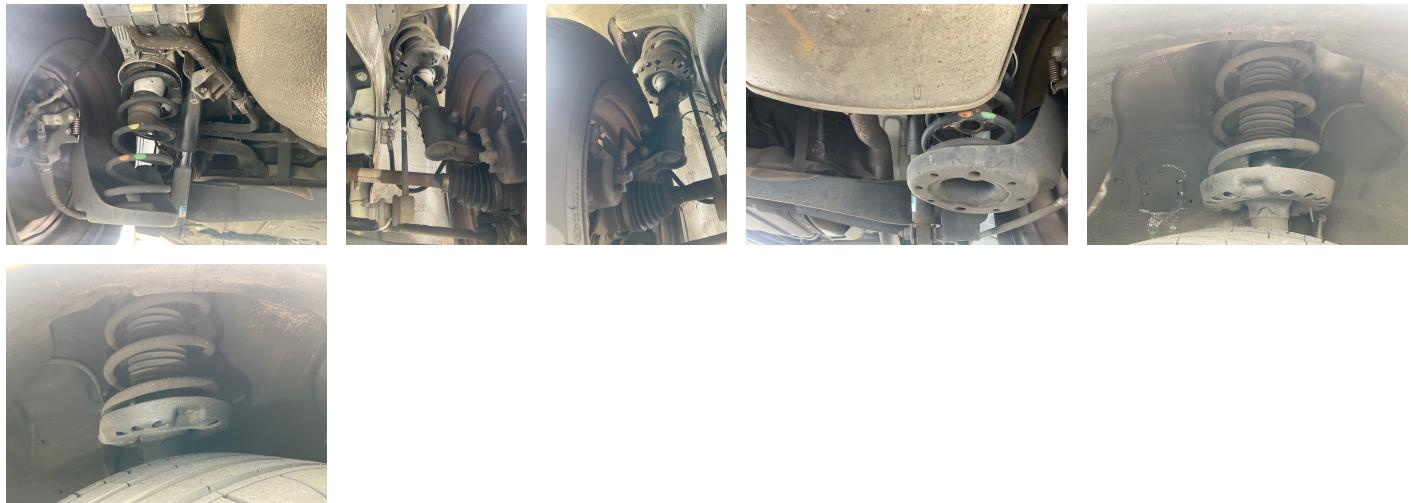

Sunroof / Aerial / Convertible

★★★☆☆ 3.0

Aerial working well at the time of inspection. General wear evident to the components consistent with the age and mileage.



Exhaust

★★★☆☆ 3.0

In servicable condition at the time of inspection. General wear (ageing) and surface rust to the components consistent with the age and mileage.



External Lights

★★★★★ 2.0

Passenger's tail light cracked/broken lens, investigate further.



Drive Shafts

★★★★★ 3.0

Working well at the time of inspection. General wear (ageing) evident to the visible driveshafts, boots and joint components consistent with the age and mileage.



Body Condition

★★★☆☆ 3.0

Vehicle presents in servicable condition at the time, possible previous paint repairs detected to the bonnet and boot also both sides of vehicle (paint depth inconsistent): further investigation needed. Various minor dents, scratches and marks around the paint work as expected and consistent with the age and mileage. It is the buyers responsibility to conduct a final inspection prior to purchase, as we can only advise on the condition at the time of inspection. All attempts are made to detect hail damage but weather and vehicle condition can minimize detection.






Steering Components

★★★☆☆ 3.0

In servicable condition at the time of inspection. General wear (ageing) to the steering gear, linkages and components consistent with the age and mileage.

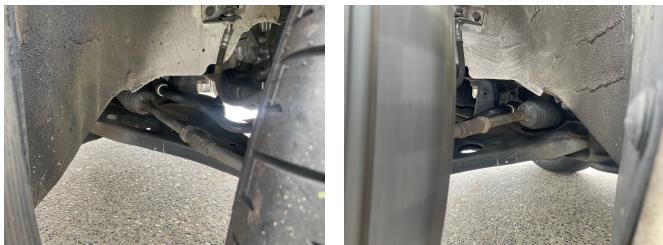

Tyres ★ 3.0

Brake Calipers, Hoses and Pipes

★★★☆☆ 3.0

General wear (ageing) to the brake hoses, calipers and components consistent with the age and mileage of the vehicle.

Park Brake


★★★☆☆ 3.0

Working well at the time of inspection. Some minor adjustment required to the park brake, general wear to the components.

Tyres & Wheel Rims

★★★☆☆ 3.0

General wear to the front and rear wheel tyres with approx. 6.4mm tread remaining to the front and approx. 3.5mm tread remaining to the rear. Tyres fitted to the vehicle complies with manufacturer speed and load rating requirements. Minor wear visible to wheel rims.

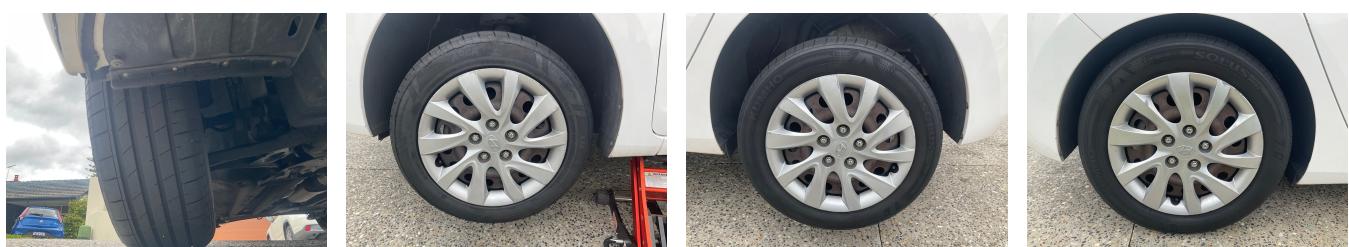

Spare Tyre / Rim

★★★☆☆ 3.0

Spare tyre present and shows general wear at time of inspection.



Brake Pads & Discs

★★★☆☆ 3.0

General wear including lips, grooves and minor surface rust to brake discs, consistent with the age and mileage. The scope of the inspection is limited to an approximate and what is visible at the time. Brake disc thickness not measured during this inspection.

Road Test ★ 3.0

Owner's Manual - Service Intervals

★★★☆☆ 3.0

Most services stamped and documented into the booklet, owners manuals and folder present. Next service due at: 140,000km.



Brake Operation

★★★☆☆ 3.0

Working well at the time of testing, limited road test due to local speed limits, road conditions and/or traffic at the time.

Speedometer

★★★☆☆ 3.0

Normal operation of speedometer on roadtest, minor wear/scratches to cluster but otherwise working well at time of testing.

Gearbox Auto / Manual

★★★☆☆ 3.0

Normal operational noise(s)/minor free play detected, consistent with age/mileage displayed.

Steering / Suspension

 3.0

Normal operational noise(s)/minor free play detected, consistent with age and mileage displayed.

Engine/Motor Performance

 3.0

Normal engine performance expected of this type of engine.

Exhaust Smoke / Emissions

 1.0

Excessive smoke emitted from the vehicle on road test, repairs required for roadworthiness: further diagnosis and investigation required. NOTE VERY LARGE AMOUNT OF SMOKE COMING FROM EXHAUST POSSIBLE DUE TO ENGINE OIL LEVEL? ROAD TEST WAS NOT PROPERLY CARRIED OUT

4WD/AWD

Not Applicable (including constant all wheel drive and 2WD vehicles)

Cruise Control

Not Checked

Ease of Starting Idle

 3.0

Easy to start at time of inspection.

Engine Driving Noise

 3.0

Normal operational noise to the engine typical of the age and mileage.

Logbooks Present

Yes

Rating guide

★ 4.5 ~ 5.0 Very good

Item found to be in working order and/or no obvious signs of damage/degradation, consistent with age of vehicle.

★ 3.5 ~ 4.0 Good

Item found to be in working order with some signs of damage and/or wear & tear, consistent with age of vehicle.

★ 2.5 ~ 3.0 Fair

Item found to be in working order with some signs of damage and/or wear & tear, consistent with age of vehicle.

★ 1.5 ~ 2.0 Poor

Item found not to be in working order and/or major signs of damage and/or wear & tear.

★ 0.5 ~ 1.0 Very poor

Item found not to be in working order and/or major signs of damage and/or wear & tear.

Disclaimer

(a) The inspection is VISUAL and non-mechanical only and RedBook Inspect will not be responsible for any defects that are latent discovered which were not visually apparent during the inspection. The inspection will cover the vehicle's exterior, interior, engine compartment, tyres and wheels, brakes, under body and a road test where possible. The inspection will specifically not cover the items set out below. No removal of parts or components is undertaken during the inspection process. You acknowledge that while RedBook Inspect's inspectors use accepted methods for fault detection, these methods will not necessarily identify all faults with a vehicle. You should consider the age and condition of the vehicle at the time of inspection and any Report should be reviewed in this context. Vehicles are only road tested to speed limit of local area.

(b) The Report provided by RedBook Inspect to you is only current as at the time it is issued. It is a buyer's responsibility to conduct a visual inspection of the vehicle at the point of sale as RedBook Inspect can only advise on the condition of the vehicle at the time of inspection. The Report is not a roadworthy certificate and cannot be used as a roadworthy. You acknowledge that RedBook Inspect does not check for any manufacturer recall notices and you should check that the vehicle is not subject to a recall notice.

(c) RedBook Inspect will not be responsible for the terms of any transaction between any persons in relation to any vehicle inspected by RedBook Inspect or for resolving any dispute between any persons regarding any transaction.

(d) Subject to all applicable laws, RedBook Inspect does not provide any guarantee, warranty or representation regarding the nature, reliability, accuracy or completeness of any information contained in the Report or the fitness of the information contained in the Report for any purpose intended by you. To the full extent permitted by the law, RedBook Inspect will only be liable to you: (i) pursuant to any guarantee, right or contractual term that arises, is created or is implied by operation of law and that cannot be excluded PROVIDED THAT to the full extent permitted by law, any such liability of RedBook Inspect is limited, at RedBook Inspect's option, to (A) replacing or repairing the relevant goods (B) supplying goods equivalent to the relevant goods (C) supplying the relevant services again; or (D) paying the cost of such replacement, repairs or supply, subject always to subclause (g) below; or (ii) if Your claim arises from or in connection with any deliberate breach of these terms and conditions or fraud by RedBook Inspect.

(e) Except to the extent that liability cannot be excluded, RedBook Inspect, will not be liable to you for claims arising out of or in connection with your access and use of the this Report whether arising in contract, tort (including negligence), indemnity, strict liability, breach of warranty or statute.

(f) To the full extent permitted by law, RedBook Inspect will not be liable to you for loss of use, production, profit, revenue, business, data, contractor anticipated savings or for delay or for any financing costs or increase in operating costs or any economic loss for any indirect or consequential loss or damage.

(g) Your use of this Inspection Report is subject to the RedBook Inspect Service Terms available at <https://www.redbookinspect.com.au/terms-of-service>.