

TAKEOFF VERIFICATION

Jennian IQ / hold this document against the plans

JOB JM-0061
JMW JM-0061
PLAN VER. 1

CLIENT	Fenner Haydon	ADDRESS	Trial
TAKEOFF RUN	c2159cc7 / 30/06/2026, 08:40 NZT	PRINTED	30/06/2026, 12:10 NZT

1 / Key measures

Checked against plan []

Review Floor area (living)	249.9 m2	VIS / mid
Review Garage area	36.3 m2	VEC
Alfresco area	2.7 m2	VIS
First-floor area	N/A m2	
Total area	252.6 m2	DRV
External wall length	89.1 lm	GEO / mid
External wall height	2.4 m	
Review External wall area	Not calculated - opening reconciliation required m2	DRV
Review Printed cladding area (review only - not calculated external wall area)	258.8 m2	VEC / mid
Review Internal walls - ribbon-trace v1 (verify; ~+25% joinery bias; not exported)	117.8 lm	VEC / mid
Roof area	287.39 m2	VIS
Gable span (envelope short side)	16.48 m	GEO
Stud height	2,400 mm	
Ceiling height	2.4 m	GEO
Foundation	TC1	AST

Authority: **persisted_current_run** / run **c2159cc7-aecd-4644-b339-fe3443acef9f** / clean totals exclude needs_review, missing_evidence, conflict, and ignored rows.

EXTERIOR PERIMETER

Clean count 1

Clean length 89100 mm

Clean area - m2

needs_review 0

missing 0

conflict 0

ignored 0

confidence 70

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Exterior perimeter vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / external-perimeter	extracted	1	-	-	89100	-	70	- / EnrichedTakeoff.external_wall_lm

INTERIOR DOORS

Clean count 20

Clean length - mm

Clean area - m2

needs_review 0

missing 0

conflict 0

ignored 0

confidence 95

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Interior doors - standard vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-standard	extracted	10	-	-	-	-	95	- / deterministic interior-door engine confirmed count
Interior doors - double vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-double	extracted	8	-	-	-	-	95	- / deterministic interior-door engine confirmed count
Interior doors - cavity sliders vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-cavity	extracted	2	-	-	-	-	95	- / deterministic interior-door engine confirmed count

WINDOWS/OPENINGS

Clean count 9

Clean length - mm

Clean area 17.630000000000003 m2

needs_review 19

missing 1

conflict 13

ignored 0

confidence 75

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening floorplan-label-1 - FAMILY pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-1	extracted	1	2400	1300	-	3.12	70	p1 / 345.17, 168.32, 381.17, 182.32 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near FAMILY; clean floor-plan opening label 1300 x 2400 assigned to FAMILY by unique room proximity/order
Opening floorplan-label-2 - DINING pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-2	extracted	1	2400	1300	-	3.12	70	p1 / 459.41, 168.32, 495.41, 182.32 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near DINING; clean floor-plan opening label 1300 x 2400 assigned to DINING by unique room proximity/order
Opening floorplan-label-6 - STUDY/BED4 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-6	extracted	1	1500	1300	-	1.95	70	p1 / 631.92, 463.11, 667.92, 477.11 / floorplan_text; dimension; 1300 x 1500; width 1500mm; height 1300mm; area 1.95m2; near STUDY/BED4; clean floor-plan opening label 1300 x 1500 assigned to STUDY/BED4 by unique room proximity/order
Opening floorplan-label-7 - ENSUITE pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-7	extracted	1	600	2150	-	1.29	70	p1 / 326.19, 646.52, 362.19, 660.52 / floorplan_text; dimension; 2150 x 600; width 600mm; height 2150mm; area 1.29m2; near ENSUITE; clean floor-plan opening label 2150 x 600 assigned to ENSUITE by unique room proximity/order
Opening floorplan-label-9 - BATH pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-9	extracted	1	1200	1100	-	1.32	70	p1 / 449.09, 646.52, 485.09, 660.52 / floorplan_text; dimension; 1100 x 1200; width 1200mm; height 1100mm; area 1.32m2; near BATH; clean floor-plan opening label 1100 x 1200 assigned to BATH by unique room proximity/order
Opening floorplan-label-10 - BED2 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-10	extracted	1	1500	1300	-	1.95	70	p1 / 529.97, 646.52, 565.97, 660.52 / floorplan_text; dimension; 1300 x 1500; width 1500mm; height 1300mm; area 1.95m2; near BED2; clean floor-plan opening label 1300 x 1500 assigned to BED2 by unique room proximity/order
Opening floorplan-label-11 - MASTERBED pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-11	extracted	1	800	1100	-	0.88	70	p1 / 182.76, 612.77, 218.76, 626.77 / floorplan_text; dimension; 1100 x 800; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; clean floor-plan opening label 1100 x 800 assigned to MASTERBED by unique room proximity/order
Opening floorplan-label-12 - MASTERBED pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-12	extracted	1	800	1100	-	0.88	70	p1 / 182.76, 528.77, 218.76, 542.77 / floorplan_text; dimension; 1100 x 800; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; clean floor-plan opening label 1100 x 800 assigned to MASTERBED by unique room proximity/order
Opening floorplan-label-13 - BED3 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-13	extracted	1	2400	1300	-	3.12	70	p1 / 705.24, 571.11, 741.24, 585.11 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near BED3; clean floor-plan opening label 1300 x 2400 assigned to BED3 by unique room proximity/order
Opening visual-opening-1 - Master Bed visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-1	needs_review	1	600	1100	-	-	95	area_not_calculated / - / vision; dimension; 1100x600; width 600mm; height 1100mm; area 0.66m2; near Master Bed; printed 1100x600 on Master Bed south wall; marker placed on window symbol in external wall
Opening visual-opening-2 - Ensuite visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-2	needs_review	1	600	2130	-	-	95	area_not_calculated / - / vision; dimension; 2130x600; width 600mm; height 2130mm; area 1.28m2; near Ensuite; printed 2130x600 on Ensuite south wall; marker placed on window line
Opening visual-opening-3 - Bath visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f /	needs_review	1	600	1100	-	-	95	area_not_calculated / - / vision; dimension; 1100x600; width 600mm; height 1100mm; area 0.66m2; near Bath; printed 1100x600 on Bath south wall; marker placed on window symbol

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
opening-visual-opening-3								
Opening visual-opening-4 - Bed 2 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-4	needs_review	1	1200	1100	-	-	95	area_not_calculated / - / vision; dimension; 1100x1200; width 1200mm; height 1100mm; area 1.32m2; near Bed 2; printed 1100x1200 on Bed 2 south wall; marker placed on window line
Opening visual-opening-5 - Bed 3 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-5	needs_review	1	1300	1300	-	-	95	area_not_calculated / - / vision; dimension; 1300x1300; width 1300mm; height 1300mm; area 1.69m2; near Bed 3; printed 1300x1300 on Bed 3 south wall; marker placed on window symbol
Opening visual-opening-6 - Bed 3 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-6	needs_review	1	1510	1810	-	-	95	area_not_calculated / - / vision; dimension; 1810x1510; width 1510mm; height 1810mm; area 2.73m2; near Bed 3; printed 1810x1510 on Bed 3 east wall; marker placed on window line
Opening visual-opening-7 - Study/Bed 4 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-7	needs_review	1	1300	1300	-	-	95	area_not_calculated / - / vision; dimension; 1300x1300; width 1300mm; height 1300mm; area 1.69m2; near Study/Bed 4; printed 1300x1300 on Study/Bed 4 east wall; marker placed on window symbol
Opening visual-opening-8 - Laundry/Mudroom visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-8	needs_review	1	3000	700	-	-	70	area_not_calculated / - / vision; dimension; 700x3000; width 3000mm; height 700mm; area 2.1m2; near Laundry/Mudroom; printed 700x3000 near Laundry/Mudroom; marker placed on window line in east wall
Opening visual-opening-11 - Pantry visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-11	needs_review	1	1500	1100	-	-	95	area_not_calculated / - / vision; dimension; 1100x1500; width 1500mm; height 1100mm; area 1.65m2; near Pantry; printed 1100x1500 on Pantry north wall; marker placed on opening line
Opening visual-opening-12 - Dining visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-12	needs_review	1	2400	1300	-	-	95	area_not_calculated / - / vision; dimension; 1300x2400; width 2400mm; height 1300mm; area 3.12m2; near Dining; printed 1300x2400 on Dining north wall; marker placed on slider opening
Opening visual-opening-13 - Dining visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-13	needs_review	1	2400	1300	-	-	95	area_not_calculated / - / vision; dimension; 1300x2400; width 2400mm; height 1300mm; area 3.12m2; near Dining; printed 1300x2400 second slider on Dining north wall; marker placed on slider opening
Opening visual-opening-14 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-14	needs_review	1	1400	790	-	-	95	area_not_calculated / - / vision; dimension; 790x1400; width 1400mm; height 790mm; area 1.11m2; near Family; printed 790x1400 on Family west wall; marker placed on window symbol
Opening visual-opening-15 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-15	needs_review	1	1730	1300	-	-	95	area_not_calculated / - / vision; dimension; 1300x1725; width 1730mm; height 1300mm; area 2.25m2; near Family; printed 1300x1725 on Family west wall; marker placed on slider opening
Opening visual-opening-16 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-16	needs_review	1	1400	790	-	-	95	area_not_calculated / - / vision; dimension; 790x1400; width 1400mm; height 790mm; area 1.11m2; near Family; printed 790x1400 on Family west wall lower; marker placed on window line
Opening visual-opening-18 - Master Bed visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-18	needs_review	1	600	1320	-	-	95	area_not_calculated / - / vision; dimension; 1320x600; width 600mm; height 1320mm; area 0.79m2; near Master Bed; printed 1320x600 on Master Bed west wall; marker placed on window symbol

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening floorplan-label-3 - DINING pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-3	needs_review	1	1500	1100	-	-	35	area_not_calculated / p1 / 565.61, 168.32, 601.61, 182.32 / floorplan_text; dimension; 1100 x 1500; width 1500mm; height 1100mm; near DINING; floor-plan opening label 1100 x 1500 retained for review: room/order assignment is ambiguous
Opening floorplan-label-4 - LAUNDRY/MUDROOM pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-4	needs_review	1	3000	700	-	-	35	area_not_calculated / p1 / 695.13, 363.08, 731.13, 377.08 / floorplan_text; dimension; 700 x 3000; width 3000mm; height 700mm; near LAUNDRY/MUDROOM; floor-plan opening label 700 x 3000 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening floorplan-label-5 - STUDY/BED4 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-5	needs_review	1	400	2150	-	-	35	area_not_calculated / p1 / 595.32, 392.93, 631.32, 406.93 / floorplan_text; dimension; 2150 x 400; width 400mm; height 2150mm; near STUDY/BED4; floor-plan opening label 2150 x 400 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening floorplan-label-8 - ENSUITE pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-8	needs_review	1	600	1100	-	-	35	area_not_calculated / p1 / 402.39, 646.52, 438.39, 660.52 / floorplan_text; dimension; 1100 x 600; width 600mm; height 1100mm; near ENSUITE; floor-plan opening label 1100 x 600 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening visual-opening-17 - Lounge visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-17	missing_evidence	1	-	-	-	-	70	width_not_extracted, height_not_extracted, area_not_calculated / - / vision; candidate; near Lounge; slider opening visible on Lounge west wall to deck; no clear dimension label; elevation confirms slider presence
Opening held-blocked-opening-12 - MASTERBED floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-12	conflict	1	800	1100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-13 - BED3 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-13	conflict	1	2400	1300	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near BED3; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-1 - FAMILY floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-1	conflict	1	2400	1300	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near FAMILY; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-2 - DINING floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-2	conflict	1	2400	1300	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near DINING; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-3 - DINING floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-3	conflict	1	1500	1100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 1500mm; height 1100mm; area 1.65m2; near DINING; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-4 - LAUNDRY/MUDROOM floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-4	conflict	1	3000	700	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 3000mm; height 700mm; area 2.1m2; near LAUNDRY/MUDROOM; window opening has complete dimensions but is held out of pricing from vector

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening held-blocked-opening-5 - STUDY/BED4 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-5	conflict	1	400	2150	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 400mm; height 2150mm; area 0.86m2; near STUDY/BED4; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-6 - STUDY/BED4 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-6	conflict	1	1500	1300	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 1500mm; height 1300mm; area 1.95m2; near STUDY/BED4; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-7 - ENSUITE floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-7	conflict	1	600	2150	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 600mm; height 2150mm; area 1.29m2; near ENSUITE; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-8 - ENSUITE floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-8	conflict	1	600	1100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 600mm; height 1100mm; area 0.66m2; near ENSUITE; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-9 - BATH floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-9	conflict	1	1200	1100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 1200mm; height 1100mm; area 1.32m2; near BATH; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-10 - BED2 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-10	conflict	1	1500	1300	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 1500mm; height 1300mm; area 1.95m2; near BED2; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-11 - MASTERBED floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-11	conflict	1	800	1100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; window opening has complete dimensions but is held out of pricing from vector

OPENINGS

Clean count 0	Clean length - mm	Clean area - m2	needs_review 1	missing 24	conflict 0	ignored 0	confidence 39
---------------	-------------------	-----------------	----------------	------------	------------	-----------	---------------

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening floorplan-gap-1 - PANTRY vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-1	needs_review	1	2750	1000	-	-	70	area_not_calculated / p1 / 665.55, 106.62, 667.76, 184.5 / floorplan_gap; width; width 2750mm; near PANTRY; wall V-111; measured floor-plan exterior wall gap near PANTRY; gap routed to PANTRY on the west side of the wall; height still needs text/elevation/schedule confirmation
Opening drafting-issue-1 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-drafting-issue-1	missing_evidence	1	-	-	-	-	35	width_not_extracted, height_not_extracted, area_not_calculated, source_conflict / - / floorplan_text; conflict; 1300x175036001300x1750; malformed floor-plan text is retained as evidence but is not priced unless another source confirms the opening
Opening floorplan-gap-2 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-2	missing_evidence	1	1990	-	-	-	70	height_not_extracted, area_not_calculated / p1 / 310.5, 638.46, 313.03, 694.98 / floorplan_gap; width; width 1990mm; near ENSUITE; wall V-52; measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-3 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-3	missing_evidence	1	380	-	-	-	70	height_not_extracted, area_not_calculated / p1 / 205.06, 684.18, 208.7, 694.98 / floorplan_gap; width; width 380mm; near ENSUITE; wall V-34; measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-4 - LOUNGE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-4	missing_evidence	1	4980	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 454.74, 355.98, 463.64, 497.22 / floorplan_gap; width; width 4980mm; near LOUNGE; wall V-77; measured floor-plan interior wall gap near LOUNGE; gap routed to LOUNGE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-5 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-5	missing_evidence	1	4590	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 363.17, 541.98, 365.7, 672.06 / floorplan_gap; width; width 4590mm; near ENSUITE; wall V-61; measured floor-plan interior wall gap near ENSUITE; gap routed to ENSUITE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-6 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-6	missing_evidence	1	4310	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 117.66, 356.06, 239.82, 358.54 / floorplan_gap; width; width 4310mm; near MASTERBED; wall H-60; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-7 - BATH vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-7	missing_evidence	1	3650	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 403.98, 591.23, 507.3, 594.29 / floorplan_gap; width; width 3650mm; near BATH; wall H-99; measured floor-plan interior wall gap near BATH; gap is near BATH and WIR; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-8 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-8	missing_evidence	1	3630	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 99.9, 639.19, 202.8, 642.26 / floorplan_gap; width; width 3630mm; near MASTERBED; wall H-107; measured floor-plan interior wall gap near MASTERBED; gap routed to

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
								MASTERBED on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-9 - STUDY/BED4 vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-9	missing_evidence	1	3180	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 565.3, 423.42, 574.09, 513.66 / floorplan_gap; width; width 3180mm; near STUDY/BED4; wall V-95; measured floor-plan interior wall gap near STUDY/BED4; gap is near STUDY/BED4 and ENTRY; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-10 - MASTERBED vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-10	missing_evidence	1	3110	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 117.66, 511.02, 205.86, 513.59 / floorplan_gap; width; width 3110mm; near MASTERBED; wall H-85; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-11 - BATH vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-11	missing_evidence	1	1960	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 498.7, 639.42, 501.3, 694.98 / floorplan_gap; width; width 1960mm; near BATH; wall V-83; measured floor-plan exterior wall gap near BATH; gap is near BATH and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-12 - BED2 vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-12	missing_evidence	1	1960	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 597.51, 639.42, 600.06, 694.98 / floorplan_gap; width; width 1960mm; near BED2; wall V-100; measured floor-plan exterior wall gap near BED2; gap is near BED2 and BED3; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-13 - BED3 vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-13	missing_evidence	1	1960	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 616.5, 639.42, 619.37, 694.98 / floorplan_gap; width; width 1960mm; near BED3; wall V-103; measured floor-plan exterior wall gap near BED3; gap is near BED3 and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-14 - WIR vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-14	missing_evidence	1	1880	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 369.64, 543.42, 378.65, 596.58 / floorplan_gap; width; width 1880mm; near WIR; wall V-62; measured floor-plan interior wall gap near WIR; gap routed to WIR on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-15 - FAMILY vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-15	missing_evidence	1	1870	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 251.82, 356.06, 304.86, 358.54 / floorplan_gap; width; width 1870mm; near FAMILY; wall H-60; measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-16 - MASTERBED vector_geometry / c2159cc7- aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-16	missing_evidence	1	1850	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 194.34, 550.26, 202.46, 602.82 / floorplan_gap; width; width 1850mm; near MASTERBED; wall V-33; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the east side of the wall; measured gap is on an interior wall line, so it is review-only until exterior

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
								wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-17 - LAUNDRY/MUDROOM vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-17	missing_evidence	1	1850	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 637.24, 371.94, 640.21, 424.32 / floorplan_gap; width; width 1850mm; near LAUNDRY/MUDROOM; wall V-106; measured floor-plan exterior wall gap near LAUNDRY/MUDROOM; gap is near LAUNDRY/MUDROOM and ENTRY; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-18 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-18	missing_evidence	1	1770	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 265.5, 596.67, 315.78, 600.45 / floorplan_gap; width; width 1770mm; near MASTERBED; wall H-100; measured floor-plan interior wall gap near MASTERBED; gap is near MASTERBED and ENSUITE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-19 - FAMILY vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-19	missing_evidence	1	1770	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 251.82, 182.32, 301.92, 184.56 / floorplan_gap; width; width 1770mm; near FAMILY; wall H-31; measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-20 - BATH vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-20	missing_evidence	1	1660	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 406.86, 516.9, 453.9, 525.78 / floorplan_gap; width; width 1660mm; near BATH; wall H-87; measured floor-plan interior wall gap near BATH; gap is near BATH and LOUNGE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-21 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-21	missing_evidence	1	510	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 1119.42, 356.06, 1133.82, 358.54 / floorplan_gap; width; width 510mm; wall H-60; measured floor-plan wall gap; room and height still need confirmation
Opening floorplan-gap-22 - BED2 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-22	missing_evidence	1	470	-	-	-	35	height_not_extracted, area_not_calculated, source_conflict / p1 / 588.9, 540.66, 602.1, 549.43 / floorplan_gap; width; width 470mm; near BED2; wall H-91; measured floor-plan interior wall gap near BED2; gap is near BED2 and STUDY/BED4; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-23 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-23	missing_evidence	1	400	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 710.57, 683.58, 713.56, 694.98 / floorplan_gap; width; width 400mm; wall V-119; measured floor-plan wall gap; room and height still need confirmation
Opening floorplan-gap-24 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-24	missing_evidence	1	400	-	-	-	35	height_not_extracted, area_not_calculated / p1 / 304.28, 106.62, 307.48, 117.9 / floorplan_gap; width; width 400mm; wall V-51; measured floor-plan wall gap; room and height still need confirmation

EXTERIOR DOORS

Clean count 0	Clean length - mm	Clean area - m2	needs_review 4	missing 0	conflict 0	ignored 0	confidence 53
---------------	-------------------	-----------------	----------------	-----------	------------	-----------	---------------

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening quarantined-opening-1 - Laundry Mudroom pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-quarantined-opening-1	needs_review	1	1030	-	-	-	70	assumed_height_rejected, area_not_calculated, source_conflict / - / floorplan_text; dimension; width 1030mm; height 2100mm; area 2.16m2; near Laundry Mudroom; pa_door opening held out of pricing from floorplan_text
Opening quarantined-opening-2 - Entry floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-quarantined-opening-2	needs_review	1	0	-	-	-	35	assumed_height_rejected, area_not_calculated, source_conflict / - / vector; dimension; width 0mm; height 2100mm; area 0m2; near Entry; entrance opening held out of pricing from vector
Opening visual-opening-9 - Laundry/Mudroom visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-9	needs_review	1	900	2100	-	-	35	area_not_calculated / - / vision; dimension; width 900mm; height 2100mm; area 1.89m2; near Laundry/Mudroom; door symbol visible on Laundry east wall leading to garage area; standard door assumed; marker on door opening
Opening visual-opening-19 - Entry visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-19	needs_review	1	1000	2100	-	-	70	area_not_calculated / - / vision; dimension; width 1000mm; height 2100mm; area 2.1m2; near Entry; entry door visible on Entry west wall; standard entry door assumed; marker on door opening

Garage Doors

Clean count 0	Clean length - mm	Clean area - m2	needs_review 0	missing 1	conflict 1	ignored 0	confidence 53
---------------	-------------------	-----------------	----------------	-----------	------------	-----------	---------------

LABEL	STATUS	COUNT	W	H	LEN	AREA	CONF.	EVIDENCE
Opening visual-opening-10 - Garage visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-10	missing_evidence	1	-	-	-	-	35	width_not_extracted, height_not_extracted, area_not_calculated / - / vision; candidate; near Garage; large garage opening visible on north wall of Garage; no clear dimension label on floor plan; elevation shows sectional door
Opening held-blocked-opening-14 - Garage floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-14	conflict	1	4800	2100	-	-	70	area_not_calculated, source_conflict / - / vector; dimension; width 4800mm; height 2100mm; area 10.08m2; near Garage; sectional_door opening has complete dimensions but is held out of pricing from vector

2 / Windows & glazed openings

Checked against plan []

Opening reconciliation blocked	Floor-plan and elevation opening counts disagree. Use Extracted Quantities Review; do not price openings or cladding from this run.	Opening reconciliation is unresolved. Use Extracted Quantities Review before pricing.	Detail: review found 17 QS-glazed external openings; composed opening set has 13.	Detail: floor-plan/elevation check 17; active composed openings 13.
--------------------------------	---	---	---	---

PER-ROOM (AS THE QS SHEET RECEIVES IT)

No per-room window rows.

WINDOW SCHEDULE (PLAN CROSS-CHECK)

No schedule read for this run.

PRICING STATUS	REVIEW-ONLY VISUAL QS OPENINGS	REVIEW-ONLY GARAGE CANDIDATES	GLAZED - m2	TOTAL OPENINGS - m2
9	17	1		

Interior counts source: **Extracted Quantity Ledger** / vision hint: 12 (never exported)

INTERIOR

Interior doors - standard	10
Interior doors - double	8
Interior doors - cavity sliders	2
Total interior	20

EXTERNAL & GARAGE

Garage door size	Blocked - verify manually	Review
Opening reconciliation blocked; garage door size is review-only until reconciled.		
None.		

Active extracted quantity overlay: **persisted_current_run** / run **c2159cc7-aecd-4644-b339-fe3443acef9f**

Total ledger rows 77

Rows with markers 37

Rows without markers 40

DRAWABLE LEDGER MARKERS

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening floorplan-label-1 - FAMILY pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-1 anchor / va_wgpn8x	window	extracted	1	2400	1300	-	3.12	p1 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near FAMILY; clean floor-plan opening label 1300 x 2400 assigned to FAMILY by unique room proximity/order
Opening floorplan-label-2 - DINING pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-2 anchor / va_1o4b7vq	window	extracted	1	2400	1300	-	3.12	p1 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near DINING; clean floor-plan opening label 1300 x 2400 assigned to DINING by unique room proximity/order
Opening floorplan-label-3 - DINING pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-3 anchor / va_uabvcc	window	needs_review	1	1500	1100	-	-	area_not_calculated / p1 / floorplan_text; dimension; 1100 x 1500; width 1500mm; height 1100mm; near DINING; floor-plan opening label 1100 x 1500 retained for review: room/order assignment is ambiguous
Opening floorplan-label-4 - LAUNDRY/MUDROOM pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-4 anchor / va_1bz5v1y	window	needs_review	1	3000	700	-	-	area_not_calculated / p1 / floorplan_text; dimension; 700 x 3000; width 3000mm; height 700mm; near LAUNDRY/MUDROOM; floor-plan opening label 700 x 3000 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening floorplan-label-5 - STUDY/BED4 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-5 anchor / va_qj6ywm	window	needs_review	1	400	2150	-	-	area_not_calculated / p1 / floorplan_text; dimension; 2150 x 400; width 400mm; height 2150mm; near STUDY/BED4; floor-plan opening label 2150 x 400 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening floorplan-label-6 - STUDY/BED4 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-6 anchor / va_wn5a0m	window	extracted	1	1500	1300	-	1.95	p1 / floorplan_text; dimension; 1300 x 1500; width 1500mm; height 1300mm; area 1.95m2; near STUDY/BED4; clean floor-plan opening label 1300 x 1500 assigned to STUDY/BED4 by unique room proximity/order
Opening floorplan-label-7 - ENSUITE pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-7 anchor / va_398y6z	window	extracted	1	600	2150	-	1.29	p1 / floorplan_text; dimension; 2150 x 600; width 600mm; height 2150mm; area 1.29m2; near ENSUITE; clean floor-plan opening label 2150 x 600 assigned to ENSUITE by unique room proximity/order
Opening floorplan-label-8 - ENSUITE pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-8 anchor / va_1eykxht	window	needs_review	1	600	1100	-	-	area_not_calculated / p1 / floorplan_text; dimension; 1100 x 600; width 600mm; height 1100mm; near ENSUITE; floor-plan opening label 1100 x 600 retained for review: dimension band is large, narrow, or door-like; keep for review
Opening floorplan-label-9 - BATH pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-9	window	extracted	1	1200	1100	-	1.32	p1 / floorplan_text; dimension; 1100 x 1200; width 1200mm; height 1100mm; area 1.32m2; near BATH; clean floor-plan opening label 1100 x 1200 assigned to BATH by unique room proximity/order

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
anchor / va_1g02lw5								
Opening floorplan-label-10 - BED2 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-10 anchor / va_dgc51h	window	extracted	1	1500	1300	-	1.95	p1 / floorplan_text; dimension; 1300 x 1500; width 1500mm; height 1300mm; area 1.95m2; near BED2; clean floor-plan opening label 1300 x 1500 assigned to BED2 by unique room proximity/order
Opening floorplan-label-11 - MASTERBED pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-11 anchor / va_brpkdz	window	extracted	1	800	1100	-	0.88	p1 / floorplan_text; dimension; 1100 x 800; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; clean floor-plan opening label 1100 x 800 assigned to MASTERBED by unique room proximity/order
Opening floorplan-label-12 - MASTERBED pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-12 anchor / va_gqzqmp	window	extracted	1	800	1100	-	0.88	p1 / floorplan_text; dimension; 1100 x 800; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; clean floor-plan opening label 1100 x 800 assigned to MASTERBED by unique room proximity/order
Opening floorplan-label-13 - BED3 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-label-13 anchor / va_1n0ke3z	window	extracted	1	2400	1300	-	3.12	p1 / floorplan_text; dimension; 1300 x 2400; width 2400mm; height 1300mm; area 3.12m2; near BED3; clean floor-plan opening label 1300 x 2400 assigned to BED3 by unique room proximity/order
Opening floorplan-gap-1 - PANTRY vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-1 anchor / va_1bzs5me	opening	needs_review	1	2750	1000	-	-	area_not_calculated / p1 / floorplan_gap; width; width 2750mm; near PANTRY; wall V-111; measured floor-plan exterior wall gap near PANTRY; gap routed to PANTRY on the west side of the wall; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-2 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-2 anchor / va_fkxm0x	opening	missing_evidence	1	1990	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 1990mm; near ENSUITE; wall V-52; measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-3 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-3 anchor / va_xk517z	opening	missing_evidence	1	380	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 380mm; near ENSUITE; wall V-34; measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-4 - LOUNGE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-	opening	missing_evidence	1	4980	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 4980mm; near LOUNGE; wall V-77; measured floor-plan interior wall gap near LOUNGE; gap routed to LOUNGE on the west side of the wall; measured

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
gap-4 anchor / va_cl3ky9								gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-5 - ENSUITE vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-5 anchor / va_jtboeh	opening	missing_evidence	1	4590	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 4590mm; near ENSUITE; wall V-61; measured floor-plan interior wall gap near ENSUITE; gap routed to ENSUITE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-6 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-6 anchor / va_1q9dzh0	opening	missing_evidence	1	4310	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 4310mm; near MASTERBED; wall H-60; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-7 - BATH vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-7 anchor / va_37hjcw	opening	missing_evidence	1	3650	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 3650mm; near BATH; wall H-99; measured floor-plan interior wall gap near BATH; gap is near BATH and WIR; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-8 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-8 anchor / va_152zwl0	opening	missing_evidence	1	3630	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 3630mm; near MASTERBED; wall H-107; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-9 - STUDY/BED4 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-9 anchor / va_o6ys0v	opening	missing_evidence	1	3180	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 3180mm; near STUDY/BED4; wall V-95; measured floor-plan interior wall gap near STUDY/BED4; gap is near STUDY/BED4 and ENTRY; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-10 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-10 anchor / va_omy127	opening	missing_evidence	1	3110	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 3110mm; near MASTERBED; wall H-85; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-11 - BATH vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-11 anchor / va_1be8dw2	opening	missing_evidence	1	1960	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1960mm; near BATH; wall V-83; measured floor-plan exterior wall gap near BATH; gap is near BATH and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-12 - BED2	opening	missing_evidence	1	1960	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1960mm; near BED2; wall V-100; measured floor-plan exterior wall gap near BED2; gap is near BED2 and BED3; keep room routing under

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-12 anchor / va_13s9fdh								review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-13 - BED3 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-13 anchor / va_6ae55t	opening	missing_evidence	1	1960	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1960mm; near BED3; wall V-103; measured floor-plan exterior wall gap near BED3; gap is near BED3 and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-14 - WIR vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-14 anchor / va_is8rmx	opening	missing_evidence	1	1880	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 1880mm; near WIR; wall V-62; measured floor-plan interior wall gap near WIR; gap routed to WIR on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-15 - FAMILY vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-15 anchor / va_1xnwpfo	opening	missing_evidence	1	1870	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 1870mm; near FAMILY; wall H-60; measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-16 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-16 anchor / va_64zgb2	opening	missing_evidence	1	1850	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 1850mm; near MASTERBED; wall V-33; measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the east side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-17 - LAUNDRY/MUDROOM vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-17 anchor / va_ioig6y	opening	missing_evidence	1	1850	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1850mm; near LAUNDRY/MUDROOM; wall V-106; measured floor-plan exterior wall gap near LAUNDRY/MUDROOM; gap is near LAUNDRY/MUDROOM and ENTRY; keep room routing under review; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-18 - MASTERBED vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-18 anchor / va_1lizbqk	opening	missing_evidence	1	1770	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1770mm; near MASTERBED; wall H-100; measured floor-plan interior wall gap near MASTERBED; gap is near MASTERBED and ENSUITE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-19 - FAMILY vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-19 anchor / va_i87wys	opening	missing_evidence	1	1770	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 1770mm; near FAMILY; wall H-31; measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening floorplan-gap-20 - BATH vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-20 anchor / va_zzogcl	opening	missing_evidence	1	1660	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 1660mm; near BATH; wall H-87; measured floor-plan interior wall gap near BATH; gap is near BATH and LOUNGE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-21 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-21 anchor / va_kb0xof	opening	missing_evidence	1	510	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 510mm; wall H-60; measured floor-plan wall gap; room and height still need confirmation
Opening floorplan-gap-22 - BED2 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-22 anchor / va_lbly4t	opening	missing_evidence	1	470	-	-	-	height_not_extracted, area_not_calculated, source_conflict / p1 / floorplan_gap; width; width 470mm; near BED2; wall H-91; measured floor-plan interior wall gap near BED2; gap is near BED2 and STUDY/BED4; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation
Opening floorplan-gap-23 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-23 anchor / va_1ty464y	opening	missing_evidence	1	400	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 400mm; wall V-119; measured floor-plan wall gap; room and height still need confirmation
Opening floorplan-gap-24 vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-floorplan-gap-24 anchor / va_1qst3ie	opening	missing_evidence	1	400	-	-	-	height_not_extracted, area_not_calculated / p1 / floorplan_gap; width; width 400mm; wall V-51; measured floor-plan wall gap; room and height still need confirmation

ROWS WITHOUT MARKERS


LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening held-blocked-opening-12 - MASTERBED floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-12	window	conflict	1	800	1100	-	-	area_not_calculated, source_conflict / vector; dimension; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-13 - BED3 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-13	window	conflict	1	2400	1300	-	-	area_not_calculated, source_conflict / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near BED3; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-14 - Garage floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-14	garage_door	conflict	1	4800	2100	-	-	area_not_calculated, source_conflict / vector; dimension; width 4800mm; height 2100mm; area 10.08m2; near Garage; sectional_door opening has complete dimensions but is held out of pricing from vector
Exterior perimeter vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / external-perimeter	exterior_perimeter	extracted	1	-	-	89100	-	EnrichedTakeoff.external_wall_lm
Interior doors - standard vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-standard	interior_door	extracted	10	-	-	-	-	deterministic interior-door engine confirmed count
Interior doors - double vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-double	interior_door	extracted	8	-	-	-	-	deterministic interior-door engine confirmed count
Interior doors - cavity sliders vector_geometry / c2159cc7-aecd-4644-b339-fe3443acef9f / interior-door-cavity	interior_door	extracted	2	-	-	-	-	deterministic interior-door engine confirmed count
Opening held-blocked-opening-1 - FAMILY floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-1	window	conflict	1	2400	1300	-	-	area_not_calculated, source_conflict / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near FAMILY; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-2 - DINING floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-2	window	conflict	1	2400	1300	-	-	area_not_calculated, source_conflict / vector; dimension; width 2400mm; height 1300mm; area 3.12m2; near DINING; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-3 - DINING floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-3	window	conflict	1	1500	1100	-	-	area_not_calculated, source_conflict / vector; dimension; width 1500mm; height 1100mm; area 1.65m2; near DINING; window opening has complete dimensions but is held out of pricing from vector

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening held-blocked-opening-4 - LAUNDRY/MUDROOM floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-4	window	conflict	1	3000	700	-	-	area_not_calculated, source_conflict / vector; dimension; width 3000mm; height 700mm; area 2.1m2; near LAUNDRY/MUDROOM; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-5 - STUDY/BED4 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-5	window	conflict	1	400	2150	-	-	area_not_calculated, source_conflict / vector; dimension; width 400mm; height 2150mm; area 0.86m2; near STUDY/BED4; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-6 - STUDY/BED4 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-6	window	conflict	1	1500	1300	-	-	area_not_calculated, source_conflict / vector; dimension; width 1500mm; height 1300mm; area 1.95m2; near STUDY/BED4; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-7 - ENSUITE floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-7	window	conflict	1	600	2150	-	-	area_not_calculated, source_conflict / vector; dimension; width 600mm; height 2150mm; area 1.29m2; near ENSUITE; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-8 - ENSUITE floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-8	window	conflict	1	600	1100	-	-	area_not_calculated, source_conflict / vector; dimension; width 600mm; height 1100mm; area 0.66m2; near ENSUITE; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-9 - BATH floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-9	window	conflict	1	1200	1100	-	-	area_not_calculated, source_conflict / vector; dimension; width 1200mm; height 1100mm; area 1.32m2; near BATH; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-10 - BED2 floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-10	window	conflict	1	1500	1300	-	-	area_not_calculated, source_conflict / vector; dimension; width 1500mm; height 1300mm; area 1.95m2; near BED2; window opening has complete dimensions but is held out of pricing from vector
Opening held-blocked-opening-11 - MASTERBED floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-held-blocked-opening-11	window	conflict	1	800	1100	-	-	area_not_calculated, source_conflict / vector; dimension; width 800mm; height 1100mm; area 0.88m2; near MASTERBED; window opening has complete dimensions but is held out of pricing from vector
Opening quarantined-opening-1 - Laundry Mudroom pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-quarantined-opening-1	exterior_door	needs_review	1	1030	-	-	-	assumed_height_rejected, area_not_calculated, source_conflict / floorplan_text; dimension; width 1030mm; height 2100mm; area 2.16m2; near Laundry Mudroom; pa_door opening held out of pricing from floorplan_text
Opening quarantined-opening-2 - Entry floorplan_symbol / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-quarantined-opening-2	exterior_door	needs_review	1	0	-	-	-	assumed_height_rejected, area_not_calculated, source_conflict / vector; dimension; width 0mm; height 2100mm; area 0m2; near Entry; entrance opening held out of pricing from vector

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening visual-opening-1 - Master Bed visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-1	window	needs_review	1	600	1100	-	-	area_not_calculated / vision; dimension; 1100x600; width 600mm; height 1100mm; area 0.66m2; near Master Bed; printed 1100x600 on Master Bed south wall; marker placed on window symbol in external wall
Opening visual-opening-2 - Ensuite visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-2	window	needs_review	1	600	2130	-	-	area_not_calculated / vision; dimension; 2130x600; width 600mm; height 2130mm; area 1.28m2; near Ensuite; printed 2130x600 on Ensuite south wall; marker placed on window line
Opening visual-opening-3 - Bath visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-3	window	needs_review	1	600	1100	-	-	area_not_calculated / vision; dimension; 1100x600; width 600mm; height 1100mm; area 0.66m2; near Bath; printed 1100x600 on Bath south wall; marker placed on window symbol
Opening visual-opening-4 - Bed 2 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-4	window	needs_review	1	1200	1100	-	-	area_not_calculated / vision; dimension; 1100x1200; width 1200mm; height 1100mm; area 1.32m2; near Bed 2; printed 1100x1200 on Bed 2 south wall; marker placed on window line
Opening visual-opening-5 - Bed 3 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-5	window	needs_review	1	1300	1300	-	-	area_not_calculated / vision; dimension; 1300x1300; width 1300mm; height 1300mm; area 1.69m2; near Bed 3; printed 1300x1300 on Bed 3 south wall; marker placed on window symbol
Opening visual-opening-6 - Bed 3 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-6	window	needs_review	1	1510	1810	-	-	area_not_calculated / vision; dimension; 1810x1510; width 1510mm; height 1810mm; area 2.73m2; near Bed 3; printed 1810x1510 on Bed 3 east wall; marker placed on window line
Opening visual-opening-7 - Study/Bed 4 visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-7	window	needs_review	1	1300	1300	-	-	area_not_calculated / vision; dimension; 1300x1300; width 1300mm; height 1300mm; area 1.69m2; near Study/Bed 4; printed 1300x1300 on Study/Bed 4 east wall; marker placed on window symbol
Opening visual-opening-8 - Laundry/Mudroom visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-8	window	needs_review	1	3000	700	-	-	area_not_calculated / vision; dimension; 700x3000; width 3000mm; height 700mm; area 2.1m2; near Laundry/Mudroom; printed 700x3000 near Laundry/Mudroom; marker placed on window line in east wall
Opening visual-opening-9 - Laundry/Mudroom visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-9	exterior_door	needs_review	1	900	2100	-	-	area_not_calculated / vision; dimension; width 900mm; height 2100mm; area 1.89m2; near Laundry/Mudroom; door symbol visible on Laundry east wall leading to garage area; standard door assumed; marker on door opening
Opening visual-opening-10 - Garage visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-10	garage_door	missing_evidence	1	-	-	-	-	width_not_extracted, height_not_extracted, area_not_calculated / vision; candidate; near Garage; large garage opening visible on north wall of Garage; no clear dimension label on floor plan; elevation shows sectional door
Opening visual-opening-11 - Pantry visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-11	window	needs_review	1	1500	1100	-	-	area_not_calculated / vision; dimension; 1100x1500; width 1500mm; height 1100mm; area 1.65m2; near Pantry; printed 1100x1500 on Pantry north wall; marker placed on opening line
Opening visual-opening-12 - Dining visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-12	window	needs_review	1	2400	1300	-	-	area_not_calculated / vision; dimension; 1300x2400; width 2400mm; height 1300mm; area 3.12m2; near Dining; printed 1300x2400 on Dining north wall; marker placed on slider opening
Opening visual-opening-13 - Dining visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-13	window	needs_review	1	2400	1300	-	-	area_not_calculated / vision; dimension; 1300x2400; width 2400mm; height 1300mm; area 3.12m2; near Dining; printed 1300x2400 second slider on Dining north wall; marker placed on slider opening

LEDGER ROW	CATEGORY	STATUS	COUNT	W	H	LEN	AREA	WARNINGS / EVIDENCE
Opening visual-opening-14 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-14	window	needs_review	1	1400	790	-	-	area_not_calculated / vision; dimension; 790x1400; width 1400mm; height 790mm; area 1.11m2; near Family; printed 790x1400 on Family west wall; marker placed on window symbol
Opening visual-opening-15 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-15	window	needs_review	1	1730	1300	-	-	area_not_calculated / vision; dimension; 1300x1725; width 1730mm; height 1300mm; area 2.25m2; near Family; printed 1300x1725 on Family west wall; marker placed on slider opening
Opening visual-opening-16 - Family visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-16	window	needs_review	1	1400	790	-	-	area_not_calculated / vision; dimension; 790x1400; width 1400mm; height 790mm; area 1.11m2; near Family; printed 790x1400 on Family west wall lower; marker placed on window line
Opening visual-opening-17 - Lounge visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-17	window	missing_evidence	1	-	-	-	-	width_not_extracted, height_not_extracted, area_not_calculated / vision; candidate; near Lounge; slider opening visible on Lounge west wall to deck; no clear dimension label; elevation confirms slider presence
Opening visual-opening-18 - Master Bed visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-18	window	needs_review	1	600	1320	-	-	area_not_calculated / vision; dimension; 1320x600; width 600mm; height 1320mm; area 0.79m2; near Master Bed; printed 1320x600 on Master Bed west wall; marker placed on window symbol
Opening visual-opening-19 - Entry visual_detection / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-visual-opening-19	exterior_door	needs_review	1	1000	2100	-	-	area_not_calculated / vision; dimension; width 1000mm; height 2100mm; area 2.1m2; near Entry; entry door visible on Entry west wall; standard entry door assumed; marker on door opening
Opening drafting-issue-1 pdf_text / c2159cc7-aecd-4644-b339-fe3443acef9f / opening-drafting-issue-1	opening	missing_evidence	1	-	-	-	-	width_not_extracted, height_not_extracted, area_not_calculated, source_conflict / floorplan_text; conflict; 1300x175036001300x1750; malformed floor-plan text is retained as evidence but is not priced unless another source confirms the opening

Legacy visual evidence only. Legacy door hits: 20; legacy visual openings: 19. Legacy visual evidence only - not active extracted quantity authority.

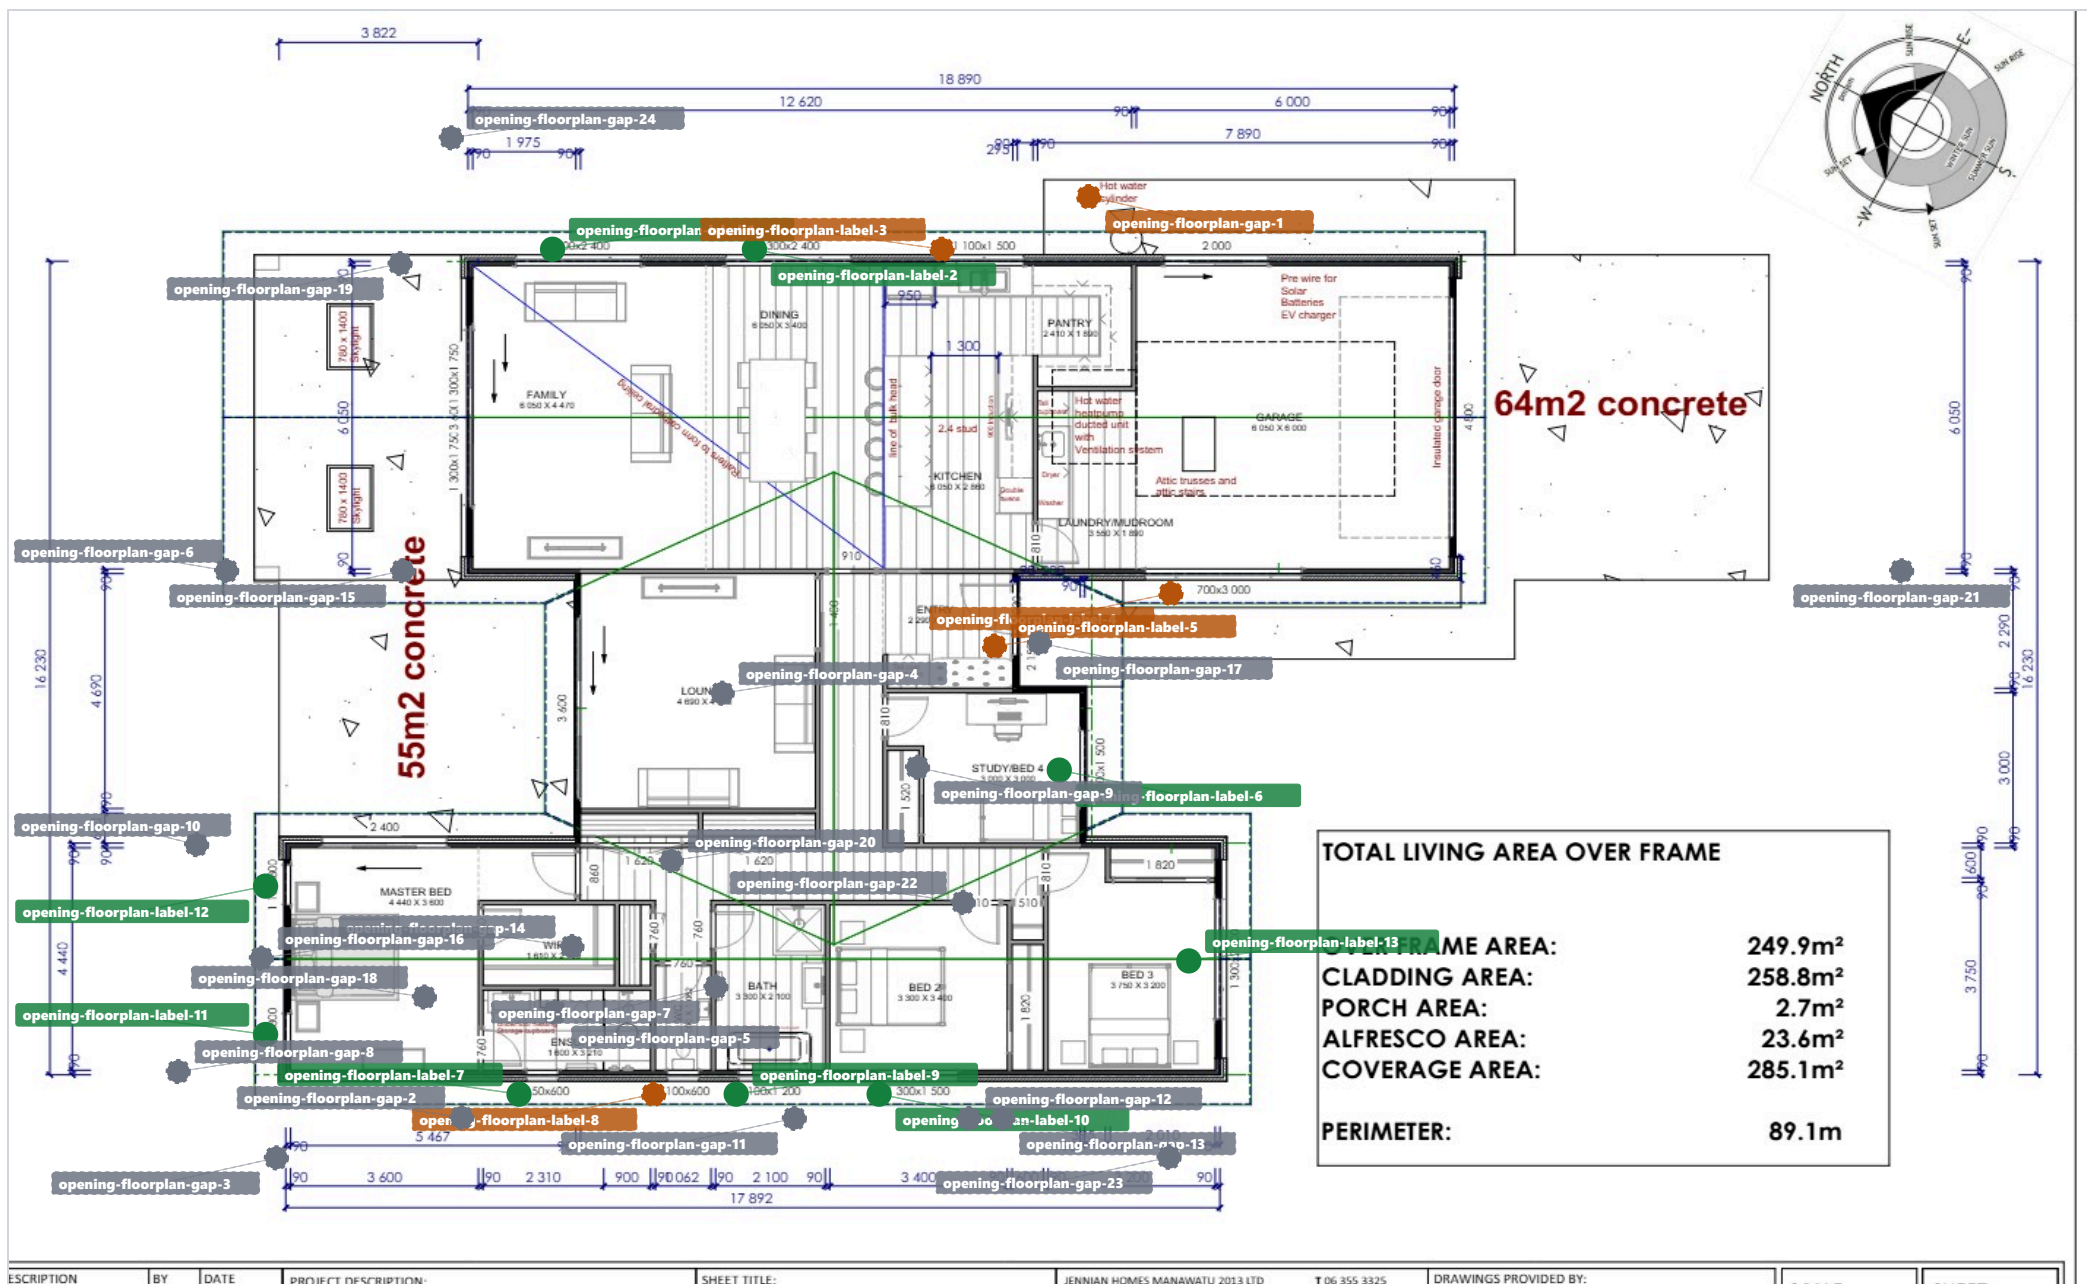

Active overlay markers are drawn only from active extracted quantity ledger rows with bbox evidence. Rows without bbox stay visible above as no-marker ledger rows.

Some dimension labels partially obscured or not clearly readable	Garage door dimension not labelled on floor plan	One or more visual markers failed floor-plan position validation and were excluded from the Visual QS count.
--	--	--

Legacy visual evidence only - not active extracted quantity authority: **18** total / **17** QS glazed/opening items / **1** garage door excluded from glazing / **1** uncertain/low.

#	TYPE	ROOM	SIZE	CONF.	EVIDENCE / FLAGS
O1	window	Master Bed	1100 x 600	high	printed 1100x600 on Master Bed south wall; marker placed on window symbol in external wall
O2	window	Ensuite	2130 x 600	high	printed 2130x600 on Ensuite south wall; marker placed on window line
O3	window	Bath	1100 x 600	high	printed 1100x600 on Bath south wall; marker placed on window symbol
O4	window	Bed 2	1100 x 1200	high	printed 1100x1200 on Bed 2 south wall; marker placed on window line
O5	window	Bed 3	1300 x 1300	high	printed 1300x1300 on Bed 3 south wall; marker placed on window symbol
O6	window	Bed 3	1810 x 1510	high	printed 1810x1510 on Bed 3 east wall; marker placed on window line
O7	window	Study/Bed 4	1300 x 1300	high	printed 1300x1300 on Study/Bed 4 east wall; marker placed on window symbol
O8	window	Laundry/Mudroom	700 x 3000	medium	printed 700x3000 near Laundry/Mudroom; marker placed on window line in east wall / unusual height dimension
O9	opening	Laundry/Mudroom	2100 x 900	low	door symbol visible on Laundry east wall leading to garage area; standard door assumed; marker on door opening / dimension not labelled / visual marker not on verified floor-plan opening - not counted / nearby dimensioned visual opening already represents this physical opening
O10	garage door	Garage	-	low	large garage opening visible on north wall of Garage; no clear dimension label on floor plan; elevation shows sectional door / dimension not labelled / marker position approximate / marker not confirmed on physical opening
O11	slider	Pantry	1100 x 1500	high	printed 1100x1500 on Pantry north wall; marker placed on opening line
O12	slider	Dining	1300 x 2400	high	printed 1300x2400 on Dining north wall; marker placed on slider opening
O13	slider	Dining	1300 x 2400	high	printed 1300x2400 second slider on Dining north wall; marker placed on slider opening
O14	window	Family	790 x 1400	high	printed 790x1400 on Family west wall; marker placed on window symbol
O15	slider	Family	1300 x 1730	high	printed 1300x1725 on Family west wall; marker placed on slider opening
O16	window	Family	790 x 1400	high	printed 790x1400 on Family west wall lower; marker placed on window line
O17	slider	Lounge	-	medium	slider opening visible on Lounge west wall to deck; no clear dimension label; elevation confirms slider presence / dimension not labelled
O18	window	Master Bed	1320 x 600	high	printed 1320x600 on Master Bed west wall; marker placed on window symbol
O19	opening	Entry	2100 x 1000	medium	entry door visible on Entry west wall; standard entry door assumed; marker on door opening / dimension not labelled

Legacy door-engine evidence only - not active extracted quantity authority: 20 hits / 0 verify / 0 flagged (hinged 10 / double 8 / cavity 2). These legacy hits are not active ledger totals.

#	TYPE	WIDTH (MM)	STATUS	NOTE
D1	double	2000	confirmed	
D2	double	1300	confirmed	
D3	cavity	910	confirmed	no swing arc — slider
D4	hinged	810	confirmed	
D5	double	1400	confirmed	
D6	hinged	810	confirmed	
D7	double	1520	confirmed	
D8	cavity	600	confirmed	no swing arc — slider
D9	hinged	860	confirmed	recovered from wall-opening evidence
D10	double	1620	confirmed	
D11	double	1620	confirmed	
D12	hinged	810	confirmed	
D13	double	1820	confirmed	
D14	hinged	760	confirmed	
D15	hinged	760	confirmed	
D16	hinged	810	confirmed	
D17	hinged	510	confirmed	
D18	hinged	760	confirmed	
D19	double	1820	confirmed	
D20	hinged	760	confirmed	

5 / Roof, cladding & elevations

Checked against plan []

Review Elevation opening ledger is low-confidence (25 of 49 opening(s) have no readable dimensions). Floor-plan/window-code evidence remains the source of truth until the elevation openings can be read cleanly. Elevation opening ledger disagrees with elevation summary - ledger windows 45, summary windows 22. Use the per-opening ledger for review.

ROOF & CLADDING

Roof pitch	30deg
Ridge type	-
Underlay	-
Cladding 1	BRICK
Cladding 2	-
Cladding code	3 - mixed

ELEVATIONS & SITE

Roof type (elevations)	Gable roof - Long Run Trim Rib
Roof pitch (elevations)	30 deg
Gable ends	2
Driveway concrete	-
Paths / patio concrete	-
Total concrete	-

6 / Services & extras

Checked against plan []

DOWNPIPES

None.

SKYLIGHTS

None.

HEAT PUMPS

None.

EXTRAS / PC ITEMS

None.

7 / Specifications (meeting answers)

Checked against plan []

SERVICES

Services	Residential
----------	-------------

KITCHEN

Kitchen PC sum	\$15K
----------------	-------

LAUNDRY

Laundry PC sum	\$2K
----------------	------

APPLIANCES

Cooktop	Standard
Oven	Standard
Dishwasher	Standard

HOT WATER

Hot water	Standard
-----------	----------

HEATING

Heating	High wall heat pump
---------	---------------------

BATHROOMS

Shower	Acrylic
Bath	Tiled-in cradle

INTERIOR

Interior door type	Std flush
Ceiling hatch	Standard

INSULATION

Acoustic insulation	No (standard)
Underslab insulation	No (standard)
Hot edge insulation	No (standard)

FLOORING

Garage carpet	No (standard)
---------------	---------------

8 / Exceptions & review flags

Review Floor area

Floor area: rejected geometry candidate 317.62; floor_area_m2: geometry=317.62, printed=249.9, diff=27.1%. Using vision/title-block candidate 249.9.

Review Garage area

reconciliation: garage area taken from the plan's printed room dims (6050x6000 = 36.3 m2).

Review Internal wall (lm)

Review ribbon-trace v1 - deterministic from the plan's wall pairs (38 ribbons); known ~+25% joinery bias, VERIFY before pricing. Not exported.

Review Windows by room

Visual QS retained external-wall openings as review evidence only; deterministic geometry, schedule, or approved measured evidence must promote priceable openings.

O1: visual opening retained as evidence only; not promoted into QS openings.

O2: visual opening retained as evidence only; not promoted into QS openings.

O3: visual opening retained as evidence only; not promoted into QS openings.

O4: visual opening retained as evidence only; not promoted into QS openings.

O5: visual opening retained as evidence only; not promoted into QS openings.

O6: visual opening retained as evidence only; not promoted into QS openings.

O7: visual opening retained as evidence only; not promoted into QS openings.

O8: visual opening retained as evidence only; not promoted into QS openings.

O9: visual marker rejected by floor-plan validation; not promoted.

O10: visual garage door size unreadable; not promoted.

O10: visual opening retained as evidence only; not promoted into QS openings.

O11: visual opening retained as evidence only; not promoted into QS openings.

O12: visual opening retained as evidence only; not promoted into QS openings.

O13: visual opening retained as evidence only; not promoted into QS openings.

O14: visual opening retained as evidence only; not promoted into QS openings.

O15: visual opening retained as evidence only; not promoted into QS openings.

O16: visual opening retained as evidence only; not promoted into QS openings.

O17: visual opening size unreadable; retained as review evidence only.

O17: visual opening retained as evidence only; not promoted into QS openings.

O18: visual opening retained as evidence only; not promoted into QS openings.

O19: visual opening retained as evidence only; not promoted into QS openings.

Laundry Mudroom: pa_door 1.03m x 2.1m quarantined from pricing (asserted height).

Entry: entrance 0m x 2.1m quarantined from pricing (missing width, asserted height).

Review Garage door

Garage door recovered from elevation-face-5 elevation vector candidate 4873x2100mm and snapped to QS size 4.8x2.1.

Review Opening evidence - held-blocked-opening-1

Status: not priced; held_blocked; type window; near FAMILY; width 2400mm; height 1300mm

vector dimension (width 2400mm, height 1300mm, near FAMILY): window opening has complete dimensions but is held out of pricing from vector

Conflicts: visual_reconciliation_error

Review Opening evidence - held-blocked-opening-2

Status: not priced; held_blocked; type window; near DINING; width 2400mm; height 1300mm

vector dimension (width 2400mm, height 1300mm, near DINING): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-3

Status: not priced; held_blocked; type window; near DINING; width 1500mm; height 1100mm

vector dimension (width 1500mm, height 1100mm, near DINING): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-4

Status: not priced; held_blocked; type window; near LAUNDRY/MUDROOM; width 3000mm; height 700mm

vector dimension (width 3000mm, height 700mm, near LAUNDRY/MUDROOM): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-5

Status: not priced; held_blocked; type window; near STUDY/BED4; width 400mm; height 2150mm

vector dimension (width 400mm, height 2150mm, near STUDY/BED4): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-6

Status: not priced; held_blocked; type window; near STUDY/BED4; width 1500mm; height 1300mm
vector dimension (width 1500mm, height 1300mm, near STUDY/BED4): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-7

Status: not priced; held_blocked; type window; near ENSUITE; width 600mm; height 2150mm
vector dimension (width 600mm, height 2150mm, near ENSUITE): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-8

Status: not priced; held_blocked; type window; near ENSUITE; width 600mm; height 1100mm
vector dimension (width 600mm, height 1100mm, near ENSUITE): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-9

Status: not priced; held_blocked; type window; near BATH; width 1200mm; height 1100mm
vector dimension (width 1200mm, height 1100mm, near BATH): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-10

Status: not priced; held_blocked; type window; near BED2; width 1500mm; height 1300mm
vector dimension (width 1500mm, height 1300mm, near BED2): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-11

Status: not priced; held_blocked; type window; near MASTERBED; width 800mm; height 1100mm
vector dimension (width 800mm, height 1100mm, near MASTERBED): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-13

Status: not priced; held_blocked; type window; near BED3; width 2400mm; height 1300mm
vector dimension (width 2400mm, height 1300mm, near BED3): window opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - held-blocked-opening-14

Status: not priced; held_blocked; type sectional_door; near Garage; width 4800mm; height 2100mm
vector dimension (width 4800mm, height 2100mm, near Garage): sectional_door opening has complete dimensions but is held out of pricing from vector

Review Opening evidence - quarantined-opening-1

Status: not priced; review; type pa_door; near Laundry Mudroom; width 1030mm; height 2100mm
height assumed standard 2.1m - confirm against the elevation/joinery schedule
floorplan_text dimension (width 1030mm, height 2100mm, near Laundry Mudroom): pa_door opening held out of pricing from floorplan_text
Conflicts: asserted_height

Review Opening evidence - quarantined-opening-2

Status: not priced; review; type entrance; near Entry; width 0mm; height 2100mm
width unresolved - confirm against plan
vector dimension (width 0mm, height 2100mm, near Entry): entrance opening held out of pricing from vector
Conflicts: missing_width, asserted_height

Review Opening evidence - visual-opening-1

Status: not priced; review; type window; near Master Bed; width 600mm; height 1100mm
Visual opening is evidence only; it is not priced until deterministic geometry/schedule proof promotes it.
vision dimension (width 600mm, height 1100mm, near Master Bed): printed 1100x600 on Master Bed south wall; marker placed on window symbol in external wall

Review Opening evidence - visual-opening-2

Status: not priced; review; type window; near Ensuite; width 600mm; height 2130mm
vision dimension (width 600mm, height 2130mm, near Ensuite): printed 2130x600 on Ensuite south wall; marker placed on window line

Review Opening evidence - visual-opening-3

Status: not priced; review; type window; near Bath; width 600mm; height 1100mm
vision dimension (width 600mm, height 1100mm, near Bath): printed 1100x600 on Bath south wall; marker placed on window symbol

Review Opening evidence - visual-opening-4

Status: not priced; review; type window; near Bed 2; width 1200mm; height 1100mm
vision dimension (width 1200mm, height 1100mm, near Bed 2): printed 1100x1200 on Bed 2 south wall; marker placed on window line

Review Opening evidence - visual-opening-5

Status: not priced; review; type window; near Bed 3; width 1300mm; height 1300mm

vision dimension (width 1300mm, height 1300mm, near Bed 3): printed 1300x1300 on Bed 3 south wall; marker placed on window symbol

Review Opening evidence - visual-opening-6

Status: not priced; review; type window; near Bed 3; width 1510mm; height 1810mm

vision dimension (width 1510mm, height 1810mm, near Bed 3): printed 1810x1510 on Bed 3 east wall; marker placed on window line

Review Opening evidence - visual-opening-7

Status: not priced; review; type window; near Study/Bed 4; width 1300mm; height 1300mm

vision dimension (width 1300mm, height 1300mm, near Study/Bed 4): printed 1300x1300 on Study/Bed 4 east wall; marker placed on window symbol

Review Opening evidence - visual-opening-8

Status: not priced; review; type window; near Laundry/Mudroom; width 3000mm; height 700mm

unusual height dimension

vision dimension (width 3000mm, height 700mm, near Laundry/Mudroom): printed 700x3000 near Laundry/Mudroom; marker placed on window line in east wall

Review Opening evidence - visual-opening-9

Status: not priced; review; type pa_door; near Laundry/Mudroom; width 900mm; height 2100mm

dimension not labelled

visual marker not on verified floor-plan opening - not counted

nearby dimensioned visual opening already represents this physical opening

vision dimension (width 900mm, height 2100mm, near Laundry/Mudroom): door symbol visible on Laundry east wall leading to garage area;

standard door assumed; marker on door opening

Review Opening evidence - visual-opening-10

Status: not priced; review; type sectional_door; near Garage

marker position approximate

marker not confirmed on physical opening

vision candidate (near Garage): large garage opening visible on north wall of Garage; no clear dimension label on floor plan; elevation shows sectional door

Review Opening evidence - visual-opening-11

Status: not priced; review; type slider; near Pantry; width 1500mm; height 1100mm

vision dimension (width 1500mm, height 1100mm, near Pantry): printed 1100x1500 on Pantry north wall; marker placed on opening line

Review Opening evidence - visual-opening-12

Status: not priced; review; type slider; near Dining; width 2400mm; height 1300mm

vision dimension (width 2400mm, height 1300mm, near Dining): printed 1300x2400 on Dining north wall; marker placed on slider opening

Review Opening evidence - visual-opening-13

vision dimension (width 2400mm, height 1300mm, near Dining): printed 1300x2400 second slider on Dining north wall; marker placed on slider opening

Review Opening evidence - visual-opening-14

Status: not priced; review; type window; near Family; width 1400mm; height 790mm

vision dimension (width 1400mm, height 790mm, near Family): printed 790x1400 on Family west wall; marker placed on window symbol

Review Opening evidence - visual-opening-15

Status: not priced; review; type slider; near Family; width 1730mm; height 1300mm

vision dimension (width 1730mm, height 1300mm, near Family): printed 1300x1725 on Family west wall; marker placed on slider opening

Review Opening evidence - visual-opening-16

vision dimension (width 1400mm, height 790mm, near Family): printed 790x1400 on Family west wall lower; marker placed on window line

Review Opening evidence - visual-opening-17

Status: not priced; review; type slider; near Lounge

vision candidate (near Lounge): slider opening visible on Lounge west wall to deck; no clear dimension label; elevation confirms slider presence

Review Opening evidence - visual-opening-18

Status: not priced; review; type window; near Master Bed; width 600mm; height 1320mm

vision dimension (width 600mm, height 1320mm, near Master Bed): printed 1320x600 on Master Bed west wall; marker placed on window symbol

Review Opening evidence - visual-opening-19

Status: not priced; review; type entrance; near Entry; width 1000mm; height 2100mm

vision dimension (width 1000mm, height 2100mm, near Entry): entry door visible on Entry west wall; standard entry door assumed; marker on door opening

Review Opening evidence - drafting-issue-1

Status: not priced; review; type unknown

Malformed dimension label "1300x175036001300x1750" found on the floor plan; do not price from that label unless another source confirms the opening size.

floorplan_text conflict: malformed floor-plan text is retained as evidence but is not priced unless another source confirms the opening

Conflicts: 1300x175036001300x1750

Review Opening evidence - floorplan-label-1

Status: not priced; extracted; type window; near FAMILY; width 2400mm; height 1300mm

Clean floor-plan W x H label 1300 x 2400 auto-recovered as evidence-only opening; not a pricing write.

floorplan_text dimension (width 2400mm, height 1300mm, near FAMILY): clean floor-plan opening label 1300 x 2400 assigned to FAMILY by unique room proximity/order

Review Opening evidence - floorplan-label-2

Status: not priced; extracted; type window; near DINING; width 2400mm; height 1300mm

floorplan_text dimension (width 2400mm, height 1300mm, near DINING): clean floor-plan opening label 1300 x 2400 assigned to DINING by unique room proximity/order

Review Opening evidence - floorplan-label-3

Status: not priced; review; type window; near DINING; width 1500mm; height 1100mm

Floor-plan opening label 1100 x 1500 is not clean enough for automatic recovery: room/order assignment is ambiguous.

floorplan_text dimension (width 1500mm, height 1100mm, near DINING): floor-plan opening label 1100 x 1500 retained for review: room/order assignment is ambiguous

Review Opening evidence - floorplan-label-4

Status: not priced; review; type window; near LAUNDRY/MUDROOM; width 3000mm; height 700mm

Floor-plan opening label 700 x 3000 is not clean enough for automatic recovery: dimension band is large, narrow, or door-like; keep for review.

floorplan_text dimension (width 3000mm, height 700mm, near LAUNDRY/MUDROOM): floor-plan opening label 700 x 3000 retained for review: dimension band is large, narrow, or door-like; keep for review

Review Opening evidence - floorplan-label-5

Status: not priced; review; type window; near STUDY/BED4; width 400mm; height 2150mm

Floor-plan opening label 2150 x 400 is not clean enough for automatic recovery: dimension band is large, narrow, or door-like; keep for review.

floorplan_text dimension (width 400mm, height 2150mm, near STUDY/BED4): floor-plan opening label 2150 x 400 retained for review: dimension band is large, narrow, or door-like; keep for review

Review Opening evidence - floorplan-label-6

Status: not priced; extracted; type window; near STUDY/BED4; width 1500mm; height 1300mm

Clean floor-plan W x H label 1300 x 1500 auto-recovered as evidence-only opening; not a pricing write.

floorplan_text dimension (width 1500mm, height 1300mm, near STUDY/BED4): clean floor-plan opening label 1300 x 1500 assigned to STUDY/BED4 by unique room proximity/order

Review Opening evidence - floorplan-label-7

Status: not priced; extracted; type window; near ENSUITE; width 600mm; height 2150mm

Clean floor-plan W x H label 2150 x 600 auto-recovered as evidence-only opening; not a pricing write.

floorplan_text dimension (width 600mm, height 2150mm, near ENSUITE): clean floor-plan opening label 2150 x 600 assigned to ENSUITE by unique room proximity/order

Review Opening evidence - floorplan-label-8

Status: not priced; review; type window; near ENSUITE; width 600mm; height 1100mm

Floor-plan opening label 1100 x 600 is not clean enough for automatic recovery: dimension band is large, narrow, or door-like; keep for review.

floorplan_text dimension (width 600mm, height 1100mm, near ENSUITE): floor-plan opening label 1100 x 600 retained for review: dimension band is large, narrow, or door-like; keep for review

Review Opening evidence - floorplan-label-9

Status: not priced; extracted; type window; near BATH; width 1200mm; height 1100mm

Clean floor-plan W x H label 1100 x 1200 auto-recovered as evidence-only opening; not a pricing write.

floorplan_text dimension (width 1200mm, height 1100mm, near BATH): clean floor-plan opening label 1100 x 1200 assigned to BATH by unique room proximity/order

Review Opening evidence - floorplan-label-10

Status: not priced; extracted; type window; near BED2; width 1500mm; height 1300mm

floorplan_text dimension (width 1500mm, height 1300mm, near BED2): clean floor-plan opening label 1300 x 1500 assigned to BED2 by unique room proximity/order

Review Opening evidence - floorplan-label-11

Status: not priced; extracted; type window; near MASTERBED; width 800mm; height 1100mm

Clean floor-plan W x H label 1100 x 800 auto-recovered as evidence-only opening; not a pricing write.

floorplan_text dimension (width 800mm, height 1100mm, near MASTERBED): clean floor-plan opening label 1100 x 800 assigned to MASTERBED by unique room proximity/order

Review Opening evidence - floorplan-label-13

Status: not priced; extracted; type window; near BED3; width 2400mm; height 1300mm

floorplan_text dimension (width 2400mm, height 1300mm, near BED3): clean floor-plan opening label 1300 x 2400 assigned to BED3 by unique room proximity/order

Review Opening evidence - floorplan-gap-1

Status: not priced; review; type unknown; near PANTRY; width 2750mm; height 1000mm

Measured floor-plan wall gap 2747mm near PANTRY on exterior wall face V-111; elevation elevation-face-1 has matching width/height evidence, but its face is not matched to the floor-plan wall; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 2750mm, near PANTRY, wall V-111): measured floor-plan exterior wall gap near PANTRY; gap routed to PANTRY on the west side of the wall; height still needs text/elevation/schedule confirmation

elevation_measurement height (width 2710mm, height 1000mm, near PANTRY, wall V-111): elevation-face-1 elevation opening confirms 2714mm width within 33mm of measured floor-plan gap; height 999mm recovered as evidence only.

Review Opening evidence - floorplan-gap-2

Status: not priced; review; type unknown; near ENSUITE; width 1990mm

Measured floor-plan wall gap 1994mm near ENSUITE on exterior wall face V-52; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1990mm, near ENSUITE, wall V-52): measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-3

Status: not priced; review; type unknown; near ENSUITE; width 380mm

Measured floor-plan wall gap 381mm near ENSUITE on exterior wall face V-34; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 380mm, near ENSUITE, wall V-34): measured floor-plan exterior wall gap near ENSUITE; gap routed to ENSUITE on the east side of the wall; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-4

Status: not priced; review; type unknown; near LOUNGE; width 4980mm

Measured floor-plan wall gap 4983mm near LOUNGE on interior wall face V-77; gap routed to LOUNGE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 4980mm, near LOUNGE, wall V-77): measured floor-plan interior wall gap near LOUNGE; gap routed to LOUNGE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-5

Status: not priced; review; type unknown; near ENSUITE; width 4590mm

Measured floor-plan wall gap 4589mm near ENSUITE on interior wall face V-61; gap routed to ENSUITE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 4590mm, near ENSUITE, wall V-61): measured floor-plan interior wall gap near ENSUITE; gap routed to ENSUITE on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-6

Status: not priced; review; type unknown; near MASTERBED; width 4310mm

Measured floor-plan wall gap 4310mm near MASTERBED on interior wall face H-60; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 4310mm, near MASTERBED, wall H-60): measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-7

Status: not priced; review; type unknown; near BATH; width 3650mm

Measured floor-plan wall gap 3645mm near BATH on interior wall face H-99; gap is near BATH and WIR; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 3650mm, near BATH, wall H-99): measured floor-plan interior wall gap near BATH; gap is near BATH and WIR; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Conflicts: WIR

Review Opening evidence - floorplan-gap-8

Status: not priced; review; type unknown; near MASTERBED; width 3630mm

Measured floor-plan wall gap 3630mm near MASTERBED on interior wall face H-107; gap routed to MASTERBED on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 3630mm, near MASTERBED, wall H-107): measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-9

Status: not priced; review; type unknown; near STUDY/BED4; width 3180mm

Measured floor-plan wall gap 3183mm near STUDY/BED4 on interior wall face V-95; gap is near STUDY/BED4 and ENTRY; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 3180mm, near STUDY/BED4, wall V-95): measured floor-plan interior wall gap near STUDY/BED4; gap is near STUDY/BED4 and ENTRY; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Conflicts: ENTRY

Review Opening evidence - floorplan-gap-10

Status: not priced; review; type unknown; near MASTERBED; width 3110mm

Measured floor-plan wall gap 3111mm near MASTERBED on interior wall face H-85; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 3110mm, near MASTERBED, wall H-85): measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-11

Status: not priced; review; type unknown; near BATH; width 1960mm

Measured floor-plan wall gap 1960mm near BATH on exterior wall face V-83; gap is near BATH and BED2; keep room routing under review; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1960mm, near BATH, wall V-83): measured floor-plan exterior wall gap near BATH; gap is near BATH and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation

Conflicts: BED2

Review Opening evidence - floorplan-gap-12

Status: not priced; review; type unknown; near BED2; width 1960mm

Measured floor-plan wall gap 1960mm near BED2 on exterior wall face V-100; gap is near BED2 and BED3; keep room routing under review; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1960mm, near BED2, wall V-100): measured floor-plan exterior wall gap near BED2; gap is near BED2 and BED3; keep room routing under review; height still needs text/elevation/schedule confirmation

Conflicts: BED3

Review Opening evidence - floorplan-gap-13

Status: not priced; review; type unknown; near BED3; width 1960mm

Measured floor-plan wall gap 1960mm near BED3 on exterior wall face V-103; gap is near BED3 and BED2; keep room routing under review; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1960mm, near BED3, wall V-103): measured floor-plan exterior wall gap near BED3; gap is near BED3 and BED2; keep room routing under review; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-14

Status: not priced; review; type unknown; near WIR; width 1880mm

Measured floor-plan wall gap 1875mm near WIR on interior wall face V-62; gap routed to WIR on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1880mm, near WIR, wall V-62): measured floor-plan interior wall gap near WIR; gap routed to WIR on the west side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-15

Status: not priced; review; type unknown; near FAMILY; width 1870mm

Measured floor-plan wall gap 1871mm near FAMILY on interior wall face H-60; gap routed to FAMILY on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1870mm, near FAMILY, wall H-60): measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the north side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-16

Status: not priced; review; type unknown; near MASTERBED; width 1850mm

Measured floor-plan wall gap 1854mm near MASTERBED on interior wall face V-33; gap routed to MASTERBED on the east side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1850mm, near MASTERBED, wall V-33): measured floor-plan interior wall gap near MASTERBED; gap routed to MASTERBED on the east side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-17

Status: not priced; review; type unknown; near LAUNDRY/MUDROOM; width 1850mm

Measured floor-plan wall gap 1848mm near LAUNDRY/MUDROOM on exterior wall face V-106; gap is near LAUNDRY/MUDROOM and ENTRY; keep room routing under review; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1850mm, near LAUNDRY/MUDROOM, wall V-106): measured floor-plan exterior wall gap near LAUNDRY/MUDROOM; gap is near LAUNDRY/MUDROOM and ENTRY; keep room routing under review; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-18

Status: not priced; review; type unknown; near MASTERBED; width 1770mm

Measured floor-plan wall gap 1774mm near MASTERBED on interior wall face H-100; gap is near MASTERBED and ENSUITE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1770mm, near MASTERBED, wall H-100): measured floor-plan interior wall gap near MASTERBED; gap is near MASTERBED and ENSUITE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Conflicts: ENSUITE

Review Opening evidence - floorplan-gap-19

Status: not priced; review; type unknown; near FAMILY; width 1770mm

Measured floor-plan wall gap 1767mm near FAMILY on interior wall face H-31; gap routed to FAMILY on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1770mm, near FAMILY, wall H-31): measured floor-plan interior wall gap near FAMILY; gap routed to FAMILY on the south side of the wall; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Review Opening evidence - floorplan-gap-20

Status: not priced; review; type unknown; near BATH; width 1660mm

Measured floor-plan wall gap 1659mm near BATH on interior wall face H-87; gap is near BATH and LOUNGE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 1660mm, near BATH, wall H-87): measured floor-plan interior wall gap near BATH; gap is near BATH and LOUNGE; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Conflicts: LOUNGE

Review Opening evidence - floorplan-gap-21

Status: not priced; review; type unknown; width 510mm

Measured floor-plan wall gap 508mm on interior wall face H-60; no room label found near the measured wall gap; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 510mm, wall H-60): measured floor-plan wall gap; room and height still need confirmation

Review Opening evidence - floorplan-gap-22

Status: not priced; review; type unknown; near BED2; width 470mm

Measured floor-plan wall gap 466mm near BED2 on interior wall face H-91; gap is near BED2 and STUDY/BED4; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 470mm, near BED2, wall H-91): measured floor-plan interior wall gap near BED2; gap is near BED2 and STUDY/BED4; keep room routing under review; measured gap is on an interior wall line, so it is review-only until exterior wall identity is proven; height still needs text/elevation/schedule confirmation

Conflicts: STUDY/BED4

Review Opening evidence - floorplan-gap-23

Status: not priced; review; type unknown; width 400mm

Measured floor-plan wall gap 402mm on exterior wall face V-119; no room label found near the measured wall gap; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 400mm, wall V-119): measured floor-plan wall gap; room and height still need confirmation

Review Opening evidence - floorplan-gap-24

Measured floor-plan wall gap 398mm on exterior wall face V-51; no room label found near the measured wall gap; not priced until height/type/face are confirmed by text, elevation, schedule, or review.

floorplan_gap width (width 400mm, wall V-51): measured floor-plan wall gap; room and height still need confirmation

- GEO

Measured by geometry engine
- VEC

Read from PDF vector layer
- VIS

Vision read
- SCH

Door & Window Schedule
- DRV

Derived from other fields
- AST

Asserted building standard
- FLG

Unknown - needs confirmation
- MAN

Manual override

VERIFIED BY

SIGNATURE

DATE

Generated by Jennian IQ / values on this document are produced by the same composer as the QS export (source: enriched). An unfilled cell beats a wrong cell - anything marked Review or "- not set" must be resolved before pricing.