DAILY WORK REPORT

PROJECT	SC 93 Widening, Phase 2	**CONTRACT NO.**	P-0293-24
LOCATION	Clemson, SC	**DATE**	Thursday, October 15, 2026
PRIME CONTRACTOR	Palmetto Site Works	**REPORT NO.**	42
INSPECTOR	Tyler Bowles	**WORKERS ON SITE**	10

WEATHER

AM	PM	7 AM	Noon	4 PM	High / low	Precip.	Wind
Clear	Partly cloudy	55 F	71 F	76 F	78 / 52 F	0.00 in	9 mph

Weather from Open-Meteo for 34.6834, -82.8374.

CONTRACTOR FORCES

Contractor	Classification	No.	Hours
Palmetto Site Works	Foreman	1	8
Palmetto Site Works	Laborer	4	8
Palmetto Site Works	Operator	2	8
Upstate Concrete	Finisher	3	6

EQUIPMENT

Description	No.	Status	Hours
CAT 320 excavator	1	Working	
Skid steer	1	Working	
Smooth drum roller	1	Idle	

WORK PERFORMED

Description	Location	Quantity
Excavated and backfilled the storm drain trench from station 12+50 to 14+00, about 150 linear feet of 24 inch RCP installed	Sta. 12+50 to 14+00	150 linear feet
Poured the curb and gutter on the east side, about 18 cubic yards	east side	18 cubic yards

MATERIALS RECEIVED

- Received six loads of number 57 stone.

TESTS AND INSPECTIONS

- Ran a slump test on the second truck, four inch slump, and made one set of cylinders.
- Nuclear gauge density tests on the trench backfill all passed.

VISITORS

- Tom Reed from the county came by at 2 PM to look at the drainage.

DELAYS, PROBLEMS AND RFIS

- Lost about an hour in the morning waiting on the first concrete truck.
- Found an unmarked water line at station 13+20, contractor stopped and called the utility, we need an RFI.

SAFETY

- Trench box was in place all day, one worker without a vest, talked to the foreman about it.

REMARKS

- Weather on site: Weather was clear and cool in the morning, warming up after lunch.
- October 15th, Highway 93 widening near Clemson.

CERTIFICATION

I certify that this report is a true record of the work and conditions observed.

INSPECTOR		REVIEWED BY (RESIDENT ENGINEER)	
Signature	Date	Signature	Date

PHOTOGRAPHS

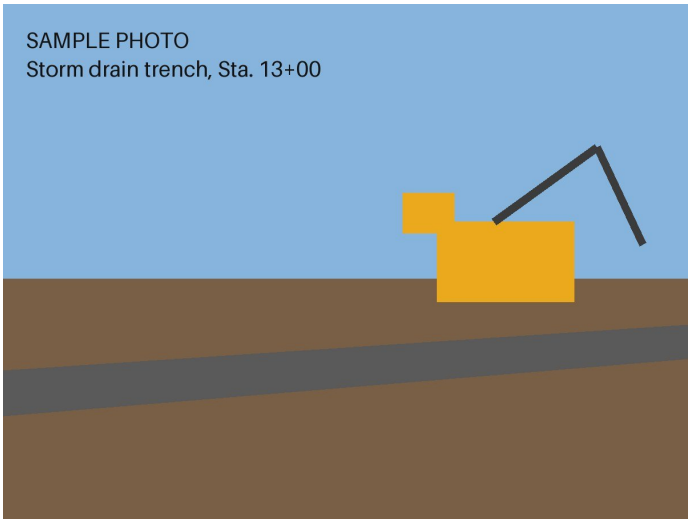


Photo 1. 10:42 AM. Open storm drain trench with trench box in place and excavator working near Sta. 13+00.

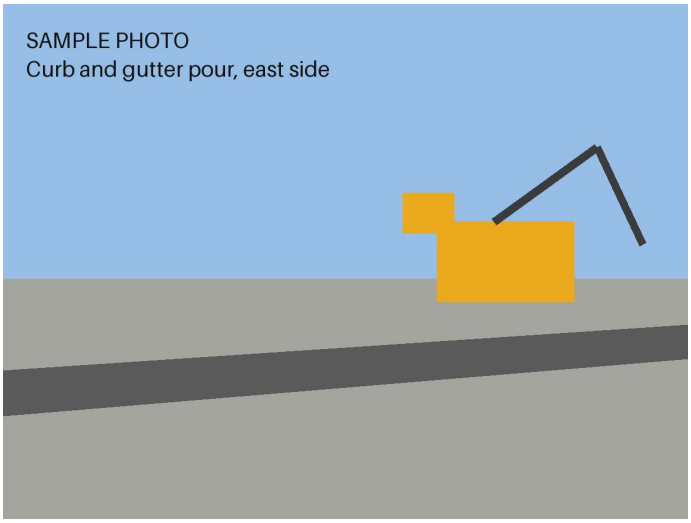


Photo 2. 2:18 PM. Fresh curb and gutter on the east side after the afternoon pour.