ROADSENSE | Infrastructure Intelligence

DATE: November 09, 2026
STANDARDS: ASTM D6433 | IRC:SP:77 / IRC:82

ASTM D6433 CONDITION	ROUGHNESS INDEX (IRI)	MATERIAL REQUIRED	ESTIMATED REPAIR BUDGET
10.0 / 100 **Serious / Failed**	**19.69** m/km ASTM E1926	**5361.1 kg** Cold-Mix Bitumen	**Rs. 262568** ($4212.32)

Hazard Classification & Severity Breakdown

Hazard Category	Impact Severity	Count	Recommended Municipal Action
Pothole	Severe (Z >= 3.0)	51	Immediate Cold Patching / Asphalt Mill & Infill (<48h)
Pothole	Moderate (Z 2.0-3.0)	4	Scheduled Maintenance (<14 days)
Pothole	Minor / Anomaly (Z < 2.0)	16	Surface Seal Coating / Monitor
Speedbreaker	Standard Deflection	0	Verify Regulatory Height & Signage Painting

Priority Maintenance Dispatch Table (Top Critical Hazards)

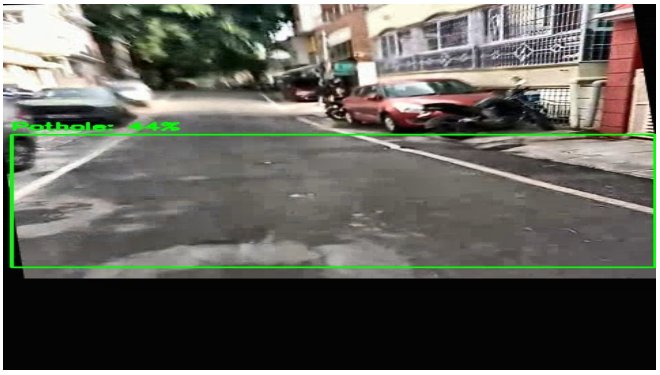
#01	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91964, 77.55478	25000cm² depth 3.4cm	**99.9 kg**	Rs.4795	Deep milling, granular sub-base recompaction & DBM overlay
#02	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91964, 77.55478	25000cm² depth 3.4cm	**99.9 kg**	Rs.4795	Deep milling, granular sub-base recompaction & DBM overlay
#03	**Pothole** Low	**Cat Category B (Standard Pothole Cavity)** IRC:SP:77-Clause 4.1	12.91943, 77.55473	3231cm² depth 3.4cm	**12.9 kg**	Rs.880	Square cut, edge priming & Cold-Mix Bituminous Patching
#04	**Pothole** Low	**Cat Category B (Standard Pothole Cavity)** IRC:SP:77-Clause 4.1	12.91933, 77.55472	6626cm² depth 3.4cm	**26.5 kg**	Rs.1491	Square cut, edge priming & Cold-Mix Bituminous Patching

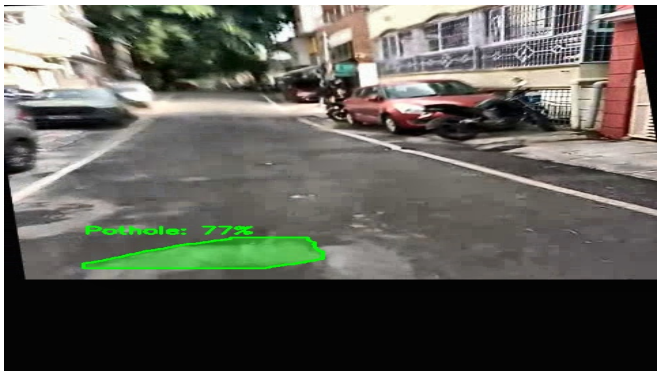
#05	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91932, 77.55472	25000cm² depth 3.4cm	**99.9 kg**	Rs.4795	Deep milling, granular sub-base recompaction & DBM overlay
#06	**Pothole** Low	**Cat Category B (Standard Pothole Cavity)** IRC:SP:77-Clause 4.1	12.91923, 77.55469	2602cm² depth 3.4cm	**10.4 kg**	Rs.768	Square cut, edge priming & Cold-Mix Bituminous Patching
#07	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91922, 77.55468	25000cm² depth 3.4cm	**99.9 kg**	Rs.4795	Deep milling, granular sub-base recompaction & DBM overlay
#08	**Pothole** Severe	**Cat Category B (Standard Pothole Cavity)** IRC:SP:77-Clause 4.1	12.91885, 77.55452	471cm² depth 3.4cm	**1.9 kg**	Rs.385	Square cut, edge priming & Cold-Mix Bituminous Patching
#09	**Pothole** Severe	**Cat Category B (Standard Pothole Cavity)** IRC:SP:77-Clause 4.1	12.91882, 77.55451	471cm² depth 3.4cm	**1.9 kg**	Rs.385	Square cut, edge priming & Cold-Mix Bituminous Patching
#10	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91873, 77.55453	25000cm² depth 3.4cm	**99.9 kg**	Rs.4795	Deep milling, granular sub-base recompaction & DBM overlay
#11	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91857, 77.55445	24668cm² depth 3.4cm	**98.5 kg**	Rs.4734	Deep milling, granular sub-base recompaction & DBM overlay
#12	**Pothole** Severe	**Cat Category C (Structural Base / Sub-base Failure)** IRC:82-Clause 6.4	12.91853, 77.55444	24668cm² depth 3.4cm	**98.5 kg**	Rs.4734	Deep milling, granular sub-base recompaction & DBM overlay

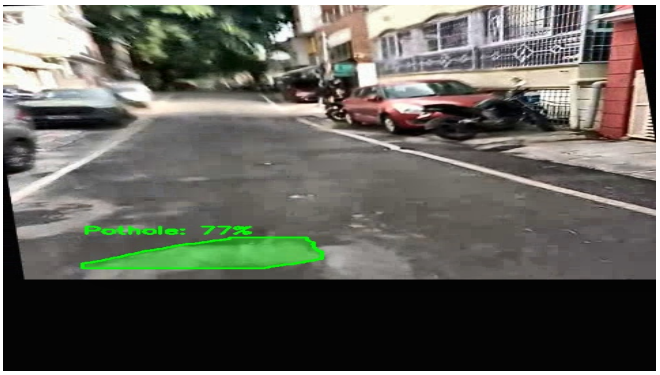
Camera Ground-Truth Evidence (AI Detection Bounding Boxes)

Visual verification frames captured by vehicle optical sensors at timestamp of impact.


Pothole: 95%


Pothole: 44%


Pothole: 77%


Pothole: 77%