


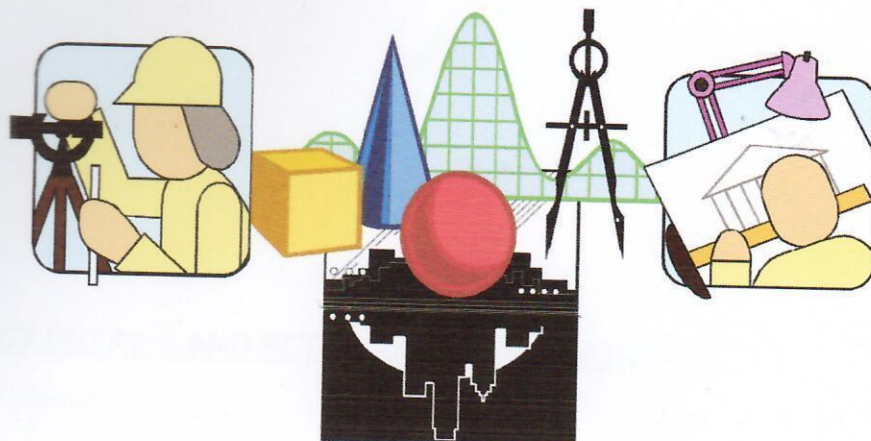

GEOTECHNICAL INVESTIGATION REPORT

LOCATION: R.S. PLOT NO. - 949(P), L.R. PLOT NO. - 949(P) & 949/1329(P), L.R. KH. NO. - 623, J.L. NO. 89, MOUZA - JOTERAM, P.O. - JOTERAM UNDER BAIKUNTHAPUR-I GRAM PANCHAYET, PURBA BARDHAMAN.

CLIENT: MR. SANJAY KUMAR GUPTA
HOLDING NO. - K5022,
P.O. - JOTERAM,
DIST. - PURBA BURDWAN,
PIN - 713104.

GEOTECHNICAL CONSULTANT:



ARCHITECTURAL, STRUCTURAL, GEOTECHNICAL,
SURVEY AND CIVIL CONSULTANCY SERVICES
258/4, APC ROAD(3RD FLOOR), KOLKATA-700006
Ph:-033-23522735/2934
e. mail: - astha.cons@gmail.com
Website - www.asthaconsultancy.in



ASTHA

258/4, A.P.C. Road (3rd Floor) Kolkata-700 006
Phone : (033) 2352 2735/2934, Tele fax : (033) 2351 0308
astha_cons@yahoo.co.in

A. PROJECT DETAILS AND SCOPE OF INVESTIGATION.

- A.1 Site Description .
- A.2 The Structure .
- A.3 Object.
- A.4 Scope of Investigation .

B. FIELD EXPLORATION.

- B.1 Boring and Sampling.
- B.2 Collection of Disturbed and Undisturbed sample.
- B.3 Standard Penetration Test.
- B.4 Ground Water Table.
- B.5 Summary of Boring Data.

C. LABORATORY INVESTIGATION.

- C.1 Laboratory Test Result.
- C.2 e Vs Log p Curves.
- C.3 Consolidation Test Result

D. CONCLUSION AND RECOMMENDATION ON THE BASIS OF LABORATORY TEST RESULT AND FIELD OPERATION.


- D.1 Subsurface Stratification.
N Vs Depth Plot.
- D.2 Selection of foundation level for shallow foundation.
- D.3 Safe bearing capacity Table.
- D.4 Selection of deep foundation (R.C. Bored Pile).

E. DISCUSSION.

F. SUMMARY AND CONCLUSION.

G. BORE - LOG DATA SHEET.


H. BORE HOLE LOCATION MAP.


SUBHRADEEP CHAKRABORTY
BCE (J U), A.I E (I), MIGS
Enrolled GEO-Technical Engineer Of NKDA
NO:- GTER/NKDA/10/00029

F. SUMMARY AND CONCLUSION

On the basis of laboratory and field result and rational judgements on the test results and observation, the following features and recommendation are summarized below.

- i) From detail investigation it reveals that the subsoil stratification is of GOOD quality with respect to the proposed various structure under standard loading pattern.
- ii) Existence of nearby structure should be given due consideration during the various stages of construction.
- iii) Here, the subsoil deposition is non cohesive in upper layer and lower layer. In lower strata, the deposits are loose to medium to dense.
- iv) **The upper 2.50 m soil deposit is very suspicious in character with very low bearing capacity. So, the shallow foundation is to be placed at (-) 2.50 m below EGL on normal deposit.**
- v) Excavation work for foundation shall be done with a great care. During the excavation work, if dewatering is required from foundation trench then safety of adjacent foundation must be ensured first.
- vi) It is preferable to do the foundation construction in dry season when ground water table is in a safe lower level, so that, hazards can be avoided.
- vii) Existence of nearby structure should be given due consideration during the various stages of construction.
- viii) The ground water table was found at average 11.50 m to 12.00 m below EGL and for design purpose soil is considered as fully submerged.
- ix) For wide variation of column load of elevated structure differential settlement take place. Differential settlement should be maintained within permissible limit as per IS 1904-1986.
- x) To avoid overstress, clear distance between two neighboring footing should be maintained 1 to 1.5 times of width of footings.



SUBHRADEEP CHAKRABORTY
BCE (J U.), A.I.E. (I), MIGS
Enrolled GEO-Technical Engineer Of NKDA
NO:- GTER/NKDA/10/00029