Document #: _____
Document Ver: _____
Release Date: _____

Quality Inspection & Test Report V4.8

Yeatru Sourcing

Standard:	ANSI/ASQC Z1.4-2003	**Level :**	AQL Level II
Inspection Type:	Final Random Inspection (FRI)	**Inspected By:**	Yeatru Sourcing QC
Factory Name:	Shaoxing Lvyinghong Houseware Co., Ltd.	**Vendor Type:**	Factory
Factory Location:	Lianzhong Village, Xialv Town, Keqiao District,	**Date:**	2026-10-14
P.O. #:	DF260812	**Product Description**	CHESYPORA Premium Microfiber Entrance Mat, 60 × 90 cm (Model PC0010; Amazon FNSKU: X002NV3RHP)
P.O. Quantity:	500	**P.O. Cartons:**	42
Completed%	100% (bulk packed, 42 cartons ready)	**Customer Name:**	SHOPCORTIZ LLC
Spelling Check:	Checked – 1 artwork text error found (see Remark 4)	**Drop/Impact Testing**	Untested
Overall Inspection Result:		**NOT PASSED – PENDING**	

SKU# Measurement		Product Length (cm)	Product Width (cm)	Product Height (cm)	Package Length (cm)	Package Width (cm)	Package Height (cm)	Weight/pcs (kg)	Pack size
1	PC0010	60.0	90.0	0.9–1.0	62.0	13.0	13.0	0.763–1.102	12 pcs/ctn

Carton Measurement		Length (cm)	Width (cm)	Height (cm)	Pcs/ctns	CTNS	G.W/CTNS	TOTAL CBM	TOTAL GW
1	PC0010	51	41	65.5	12	42	21.64	5.7523	908.9
TOTAL								5.752	908.9

Inspection Details

SKU 1 - 5		PC0010	0	0	0	0
Quantity of SKU		500	0	0	0	0
QC sample size		50				
Max. Allowed (AQL 0)		0				
Max. Allowed (AQL 1.5)		2				
Max. Allowed (AQL 4.0)		5				
缺陷描述 Defects Description:	Tuft bind / tuft-withdrawal test FAILED – tufts can be pulled out under local tension (critical-grade test failure; see Photos 3)	50				
	Wrinkled hexagonal package box – 1 pc (Major; spare box available at factory)	1				
	Wrinkled hexagonal package box – 1 pc (Minor; spare box available at factory)	1				
	Colour shade mismatch between box lid and box base – 1 pc (Minor)	1				
	Loose thread on mat, < 0.5 cm – 1 pc (Minor; trimmed/repaired on site)	1				
	Systemic – polybag suffocation warning artwork: extra space in "D'étouffement" (printed "D' etouffement"). Correct artwork before next run.	—				
	Systemic – belly band loosens after roll diameter shrinkage and partly covers the printed text; trim the excess / resize the band if the covered text is not required	—				
	Systemic – master-carton marks incomplete: QTY / G.W. / N.W. fields left blank; printed MEAS 51×41×64 cm vs measured 51×41×65.5 cm.	—				
	Process – net weight of mat varies 763.4 g – 1,102.0 g caused by inconsistent TPR anti-slip backing thickness (see Measurement Data sheet).	—				
Result By Skus	**Critical**	0				
	Major	1				
	Minor	**50**				
	SKU Inspection Result	**FAIL – (pending buyer disposition)**				
Issue types	**Issue type(Fill it when Sku result is fail/pending)**	Design				
REMARK:	Advice to factory: (1) Replace the 2 wrinkled boxes and the 1 colour-mismatched box before shipment – factory confirms spare boxes are available; (2) Correct the polybag warning artwork; (3) Complete all master-carton marks (QTY/G.W./N.W.); (4) Stabilise TPR backing thickness/weight; (5) Glue/secure the hexagonal box lid or add transit protection for FBA last-mile handling; (6) Tuft-bind failure is held for the buyer's disposition – see C. REMARK.					

C. REMARK:

INSPECTION SUMMARY & DISPOSITION

Lot: 500 pcs CHESYPORA Premium Microfiber Entrance Mat, 60 × 90 cm (Model PC0010), individually rolled in polybag with belly band, in a hexagonal gift box, 12 pcs per master carton; 42 cartons in total (41 full cartons + 1 last remainder carton – no marking identified the remainder carton). Inspection carried out on finished, packed goods at factory on 2026-10-14.

Sampling: 7 cartons selected by the square-root method (√42 ≈ 7) from different stacking positions; 50 pcs drawn and each unit measured, weighed and inspected one by one (ANSI/ASQC Z1.4,

AQL Level II – Critical 0 / Major 2 / Minor 5). All 50 FNSKU labels (X002NV3RHP, Code 128) were scanned – 50/50 correct. Full per-unit data: Measurement Data sheet.

Tests: ① Slip-resistance (friction) test – PASSED (mat grips a smooth table surface and cannot easily be pushed by hand; video clip available). ② Tuft bind (tuft withdrawal) test – FAILED: tufts may pull out under local tension. Withdrawal is not severe and the practical risk to the target end user is limited, but it is a critical-grade failure; the lot is therefore held PENDING the buyer's written disposition.

Key risks & findings:
(1) Hexagonal box structure is unstable and the lid is NOT glued to the base – when units are lifted out of the master carton the lid separates; high risk of damage in Amazon FBA last-mile delivery.
(2) Net weight varies 763.4–1,102.0 g (avg ≈ 1,000 g) – root cause: inconsistent thickness/weight of the TPR anti-slip backing. Dimensions are within ±1 cm of spec; pile height 0.9–1.0 cm conforms.
(3) Master-carton QTY/G.W./N.W. marks blank; printed MEAS differs from measured (64 cm vs 65.5 cm).
(4) Polybag warning text spacing error; belly-band text partly covered after diameter shrinkage.
(5) 3 defective gift boxes (1 major wrinkle, 1 minor wrinkle, 1 lid/base colour difference) – replaceable from spare boxes; 1 mat with a loose thread < 0.5 cm, already trimmed.

Recommendation:
DO NOT SHIP until the buyer confirms disposition of the tuft-bind failure and the factory (a) replaces the 3 defective boxes, (b)completes all carton marks, (c)Improve or confirm the backing-weight consistency.

Inspector's signature:	**Manufactory's Signature:**	**Inspection Date:**
Yeatru Sourcing QC		*2026-10-14*

PHOTOS 1 — FACTORY, BULK QUANTITY & SAMPLING (all photos taken on site, 2026-10-14)

CHESYPORA Premium Microfiber Entrance Mat 60 × 90 cm (PC0010 / FNSKU X002NV3RHP) | Inspection date: 2026-10-14 | Page reference of the main QC report

1. Factory entrance & production

1. Factory entrance



2. Production line in operation



3. Production / packing area – WIP



4. On-site dimension check of each sampled unit (tape measure)



2. Finished bulk goods — 42 cartons

5. Bulk stock in warehouse: 42 master cartons (view 1)



6. Bulk stock in warehouse: 42 master cartons (view 2)



7. Packed hexagonal boxes, polybags and materials at factory after inspection



8. Reference sample prepared by the factory



3. Sampling

9. Seven cartons sampled from different stacking positions (square-root method, √42 ≈ 7)



Sampling plan: 7 of 42 cartons (square-root method) drawn from different stacking positions; 50 pcs taken from the sampled cartons and each unit measured, weighed and inspected one by one (AQL Level II, sample size 50). The last carton of the lot is a remainder carton; no remainder marking was found on any carton.

PHOTOS 2 — MASTER CARTON, HEXAGONAL BOX, POLYBAG, LABELS & BELLY BAND

CHESYPORA Premium Microfiber Entrance Mat 60 × 90 cm (PC0010 / FNSKU X002NV3RHP) | Inspection date: 2026-10-14 | Page reference of the main QC report

4. Master carton — marks, weighing & measuring

10. Shipping mark: QTY / G.W. / N.W. fields BLANK; printed MEAS 51×41×64 cm (actual 65.5 cm); 'Heavy Package' label applied



11. Master carton – side without shipping mark



12. Master carton – general outlook



13. Carton gross weight check (reading 21.684 kg; range of 7 cartons 21.260–21.815 kg)



14. Carton length measured 51 cm



15. Carton width measured 41 cm



16. Carton height measured 65.5 cm



17. Inside master carton: 12 hexagonal boxes (4 × 3) with cardboard divider




5. Unit hexagonal gift box

18. Unit hexagonal gift box – full outlook (60 × 90 cm, pile 0.9–1.0 cm printed)




19. Separate slip-on lid – lid is NOT glued to the base and separates when the unit is lifted (FBA risk)

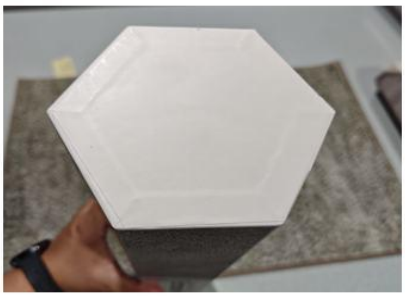


20. Unit box – alternative view




21. Box flat-to-flat width measured

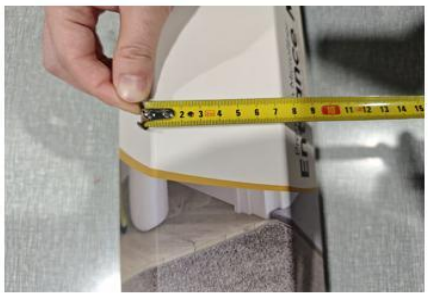


22. Hexagon point-to-point measured ≈ 12.5–13 cm

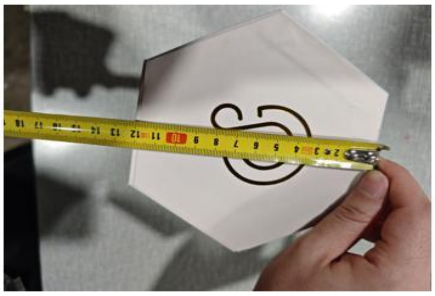

23. Hexagonal end measured

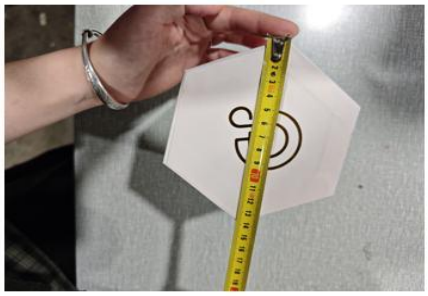

24. Inside of empty hexagonal box

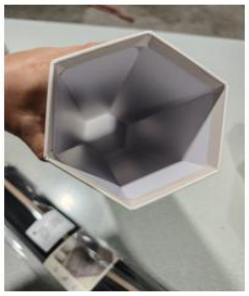

25. Unit box – general outlook



6. Polybag, card, belly band & labels

26. Rolled mat in polybag with French suffocation warning – note spacing error in “D'étouffement” (printed “D' etouffement”)



27. Unit as packed: polybag, belly band, welcome card and care label



28. Polybag packaging check



29. Welcome / thank-you card (“Bienvenue chez CHESYPORA”)



30. Belly band artwork: CHESYPORA Entrance Mat, 60 × 90 cm, pile 0.9–1.0 cm



31. Belly band loosens after roll diameter shrinkage – part of the text is covered



32. Woven brand label & care label: 100% polyester microfibre, 100% TPR base; PC0010; LOT 20260730



33. Brand / care label check




PHOTOS 3 — SAMPLE COMPARISON, DIMENSIONS, WEIGHT & ON-SITE TESTS


CHESYPORA Premium Microfiber Entrance Mat 60 × 90 cm (PC0010 / FNSKU X002NV3RHP) | Inspection date: 2026-10-14 | Page reference of the main QC report

7. Approved sample vs mass production

34. Approved sample (top) vs mass product (bottom) – overall appearance matches

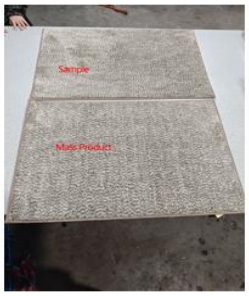

35. Sample vs mass product – face yarn / colour comparison

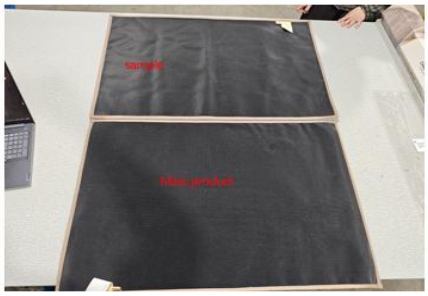

36. Sample vs mass product – edge binding comparison



37. Sample vs mass product – overall comparison (view 2)




8. Dimensions & pile height (50 units measured individually)

38. Pile height measured ≈ 1 cm (specification 0.9–1.0 cm)



39. Mass-product dimension measurement (60 × 90 cm, tolerance ±1 cm)

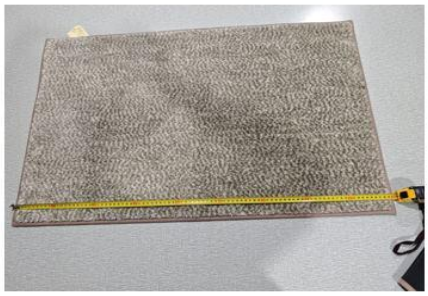

40. Mass-product dimension measurement



9. Net weight check (product only)

41. Net weight 1,003.6 g


42. Net weight 870.0 g



43. Net weight 969.8 g



44. TPR anti-slip backing – thickness/weight inconsistent between units (range 763.4–1,102.0 g)

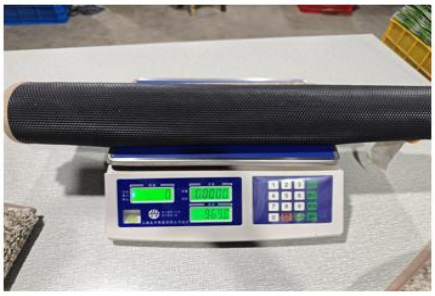



10. On-site tests

45. TUF BIND (TUFT WITHDRAWAL) TEST – FAILED: tufts can be pulled out under local tension (critical)



46. Tuft withdrawal test – tuft pulling at edge



47. Tuft withdrawal test – tuft cluster pulling out



SLIP-RESISTANCE (FRICTION) TEST – PASSED.

Method: mat laid on a smooth table surface; the mat grips the surface and is hard to push by hand (see video clip “Slip Resistance Test.mp4”).

VIDEO CLIPS AVAILABLE ON REQUEST:
“19-Tuft withdrawal test (1).mp4” (failed test),
“Slip Resistance Test.mp4” (passed test),
“sampled and open carton.mp4”,
“2-Production line (2)/(7).mp4”.

PHOTOS 4 — DEFECTS, PACKAGING RISK & MARKING FINDINGS

CHESYPORA Premium Microfiber Entrance Mat 60 × 90 cm (PC0010 / FNSKU X002NV3RHP) | Inspection date: 2026-10-14 | Page reference of the main QC report

11. Critical finding — tuft bind test failed

48. Tuft bind test FAILED – tufts pull out under local tension; withdrawal not severe, practical risk to the end user limited (critical-grade)



12. Defects on gift boxes (spare boxes confirmed available at factory)

49. MAJOR – wrinkle on hexagonal box, 1 pc



50. MINOR – wrinkle on hexagonal box, 1 pc



51. MINOR – colour shade difference between box lid and base, 1 pc



13. Defect on mat

52. MINOR – one loose thread < 0.5 cm on backing edge; trimmed / repaired on site



14. Systemic marking / artwork findings

53. Master-carton QTY / G.W. / N.W. left blank – to be filled before shipment



54. Polybag warning text – extra space in “D'étouffement” – artwork correction required




55. Belly-band text partly covered after diameter shrinkage – trim excess or resize



15. Packaging risk for Amazon FBA

56. Hexagonal box lid not glued to the base – lid comes off first when units are taken out of the master carton

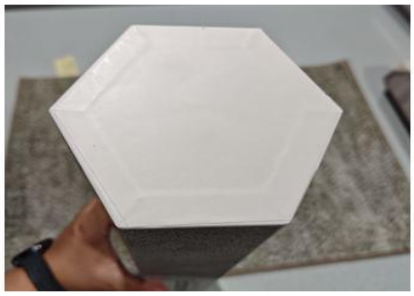

57. Hexagonal box structure unstable – high FBA last-mile crushing risk; glue/secure the lid or add transit protection



Measurement & Weight Records – 50 sampled units

Sample No.	Width (cm)	Length (cm)	Pile height (cm)	Net weight (g)
1	60.0	59.8	1.0	998.8
2	60.0	89.6	1.0	1044.6
3	60.0	90.0	1.0	982.0
4	60.2	89.7	1.0	990.0
5	60.4	89.5	1.0	1018.0
6	60.2	89.8	1.0	1059.0
7	59.9	90.1	1.0	1001.2
8	60.2	90.0	1.0	1000.4
9	60.0	89.8	1.0	987.8
10	60.0	90.7	1.0	996.0
11	60.4	89.3	1.0	947.6
12	60.0	90.0	1.0	969.8
13	60.8	89.3	1.0	1086.2
14	59.8	90.6	1.0	1067.6
15	60.0	90.2	1.0	869.8
16	60.0	90.2	1.0	1074.4
17	59.8	89.6	1.0	1031.6
18	60.5	89.5	1.0	1035.8
19	60.2	89.2	1.0	1041.0
20	59.6	90.8	1.0	1048.0
21	60.2	89.7	1.0	956.4
22	60.4	89.7	1.0	1015.2
23	60.2	89.5	1.0	981.0
24	60.0	90.0	1.0	990.0
25	60.0	90.5	1.0	991.8
26	60.1	89.3	1.0	1007.2
27	61.5	89.8	1.0	1072.4
28	60.4	89.7	1.0	959.6
29	60.2	89.6	1.0	987.0
30	60.4	90.5	1.0	963.4
31	60.1	89.5	1.0	1005.8
32	60.0	89.4	1.0	1033.4
33	60.4	89.4	1.0	992.6
34	60.1	90.7	1.0	1032.2
35	59.8	90.0	1.0	984.4
36	60.1	89.4	1.0	1029.6
37	60.0	90.0	1.0	1058.6
38	60.0	89.5	1.0	1038.0
39	60.2	89.5	1.0	924.2
40	60.8	89.8	1.0	**763.4**
41	60.2	89.6	1.0	1022.4
42	59.6	90.0	1.0	**1102.0**
43	60.1	89.5	1.0	1041.6
44	60.3	89.4	1.0	925.0
45	60.3	89.6	1.0	1001.4
46	60.0	90.5	1.0	1032.4
47	60.4	89.7	1.0	957.6
48	60.0	89.5	1.0	928.2
49	60.2	89.6	1.0	936.2
50	60.5	89.6	1.0	883.8

Statistical summary

Specificatio	60 ± 1	90 ± 1	0.9–1.0	—
Minimum	59.60	59.80	1.00	763.40
Maximum	61.50	90.80	1.00	1102.00
Average	60.17	89.20	1.00	997.33
Std. deviati	0.31	4.26	0.00	59.82
Range (max	1.90	31.00	0.00	338.60

Note: Dimensions within ±1 cm of specification. Net weight varies 763.4–1,102.0 g (range 338.6 g) – root cause confirmed at factory: inconsistent thickness/weight of the TPR anti-slip backing.

Sampled master cartons (7 of 42)

Carton No.	G.W. (kg)	L×W×H (cm)	CBM (m³)	Pcs/ctn
1	21.260	51 × 41 × 65.5	0.1370	12
2	21.575	51 × 41 × 65.5	0.1370	12
3	21.815	51 × 41 × 65.5	0.1370	12
4	21.725	51 × 41 × 65.5	0.1370	12
5	21.815	51 × 41 × 65.5	0.1370	12
6	21.535	51 × 41 × 65.5	0.1370	12
7	21.760	51 × 41 × 65.5	0.1370	12

Average G.W. (kg)	21.641	**Total CBM (42 ctns)**	5.752
Total (42 ctns) G.W. (kg)	908.9		

FNSKU / barcode verification (electronic scan log)

Barcode type	Code 128 (FNSKU)
Scan content	X002NV3RHP
Units scanned	50
Passed / Failed	**50 passed / 0 failed**
First – last scan	2026-10-14 13:47:47 – 13:52:15