


Description: **Belt conveyor first left Gearbox**

Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26123350234 Service Level: Enhanced Bottle ID: b105153076 Tested Lubricant: MOBIL SHC 630	Asset Class: Gear Drive Manufacturer: ROSSI Model: H02 R 3I 400 UP1A / 35.9 Lubricant: MOBIL SHC 630


Sample Data & Trends

Sample Info	Report Status	Caution	Caution	Normal	Caution	Caution
	Sample ID	24269259222	24343812227	25180296261	25330261229	26123350234
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b088839308	b093970818	b098287785	b105106411	b105153076
	Tested Lubricant	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630
	Sampled	10 Sep 2024	28 Nov 2024	18 Jun 2025	17 Nov 2025	26 Apr 2026
	Reported	28 Sep 2024	09 Dec 2024	01 Jul 2025	27 Nov 2025	04 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Caution	Caution	Normal	Caution	Caution
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	ISO Code (4/6/14)			22/22/20	22/21/20	
	Particle Count >4um			30291	31082	
	Particle Count >6um			20046	12107	
	Particle Count>14um			9121	6112	
	PQ Index	6	9	9	10	10
	Visc@40C (cSt)	221.8	221.6	226.2	220.9	221.7
	TAN (mg KOH/g)	1.12	0.95	0.92	0.94	0.99
	Water (Vol%)	0.010	0.020	0.010	0.040	0.040
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	4	0	1	0	0
	Cr (Chromium)	1	0	0	0	0
	Cu (Copper)	0	0	0	0	0
	Fe (Iron)	8	13	7	9	1
	Mo (Molybdenum)	2	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	0	2	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	0	0	1	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	33	22	8	42	13
Additive (ppm)	B (Boron)	16	4	8	30	18
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	4	21	46	37	5
	Mg (Magnesium)	2	0	2	2	2
	P (Phosphorus)	563	421	517	630	496
	Zn (Zinc)	24	5	28	13	5


Viscosity

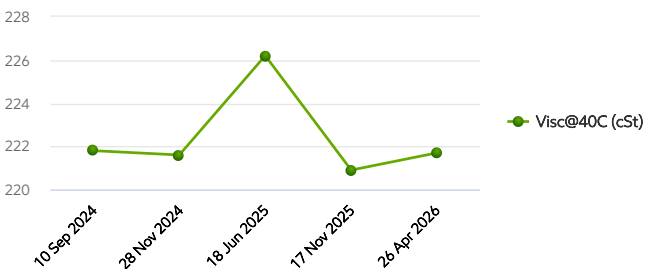


Wear

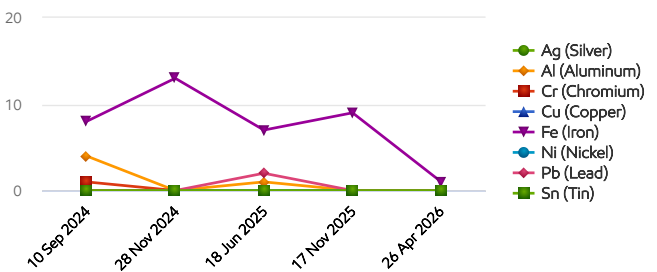

Contaminants

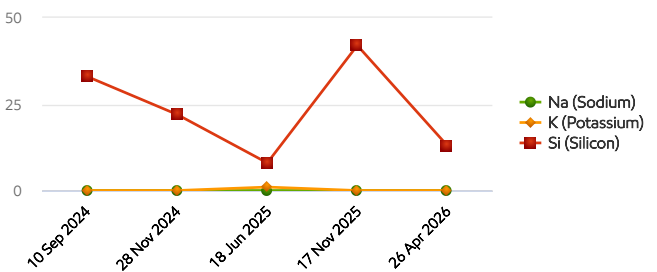

Physical Properties

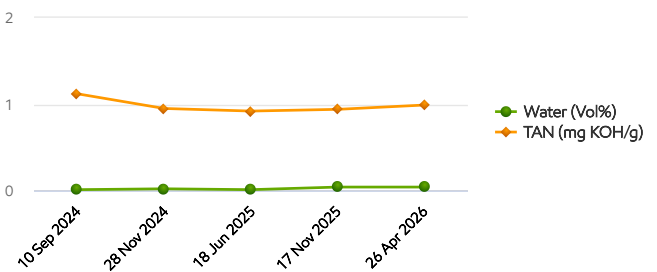

		Caution	
		Unit ID: 111.BC330.L1-4	Asset ID: 30767436
		Description: Belt conveyor first left Gearbox	
Account Information		Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG		Sample ID: 26123350234 Service Level: Enhanced Bottle ID: b105153076 Tested Lubricant: MOBIL SHC 630	Asset Class: Gear Drive Manufacturer: ROSSI Model: H02 R 3I 400 UP1A / 35.9 Lubricant: MOBIL SHC 630
Recommendation/Comments			
ADMINISTRATION - INSUFFICIENT SAMPLE VOLUME. The sample volume is insufficient to support a complete analysis. As a result, certain tests were not completed, and no analysis can be provided. Before sending future samples to the laboratory, please ensure that adequate volumes are collected. Contact your ExxonMobil representative for further assistance if necessary.			
Sample Timeline			
26 Apr 2026 10:25 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:			

Results and comments of this analysis are advisory only. The validity of the data may be impaired by a non-representative sample or incorrect data. © 2016-2024 ExxonMobil. ExxonMobil and Mobil are trademarks or registered trademarks of ExxonMobil Corporation or one of its subsidiaries. Other trademarks shown are property of their respective owners.