



Caution

Unit ID: R2.322.LQ145 (GB) Cancel

Asset ID: 50161821

Description: Mill2 gear Box

Account Information

ID: 208948
Name: Reliance Heavy Industries
Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information

Sample ID: 26124405214
Service Level: Enhanced
Bottle ID: b105154805
Tested Lubricant: MOBILGEAR 600 XP 320


Equipment Information

Asset Class: Circulating System
Manufacturer: MAAG GEAR
Model: WPU-142/C-330 ATOX 45
Lubricant: MOBILGEAR 600 XP 320


Sample Data & Trends

Sample Info	Report Status	Caution	Caution	Alert	Caution	Caution
	Sample ID	21285485216	22022220228	22116260209	22210297228	26124405214
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b060620988	b060646251	b060744976	b066954897	b105154805
	Tested Lubricant	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320	MOBILGEAR 600 XP 320
	Sampled	07 Oct 2021	17 Jan 2022	20 Apr 2022	20 Jul 2022	26 Apr 2026
	Reported	13 Oct 2021	23 Jan 2022	27 Apr 2022	31 Jul 2022	05 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
Lubricant	Filter Changed					
	Contamination Rating	Normal	Normal	Caution	Caution	Caution
	Equipment Rating	Caution	Normal	Alert	Normal	Normal
	Lubricant Rating	Normal	Caution	Normal	Normal	Normal
	ISO Code (4/6/14)	22/20/16	23/21/17		23/21/15	
	Particle Count >4um	33058	63852		51134	
	Particle Count >6um	8169	12552		13264	
	Particle Count>14um	397	885		263	
	PQ Index	18	18	18	6	36
	Visc@40C (cSt)	328.4	332.2	321.9	297.6	308.6
Wear (ppm)	Oxidation (Ab/cm)	2	6	3	2	1
	Water (Vol%)	0.030	0.040	0.030	0.050	0.040
	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	6	2	0	0
	Cr (Chromium)	2	3	0	0	0
	Cu (Copper)	4	8	2	0	0
	Fe (Iron)	42	26	57	30	26
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	5	0	0	0
Contaminant (ppm)	Sn (Tin)	0	0	0	0	0
	K (Potassium)	0	2	0	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	0	14	2	4	0
Additive (ppm)	B (Boron)	14	24	10	0	13
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	3	15	1	0	9
	Mg (Magnesium)	0	0	0	2	2
	P (Phosphorus)	309	368	434	304	386
	Zn (Zinc)	22	12	32	26	1


Viscosity

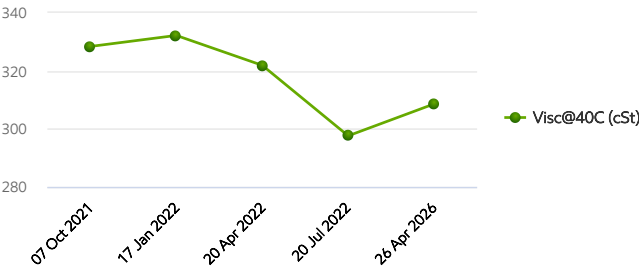


Wear

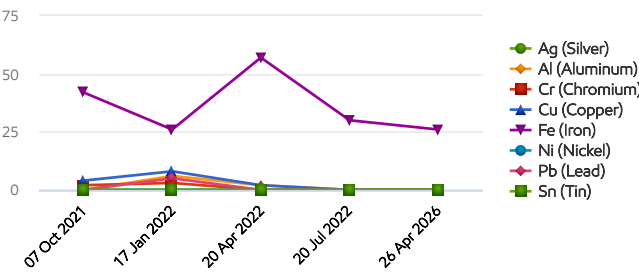

Contaminants

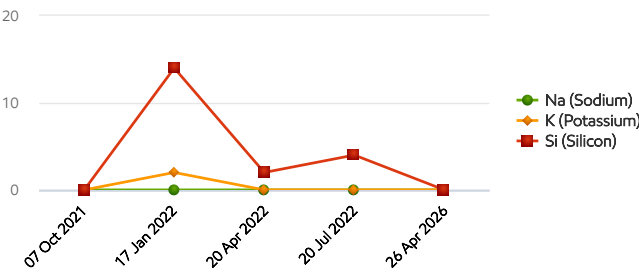

Physical Properties

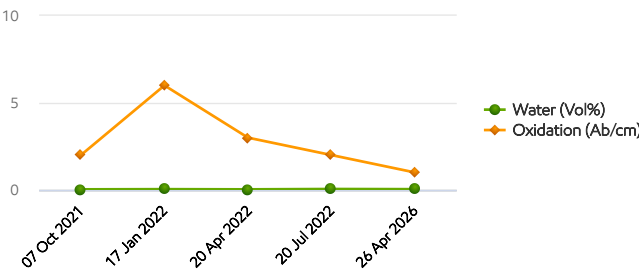

	Caution	
	Unit ID: R2.322.LQ145 (GB) Cancel	
	Asset ID: 50161821	
Description: Mill2 gear Box		
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26124405214 Service Level: Enhanced Bottle ID: b105154805 Tested Lubricant: MOBILGEAR 600 XP 320	Asset Class: Circulating System Manufacturer: MAAG GEAR Model: WPLI-142/C-330 ATOX 45 Lubricant: MOBILGEAR 600 XP 320
Recommendation/Comments		
ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
26 Apr 2026 9:58 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:		