


Coverage — GT (grey), PSScene strips 2026-03-30 (blue),
roofs with extracted signature (red) — Varese province (Busto A., Gallarate, Tradate)




Covered area zoom — NDVI split

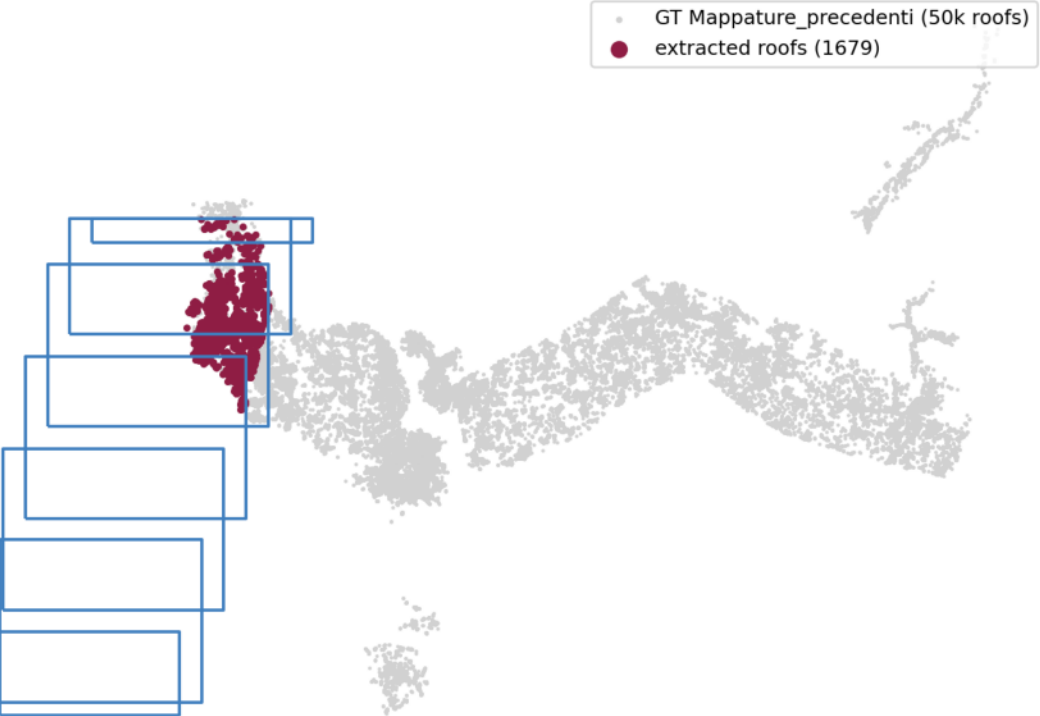


Extraction check — Planet RGB 3 m, GT outline in yellow (row 1: 'mineral' roofs · row 2: 'vegetated' = likely remediated)


MINERAL NDVI=0.01
8560 m² · 951 px

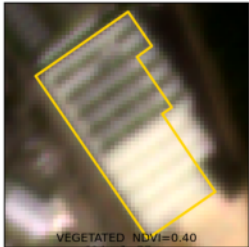


VEGETATED NDVI=0.40
694 m² · 77 px

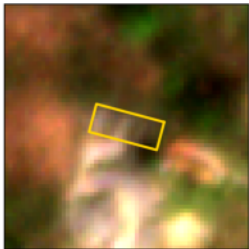

MINERAL NDVI=0.02
6818 m² · 756 px

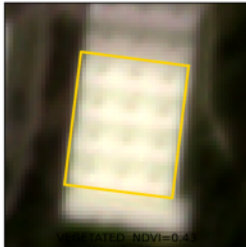


VEGETATED NDVI=0.43
665 m² · 73 px

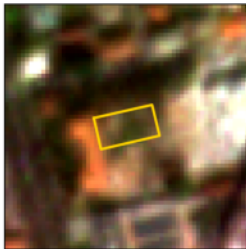


MINERAL NDVI=0.04
6379 m² · 708 px




VEGETATED NDVI=0.41
398 m² · 44 px

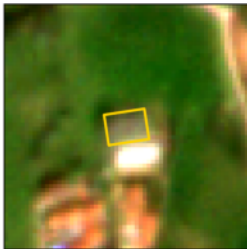

MINERAL NDVI=0.02
4483 m² · 498 px

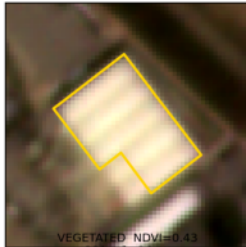


VEGETATED NDVI=0.43
331 m² · 36 px

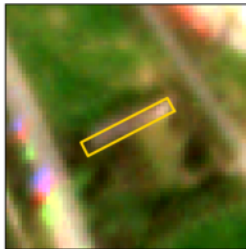


MINERAL NDVI=0.02
3513 m² · 363 px




VEGETATED NDVI=0.47
187 m² · 20 px

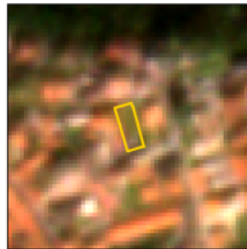

MINERAL NDVI=0.04
3361 m² · 373 px

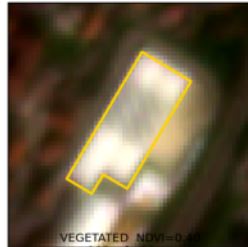


VEGETATED NDVI=0.40
182 m² · 21 px

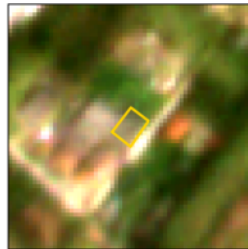


MINERAL NDVI=0.09
3133 m² · 348 px




VEGETATED NDVI=0.41
180 m² · 20 px

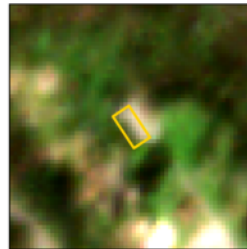


MINERAL NDVI=0.07
2965 m² · 329 px

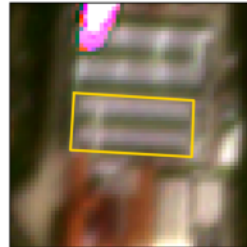


Asbestos-roof signatures, PSScene 2026-03-30 — GT F2018==1
NDVI split: GT is 8 y older than the image (remediation/overgrowth)

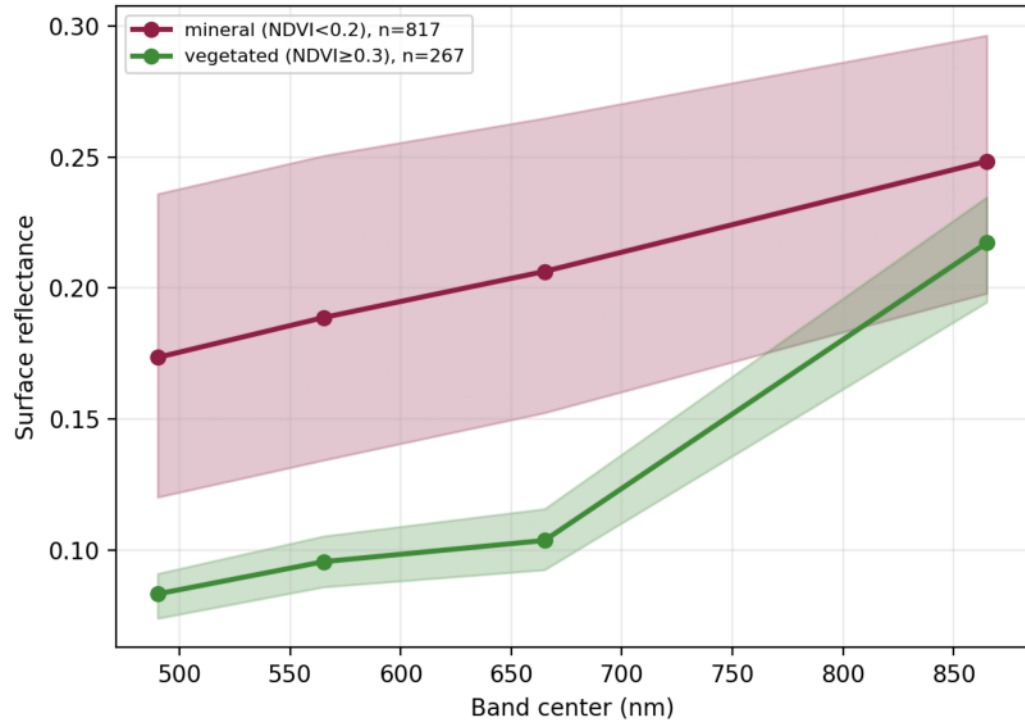


Shape vs USGS model — SAM: mineral 6.3°, vegetated 22.1°

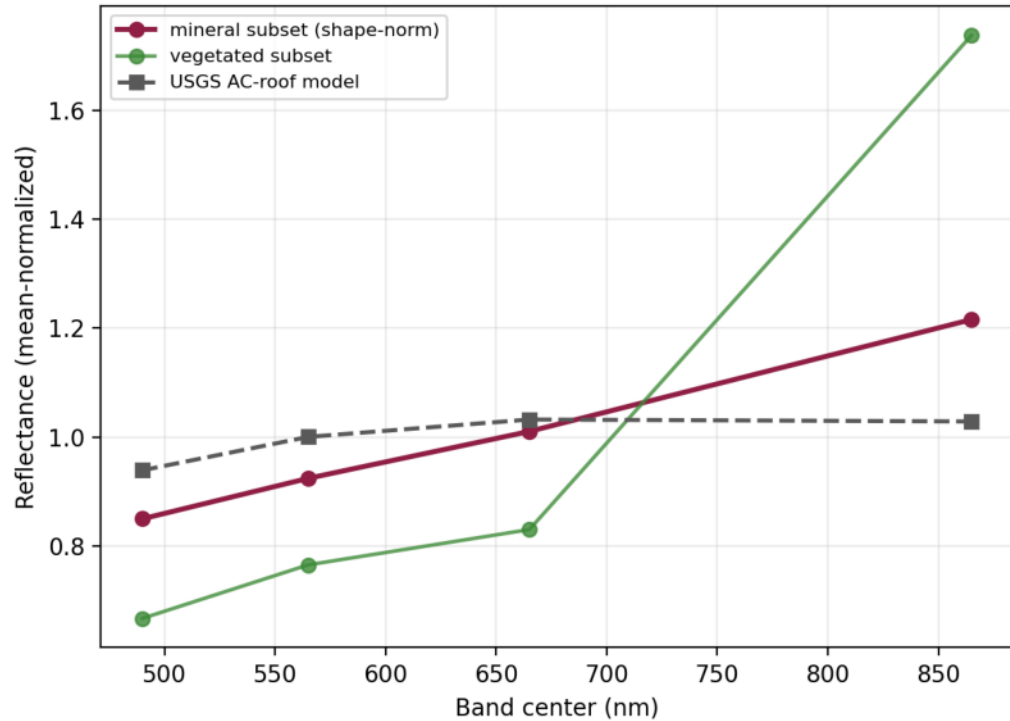


Extracted roofs by GT source

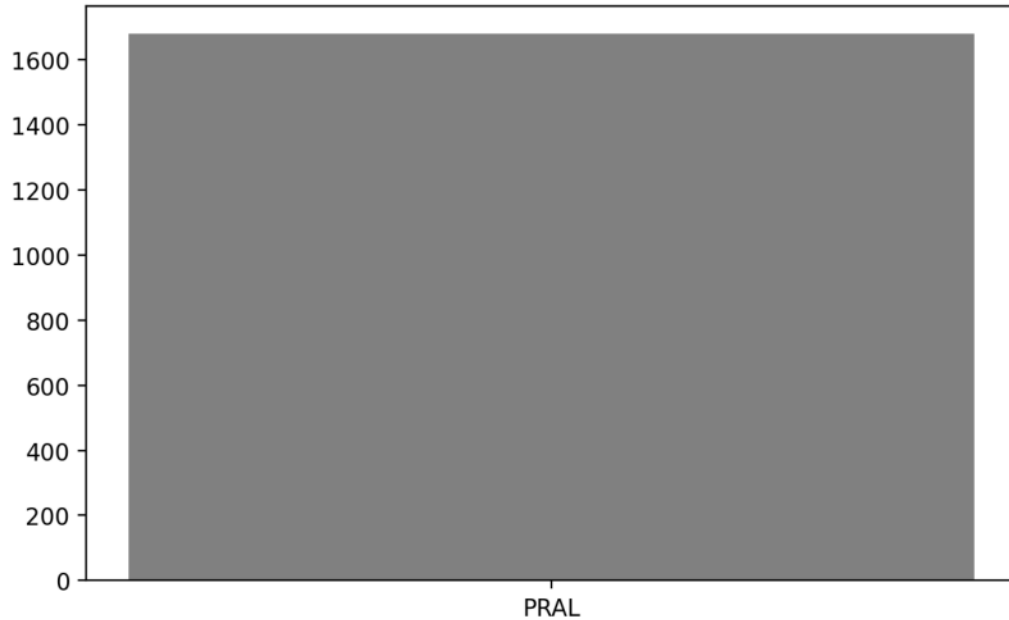


Roof brightness distribution
(bimodality → weathering / paint states)

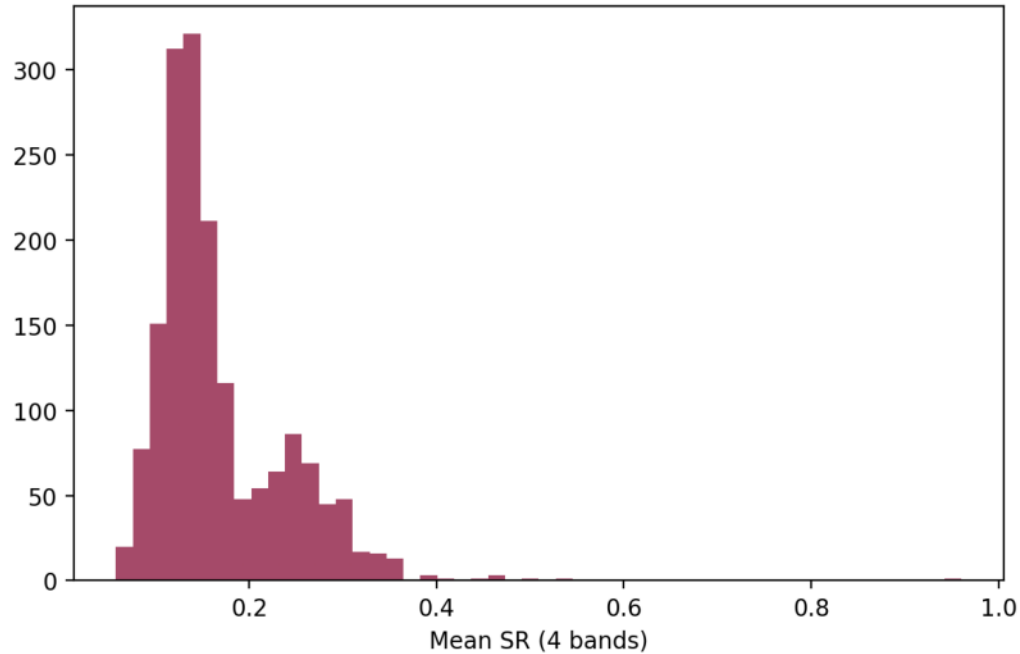

Pure asbestos minerals — USGS splib07a (ASD, 2151 ch)

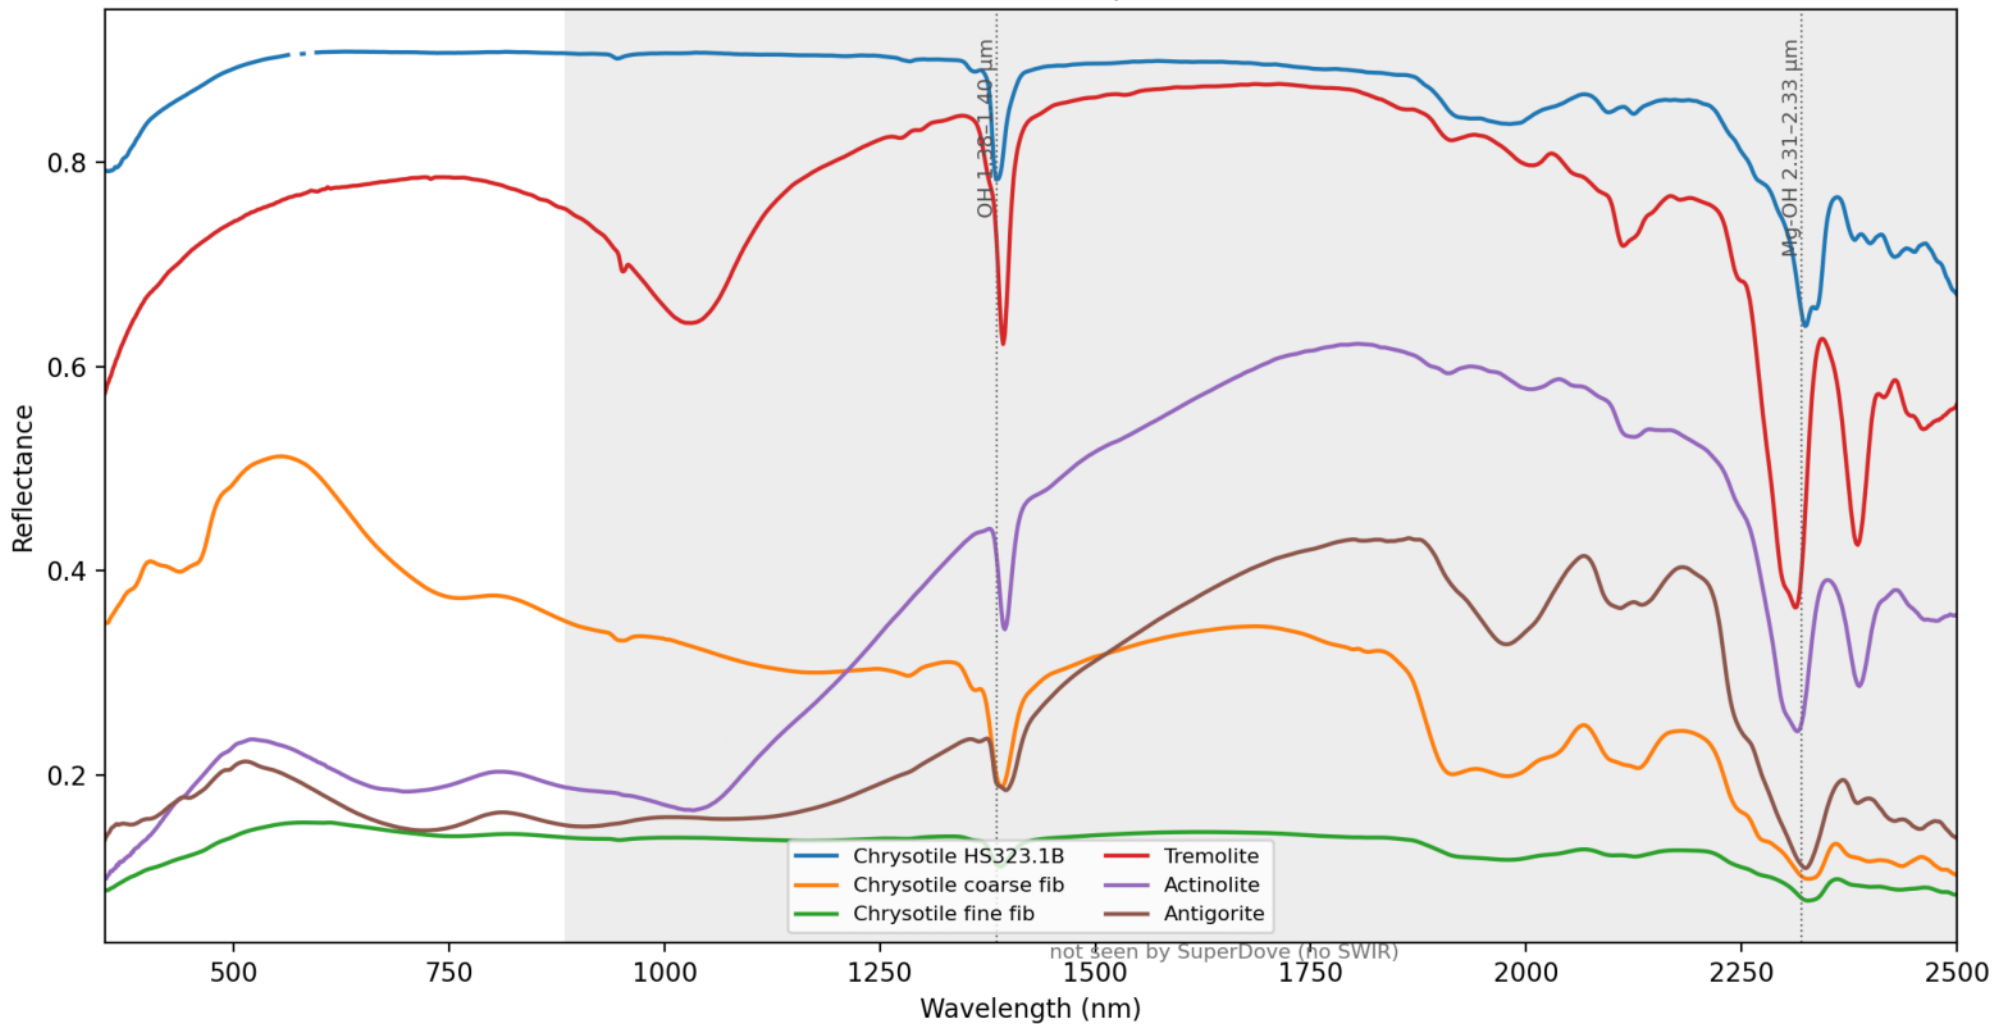


Asbestos-cement roof (modelled, Cilia 2015 mixing) vs roof confusers

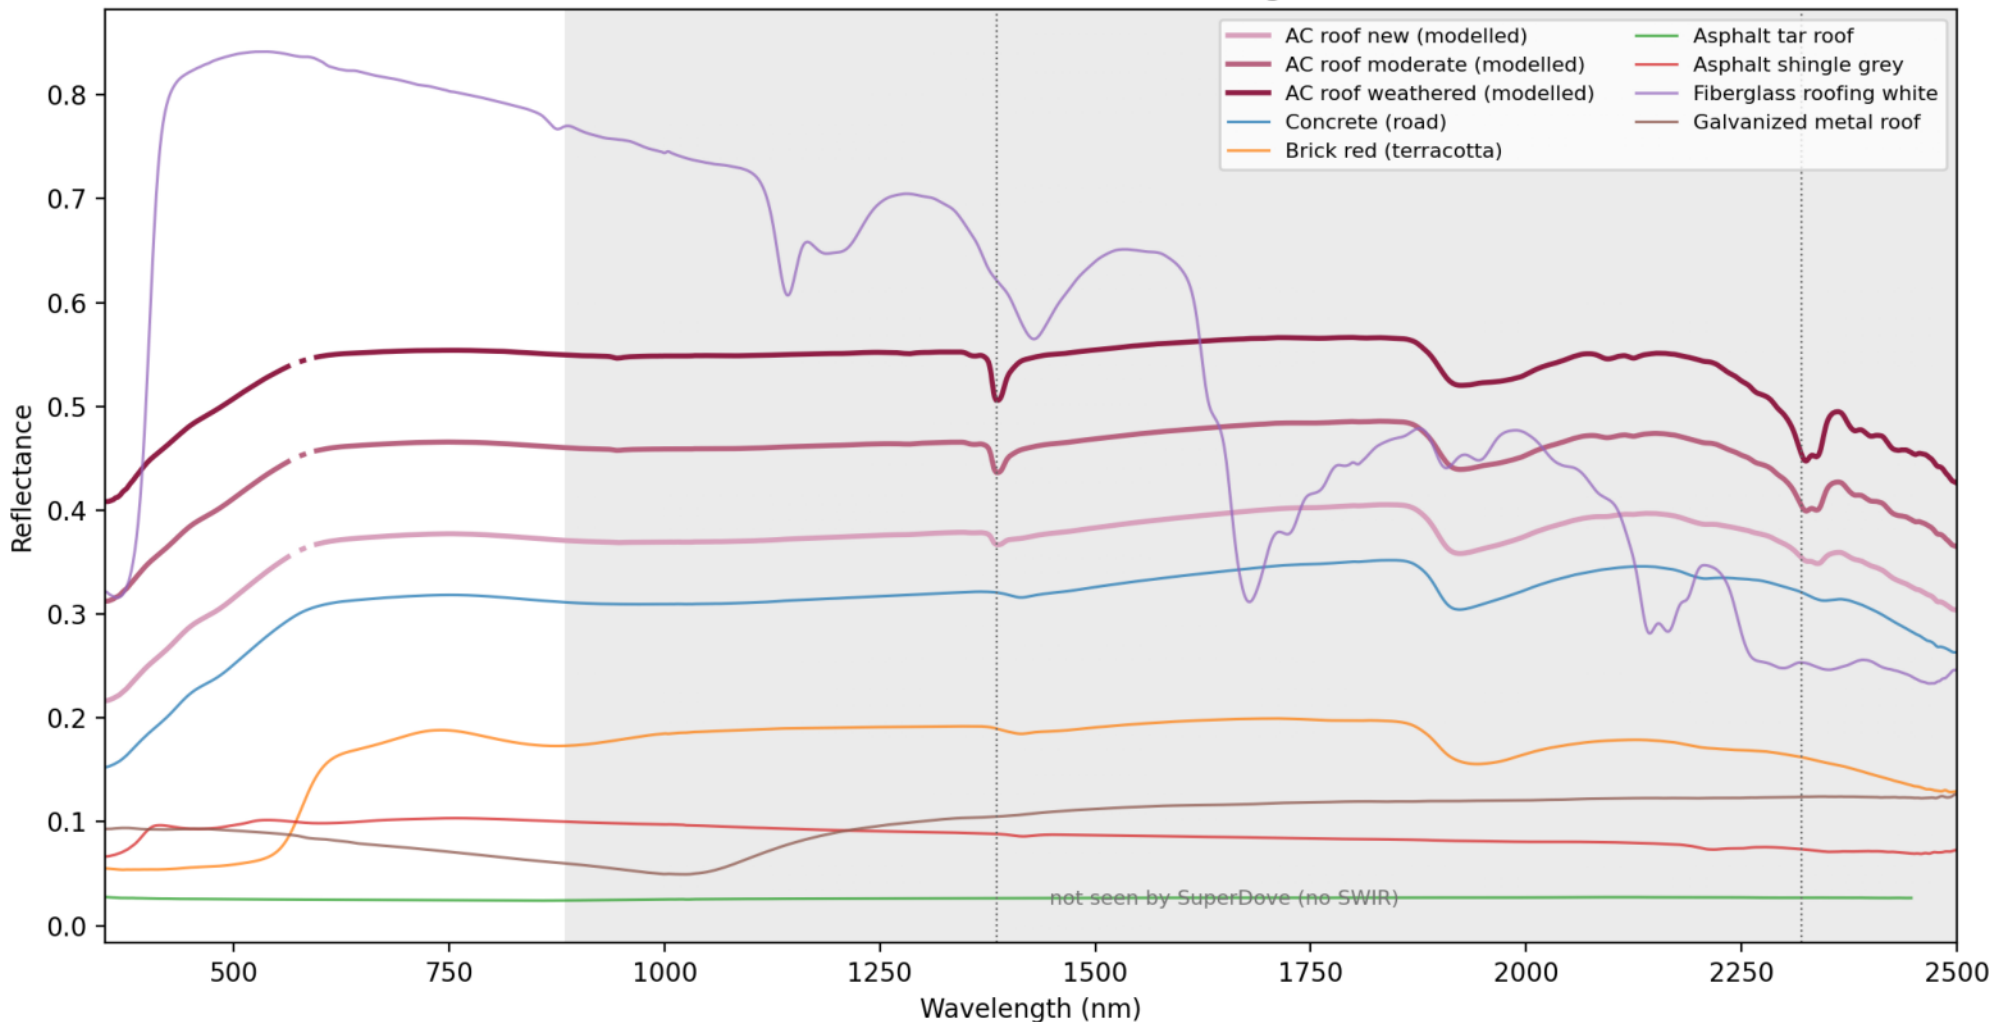


What each sensor sees — signatures resampled with Gaussian SRF


SuperDove (8b VNIR)

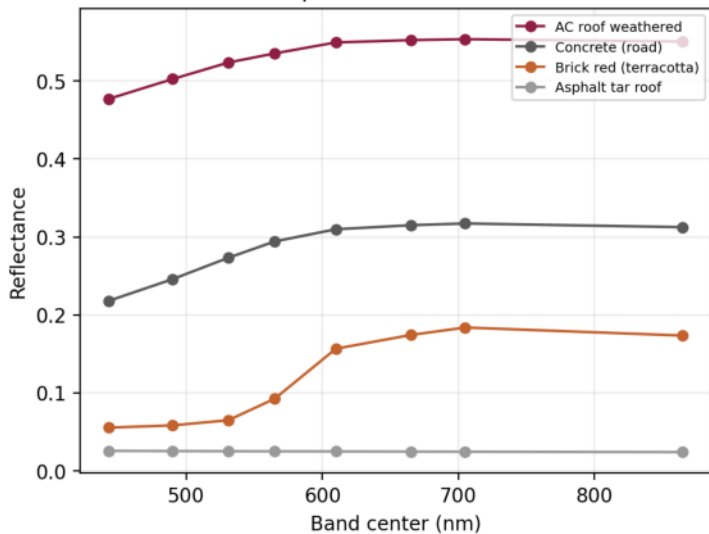


Sentinel-2 (11b)

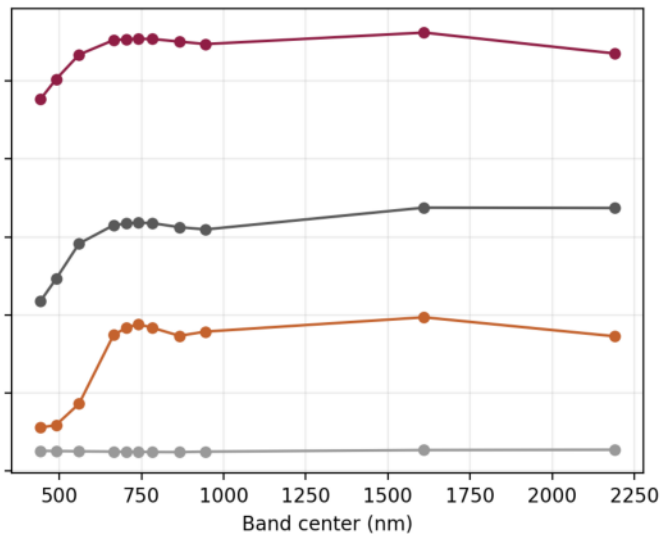

WV-3 SWIR (8b)

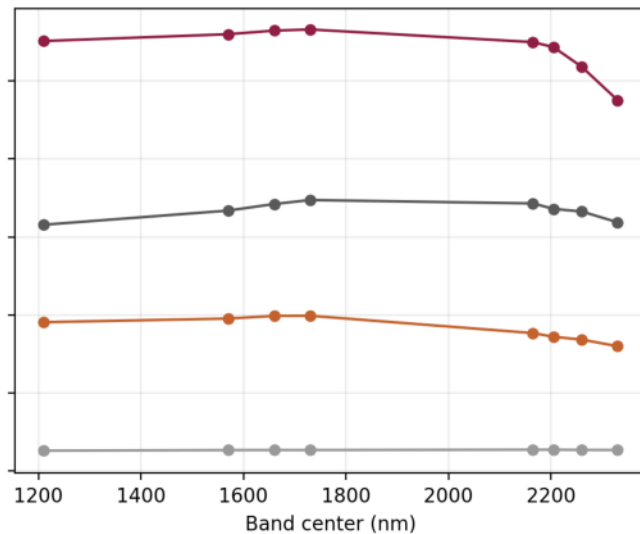

SAM separability: 'AC roof weathered' vs confusers (higher = more separable)

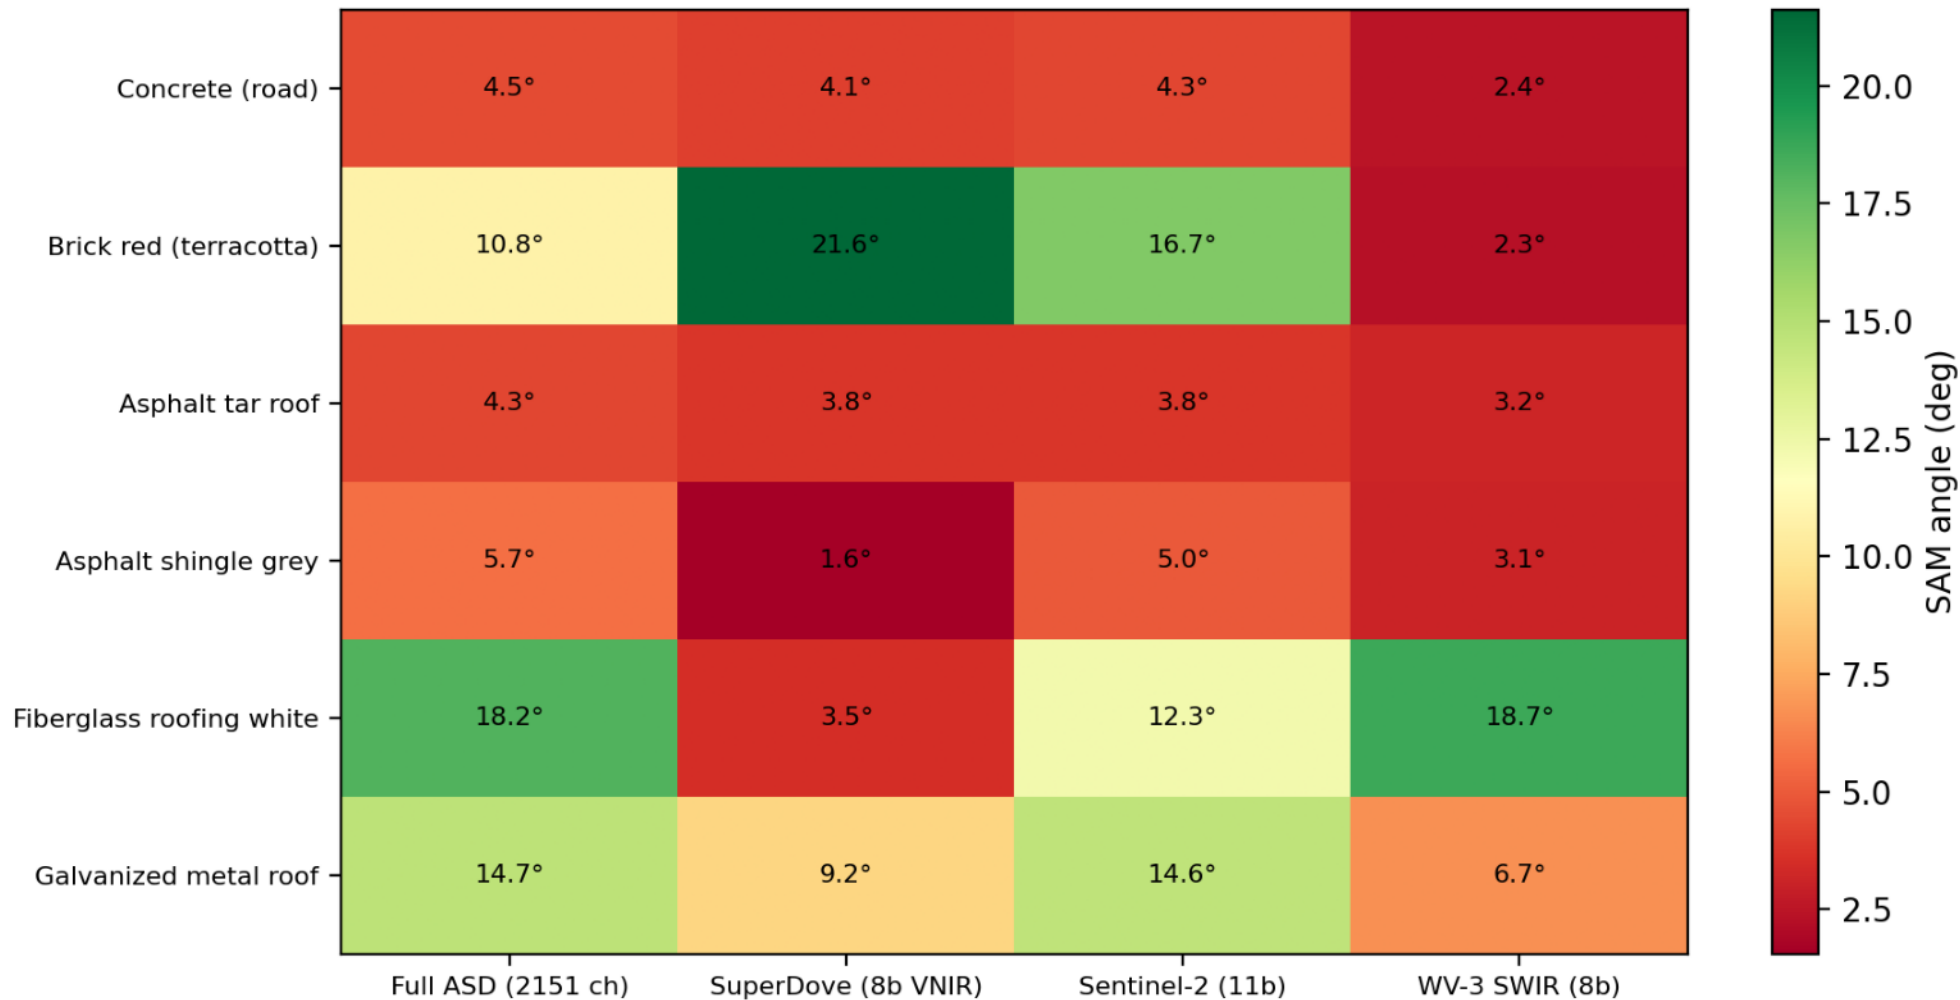

Mg-OH 2.31 μm feature — only asbestos-cement shows real depth
(seen by WV-3 SWIR S8; washed out by S2 B12, FWHM 175 nm; invisible to SuperDove)

