

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

JOB SPECIFICATION

Anticipated Award Date: <u>03/17/2026</u>	Production Completion Date: <u>07/04/2026</u> <u>07/08/2026</u>	PREPARING ACTIVITY:	
POP Start Date: <u>03/16/2026</u> <u>03/27/2026</u>	POP End Date: <u>09/30/2026</u>	SASEBO	
PREPARED BY: S.NODA	CODE H NO	DATE 3/02/2026	
APPROVED BY: S.MURAKAMI	CODE S225		
CONCURRED BY: S.MOROOKA	CODE S231		
ASSIST PLANNER'S NAME: N.KOSHOJI	CODE M KS		
ASSIST PLANNER'S NAME:	CODE		
ASSIST PLANNER'S NAME:	CODE		

DIVING OPS

DESCRIPTION:				
JSN(S): DB01-1294		CASREP # 25134, DTG: 021200ZDEC25, C-3		
S/F CONTACT: EVANS BM2 / ARMSTRONG BMC CWP #		CCNS # LPD22-022-26		
Approved by S300/S900 <u>PDIONUS</u> <u>3/2/26</u> Avl: 6EM				
LWC:				
Work Completed				
S/Force: Rate: Date:				
Ship Supt: Date: SRF CONTROL NO.: 1301339426				
WORK CERTIFICATION SIGNATURES				
COMPLETION OF WORK REVIEW:	BADGE NO.:	SHOP/CODE:	PHONE:	DATE:

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

1. SCOPE:

1.1 Title: Lower Stern Gate and Transom; repair

1.2 Location of Work:

1.2.1 Well Deck Transom (5-143-0-Q) "CRITICAL COATED AREA"

1.2.2 Lower Stern Gate

1.2.3 Upper Stern Gate

1.2.4 Stern Gate Operating Gear Room No.1 (2-194-1-Q)

1.2.5 Stern Gate Operating Gear Room No.2 (2-194-2-Q)

1.2.6 Nixie Machinery Room (3-193-1-Q)

1.2.7 Stern Gate Machinery Room No.2 (3-188-6-Q)

1.2.8 Stern Gate Operating Gear Room No.3 (4-190-1-Q)

1.2.9 Stern Gate Operating Gear Room No.4 (4-190-2-Q)

1.2.10 Well Deck (5-143-0-C)

1.2.11 Flight Deck, AFT End of Ship

1.2.12 Ballast Tank (6-193-0-W)

1.2.13 Ballast Tank (6-193-1-W)

1.2.14 Ballast Tank (6-193-2-W)

1.3 Identification:

1.3.1 Quantity (3 EA), Ballast Tank as Follows, Listed in 1.2.12 through 1.2.14

TANK NO.	CAPACITY AT 100 % FULL	REMARKS
6-193-0-W	200.756 CU METERS	BALLAST TANK
6-193-1-W	191.678 CU METERS	BALLAST TANK
6-193-2-W	191.678 CU METERS	BALLAST TANK

1.3.2 Quantity (One EA), Lower Stern Gate, Located in 1.2.1 and 1.2.2

MFR	- Huber Inc.
Part No.	- 2040-DA0-A27699/LP-H-58401
Model	- 721-5500
Figure No.	- Figure FO-35 of 2.4

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

Dimension (Feet) - 21.7 Width by 77.8 Length by 4.5 Height
Weight - 106,000 LBS

1.3.3 Quantity (One EA), Upper Stern Gate, Located in 1.2.1 and 1.2.3

MFR - Huber Inc.
Part No. - 2040-DA0-A27739/LP-H-58401A
Model - 721-5000
Figure No. - Figure FO-34 of 2.4
Dimension (Feet) - 11.7 Width by 78.5 Length by 3.0 Height
Weight - 41,000 LBS

1.3.4 Quantity (26 EA), Hinge Pin for Upper and Lower Stern Gate Located in 1.2.2 and 1.2.3

Part No./Drawing No. - 99C621-16-DWG-00-B-0
Figure & Index No. - Figure FO-15 Item 14 of 2.4
Material - Nickel-Copper Aluminum Alloy, K-Monel, QQ-N-286G

Associated Component:

Pin Keeper Plate, Figure FO-15 Item 6 of 2.4
Pin Washer, Figure FO-15 Item 7 of 2.4
Cotter Pin, Figure FO-15 Item 8 of 2.4

1.3.5 Quantity (2 EA), Upper Gate Lift Pin for Upper Stern Gate Located in 1.2.3

Part No./Drawing No. - 99C621-12-DWG-00-B-0
Figure & Index No. - Figure FO-15 Item 5 of 2.4
Material - Nickel-Copper Aluminum Alloy, K-Monel, QQ-N-286G

Associated Component:

Pin Keeper Plate, Figure FO-15 Item 6 of 2.4
Pin Washer, Figure FO-15 Item 7 of 2.4
Cotter Pin, Figure FO-15 Item 8 of 2.4

1.3.6 Quantity (2 EA), Lower Gate Outboard Hinge Pin for Lower Stern Gate Located in 1.2.2

Part No./Drawing No. - 99C621-19-DWG-00-B-0
Figure & Index No. - Figure FO-15 Item 25 of 2.4
Material - Nickel-Copper Aluminum Alloy, K-Monel, QQ-N-286G

Associated Component:

Pin Keeper Plate, Figure FO-15 Item 6 of 2.4
Pin Washer, Figure FO-15 Item 7 of 2.4
Cotter Pin, Figure FO-15 Item 8 of 2.4

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

1.3.7 Quantity (2 EA), Lower Link Arm Pin for Lower Stern Gate
Located in 1.2.2

Part No./Drawing No. - 99C621-09-DWG-01-B-0
Figure & Index No. - Figure FO-15 Item 21 of 2.4
Material - Nickel-Copper Aluminum Alloy, K-Monel,
QQ-N-286G

Associated Component:

Link Pin Keeper Plate, Figure FO-15 Item 22 of 2.4
Capscrew, Figure FO-15 Item 23 of 2.4
Lock Washer, Figure FO-15 Item 24 of 2.4

1.3.8 Quantity (30 EA), Pin Keeper Plate for Hinge Pin listed in
1.3.4 through 1.3.6

Part No./Drawing No. - 99C621-13-DWG-00-A-0
Figure & Index No. - Figure FO-15 Item 6 of 2.4
Item 61 of 2.5
Material - New: CRES, SAE AMS-QQ-S-763 Grade 316L
Dimension (Inch) - 3.0 by 2.0 by 0.5 Thickness

1.3.9 Quantity (8 EA), Temporary Lifting Padeye on Lower Stern Gate
for Removal and Installation of It

1.3.10 Quantity (8 EA), Temporary Lifting Padeye on Upper Stern Gate
for Removal and Installation of It

1.3.11 Quantity (8 EA), Temporary Holding Wire Assembly with each
Chain Hoist for Lower Stern Gate at Open/Close Position Located in
1.2.1 through 1.2.3

1.3.12 Quantity (13 EA), Existing Safety Net Assemblies at aft end of
Flight Deck located in 1.2.11

1.3.13 Quantity (11 EA), Existing Synthetic Decking Panel to be
Removed and Installed (ITEM No.19 of 2.27)

1.3.14 A Total of (10 SF) of Transom Plate, Located in 1.2.1

1.3.15 A Total of (62 FT) of Rubber Seal of Each Lower Section
(Horizontal) of The Lower Stern Gate, Item No. 8 of 2.5, Located in
1.2.1

1.3.16 A Total of (16 LF) of Rubber Seal Support Channel, C-Shaped
Steel Channel 5 Inch by 9 Pounds, Item No.12 of 2.5, Located in 1.2.1

1.3.17 A Total of (30 LF) of Welded Retainer Angle of Rubber Seal,
Item No.13 of 2.5, Located in 1.2.1

1.3.18 A Total of (22 LF) of Bolting Header, Section 11B-C of 2.5,
Located in 1.2.1

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

1.3.19 A Total of (30 LF) of Bolted Retainer Angle of the Rubber Seal, Section 11B-C of 2.5, Located in 1.2.1

1.3.20 A Total of (10 SF) of Each Pitted and Deteriorated Surface on Lower Stern Gate and Transom Plate, Located in 1.2.1 and 1.2.2

1.3.21 A Total of (4 SF) of Seal Bar and Inboard Skin Plate with Bar of Lower Stern Gate, Located in 1.2.2

1.3.22 A Total of (90 SF) of Each Preservation Area of New Rubber Seal Support Channel, Welded Retainer Angle, Bolted Retainer Angle, Header Bar and Associated Each Structure for Replacement of New Gasket, Located in 1.2.1

2. REFERENCES:

2.1 Standard Items (FY26)

2.2 167-7317994 Rev-F, Manhole List

2.3 MS-16-MH-16 Rev-2, Manhole, Flush Deck Size 15 X 23 (15X23 Clear Opening)

2.4 S9584-A3-MMC-010 Revision 7, Stern Gate, Model 721, and Operating Equipment System

2.5 169-7317967 Rev-J, Stern Gate Installation and Details for LPD-17 THRU 27 Only

2.6 MFR DWG NO. 99C621-13-DWG-00-A-0 Rev A, Pin Keeper Plate

2.7 MFR DWG NO. HI-721-5500 Rev V, Lower Gate Assembly & Weldment

2.8 MFR DWG NO. 99C621-02-DWG-02-B-0 Rev K, Lower Gate Frame Weldment, Part 1

2.9 MFR DWG NO. 99C621-02-DWG-21-A-0_Rev B, Lower Gate Lifting Lug

2.10 MFR DWG NO. 99C621-02-DWG-21-B-0_Rev C, Lower Gate Lifting Lug (35 Ton)

2.11 MFR DWG NO. 99C621-02-DWG-22-A-0_Rev B, Lower Gate Lifting Lug Cheek Plate

2.12 MFR DWG NO. HI-721-5000 Rev N, Upper Stern Gate Assembly

2.13 MFR DWG NO. 99C621-03-DWG-16-A-0_Rev B, Upper Gate Lug (12 Ton)

2.14 MFR DWG NO. 99C621-03-DWG-16-B-0_RevB, Upper Gate Lifting Lug Weldment (12 Ton)

2.15 MFR DWG NO. 99C621-03-DWG-17-A-0_Rev B, Upper Gate Lifting Lug_A (12 Ton)

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

- 2.16 MFR DWG NO. 99C621-03-DWG-17-B-0_RevB, Upper Gate Lift LUG_A Weldment (12 Ton)
- 2.17 MFR DWG NO. 99C621-03-DWG-18-A-0_Rev B, Upper Gate Lifting Lug Cheek Plate
- 2.18 804-5184133 Rev-B, Padeye Machinery Lifting
- 2.19 Avondale DWG NO. 00-3430-0002 Rev 9, UNIT-3430 CL (Partial Sub Unit)
- 2.20 Avondale DWG NO. 00-3430-0003 Rev 5, UNIT-3430 CL (Combined Partial Sub Unit)
- 2.21 Avondale DWG NO. 00-3430-0005 Rev 7, UNIT-3430 CL (Sub Assembly)
- 2.22 Avondale DWG NO. 00-3430-0006 Rev 3, UNIT-3430 CL (Main Assembly)
- 2.23 Avondale DWG No. 00-3470-0002 Rev 5, Unit-3470 CL (Partial Sub Unit)
- 2.24 Avondale DWG No. 00-3470-0003 Rev 3, Unit-3470 CL (Combined Partial Sub Unit)
- 2.25 Avondale DWG No. 00-3470-0005 Rev 5, Unit-3470 CL (Sub Assembly)
- 2.26 612-7320831 REV E, Helicopter Safety Nets Arrangement & Details
- 2.27 584-7318229 Rev C, Synthetic Deck & Batterboard
- 2.28 S9086-CH-STM-010/CH-074/V1/Rev 6, Welding and Allied Processes
- 2.29 S9086-DA-STM-010/CH-100/Rev 4, Hull Structures
- 2.30 192-7318319 Rev C, Watertight Integrity Testing Schedule
- 2.31 T.P File No. 58421-2-100_26076 Rev 00, Lower Stern Gate Temporary Lifting Padeye - Load Test
- 2.32 T.P File No. 58421-2-100_26076A Rev 00, Upper Stern Gate Temporary Lifting Padeye - Load Test

3. REQUIREMENTS:

(V) (G) "PRE-BRIEF"

3.1 Prior to the start of work, attend Pre-Brief to confirm that the Contractor, the Government, and the Ship's Force understand the tasks the contractor is required to accomplish as part of this job specification and that each of the parties understand the precautionary measures to be taken to prevent flooding while the repairs/alterations are in progress and who has responsibility for such measures. **-SHIPSUPT**

6/29

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

<u>Opening Item</u>			<u>Valve #/Size</u>
<u>TANK NO.</u>	<u>085-7318360 Rev A</u>	<u>P/S</u>	<u>529-7317947 Rev-G</u>
6-193-0-W	164	PORT	BALH-V-6-193-4 SEA VLV NO.2/ 8 Inch
6-193-0-W	165	STBD	BALH-V-6-193-1 SEA VLV NO.1/ 8 Inch
6-193-0-W	166	PORT	BALH-V-6-193-2 STRIP VLV NO.2/ 6 Inch
6-193-0-W	169	STBD	BALH-V-6-194-1 STRIP VLV NO.1/ 6 Inch
6-193-1-W	167	STBD	BALH-V-6-193-3 SEA VLV NO.1/ 6 Inch
6-193-2-W	168	PORT	BALH-V-6-193-6 SEA VLV NO.1/ 6 Inch

3.1.1 Upon completion of the work, contact SHIPSUPT and ensure that each temporary cofferdam has been cleared by Diver.

3.2 Accomplish the requirements of ENCLOSURE (T) for cleaning of each tank listed in 1.3.1 using 2.2 and 2.3 for guidance.

(V) "REPORT"

3.3 Submit one legible copy of Marine Chemist certificate to SUPERVISOR including certified location.

3.3.1 Steam clean each area located in 1.2.2 and 1.2.3 where the removal of preservative is required.

3.3.1.1 Install and remove new rust preventive compound conforming to MIL-PRF-16173, Grade 3, upon completion of the work.

3.3.1.2 Install each new bronze fill and drain plug conforming to WW-P-460, to replace those removed to accomplish steam cleaning.

3.4 Each temporary padeye listed in 1.3.9 and 1.3.10 must be planned for lifting of each upper and lower stern gate listed in 1.3.2 and 1.3.3, using 2.4, 2.5, 2.7 through 2.18 for guidance.

(V) (G) "LOAD TEST"

3.4.1 Accomplish the requirements of 2.31 and 2.32 for load test of each temporary padeye listed in 1.3.9 and 1.3.10. **-S246**

3.4.2 Provide and install each temporary holding wire rope assembly with each chain hoist listed in 1.3.12 for lower stern gate listed in 1.3.2. Upon completion of work, remove them.

3.5 Remove each existing safety net assembly listed in 1.3.12 for removal/installation of existing upper stern gate, using 2.26 for guidance. Upon completion work, install each removed safety net assembly.

3.5.1 Clean and retain each existing fastener for reuse.

3.5.2 Chase and tap each exposed threaded surface of each equipment.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

3.6 Remove each upper and lower stern gate listed in 1.3.2 and 1.3.3 for each repair work, using 2.4, 2.5, 2.7 through 2.12 for guidance.

3.6.1 Provide each mobile crane for removal and installation of upper and lower stern gate.

3.7 Remove each hinge pin, upper gate lift pin, lower gate outboard hinge pin, lower link arm pin, and associated component listed in 1.3.4 through 1.3.7, and pin keeper plate listed in 1.3.8 to remove each upper and lower stern gate listed in 1.3.2 and 1.3.3, using 2.4 and 2.5 for guidance.

3.7.1 Clean each exposed part free of oil and foreign matter leaving no residue or injurious effects.

3.7.2 Inspect each part for wear and defects.

3.7.2.1 Measure and record each size and clearance of each wearing part and fit area.

3.7.3 Remove each high spot, burr, abrasion, nick, corrosion, gasket material, and foreign matter from each flange and mating surface.

3.7.4 Remove each burr and high spot from each exposed sliding surface, screw thread, key and keyway.

3.7.4.1 Chase and tap each exposed threaded area.

3.7.5 Handwork and skim cut each machined, sealing, aligning, mating and gasket surface, taking precautions to ensure minimum metal removal.

3.7.6 Polish each surface in way of bearings, bushings, seals and packing.

3.8 Fabricate each new pin keeper plate listed in 1.3.8 out of CRES conforming to SAE AMS-QQ-S-763 Grade 316L, using 2.6 for guidance.

3.8.1 Measure and record each final size of each new pin keeper plate.

(V) "REPORT"

3.8.1.1 Submit one legible copy of condition report listing results of the requirement of 3.8.1 to SUPERVISOR.

3.9 Accomplish a visual inspection of well deck transom, upper and lower stern gate located in 1.2.1 through 1.2.3 including structure members, gasket support channels, and welded and bolted gasket retainer angles to determine each repair area in accordance with Section 6 of 2.28 and 100-2.8 of 2.29, using 2.4, 2.5, 2.7 through 2.12 and 2.19 through 2.25 for guidance.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

(V) "REPORT"

3.9.1 Submit one legible copy of a report listing results of the requirement of 3.9 to SUPERVISOR including "exact location" and "repair size" on repair recommendation.

3.10 Remove each existing rubber seal, rubber seal support channel with welded retainer angle, bolting header with bolted retainer angle, transom plate and inboard skin plate listed in 1.3.14 through 1.3.21 determined by the visual inspection in 3.9, using 2.4, 2.5, 2.7 through 2.12 and 2.19 through 2.25 for guidance.

3.10.1 Remove and install each exiting synthetic decking panel listed in 1.3.13 for repair work, using 2.27 for guidance.

3.10.1.1 Fill each counter bore attachment hole with new caulking material using General Note 18 of 2.27 for guidance.

3.10.2 Fabricate and install each new transom plate listed in 1.3.14 out of each new 18 millimeter thick high tensile steel plate conforming to ABS Grade EH-36.

3.10.3 Template from ship, fabricate and install each new rubber seal support channel with new welded retainer angle listed in 1.3.16 and 1.3.17 out of each new 5 Inch steel channel and 2 Inch by 2 Inch steel angle conforming to ASTM A-588, using Installation Procedures and Detail 11B-C of 2.5 for guidance.

3.10.3.1 Install each new fill and drain plug in new rubber seal support channel, using Detail 11A-C of 2.5 for guidance.

3.10.4 Template from ship, fabricate and install each new bolting header listed in 1.3.18 out of One inch thick high tensile steel plate conforming to MIL-S-22698 Grade DH-36.

3.10.5 Grind out and build up weld each pitted and deteriorated surface listed in 1.3.20.

3.10.5.1 Grind each built up area to smooth surface.

3.10.6 Template from ship, fabricate and install each new seal bar and inboard skin plate with bar listed in 1.3.21 out of each new 1/4 inch thick by 5 inch width CRES 316 flat bar, 1/2 inch thick high tensile steel plate and One inch square bar conforming to ABS Grade EH-36 and ASTM A-36.

3.10.7 Accomplish the requirements of 009-012 of 2.1, including Table 2, Columns A and D, Lines One through 7 for welding.

3.10.8 Accomplish the requirements of 009-025 of 2.1 for a local air hose test and air test of each new welded joint of watertight boundary. Allowable leakage: None.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

3.10.8.1 Accomplish the requirements of **009-025** of 2.1 for a completion air test of each lower stern gate. Test pressure must be 5 PSIG in accordance with 6-20.4 of 2.4 and 2.30. Hold test pressure for a minimum of ten (10) minutes. Allowable drop in pressure: None.

3.10.9 Template from each new bolting header fabricated in 3.10.4, fabricate each new bolted retainer angle listed in 1.3.19 out of 2 Inch by 2 Inch CRES angle conforming to ASTM A-276 CL 316.

3.11 Prior to installation of each new rubber seal listed in 1.3.15, accomplish the requirements of **009-032** of 2.1, including Table 2, One system out of Line One, 1A, 2, or 4 Columns A, B, C and G, or Line 3, Columns A, B and G for each area listed in 1.3.22.

3.11.1 Power tool clean each narrow area to SSPC-SP-11 where blast nozzle cannot reach.

3.11.1.1 Power tool clean each narrow area to SSPC-SP-3 where power tool in 3.11.1 cannot reach.

3.11.1.2 Hand tool clean each narrow area to SSPC-SP-2 where power tool in 3.11.1.1 cannot reach.

3.12 Template from ship, fabricate and install each new rubber seal listed in 1.3.15 with bolted gasket retainer angle, bonding adhesive (R-27710), K-MONEL fastener and Locktite 603, using 2.4, 2.5, 2.19 and 2.23 for guidance.

3.12.1 Chase and tap each exposed threaded area.

3.13 Install each upper and lower stern gate listed in 1.3.2 and 1.3.3, using 2.4 and 2.5 for guidance.

3.13.1 Install each hinge pin, upper gate lift pin, lower gate outboard hinge pin, lower link arm pin, and associated component listed in 1.3.4 through 1.3.7, and new pin keeper plate listed in 1.3.8 to install each upper and lower stern gate listed in 1.3.2 and 1.3.3, using 2.4 and 2.5 for guidance.

3.13.1.1 Install each new material listed in 5.1 Materials and new component in place of those identified to be missing or defective.

3.13.1.2 Measure and record each final size and clearance.

(V) "REPORT"

3.13.1.3 Submit one legible copy of condition report listing results of the requirement of 3.13.1.2 to SUPERVISOR.

3.13.1.4 Align and orient each pin to meet correct installation of each new pin keeper plate, using Figure FO-15, Detail K, N, P1, R1, and R2 of 2.4 for guidance.

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

3.13.1.5 Accomplish the requirements of 009-012 of 2.1 including Table 2, Column D, Lines One through 7 for welding of each new pin keeper plate.

3.13.1.6 Torque each fastener (Figure FO-15 Item 23 of 2.4) for each lower link arm assembly (Figure FO-15 Item 3 of 2.4) in accordance with Paragraph 8-14 Step d of 2.4.

(V) (G) "OPERATIONAL TEST"

3.14 Accomplish an operational test of each stern gate listed in 1.3.2 and 1.3.3 to verify correct operation, using 2.4 for guidance. -S130

3.14.1 Verify no binding, smooth, and constant movement of each stern gate and associated components.

(V) (G) "LIGHT AND WATER TEST"

3.15 Accomplish a light test and water test of each upper and lower stern gate listed in 1.3.2 and 1.3.3 in accordance with 6-20.1 through 6-20.1.2 of 2.4. -S130

3.16 Accomplish the requirements of 009-032 of 2.1 for cleaning and preservation of each new and disturbed surface to match surrounding areas.

4. NOTES:

4.1 Initial Condition - DURING NORMAL OPERATIONS IT WAS DISCOVERED THAT THE STERN GATE SILL WAS BENT DURING RECOVERY OPERATIONS LOSING WATER TIGHT INTEGRITY. RECOMMENDED OUTSIDE ACTIVITY REPAIR STERN GATE SILL TO FULL MISSION CAPABILITY. PE COMMENT EXCESSIVE DAMAGE TO SILL FRAME, RUBBER GASKET STILL IN PLACE. SILL IS WARPED INWARDS CAUSING UNCONTROLLABLE FLOODING OF THE WELL DECK IN EVEN CALM SEA STATES. WILL REQUIRE CUTTING, CROPPING, WELDING AND REPLACEMENT OF MATERIAL AT DAMAGED LOCATION OF THE SILL. THE JOB WILL REQUIRE GAS FREEING ON THE TANKS LOCATED UNDERNEATH THE WORK AREA PRIOR TO STARTING HOT WORK.

4.2 SRF Tool room will issue pressure gauges, dial indicators, torque wrenches, test weight, and dynamometer when required.

4.3 The following imperial unit plate sizes as substitutions for metric plate sizes may be used under ELM-215029, ELM-205233, ELM-205213, ELM-205065, ELM-235154, ELM-235177 and ELM-255175.

Metric Plate (millimeter)	Imperial Plate (inch)	Metric Plate (millimeter)	Imperial Plate (inch)
5	3/16	13	1/2
6	1/4	14	9/16
7	5/16	15	5/8
8	3/8	16	5/8
9	3/8	18	3/4
10	7/16	20	13/16

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

11	1/2	25	1.0
12	1/2	30	1 1/4

4.4 Design Branch authorized to replace each keeper plate for each hinge pin with CRES 316L plate and issued ELM (No.205174) as official response for ESR (No.LPD20-273/ICN-KEYOP:3820D58406-H01) on 6/19/2020.

4.5 Each Cofferdam will be installed and removed by ICN 38DXA58402_H01 for the ballast tank.

4.5.1 Each Cofferdam will be installed and removed by Diver at the same time.

4.6 Ship's Force will operate the stern gate when required.

5. GOVERNMENT FURNISHED MATERIAL (GFM) :

5.1 See attached MATERIAL LIST.

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
901			M	STEEL PLATE, HIGH TENSILE STEEL PLATE, 18MM THICK, 28.91#4 FT L X 4 FT W, ABS GRADE EH-36, MILL SHEET IS MANDATORY REQUIRED	9Z 9515 SADH0MM18	N	6029D801	1/PM	3.11
902			M	STEEL PLATE, HIGH TENSILE STEEL PLATE, 0.500 IN THICK, 4 FT L X 4 FT W, ABS GRADE EH-36, MILL SHEET IS MANDATORY REQUIRED	9Z 9515 SAAH00500	N	6029D802	1/PM	3.11
903			M	SQUARE BAR, 1 INCH SIZE, ASTM A36/A36M	9Z 9515 SA2201957	N	6029D803	10/FT	3.11
904			M	STERN GATE SEAL, STERN GATE SEAL, STERN GATE SEAL FOR LPD-18/20, STERN GATE SEAL SOLID RUBBER, 35-40 DUROMETER, NEOPRANE, 5 INCH WIDE X 2 INCH HEIGHT X 3/4 INCH THK, LENGTH; 20 FT CONTINUOUS LENGTH PER EACH, ASTM D2000 M2BC310 A14C2F17, P/N SDS-500SG-SOLID	9B 5330 SA2201234	N	6033D979	80/FT	3.11
905			M	CHANNEL, STRUCTURAL, CHANNEL, STRUCTURAL, "C" SHAPE, C5 X 9, STEEL, ASTM A588, DEPTH= 5 IN, FLANGE WIDTH= 1.885 IN, WEB THICKNESS= .313 IN. 20 FT CONTINUOUS LENGTH PER EACH	9B 9540 SA2600026	N	6029D804	20/FT	3.11

12/29

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
906			M	ANGLE, STRUCTURAL, ANGLE, STRUCTURAL, CRES 316, ASTM A276, REQUIRED SIZE: 2 IN X 2 IN X 3/16 IN THK, CONTINUOUS LENGTH 20FT PER EACH.	9B 9520 SA2600027	N	6029D805	4/EA	3.11
907			M	ANGLE, STRUCTURAL, ANGLE, STRUCTURAL, STEEL, ASTM A588, HSLA, REQUIRED SIZE: 2 IN X 2 IN X 3/16 IN THK, CONTINUOUS LENGTH 20FT PER EACH.	9B 9520 SA2600028	N	6029D806	4/EA	3.11
908			M	WASHER, LOCK, 5/16 IN, CRES 316, MS35338-140.	9B 5310 009746623 SX	N	6028D500	1/HD	3.13
909			M	BOLT, MACHINE, HEX, HD, K-400, K-MONEL, GRADE-400, SIZE: 5/16"-18UNC-2A, 3/4 IN (0.75") LENGTH, MIL-DTL-1222	9B 5305 SA2600042	N	6030D840	100/EA	3.13
910			M	PLATE, METAL, 1 INCH THK, MIL-S-22698, GR-DH36, FOR BOLTING HEADER	9B 9515 002778518	N	6028D501	1/PM	3.11
911			M	ADHESIVE, RUBBER NEOPRENE, 1 QT/CN, R27710, TYPE 1.	9B 8040 000582399	Y	6028D751	10/QT	3.13
912			M	PLUG, PIPE, 1-1/2, MS14314-8Z	9B 4730 002786305	N	6028D502	10/EA	3.11
913			M	PLUG, PIPE, BRONZE, 1/2, MS14314-4Z	9B 4730 011328753	N	6028D503	10/EA	3.11
914			M	CORROSION PREVENTIV, COMPOUND, 55GAL/CN, MIL-PRF-16173E, CL1 GR3	9B 8030 002441294	Y	6028D752	2/DR	3.11
915			M	ELECTROD, ELECTRODE WELDING, 3/32 IN DIA X 14 IN L, 7018-M, P/N 255014102, MIL-E-22200/10, U/I: 1CN=10LB NOTE: CERTIFICATION IS NOT REQUIRED.	9G 3439 SA4742861	N	NOFUND01	4/CN	3.11
916			M	ELECTROD, ELECTRODE WELDING, 1/8 IN DIA X 14 IN L, 7018-M, P/N 255014110, MIL-E-22200/10, U/I: 1CN=10LB NOTE: CERTIFICATION IS NOT REQUIRED.	9G 3439 SA4742863	N		10/CN	3.11
917			C	ADHESIVE, A-A-3097, EASTMAN 910, 10EA/BX, 1 OZ/BOTTLE, TYPE 2M CLASS 2, CLEAR.	9B 8040 001429193	Y	6028D753	5/BX	-
918			M	BOLT, MAC, 5/8-11UNC-2A, 1-1/4"L, CRES316, NASM16208, P/N: MS16208-137	9B 5306 000873762	N	6029D500	130/EA	3.2
919			M	SCREW, CA, 5/8-11UNC-1-1/2"L, CRES316, NASM35307, P/N: MS35307-462	9B 5305 007215322	N		130/EA	3.2
920			M	WASHER, F, 0.656"ID X 1.312"OD X 0.095"THK, CRES316, NASM15795, P/N: MS15795-820	9B 5310 006143505 SY	N		130/EA	3.2

13/29

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
921			M	COTTON G, SIZE: 5/8 NOMINAL SIZE, 50/1 COTTON ROVING YARN, 100% COTTON, HAND-WOVEN, 25EA/BG	9B 5325 SACOT5850	N		6/BG	3.2
922			M	NUT, PLAI, 3/4-10UNC-2B, CRES316, ASTM F594	9B 5310 015401448	N		26/EA	3.2
923			M	WASHER, F, 0.812"ID X 1.469"OD X 0.134"THK, CRES316, NASM15795, P/N: MS15795-822	9B 5310 013844230	N		26/EA	3.2
924			M	COTTON G, SIZE: 3/4 NOMINAL SIZE, 20/3 COTTON ROVING YARN, 100% COTTON, HAND-WOVEN, 25EA/BG	9B 5325 SACOT3420	N		2/BG	3.2
925			M	RUBBER S, 3/16"THK X 36"W X 36"L, 65 DUROMETER HARDNESS, NON-OIL RESISTANT, MIL-PRF-1149 TYPE II CLASS 2	9B 5330 SA2100947	N		6/SH	3.2
926			C	CORK AND, 3/16"THK X 36"W X 36"L, SAE-AMS-C-6183 TYPE II CLASS 1 GRADE C	9B 5330 002971073	N		4/SH	-
927			C	BAR, META, 3/4"DIA, CRES316, FOR MFR OF STUD BOLT, AMS-QQ-S-763	9B 9510 001890622	N		10/FT	-
928			M	STEEL PLATE, HIGH TENSILE STEEL PLATE, 0.500 IN THICK, 4 FT L X 4 FT W, ABS GRADE EH-36, MILL SHEET IS MANDATORY REQUIRED	9Z 9515	N		1/PM	3.4
929			M	STEEL PLATE, HIGH TENSILE STEEL PLATE, 1 INCH THICK, 40.8#4 FT L X 4 FT W, ABS GRADE EH-36, MILL SHEET IS MANDATORY REQUIRED	9Z 9515	N		1/PM	3.4
951			M	COTTER PIN, COTTER PIN NASM24665-740 5/16 INCH DIA-5.0 INCH LONG MONEL	9B 5315 SA2200069	N	6013D813	50/EA	3.9
952			M	CRES PLATE, CRES PLATE USSBAR316L0566 6.0X6.0X0.5 INCH THICKNESS CRES 316L	9B 9515 SA2501013	N	6013D810	6/EA	3.8
953			C	STEEL PLATE, STEEL PLATE MIL-S-22698C-EH-36 12 INCH X 12 INCH X 0.375 INCH THICKNESS STEEL	9B 9515 SAEH00375	N	6013D811	1/EA	-

14/29

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

MATERIAL LIST									
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	HAZ MAT	DOC NO.	QTY REQD/ UNIT	PARA NO.
954			C	ROUND BAR, ROUND BAR QQ-N-286 K-MONEL 6.25 INCH DIAMETER - 8.0 FEET CONTINUOUS LENGTH ADV CODE "2N"	9B 9530 SA2600095	N	6013D800	2/EA	-
955			M	LOCK WASHER, LOCK WASHER 91118A128 SIZE-1/2 MATERIAL-K-500	9B 5310 SA2600093	N	6014D801	4/EA	3.9
956			C	SCREW, HEX HEAD CAPSCREW MIL-DTL-1222 TYPE-1 SIZE 1/2-13UNC-2A-1-1/2 LENGTH FASTENER LENGTH 1-1/2 THREAD LENGTH 1-1/2 QQ-N-286	9B 5306 SA2600094	N	6013D812	4/EA	-
957			C	BUSHING, SLEEVE, BUSHING 99C621-15-DWG-00-A-0	9B 3120 015104145	N	6012D500	26/EA	-
958			C	BUSHING, SLEEVE, BUSHING 99C621-20-DWG-00-A-0	9B 3120 015104175	N	6012D501	2/EA	-
959			C	BUSHING, BUSHING 99C621-15-DWG-00-A-0 MFR DRAWING HI-721-1500- ITEM NO.13	9B 3120 SA2505150	N	6055D800	26/EA	-
960			C	BUSHING, BUSHING 99C621-20-DWG-00-A-0 MFR DRAWING HI-721-1500- ITEM NO.26	9B 3120 SA2505151	N	6055D801	2/EA	-

15/29

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN:	Rev:	Key Op:
LPD-22	USS SAN DIEGO		38DXA58402		A01

TITLE:

Lower Stern Gate and Transom; repair

General Requirements
For Tank, Void and/or Cofferdam Cleaning

Ver.05012021

1. REQUIREMENTS:

1.1 Open, ventilate, conduct gas free, empty, clean, render dry, and maintain each tank, void and/or cofferdam throughout the work item performance period.

1.1.1 Ensure that each harmful vapor, fume, and mist is ventilated to the exterior of the vessel.

(V) "REPORT"

1.1.1.1 Submit one legible copy of a report listing the location, origin, and quantity of each manhole cover removed in 1.1 with respect to its tank, ship's frame and distance off centerline to SUPERVISOR after the inspection.

1.1.2 Remove and dispose of waste liquid that is not being stored for reuse to a Government provided waste liquid conveyance.

1.1.2.1 Contact the SRF-JRMC Detachment Sasebo ESH Division, Environmental Branch, S106.3 prior to transfer of waste liquid to the conveyance.

1.1.2.2 Provide watches and following spill kits (absorbent pads, booms, etc. for oil or chemical spill containment) at each affected area where waste liquid is being transferred to ensure that each liquid is not released to any shipboard compartment or the sea. In case of a spill, take immediate action to contain the spill, and contact S106.3.

1.1.2.3 Identify each transfer hose to the conveyance by affixing the company's name and tank/space location pumping from on each hose.

1.1.2.4 Establish and maintain communication between the pumping station and the conveyance when the waste liquid is being transferred.

(V) "INSPECT PIPING AND HOSE ALIGNMENT"

1.1.2.5 Inspect alignment of each hose, valve and piping in the flow path prior to the start of pumping, purging, or flushing.

1.1.2.6 Accomplish a periodic walkthrough of each piping, hose, and valve alignment for leaks at least once an hour.

1.1.2.7 Pumping after sunset is not authorized unless approved by SUPERVISOR.

ENCLOSURE (T) 1/2

16/129

Ship/HULL NO.	Ship/HULL NAME	JON:	ICN: 38DXA58402	Rev:	Key Op: A01
LPD-22	USS SAN DIEGO				

TITLE:

Lower Stern Gate and Transom; repair

1.1.3 Coordinate the off-loading or transferring of each fluid through the ship's Damage Control Assistant (DCA), via SHIPSUPT, to maintain ship's stability and to prevent flooding.

(V) (G) "VISUAL INSPECTION"

1.2 Inspect each tank, void and/or cofferdam for cleanliness, prior to final closing. Document the personnel who were present during the inspection and confirm that they have exited the space prior to closure of each tank, void, and cofferdam. Designate one person to account for personnel who may have entered the space. -S130

1.2.1 Install each manhole cover for each tank, using each new gasket and fastener.

2. NOTES:

2.1 Booklet of General Plans and Tank Sounding Tables are available for review at the office of the SUPERVISOR.

2.2 The SUPERVISOR will provide a waste liquid conveyance to accumulate waste liquids in each tank for work being accomplished for SRF-JRMC availabilities.

2.3 See additional CHT/sewage tanks disinfection requirements of Local Standard Item 099-901YO for SRF-JRMC Sasebo availabilities.

ENCLOSURE (T) 2/2

17/
29

CUI

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN:	Rev:	Key Op:	Page 1 of 6
T.P FILE NO.: 58421-2-100_26076		38DXA58402	00	A01	

SHIP REPAIR FACILITY – JAPAN REGIONAL MAINTENANCE CENTER DET SASEBO
TEST PROCEDURE



TITLE: LOWER STERN GATE TEMPORARY LIFTING PADEYE - LOAD TEST	JCN:
	DB01-1294
	CWP:
	N/A

TEST PROCEDURE PREPARATION

PRINT NAME & SIGNATURE		PHONE	CODE	DATE
PREPARED BY D. KUBO	KUBO.DAI.159499 3841 Digitally signed by KUBO.DAI.1594993841 Date: 2026.02.25 13:44:51 +09'00'	252-8052	S246E	25-Feb-2026
REVIEWED BY S. IIDA	IIDA.SHUNICHI.1 274619127 Digitally signed by IIDA.SHUNICHI.1274619127 Date: 2026.02.25 14:00:22 +09'00'	252-8045	S246A	25-Feb-2026
APPROVED FOR ISSUE B. YOSHIKAWA	YOSHIKAWA.BRI AN.T.1282691449 Digitally signed by YOSHIKAWA.BRIAN.T.1282691449 Date: 2026.02.27 15:40:32 +09'00'	252-8050	S246CTE	27-Feb-2026

PROCEDURE COMPLETED

PRINT NAME & SIGNATURE	ORGANIZATION	BADGE/RANK	DATE
LWC			
S246	SRF-JRMC DET. SASEBO		

CERTIFICATION REVIEW AND APPROVAL OF TEST RESULTS

PRINT NAME & SIGNATURE		PHONE	CODE	DATE
REVIEWER (Test Certified Complete and Test Results Satisfactory) S. IIDA		252-8045	S246A	
TEST CODE (Test Results Reviewed and Approved)			S246CTE	

COMMENTS:

CUI

18/29

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN:	Rev:	Key Op:	
T.P FILE NO.: 58421-2-100_26076		38DXA58402	00	A01	Page 2 of 6

TEST PROCEDURE GENERAL NOTES

1. **TEST SEQUENCE:** Unless otherwise specified in the test document, this test procedure (TP) shall be completed in provided order.
2. **VERIFICATION:** The person designated to sign for an action verifies, based on personal observation, objective evidence, or watch stander reports and certifies by signature that the action has been performed in accordance with the specified requirements.
3. **USE ORIGINAL DOCUMENTS:** All data attached to the Master TP shall have original pen and ink entries on the data sheets (unless otherwise specified in the test procedure).
4. **USE DARK INK:** All signature and data shall be in dark, water insoluble ink.
5. **CORRECTIONS:** When an error was made, it shall be corrected by drawing a single line through the error, recording the correct entry, initialing, dating and printing the name of the person making the correction in accordance with JOINT FLEET MAINTENANCE MANUAL (JFMM), COMUSFLTFORCOMINST 4790.3, VOLUME V, QUALITY MAINTENANCE.
6. **LATEST APPLICABLE REVISION:** Use the latest applicable revision of plans, instructions, technical manuals, and other reference material cited in this test procedure.
7. **INSTRUMENT CALIBRATION:** All measuring equipment shall be in current calibration as required by NAVSHIPREPFACINST 4734.1.
8. **OPERATION OF COMPONENTS:** Only authorized personnel shall operate ship's permanently installed equipment. The cognizant Shop shall control and operate their temporary test equipment. Ship's Force shall operate temporary systems and equipment formally turned over to the ship.
9. **SAFETY INSTRUCTION:** The Test Director is responsible for the safe conduct of this test. The safety precautions of NAVSHIPREPFAC M-5100.8 shall be observed at all times.
10. **TEST STOPPAGE:** The Test Director shall stop the test once a problem has been found in the system or equipment being tested. S246 Testing Standard Operating Procedure (SOP) shall be used to determine course of action prior to resuming the test procedure.
11. **ENERGIZED EQUIPMENT:** NSTM 300, para 300-2.4 shall be followed when working on energized equipment.
12. **DATA COLLECTION:** The test documents may require collection of additional data for which there is no acceptance criteria, provided the data sheet identifies that data is for information only.
13. **SUPPLEMENTATION:** When supplementation is made, annotate the supplemental information on the page with 'See Remarks' followed by a sequential numbering system corresponding in the Remarks section.
14. **USE ASTERISK (*):** When supplementation, correction and/or signature is made but there is not enough space, annotate using an asterisk (*) followed by sequential number adjacent to the portion then clarify on the same page using the same annotation.

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 3 of 6
T.P FILE NO.: 58421-2-100_26076					

LOWER STERN GATE TEMPORARY LIFTING PADEYE - LOAD TEST

1. PURPOSE

- 1-1 The purpose of this test is to certify the temporary lifting padeyes (8 EA) installed on the lower stern gate. See [Table 1-1](#) and [Figure 1-1](#) for the location and the identification numbers of the padeyes.

Table 1-1: Item to be tested

Item	ID	Safe Working Load
LOWER STERN GATE TEMP. LIFTING PADEYE	P-1, P-2, P-3, P-4, P-5, P-6, P-7, and P-8	70,000 LBS

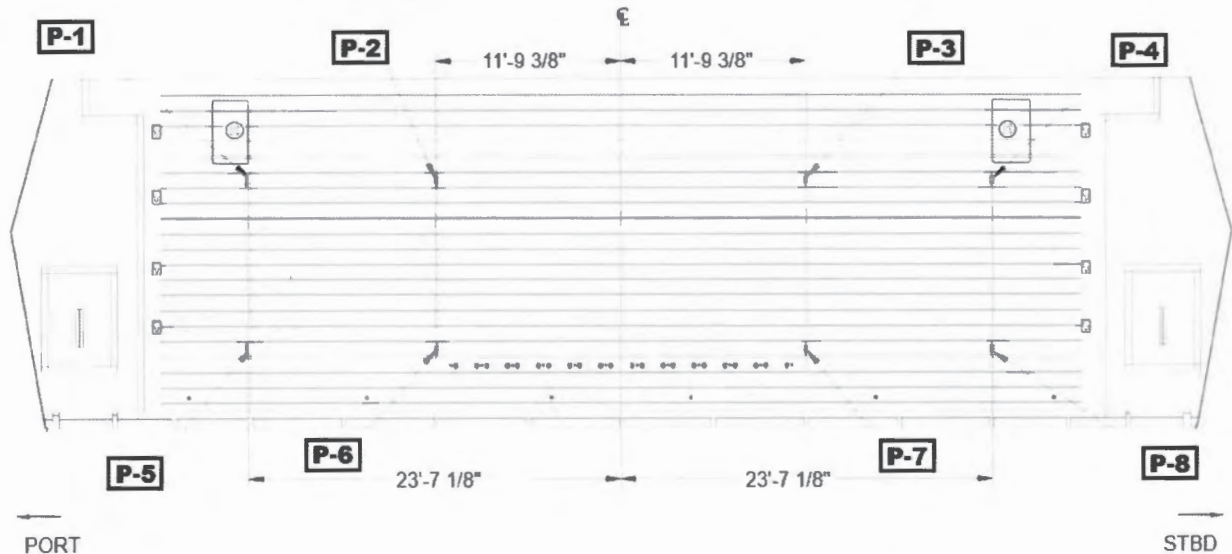


Figure 1-1: Location & Padeye ID (Lower Stern Gate)

2. REFERENCES

- 2-1 NAVSEA TECHNICAL MANUAL
- 2-1.1 S9584-A3-MMC-010; STERN GATE, MODEL 721, AND OPERATING EQUIPMENT SYSTEM
- 2-2 NAVSEA DRAWING
- 2-2.1 803-5184133; PADEYE, MACHINERY LIFTING
- 2-3 GSO-GENERAL SPECIFICATIONS FOR OVERHAUL OF SURFACE SHIPS; S9AA0-AB-GOS-010
- 2-3.1 SEC 092; SHIPBOARD TESTS
- 2-3.2 SEC 611; HULL FITTINGS
- 2-4 JFMM-JOINT FLEET MAINTENANCE MANUAL
- 2-5 NAVSHIPREPFAC M-5100.8; SAFETY AND HEALTH PROGRAM MANUAL

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 4 of 6
T.P FILE NO.: 58421-2-100_26076					

3. TEST AND SUPPORT EQUIPMENT/MATERIAL

- 3-1 Necessary Rigging Gear
- 3-2 Load applying device (e.g. Hydraulic jack etc.)
- 3-3 Load Indicating Device (e.g. Dynamometer)
- 3-4 Stopwatch
- 3-5 Warning signs, ropes and/or barricades to ensure area affected by load testing is secured

4. GENERAL PRECAUTIONS

- 4-1 Only those personnel actively engaged in performing or witnessing this test shall be permitted in the testing area. All specified safety regulations shall be strictly observed.
- 4-2 To prevent injury or death, ensure that proper test equipment is used during testing.
- 4-3 Safeguarding of personnel and equipment shall be adhered to at all times.

5. SHIPBOARD TEST

- 5-1 STATIC LOAD TEST Conduct static load test as follows and record data & result in TEST DATA SHEET.
 - 5-1.1 PRETEST BRIEFING Conduct a pre-test briefing (e.g., safety precaution, station assignments, testing steps) with all involved test personnel.
 - 5-1.2 TMDE Record all Test, Measuring & Diagnostic Equipment (TMDE) type, range, serial number and calibration due date. TMDE shall be calibrated and has not expired.
 - 5-1.3 LOAD TEST
 - (1) Inspect the condition of the padeye and its supporting structure.
Acceptance criteria: There shall be no deformation or cracks.
 - (2) Static test load of 140,000 – 147,000 pounds shall be applied plumb to the padeye and held for 10 minutes.
 - (3) After 10 minutes, slowly release the test load and inspect the tested padeye and its supporting structure.
Acceptance criteria: There shall be no deformation or cracks due to having had the load applied.
 - (4) Repeat steps (1) through (3) for remaining padeyes, as necessary.
 - 5-1.4 LWC and S246 shall sign the TEST DATA SHEET upon completion of the load test.

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 5 of 6
T.P FILE NO.: 58421-2-100_26076					

6. MARKING

- 6-1 **PADEYE MARKING** After satisfactory test, stamp the padeye in the area indicated on the [Figure 6-1](#) with the date of test on one side and the safe working load of the padeye on the other. Record the date of marking in the TEST DATA SHEET.

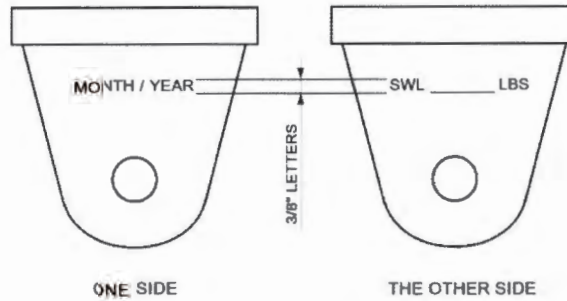


Figure 6-1: Marking (TYP)

7. REMARKS

CUI

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 6 of 6
T.P FILE NO.: 58421-2-100_26076					

TEST DATA SHEET

5-1.2 TEST, MEASURING & DIAGNOSTIC EQUIPMENT (TMDE)				
EQUIPMENT TYPE	/	RANGE	/	SERIAL NO. / CAL. DUE DATE
5-1.3 LOAD TEST				
PADEYE ID	PRE-TEST INSPECTION	TEST LOAD	TEST DURATION	POST-TEST INSPECTION
P1	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P2	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P3	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P4	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P5	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P6	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P7	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P8	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
5-1.4 COMPLETION OF THE TEST				
RESPONSIBILITY	PRINT NAME / SIGNATURE / DATE			
LWC				
S246				
6-1 MARKING				
DESCRIPTION	DATE OF INSTALLATION			
Padeyes were properly marked.				

CUI

23/12/19

CUI

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 1 of 6
T.P FILE NO.: 58421-2-100_26076A					

SHIP REPAIR FACILITY – JAPAN REGIONAL MAINTENANCE CENTER DET SASEBO
TEST PROCEDURE



TITLE:				JCN: DB01-1294	
UPPER STERN GATE TEMPORARY LIFTING PADEYE - LOAD TEST				CWP: N/A	
TEST PROCEDURE PREPARATION					
PRINT NAME & SIGNATURE			PHONE	CODE	DATE
PREPARED BY D. KUBO	KUBO.DAI.159499 3841	Digitally signed by KUBO.DAI.1594993841 Date: 2026.02.25 13:45:07 +09'00'	252-8052	S246E	25-Feb-2026
REVIEWED BY S. IIDA	IIDA.SHUNICHI.1 274619127	Digitally signed by IIDA.SHUNICHI.1274619127 Date: 2026.02.25 14:02:06 +09'00'	252-8045	S246A	25-Feb-2026
APPROVED FOR ISSUE B.YOSHIKAWA	YOSHIKAWA.BRI AN.T.1282691449	Digitally signed by YOSHIKAWA.BRIAN.T.1282691449 Date: 2026.02.27 15:45:37 +09'00'	252-8050	S246CTE	27-Feb-2026
PROCEDURE COMPLETED					
PRINT NAME & SIGNATURE			ORGANIZATION	BADGE/RANK	DATE
LWC					
S246			SRF-JRMC DET. SASEBO		
CERTIFICATION REVIEW AND APPROVAL OF TEST RESULTS					
PRINT NAME & SIGNATURE			PHONE	CODE	DATE
REVIEWER (Test Certified Complete and Test Results Satisfactory) S. IIDA			252-8045	S246A	
TEST CODE (Test Results Reviewed and Approved)				S246CTE	
COMMENTS:					

CUI

24/
29

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 2 of 6
T.P FILE NO.: 58421-2-100_26076A					

TEST PROCEDURE GENERAL NOTES

1. **TEST SEQUENCE:** Unless otherwise specified in the test document, this test procedure (TP) shall be completed in provided order.
2. **VERIFICATION:** The person designated to sign for an action verifies, based on personal observation, objective evidence, or watch stander reports and certifies by signature that the action has been performed in accordance with the specified requirements.
3. **USE ORIGINAL DOCUMENTS:** All data attached to the Master TP shall have original pen and ink entries on the data sheets (unless otherwise specified in the test procedure).
4. **USE DARK INK:** All signature and data shall be in dark, water insoluble ink.
5. **CORRECTIONS:** When an error was made, it shall be corrected by drawing a single line through the error, recording the correct entry, initialing, dating and printing the name of the person making the correction in accordance with JOINT FLEET MAINTENANCE MANUAL (JFMM), COMUSFLTFORCOMINST 4790.3, VOLUME V, QUALITY MAINTENANCE.
6. **LATEST APPLICABLE REVISION:** Use the latest applicable revision of plans, instructions, technical manuals, and other reference material cited in this test procedure.
7. **INSTRUMENT CALIBRATION:** All measuring equipment shall be in current calibration as required by NAVSHIPREPFACINST 4734.1.
8. **OPERATION OF COMPONENTS:** Only authorized personnel shall operate ship's permanently installed equipment. The cognizant Shop shall control and operate their temporary test equipment. Ship's Force shall operate temporary systems and equipment formally turned over to the ship.
9. **SAFETY INSTRUCTION:** The Test Director is responsible for the safe conduct of this test. The safety precautions of NAVSHIPREPFAC M-5100.8 shall be observed at all times.
10. **TEST STOPPAGE:** The Test Director shall stop the test once a problem has been found in the system or equipment being tested. S246 Testing Standard Operating Procedure (SOP) shall be used to determine course of action prior to resuming the test procedure.
11. **ENERGIZED EQUIPMENT:** NSTM 300, para 300-2.4 shall be followed when working on energized equipment.
12. **DATA COLLECTION:** The test documents may require collection of additional data for which there is no acceptance criteria, provided the data sheet identifies that data is for information only.
13. **SUPPLEMENTATION:** When supplementation is made, annotate the supplemental information on the page with 'See Remarks' followed by a sequential numbering system corresponding in the Remarks section.
14. **USE ASTERISK (*):** When supplementation, correction and/or signature is made but there is not enough space, annotate using an asterisk (*) followed by sequential number adjacent to the portion then clarify on the same page using the same annotation.

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 3 of 6
T.P FILE NO.: 58421-2-100_26076A					

UPPER STERN GATE TEMPORARY LIFTING PADEYE - LOAD TEST

1. PURPOSE

- 1-1 The purpose of this test is to certify the temporary lifting padeyes (8 EA) installed on the upper stern gate. See [Table 1-1](#) and [Figure 1-1](#) for the location and the identification numbers of the padeyes.

Table 1-1: Item to be tested

Item	ID	Safe Working Load
UPPER STERN GATE TEMP. LIFTING PADEYE	P-1, P-2, P-3, P-4, P-5, P-6, P-7, and P-8	24,000 LBS

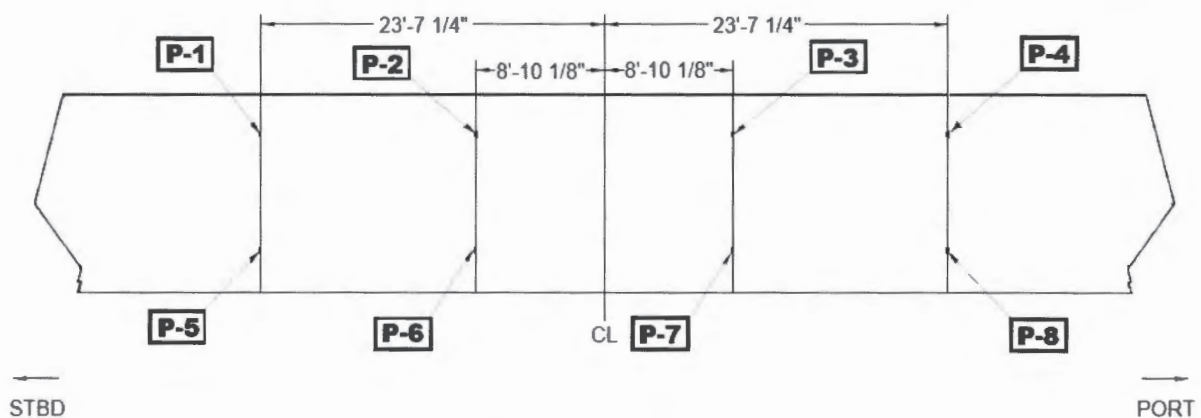


Figure 1-1: Location & Padeye ID (Upper Stern Gate)

2. REFERENCES

- 2-1 NAVSEA TECHNICAL MANUAL
- 2-1.1 S9584-A3-MMC-010; STERN GATE, MODEL 721, AND OPERATING EQUIPMENT SYSTEM
- 2-2 NAVSEA DRAWING
- 2-2.1 803-5184133; PADEYE, MACHINERY LIFTING
- 2-3 GSO-GENERAL SPECIFICATIONS FOR OVERHAUL OF SURFACE SHIPS; S9AA0-AB-GOS-010
- 2-3.1 SEC 092; SHIPBOARD TESTS
- 2-3.2 SEC 611; HULL FITTINGS
- 2-4 JFMM-JOINT FLEET MAINTENANCE MANUAL
- 2-5 NAVSHIPPREPAC M-5100.8; SAFETY AND HEALTH PROGRAM MANUAL

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 4 of 6
T.P FILE NO.: 58421-2-100_26076A					

3. TEST AND SUPPORT EQUIPMENT/MATERIAL

- 3-1 Necessary Rigging Gear
- 3-2 Load applying device (e.g. Hydraulic jack etc.)
- 3-3 Load Indicating Device (e.g. Dynamometer)
- 3-4 Stopwatch
- 3-5 Warning signs, ropes and/or barricades to ensure area affected by load testing is secured

4. GENERAL PRECAUTIONS

- 4-1 Only those personnel actively engaged in performing or witnessing this test shall be permitted in the testing area. All specified safety regulations shall be strictly observed.
- 4-2 To prevent injury or death, ensure that proper test equipment is used during testing.
- 4-3 Safeguarding of personnel and equipment shall be adhered to at all times.

5. SHIPBOARD TEST

- 5-1 STATIC LOAD TEST Conduct static load test as follows and record data & result in TEST DATA SHEET.
 - 5-1.1 PRETEST BRIEFING Conduct a pre-test briefing (e.g., safety precaution, station assignments, testing steps) with all involved test personnel.
 - 5-1.2 TMDE Record all Test, Measuring & Diagnostic Equipment (TMDE) type, range, serial number and calibration due date. TMDE shall be calibrated and has not expired.
 - 5-1.3 LOAD TEST
 - (1) Inspect the condition of the padeye and its supporting structure.
Acceptance criteria: There shall be no deformation or cracks.
 - (2) Static test load of 48,000 – 50,400 pounds shall be applied plumb to the padeye and held for 10 minutes.
 - (3) After 10 minutes, slowly release the test load and inspect the tested padeye and its supporting structure.
Acceptance criteria: There shall be no deformation or cracks due to having had the load applied.
 - (4) Repeat steps (1) through (3) for remaining padeyes, as necessary.
 - 5-1.4 LWC and S246 shall sign the TEST DATA SHEET upon completion of the load test.

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 5 of 6
T.P FILE NO.: 58421-2-100_26076A					

6. MARKING

- 6-1 **PADEYE MARKING** After satisfactory test, stamp the padeye in the area indicated on the **Figure 6-1** with the date of test on one side and the safe working load of the padeye on the other. Record the date of marking in the TEST DATA SHEET.

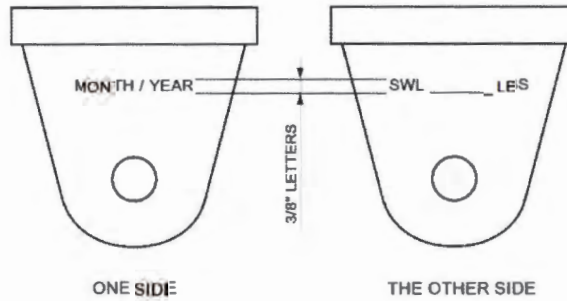


Figure 6-1: Marking (TYP)

7. REMARKS

CUI

SHIP/HULL NO.: USS SAN DIEGO / LPD-22	JON:	ICN: 38DXA58402	Rev: 00	Key Op: A01	Page 6 of 6
T.P FILE NO.: 58421-2-100_26076A					

TEST DATA SHEET

5-1.2 TEST, MEASURING & DIAGNOSTIC EQUIPMENT (TMDE)				
EQUIPMENT TYPE / RANGE / SERIAL NO. / CAL. DUE DATE				
5-1.3 LOAD TEST				
PADEYE ID	PRE-TEST INSPECTION	TEST LOAD	TEST DURATION	POST-TEST INSPECTION
P1	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P2	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P3	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P4	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P5	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P6	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P7	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
P8	☐ SAT / ☐ UNSAT	pounds	minutes	☐ SAT / ☐ UNSAT
5-1.4 COMPLETION OF THE TEST				
RESPONSIBILITY	PRINT NAME / SIGNATURE / DATE			
LWC				
S246				
6-1 MARKING				
DESCRIPTION			DATE OF INSTALLATION	
Padeye were properly marked.				

CUI

29/29