

WebAIM Short Form TASK GROUP INSTRUCTION

14-JAN-2026 1127

20.15.6.0.9333 (July 2025)

ICN: 38KB325102 KeyOp: A01

TGI NO:	COMPONENT NAME: LOUVERS	TYPE: AY	PHASE: A	REPEAT: 0	CHG/VER: 0/0
SHIP/HULL NO: DDG-76	SHIP/HULL NAME: USS HIGGINS	PROJECT: KB3	SYSTEM:	PLANT ID:	CASREP CAT:
CU PHASE TITLE: F/O - REPAIR INTAKE AND UPTAKE LOUVERS					
PREPARING ACTIVITY:		STATUS: APP		WORKING STATUS:	
PREPARED BY: YAJIMA, RYO		CODE: 231A	PHONE: 3152432791	DATE: 18-DEC-2025	
APPROVED BY: NAKAMURA, YUUJI		CODE: 231A	PHONE: 3152436041	DATE: 20-DEC-2025	
CONCURRED BY:		CODE:	PHONE:	DATE:	
REASON FOR WORK/NEED FOR CHANGE: EM02L030					
JCN: EM02-L030					
SPECIAL REQUIREMENTS: TGI Short Form					
CU PHASE DESCRIPTION: 1. SCOPE/PURPOSE: 1.1 Title: Intake and Uptake Louver; repair 1.2 Location of Work: 1.2.1 Intake Engine Room No. 2 (02-275-0-Q) 1.2.2 Uptake Engine Room No. 2 (02-242-0-Q) 1.2.3 Ship Service Gas Turbine Generator Intake (01-260-1-Q) 1.2.4 02 Level Weather, Frames between 275 and 280, Starboard (Stbd) 1.2.5 03 Level Weather, Frames between 246 and 268, Port and Stbd 1.2.6 Intake Trunk (A) Engine Room No. 2 (1-289-2-Q)					
ZONE MANAGER: YAGINUMA, TAKEHIDE		ZONE:	COMPARTMENT:	LEVEL:	FRAME: SIDE:
JOB SUMMARY ID: 251A3302	TOT MAN HR.:	TOT DUR:	TOT JML COST:	PLANNING ACCEPTANCE:	

WORK CERTIFICATION SIGNATURES:	DLs												
COMPLETION OF WORK REVIEW:			BADGE NO:		SHOP/CODE:		PHONE:		DATE:				
RECORDS REVIEW:			BADGE NO:		SHOP/CODE:		PHONE:		DATE:				



WebAIM Short Form TASK GROUP INSTRUCTION

14-JAN-2026 1127

20.15.6.0.9333 (July 2025)

(Continued)

ICN: 38KB325102

KeyOp: A01

TGI NO:	COMPONENT NAME: LOUVERS	TYPE: AY	PHASE: A	REPEAT: 0	CHG/VER: 0/0
SHIP/HULL NO: DDG-76	SHIP/HULL NAME: USS HIGGINS	PROJECT: KB3	SYSTEM:	PLANT ID:	CASREP CAT:
CU PHASE TITLE: F/O - REPAIR INTAKE AND UPTAKE LOUVERS					

CU PHASE DESCRIPTION (Cont.)

1.2.7 Intake Engine Room No. 2 (01-276-0-Q)

1.3 Identification:

1.3.1 Quantity (One Lot), Foreign Object Damage (FOD) Screen Frame of Louver in 02-275-0-Q

Base Material:

FOD Screen Frame; CRES 316, 1-1/2 Inch x 1-1/2 Inch x 3/16 Inch Thickness Angle

FOD screen; CRES 316, 0.120 Diameter Rod

Remarks: See Ref. No. 4 for base material and PIC-2B-S-3 of Sketch Enclosure-01 for location detail

1.3.2 Quantity (One Lot), Louver in 02-242-0-Q, Port

Base Material: HTS, MIL-S-22698, GR DH-36, 15.3 LBs Plate

Remarks: See Ref. No. 4 for base material and PIC-UP-PI-1 of Sketch Enclosure-01 for location detail

1.3.3 Quantity (One Lot), Louver in 02-242-0-Q, Port

Base Material: Steel, ASTM A-588, 3 Inches x 3/8 Inch Thickness Flatbar

Remarks: See Ref. No. 4 for base material and PIC-UP-PI-8, PIC-UP-PI-9, PIC-UP-PI-24, and PIC-UP-PI-25 of Sketch Enclosure-01 for location detail

1.3.4 Quantity (One Lot), Louver in 02-242-0-Q, Stbd

Base Material: Steel, ASTM A-588, 3 Inches x 3/8 Inch Thickness Flatbar

Remarks: See Ref. No. 4 for base material and PIC-UP-SI-6, PIC-UP-SI-7, PIC-UP-SI-12, and PIC-UP-SI-21 of Sketch Enclosure-01 for location detail

1.3.5 Quantity (One Lot), Bonding Strap on Louver in 01-260-1-Q, Stbd

Remarks: See Ref. No. 5 and PIC-G21-20 of Sketch Enclosure-01 for location and detail

1.4 Security Classification: None.

1.5 Initial Condition: None.

1.6 Contractor work start date: 29/JUN/2026

1.7 Contractor work completion date: 8/DEC/2026

2. PROCEDURE:

2.1 Accomplish the requirements of Ref. No. 3.

(V)(G) "GAS TURBINE MAINTENANCE PROCEDURE"

2.2 Accomplish weld repair of deficient weld on screen frame, corrosion hole and mechanical damage on each existing louver listed in 1.3.1 through 1.3.4, using Ref. No. 4 for guidance.

WebAIM Short Form TASK GROUP INSTRUCTION

14-JAN-2026 1127

20.15.6.0.9333 (July 2025)

(Continued)

ICN: 38KB325102

KeyOp: A01

TGI NO:	COMPONENT NAME: LOUVERS	TYPE: AY	PHASE: A	REPEAT: 0	CHG/VER: 0/0
SHIP/HULL NO: DDG-76	SHIP/HULL NAME: USS HIGGINS	PROJECT: KB3	SYSTEM:	PLANT ID:	CASREP CAT:
CU PHASE TITLE: F/O - REPAIR INTAKE AND UPTAKE LOUVERS					

CU PHASE DESCRIPTION (Cont.)

- 2.2.1 Drill 1/2 inch diameter hole on corrosion hole of each louver listed in 1.3.2.
- 2.2.1.1 Shape remaining hole to minimum 20 degrees countersink.
- 2.2.2 Accomplish the requirements of 009-012 of Ref. No. One, including Table 2, Column(s) A and D, Lines One through 7.
- 2.3 Remove existing and install new each bonding strap listed in 1.3.5 in accordance with Ref. No. 5.
- 2.4 Accomplish the requirements of 009-032 of Ref. No. One for each new and disturbed surface.
- 2.5 Notes:
- 2.5.1 Planner: Code 231A R. Yajima, 243-2791
Engineer: Code 250 M. Imamura, 243-4325
- 2.5.2 Work Integration Manager (WIM): Code 333 T. Yaginuma, 080-6522-9560
- 2.5.3 This TGI is in response to Condition Report No. NNR21048-9-02 from Sumitomo Heavy Industries, Ltd. Dated 5-JAN-2023.
- 2.5.4 WPC will copy the following pages in reference.
- REF No. 4: Pages 27B-6, 28B-6, and 22C-6
- 2.5.5 JCN EM02-L030 is related to this TGI.
- 2.6 Government Furnished Material (GFM):
- 2.6.1 SRF-JRMC will provide GFM listed in the Material List.
- 2.7 SRF-JRMC will provide the following service work: (TGI No. 38KB325102S02).
- 2.7.1 [C740] Crane and crane rigging service.
- 2.7.2 [X99E] Utility service, electrical.
- 2.7.3 [X99M] Utility service, including low pressure air supply, water supply, and steam supply.
- 2.7.4 [C106.1] Safety inspection for SRF-JRMC employees.
- 2.7.5 [C106.2] Gas free inspection for SRF-JRMC employees.
- 2.7.6 [C133] QA inspection for (G) symbol(s).
- 2.7.7 [C285] Inspection for (G) symbol(s).

WebAIM Short Form TASK GROUP INSTRUCTION

14-JAN-2026 1127

20.15.6.0.9333 (July 2025) (Continued) ICN: 38KB325102 KeyOp: A01

TGI NO:	COMPONENT NAME: LOUVERS	TYPE: AY	PHASE: A	REPEAT: 0	CHG/VER: 0/0
SHIP/HULL NO: DDG-76	SHIP/HULL NAME: USS HIGGINS	PROJECT: KB3	SYSTEM:	PLANT ID:	CASREP CAT:
CU PHASE TITLE: F/O - REPAIR INTAKE AND UPTAKE LOUVERS					

CU PHASE DESCRIPTION (Cont.)

Ref. No.	Document/Drawing Number	DOCUMENT/DRAWING TITLE	REV	CHG NO.	CPY REQ	PARAGRAPH	SECT	PG	CHPT
----------	-------------------------	------------------------	-----	---------	---------	-----------	------	----	------

WebAIM Short Form TASK GROUP INSTRUCTION

14-JAN-2026 1127

20.15.6.0.9333 (July 2025)

(Continued)

ICN: 38KB325102

KeyOp: A01

TGI NO:	COMPONENT NAME: LOUVERS	TYPE: AY	PHASE: A	REPEAT: 0	CHG/VER: 0/0
SHIP/HULL NO: DDG-76	SHIP/HULL NAME: USS HIGGINS	PROJECT: KB3	SYSTEM:	PLANT ID:	CASREP CAT:
CU PHASE TITLE: F/O - REPAIR INTAKE AND UPTAKE LOUVERS					

Ref. No.	Document/Drawing Number	DOCUMENT/DRAWING TITLE	REV	CHG NO.	CPY REQ	PARAGRAPH	SECT	PG	CHPT
1	NSI FY-26	NAVSEA Standard Items	-	1	N				
2	LI FY-26	Local Standard Items	-	ORG	N				
3	MP LM19-KB325102-EM02L030	2B GTM AND NR.2 SSGTG INTAKE SYSTEM FOD PROTECTION FOR INTAKE LOUVER REPAIR	-		Y			ALL	
4	DWG 259-6566713	DDG51 CLASS FAB & INSTL OF INTAKE LVRS FOR GTRB & SSGTRB	M		Y			SE E NO TE	
5	MIL MIL-STD-1310	Shipboard Bonding, Grounding, and Other Techniques for EMP Mitigation and Safety	H		N				

MATERIAL REFERENCES			
REF NO.	DOCUMENT/DRAWING NUMBER	DOCUMENT/DRAWING TITLE	REV

ICN: 38KB325102	KEY OP: A01
-----------------	-------------

MATERIAL LIST												
ITEM NO.	PC NO.	REF NO.	M / C	DESCRIPTION	STOCK NUMBER	GENERIC MATL TYPE	LVL	QA	HAZ MAT	DOC NO.	QTY REQD/ UNIT	QTY USED/ UNIT
001			M	STRIP,EL, ORDERED FOR KTR ORIG: C231A R. YAJIMA 243-2791	9B 5999 013438667		NA	4	N	53535042	1/EA	
002			M	SCREW,CA, ORDERED FOR KTR ORIG: C231A R. YAJIMA 243-2791	9B 5305 014535741		NA	4	N	53535043	2/EA	


ATTACHMENT LIST


TITLE	FILE NAME	SAVED DATE
ENCLOSURE-01	38KB325102A01-Sketch.pdf	18-DEC-2025 0000

LOCATION MAP OF LOUVER REPAIR IN VARIOUS LOCATION

PIC NO.	Condtion	Size(SF)	Reference
PIC-2A-S-22	Corroded Area (Area circled in red)	0.014	See Attachment-4 and 6
PIC-2A-S-23	Corroded Area (Area circled in red)	0.010	See Attachment-4 and 6
PIC-2A-S-24	Corroded Area (Area circled in red)	0.003	See Attachment-4 and 6
PIC-2A-S-25	Corroded Area (Area circled in red)	0.014	See Attachment-4 and 7
PIC-2B-S-1	Corroded Area (Area circled in red)	0.003	See Attachment-4 and 8
PIC-2B-S-2	Corroded Area (Area circled in red)	0.007	See Attachment-4 and 8
PIC-2B-S-3	Corroded & Crack (Area circled in red)	0.007	See Attachment-4 and 8
PIC-2B-S-4	Corroded Area (Area circled in red)	0.024	See Attachment-4 and 8
PIC-2B-S-5	Corroded Area (Area circled in red)	0.021	See Attachment-4 and 8
PIC-2B-S-6	Corroded Area (Area circled in red)	0.007	See Attachment-4 and 8
PIC-2B-S-7	Corroded Area (Area circled in red)	0.014	See Attachment-4 and 8
PIC-2B-S-8	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 8
PIC-2B-S-9	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 8
PIC-2B-S-10	Corroded Area (Area circled in red)	0.031	See Attachment-4 and 8
PIC-2B-S-11	Corroded Area (Area circled in red)	0.042	See Attachment-4 and 8
PIC-2B-S-12	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 8
PIC-2B-S-13	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 9
PIC-2B-S-14	Corroded Area (Area circled in red)	0.024	See Attachment-4 and 9
PIC-2B-S-15	Corroded Area (Area circled in red)	0.024	See Attachment-4 and 9
PIC-2B-S-16	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 9
PIC-2B-S-17	Corroded Area (Area circled in red)	0.002	See Attachment-4 and 9
PIC-2B-S-18	Corroded Area (Area circled in red)	0.003	See Attachment-4 and 9
PIC-2B-S-19	Corroded Area (Area circled in red)	0.007	See Attachment-4 and 9
PIC-2B-S-20	Corroded Area (Area circled in red)	0.007	See Attachment-4 and 9

Intake Engine Room No. 2
 (02-275-0-Q) (02-284-0-Q) Louver, STBD
 LKG STBD

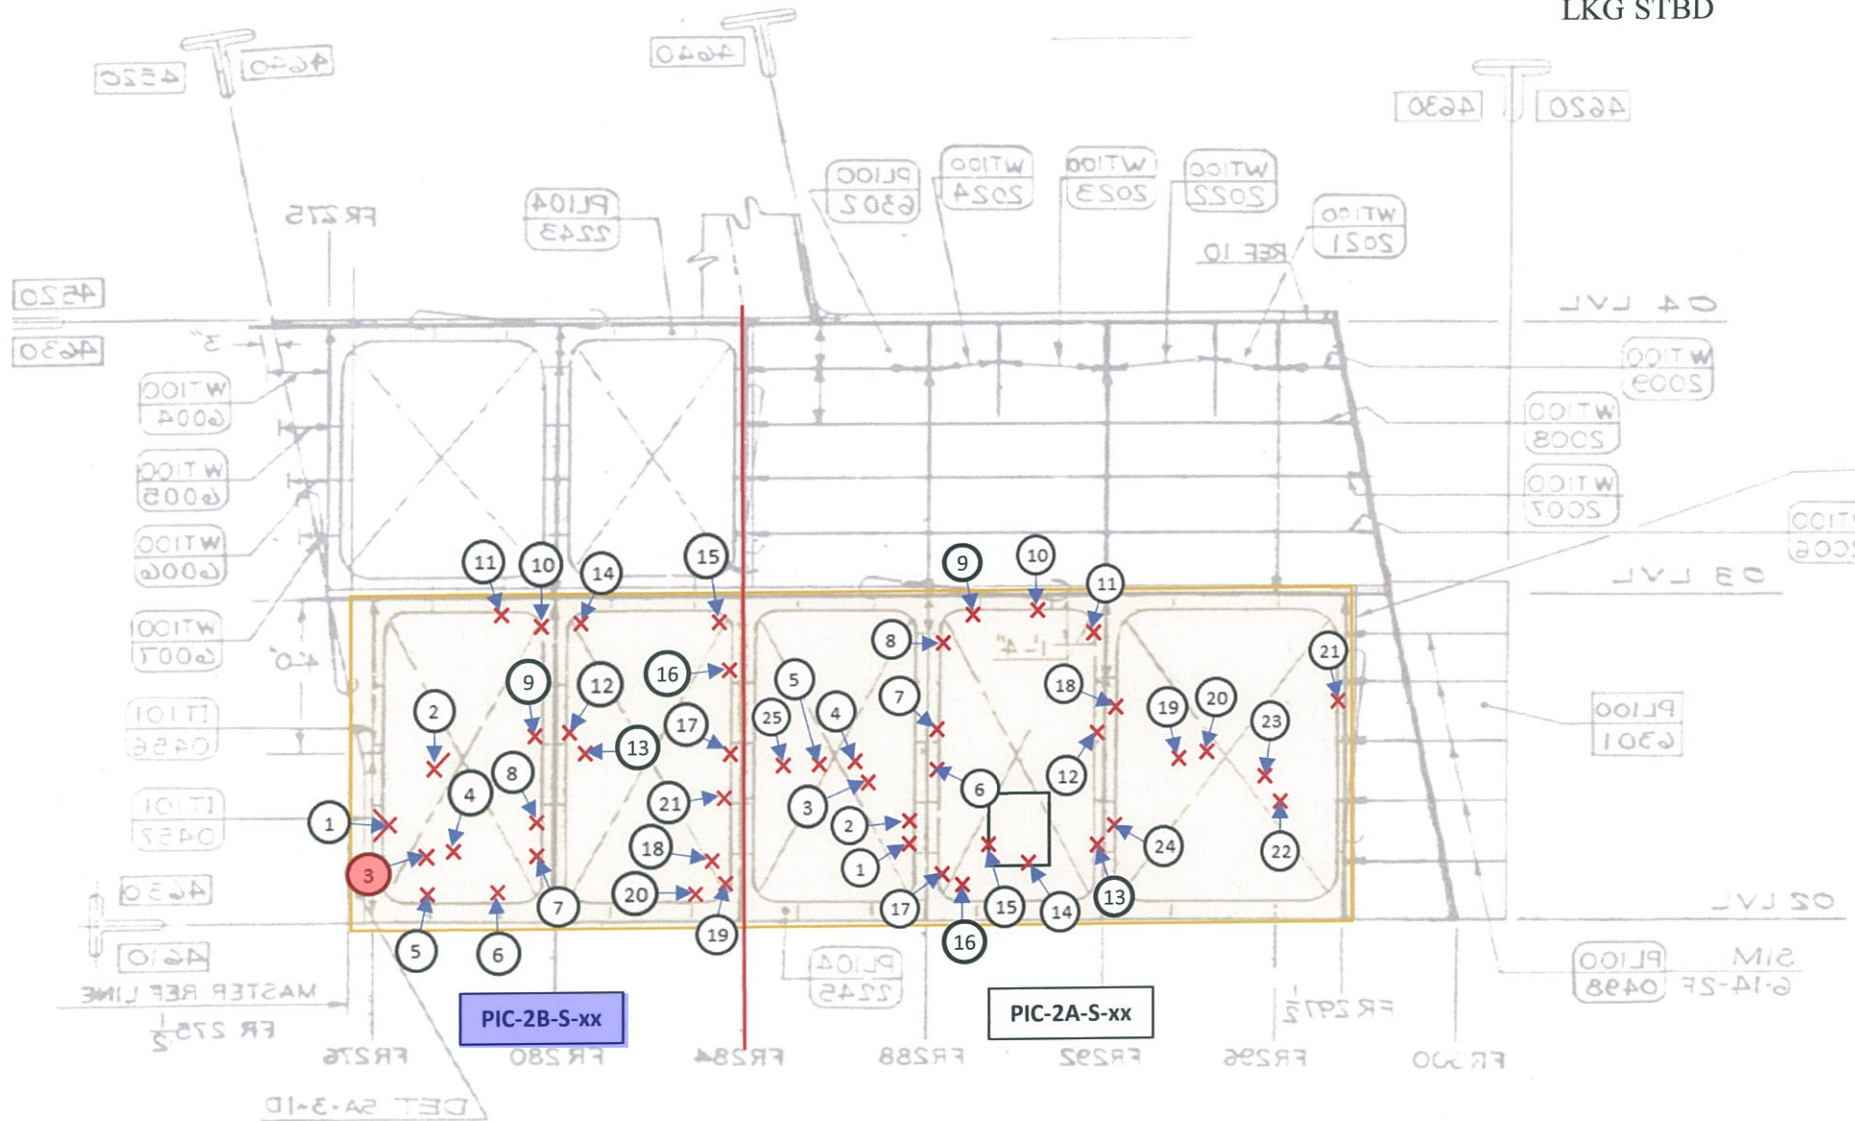

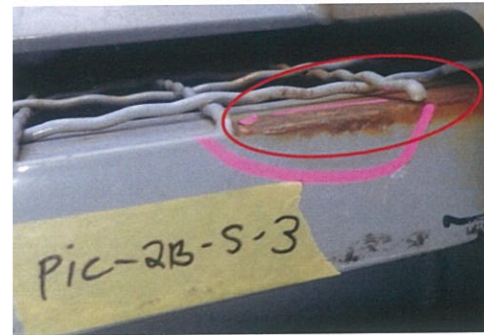


PIC-2B-S-3
(Red circled areas are corroded areas.)

VISUAL INSPECTION RECORD

PIC NO.	Condition	Size(SF)	Reference
PIC-UP-PI-1	Corrosion hole (Area circled in red)	1/4"	See Attachment-87 and 88
PIC-UP-PI-2	Corroded Area (Area circled in red)	0.056	See Attachment-87 and 88
PIC-UP-PI-3	Corroded Area (Area circled in red)	0.021	See Attachment-87 and 88
PIC-UP-PI-4	Mechanical Damage (Area circled in red)	1/2" x 2EA	See Attachment-87 and 88
PIC-UP-PI-5	Corroded Area (Area circled in red)	0.007	See Attachment-87 and 88
PIC-UP-PI-6	Corroded Area (Area circled in red)	0.028	See Attachment-87 and 88
PIC-UP-PI-7	Corroded Area (Area circled in red)	0.002	See Attachment-87 and 88
PIC-UP-PI-8	Mechanical Damage (Area circled in red)	1/2"	See Attachment-87 and 88
PIC-UP-PI-9	Mechanical Damage (Area circled in red)	1/2"	See Attachment-87 and 88
PIC-UP-PI-10	Corroded Area (Area circled in red)	0.003	See Attachment-87 and 88
PIC-UP-PI-11	Corroded Area (Area circled in red)	0.003	See Attachment-87 and 88
PIC-UP-PI-12	Corroded Area (Area circled in red)	0.002	See Attachment-87 and 88
PIC-UP-PI-13	Corroded Area (Area circled in red)	0.139	See Attachment-87 and 89
PIC-UP-PI-14	Corroded Area (Area circled in red)	0.002	See Attachment-87 and 89
PIC-UP-PI-15	Corroded Area (Area circled in red)	0.002	See Attachment-87 and 89
PIC-UP-PI-16	Corroded Area (Area circled in red)	0.003	See Attachment-87 and 89
PIC-UP-PI-17	Corroded Area (Area circled in red)	0.017	See Attachment-87 and 89
PIC-UP-PI-18	Corroded Area (Area circled in red)	0.042	See Attachment-87 and 89
PIC-UP-PI-19	Corroded Area (Area circled in red)	0.003	See Attachment-87 and 89
PIC-UP-PI-20	Corroded Area (Area circled in red)	0.035	See Attachment-87 and 89
PIC-UP-PI-21	Corroded Area (Area circled in red)	0.007	See Attachment-87 and 89


VISUAL INSPECTION RECORD

[illegible]

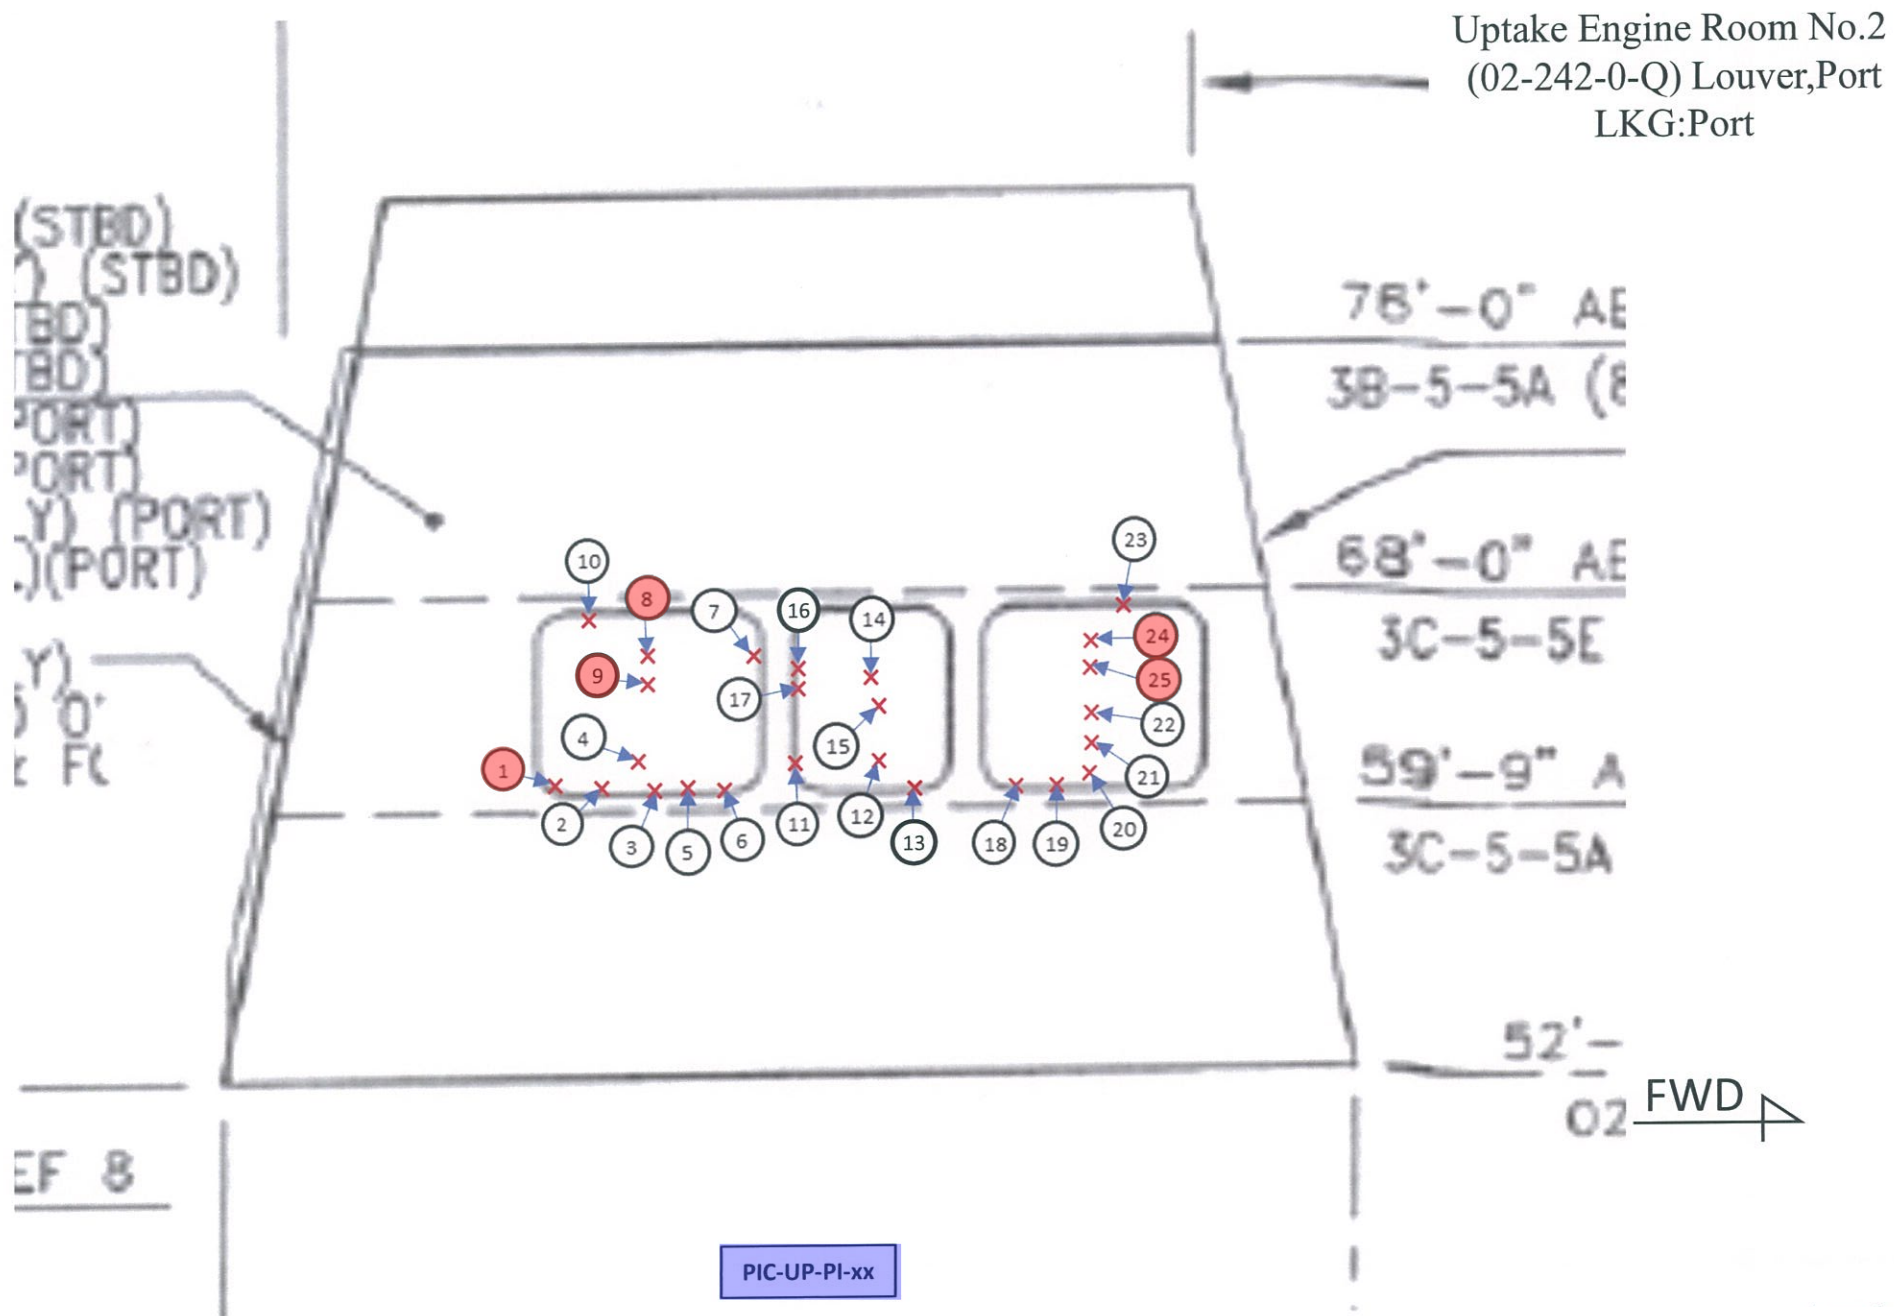





PIC-UP-PI-1
(Red circled areas are corroded areas.)

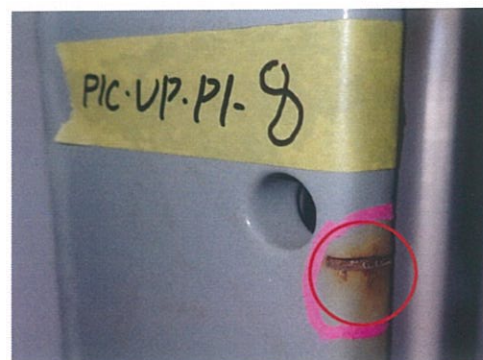


PIC-UP-PI-8
(Red circled areas are corroded areas.)

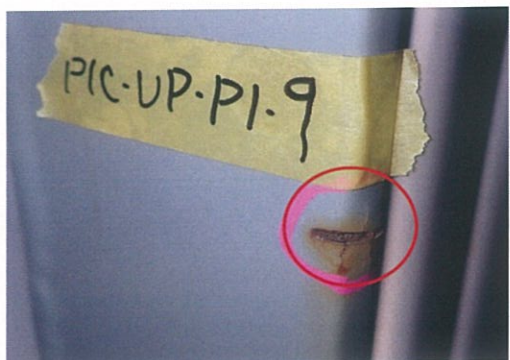

PIC-UP-PI-9
(Red circled areas are corroded areas.)

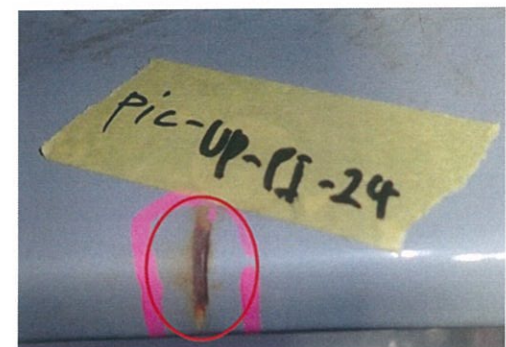

PIC-UP-PI-24
(Red circled areas are Mechanical Damage.)

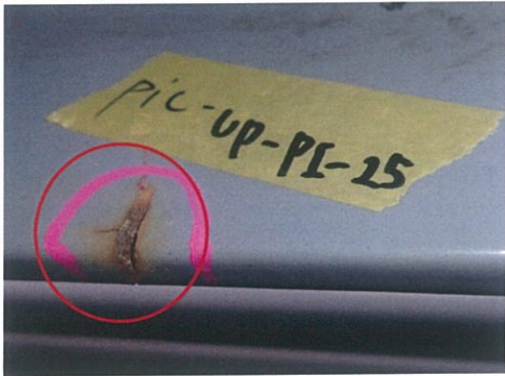



PIC-UP-PI-25
(Red circled areas are Mechanical Damage.)

VISUAL INSPECTION RECORD


PIC NO.	Condition	Size(SF)	Reference
PIC-UP-SI-1	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 99
PIC-UP-SI-2	Corroded Area (Area circled in red)	0.014	See Attachment-98 and 99
PIC-UP-SI-3	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 99
PIC-UP-SI-4	Mechanical Damage (Area circled in red)	1-1/2"	See Attachment-98 and 99
PIC-UP-SI-5	Mechanical Damage (Area circled in red)	1-1/2"	See Attachment-98 and 99
PIC-UP-SI-6	Corroded & Mechanical Damage (Area circled in red)	0.017SF, 2" x 2EA	See Attachment-98 and 99
PIC-UP-SI-7	Mechanical Damage (Area circled in red)	1/4"	See Attachment-98 and 99
PIC-UP-SI-8	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 99
PIC-UP-SI-9	Corroded Area (Area circled in red)	0.007	See Attachment-98 and 99
PIC-UP-SI-10	Corroded Area (Area circled in red)	0.139	See Attachment-98 and 99
PIC-UP-SI-11	Mechanical Damage (Area circled in red)	1"	See Attachment-98 and 99
PIC-UP-SI-12	Mechanical Damage (Area circled in red)	2" , 1/2"	See Attachment-98 and 99
PIC-UP-SI-13	Corroded & Mechanical Damage (Area circled in red)	0.003SF, 2" , 1/2" x 2EA	See Attachment-98 and 100
PIC-UP-SI-14	Corroded Area (Area circled in red)	0.007	See Attachment-98 and 100
PIC-UP-SI-15	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 100
PIC-UP-SI-16	Corroded Area (Area circled in red)	0.003	See Attachment-98 and 100
PIC-UP-SI-17	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 100
PIC-UP-SI-18	Mechanical Damage (Area circled in red)	1/2"	See Attachment-98 and 100
PIC-UP-SI-19	Mechanical Damage (Area circled in red)	1/2"	See Attachment-98 and 100
PIC-UP-SI-20	Corroded Area (Area circled in red)	0.002	See Attachment-98 and 100
PIC-UP-SI-21	Mechanical Damage (Area circled in red)	1"	See Attachment-98 and 100

PIC-UP-SI-xx

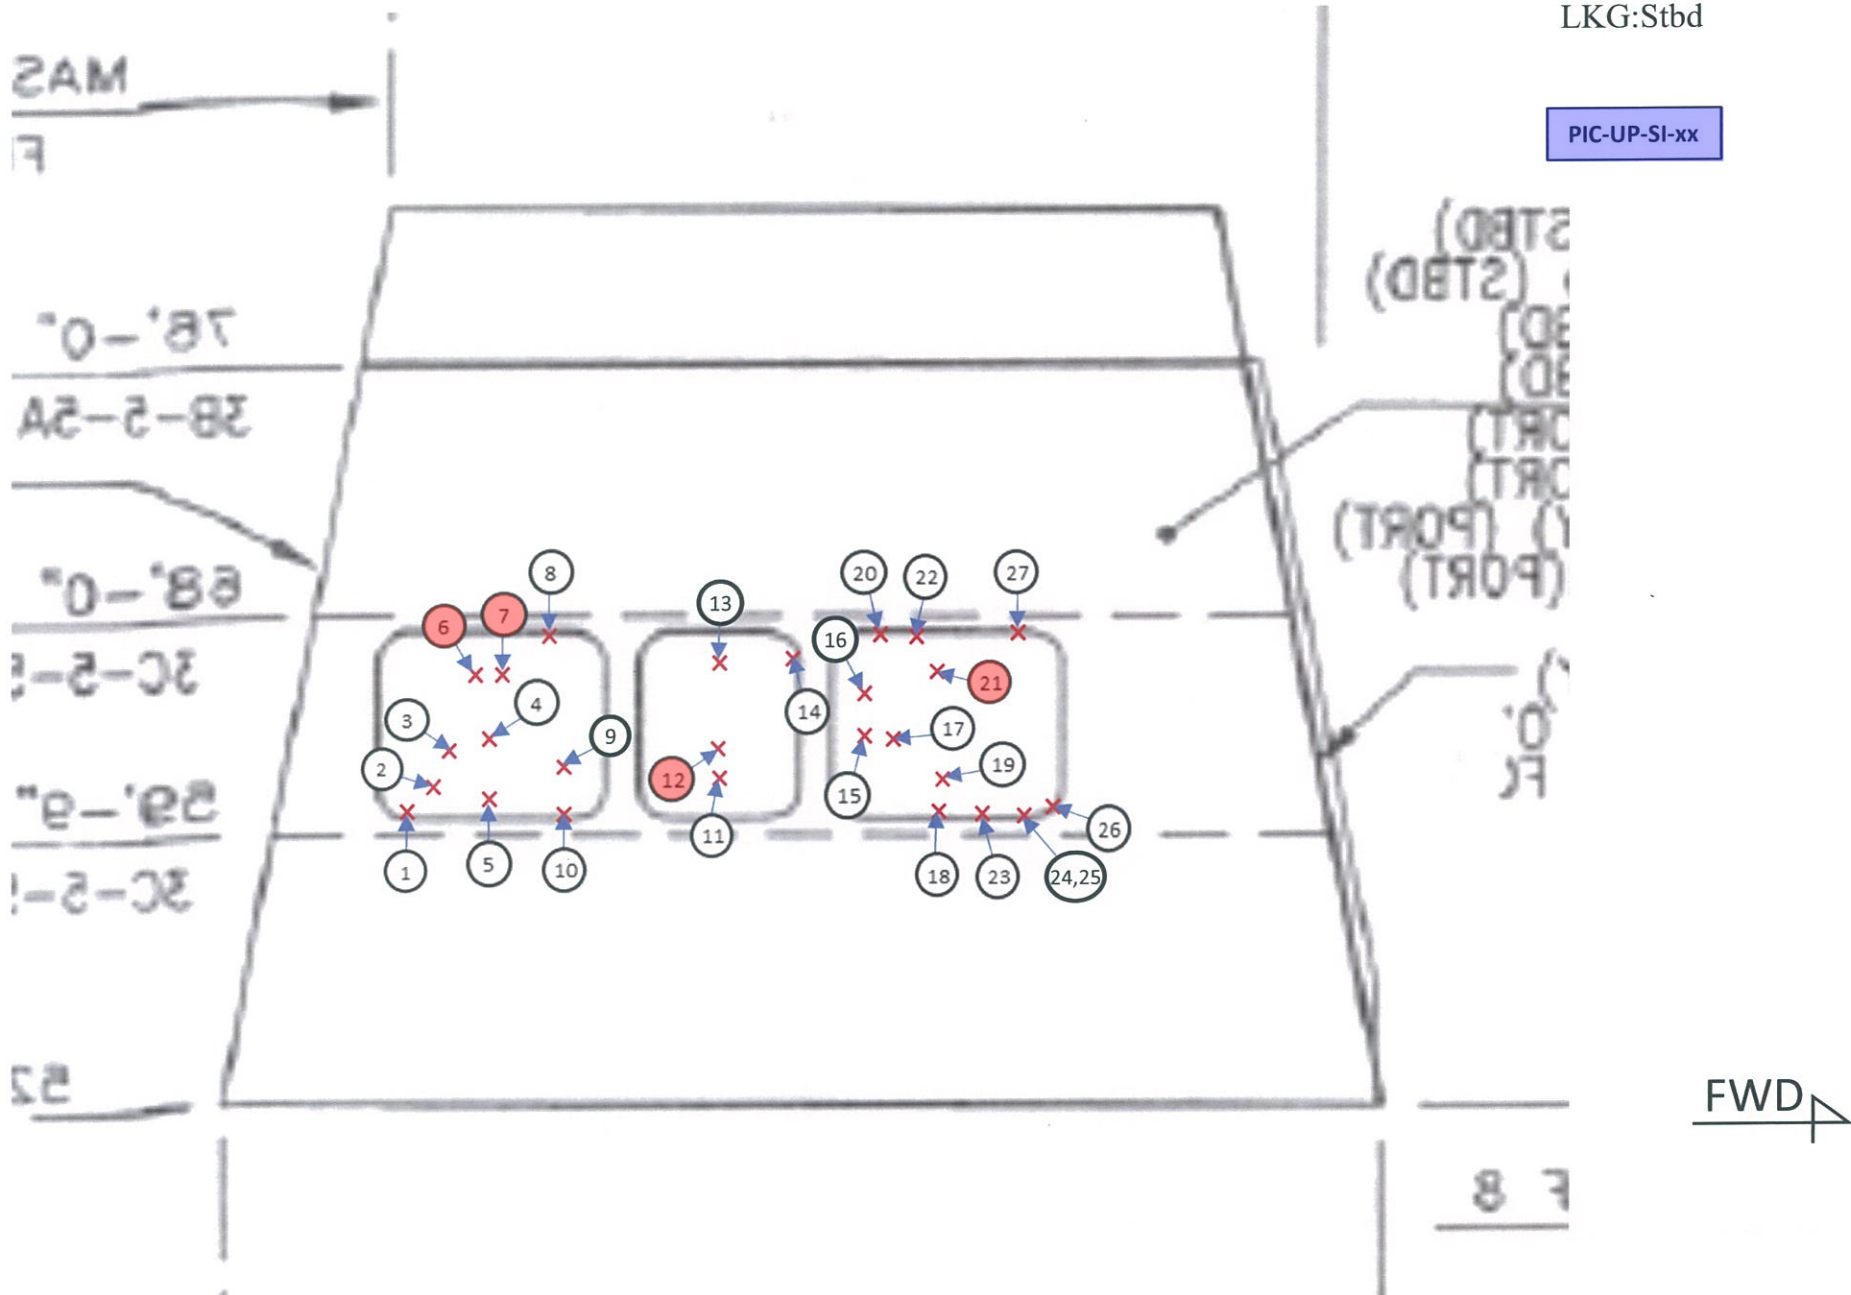


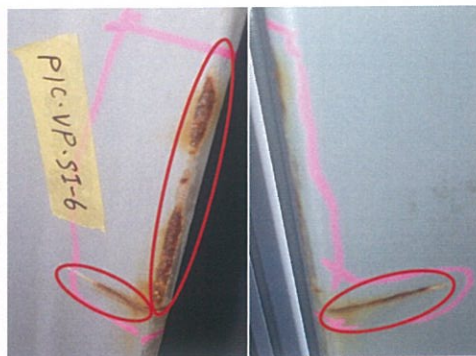


PIC-UP-SI-6
(Red circled areas are Corroded & Mechanical Damage.)

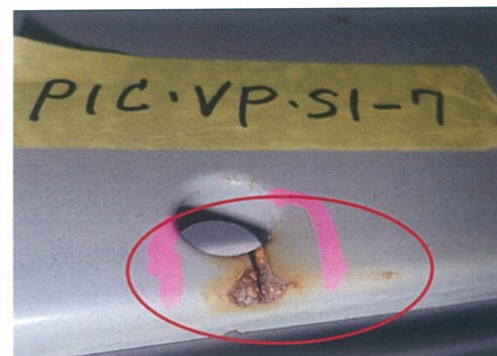

PIC-UP-SI-7
(Red circled areas are Mechanical Damage.)

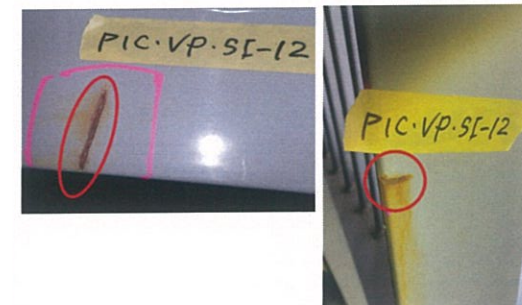


PIC-UP-SI-12
(Red circled areas are Mechanical Damage.)

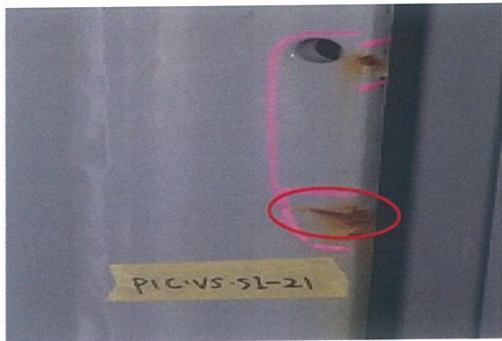


PIC-UP-SI-21
(Red circled areas are Mechanical Damage.)

VISUAL INSPECTION RECORD


PIC NO.	Condition	Size(SF)	Reference
PIC-G2I-1	Corroded Area (Area circled in red)	0.042	See Attachment-108 and 111
PIC-G2I-2	Corroded Area (Area circled in red)	0.007	See Attachment-108 and 111
PIC-G2I-3	Corroded Area (Area circled in red)	0.002	See Attachment-108 and 111
PIC-G2I-4	Corroded Area (Area circled in red)	0.007	See Attachment-108 and 111
PIC-G2I-5	Corroded Area (Area circled in red)	0.104	See Attachment-108 and 111
PIC-G2I-6	Corroded Area (Area circled in red)	0.014	See Attachment-108 and 111
PIC-G2I-7	Corroded Area (Area circled in red)	0.007	See Attachment-108 and 111
PIC-G2I-8	Corroded Area (Area circled in red)	0.007	See Attachment-108 and 111
PIC-G2I-9	Corroded Area (Area circled in red)	0.007	See Attachment-108 and 111
PIC-G2I-10	Corroded Area (Area circled in red)	0.021	See Attachment-108 and 111
PIC-G2I-11	Corroded Area (Area circled in red)	0.035	See Attachment-108 and 111
PIC-G2I-12	Corroded Area (Area circled in red)	0.042	See Attachment-108 and 111
PIC-G2I-13	Corroded Area (Area circled in red)	0.042	See Attachment-108 and 112
PIC-G2I-14	Corroded Area (Area circled in red)	0.042	See Attachment-108 and 112
PIC-G2I-15	Corroded Area (Area circled in red)	0.042	See Attachment-108 and 112
PIC-G2I-16	Corroded Area (Area circled in red)	0.25	See Attachment-108 and 112
PIC-G2I-17	Corroded Area (Area circled in red)	0.021	See Attachment-108 and 112
PIC-G2I-18	Corroded Area (Area circled in red)	0.125	See Attachment-108 and 112
PIC-G2I-19	Corroded Area (Area circled in red)	0.069	See Attachment-108 and 112
PIC-G2I-20	Bonding strap is damaged (Area circled in red)	-	See Attachment-108 and 112
PIC-G2I-21	Corroded Area (Area circled in red)	0.035	See Attachment-108 and 112
PIC-G2I-22	Corroded Area (Area circled in red)	0.014	See Attachment-108 and 112
PIC-G2I-23	Corroded Area (Area circled in red)	0.083	See Attachment-108 and 112
PIC-G2I-24	Caulking of bolt for FOD screen is deteriorated	-	See Attachment-108 and 113

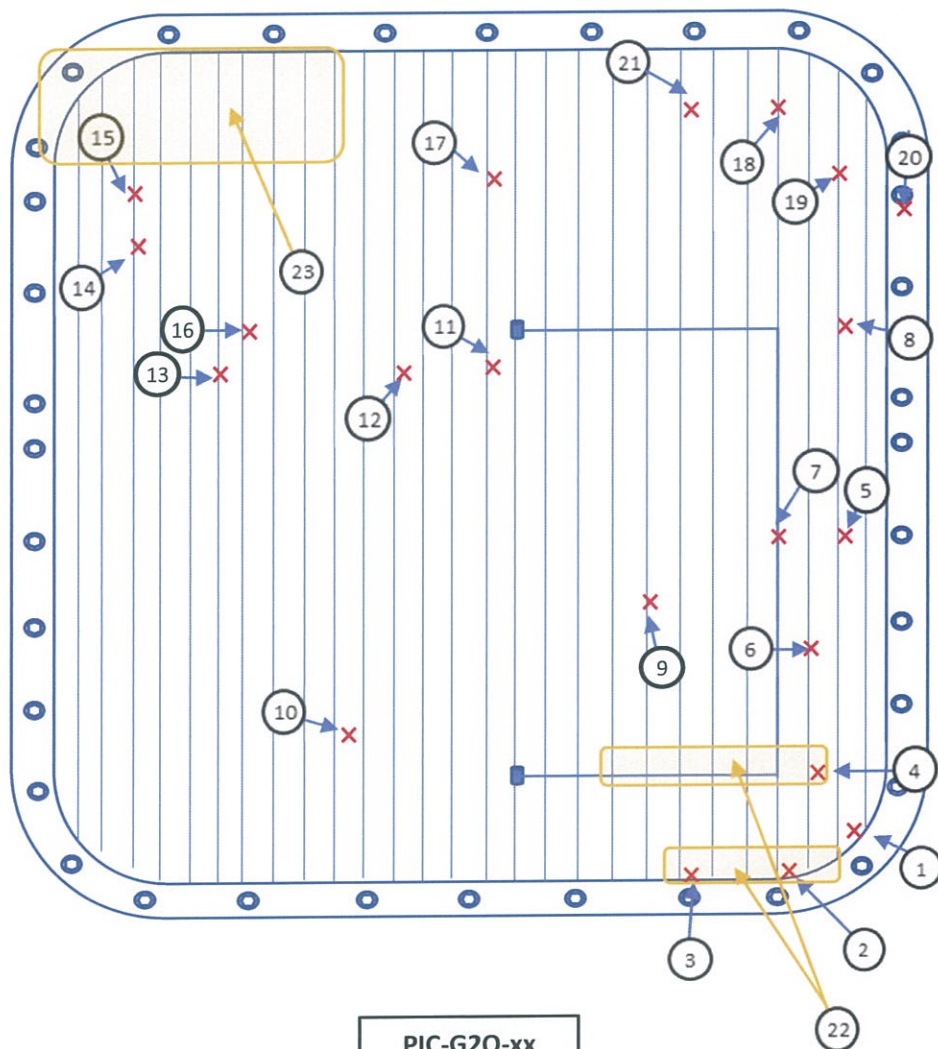

Gas Turbine Generator Intake (01-260-1-Q)
Louver, Stbd
LKG: PORT

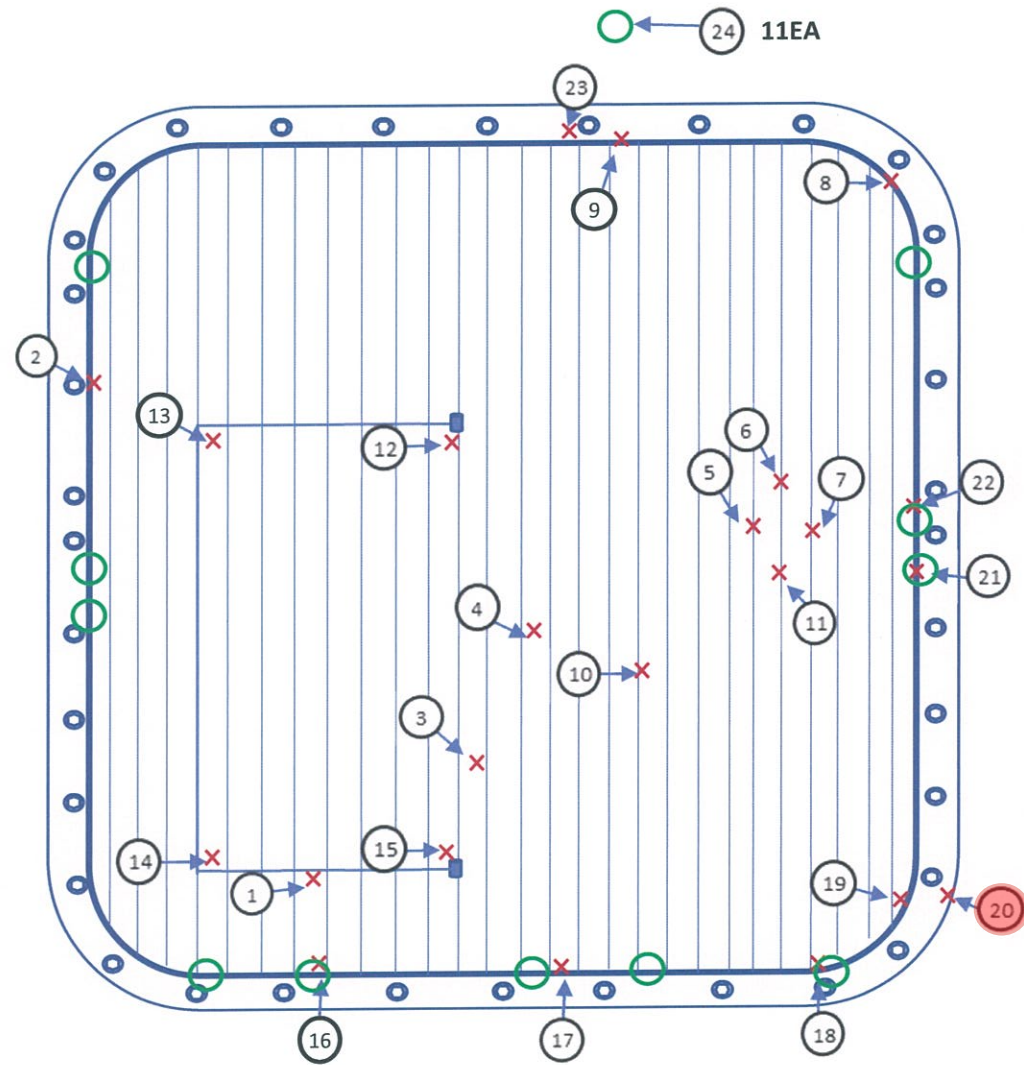

Gas Turbine Generator Intake (01-260-1-Q)
Louver,Stbd
LKG: STBD

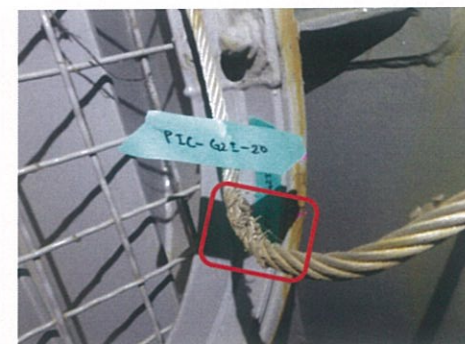

PIC-G2I-20
(Bonding strap is damaged.)