



Radiation Tests: HCPL7800 Isolation Amp (1)

- This chip was not originally in the design, but was considered after initial failures of the original isolation amplifier
- TID and SEE tests performed together at a flux of 2.1×10^8 p/cm²/s up
 - Some SETs were observed on the output voltages, with small amplitude (~ 100 mV) and short time (~ 5 us), but as they will be filtered by low-pass filters on the brick, **the chip passed the SEE tests**
 - **There were also no changes in parameters due to TID**
- **For NIEL tests**, samples irradiated up to 8×10^{12} n/cm² at JSI showed failure, but **the ones irradiated up to 5×10^{12} n/cm² were working fine**

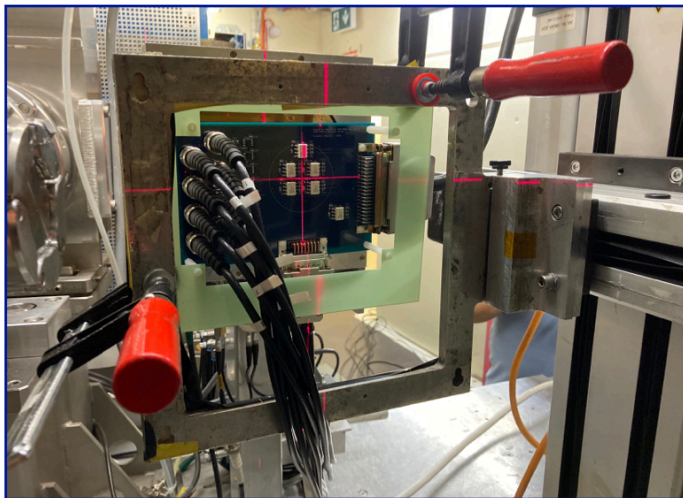

HCPL7800 test board at PIF

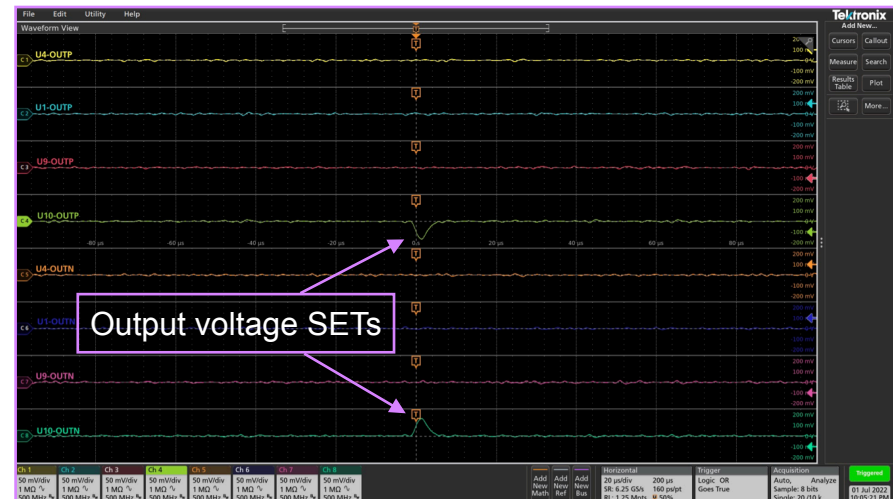

Couple of SETs in HCPL7800 output voltages