
Elizabeth St flood report field test: matching review

Survey date: 19 October 2026 **Reports:** 12 **Generated:** 19 October 2026

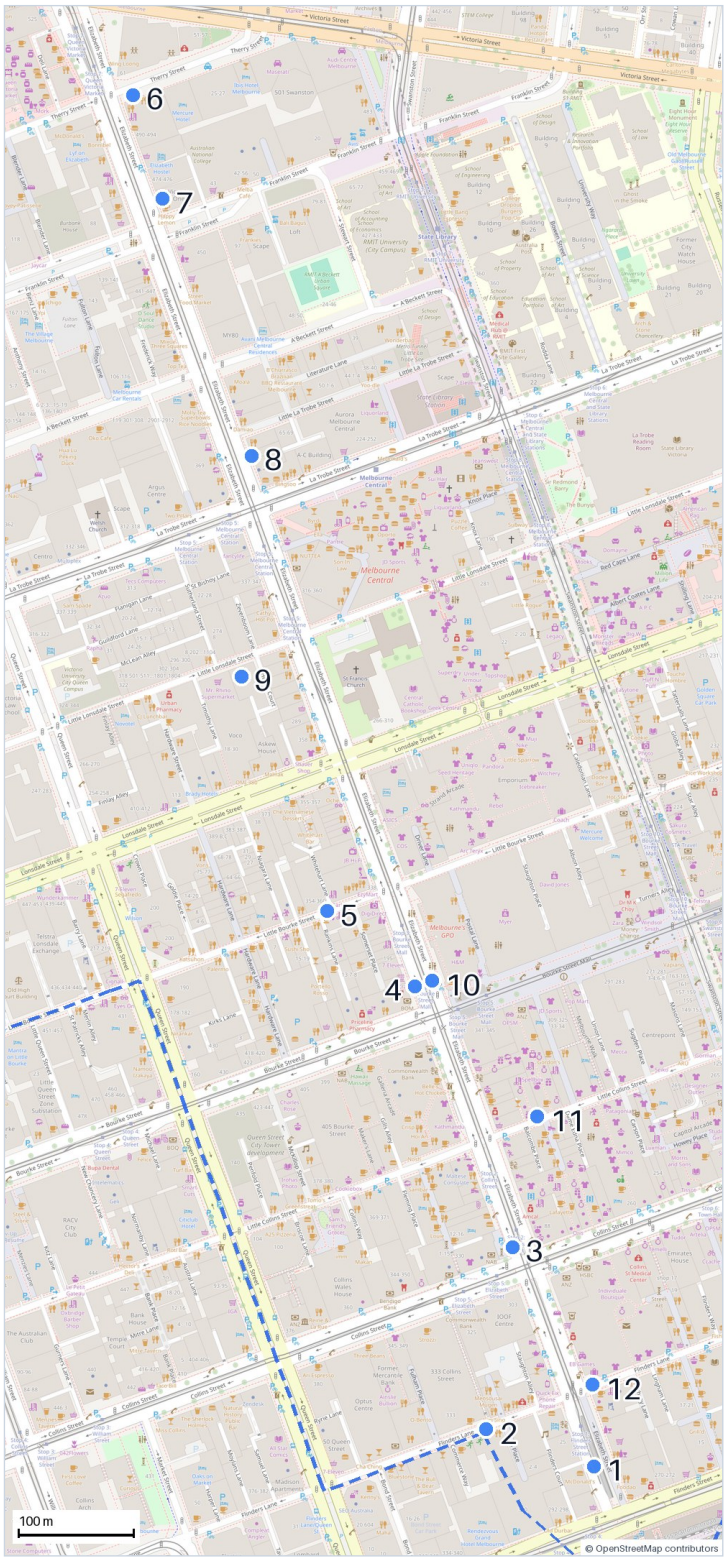

Report locations, labelled with report numbers (one page each). Blue: candidates found; red: no inlet within the search radius. Dashed blue line: Elizabeth St Drain catchment.

Tally

Correct	7
Almost correct	4
Not correct	1
No candidates	0
Total	12

Grade definitions

Grade only the **#1 (top-ranked) candidate** against the drain that was photographed.

Correct: the #1 candidate is the drain that was photographed.
Almost correct: the photographed drain is candidate #2 to #5.
Not correct: the photographed drain is not among the candidates. A pit next to the photographed one does **not** count as a match.
No candidates: no inlet within the search radius (counted separately).

Where the grade is not Correct, write the asset number of the drain actually photographed in *Actual asset no.*


How matching works


Only surface inlets are candidates. Location uncertainty (sigma) is the GPS accuracy clamped to 5 to 50 m (a manual pin uses 15 m). Search radius = max(20 m, 2 sigma), shown as the blue circle on each map. Each inlet in the radius is scored exp(-d²/2sigma²); the top 5 are listed with scores normalised to sum to 100%.

Basemap © OpenStreetMap contributors. Stormwater pits: City of Melbourne (CC BY 4.0). Catchment: Melbourne Water (CC BY 4.0).

Report #1

19 Oct 2026, 6:14:23 PM · GPS ±3 m · -37.817753, 144.964714

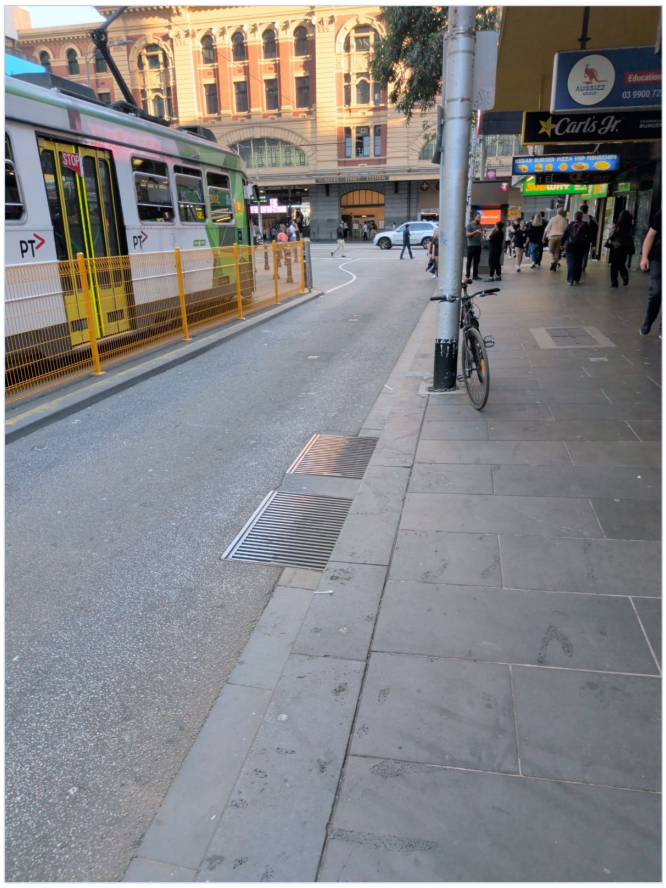

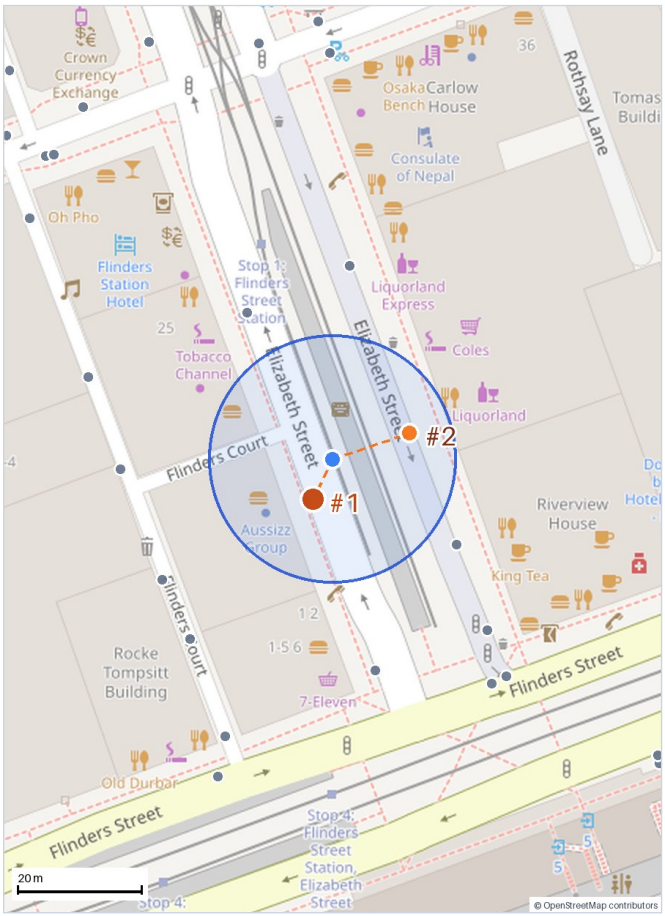

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1142958**	**Grated OFK**	**7.2 m**	**91%**
2	1142956	Grated OFK	13.0 m	9%

Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1142958

Report #2

19 Oct 2026, 6:18:14 PM · GPS ±24 m · -37.817467, 144.963653



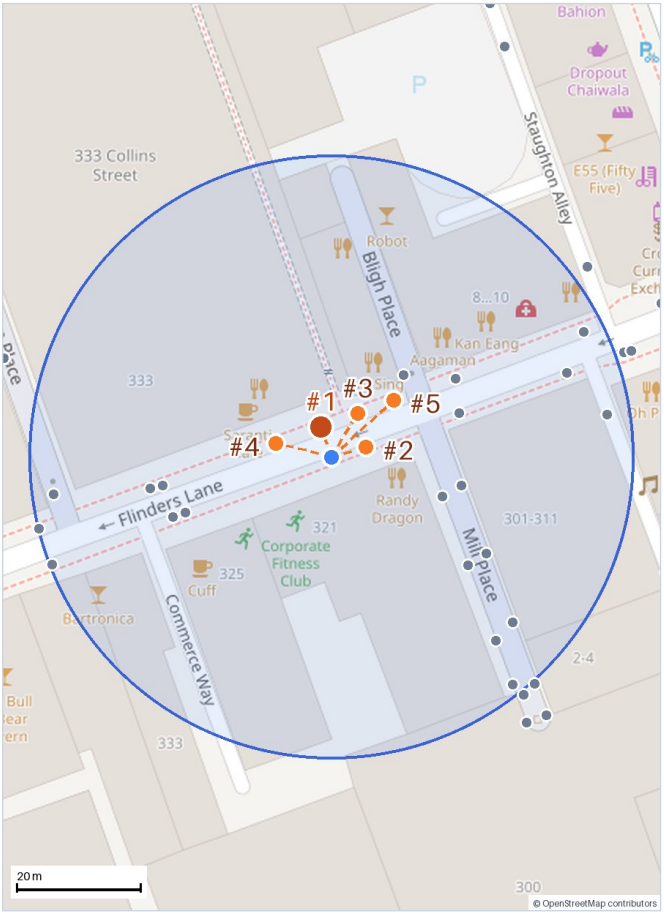

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1143204**	**Grated OFK**	**5.1 m**	**21%**
2	1143207	Grated OFK	5.8 m	21%
3	1757780	Grated OFK	8.2 m	20%
4	1143203	Grated OFK	9.3 m	20%
5	1143208	Grated Kerbside	13.5 m	18%


Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1143204

Report #3

19 Oct 2026, 6:20:06 PM · GPS ±10 m · -37.816050, 144.963913

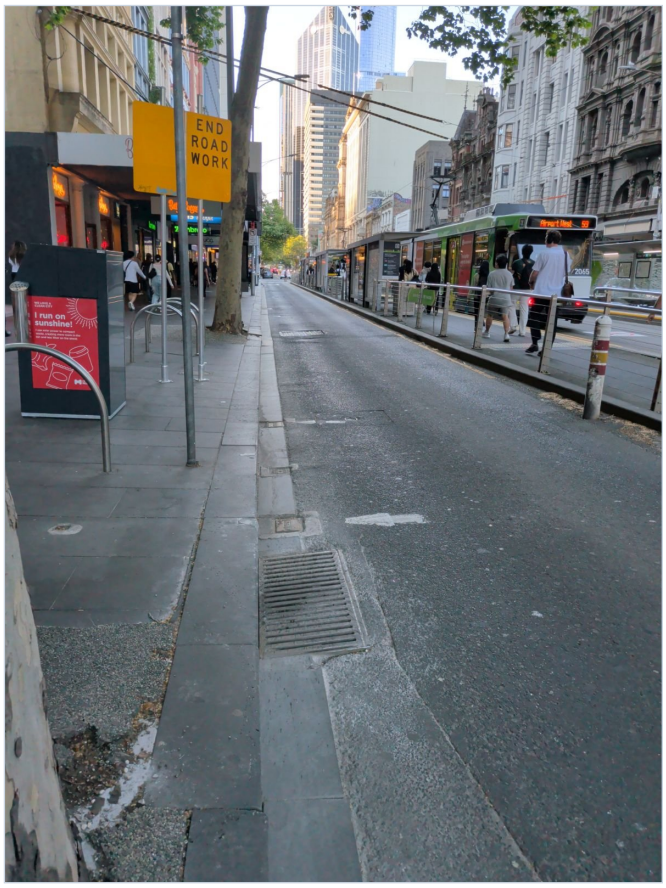

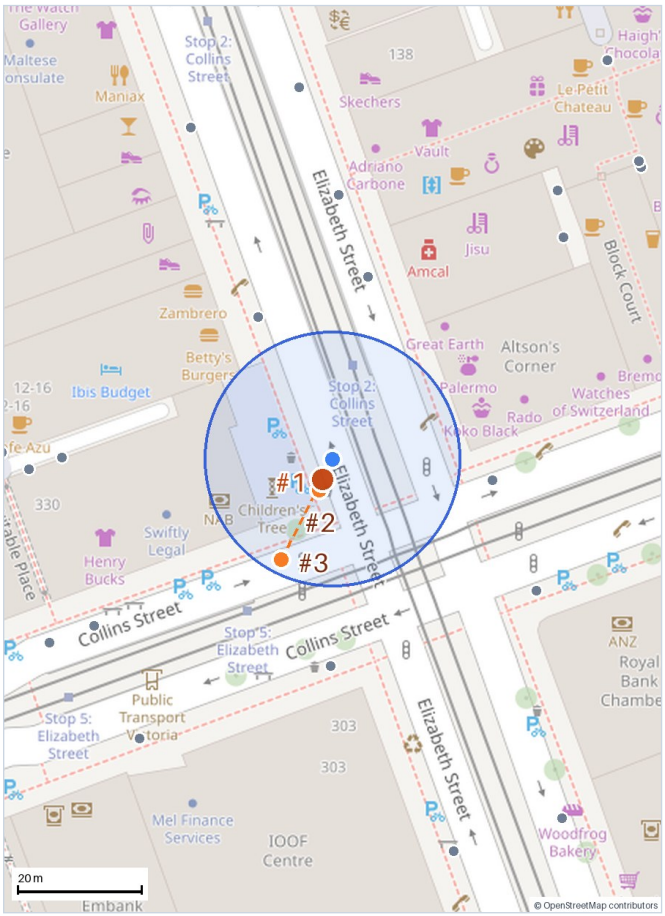

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1575347**	**Grated Manhole**	**3.6 m**	**46%**
2	1142963	Grated OFK	5.5 m	43%
3	1804333	Grated OFK	18.2 m	11%


Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1575347

Report #4

19 Oct 2026, 6:21:44 PM · GPS ±16 m · -37.814019, 144.962951

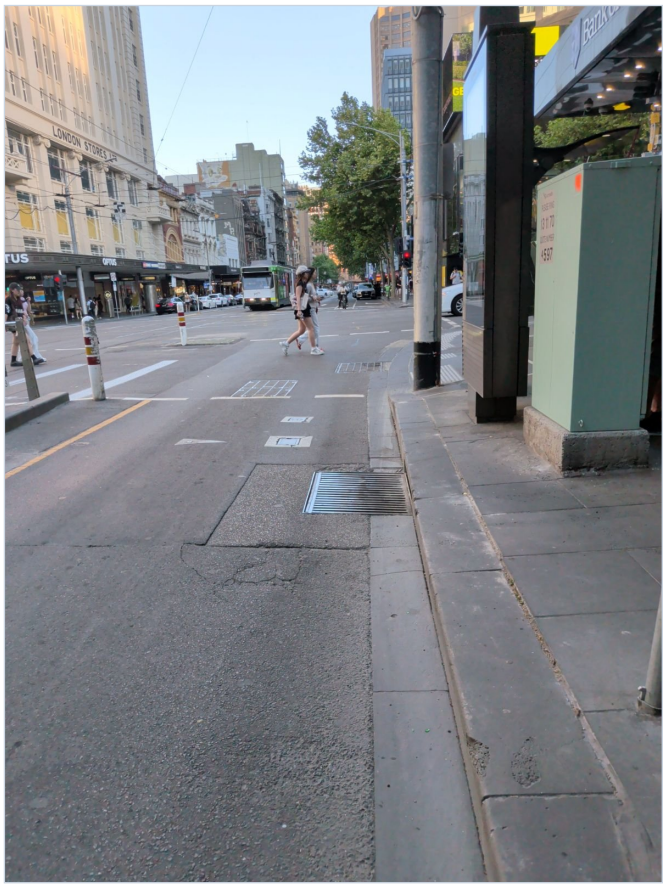

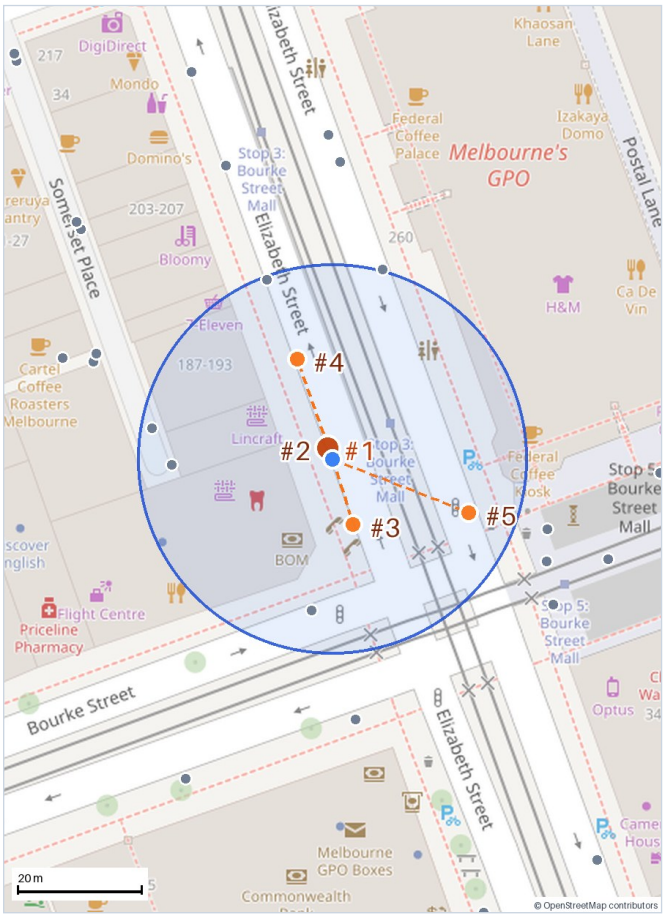

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1575344**	**Grated OFK**	**2.0 m**	**27%**
2	1364235	Grated OFK	2.0 m	27%
3	1141120	Grated OFK	11.1 m	21%
4	1141121	Grated OFK	17.0 m	15%
5	1141078	Grated OFK	23.6 m	9%

Grade: was the #1 candidate the drain that was photographed?


☐ Correct ☑ Almost correct ☐ Not correct

Actual asset no.: 1141120

Report #5

19 Oct 2026, 6:23:19 PM · GPS ±9 m · -37.813437, 144.962087



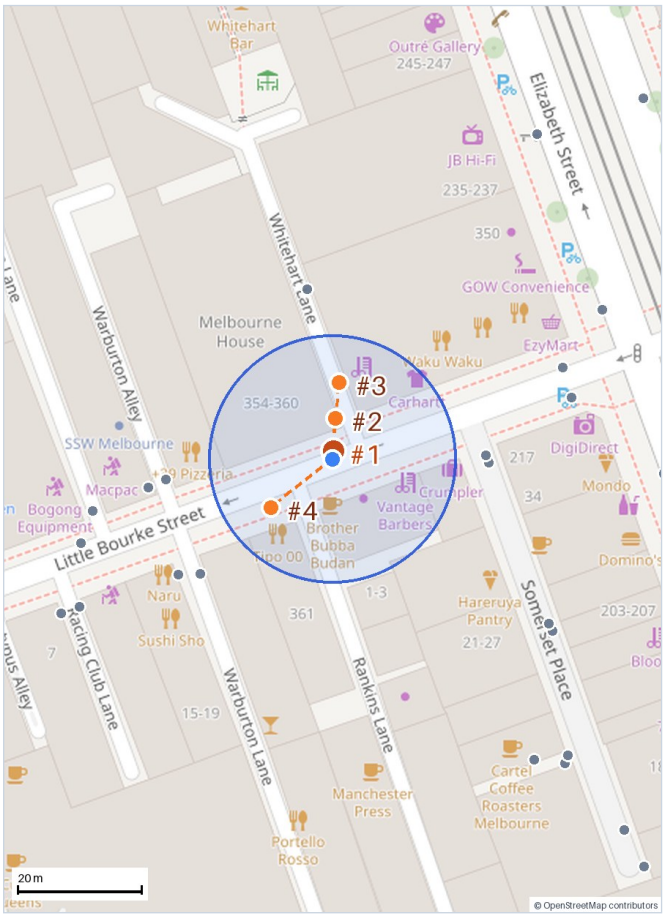

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1141137**	**Grated OFK**	**1.3 m**	**38%**
2	1141134	Grated OFK	6.5 m	30%
3	1141135	Grated OFK	12.4 m	16%
4	1141139	Grated OFK	12.6 m	16%

Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1141137

Report #6

19 Oct 2026, 6:28:46 PM · GPS ±7 m · -37.807086, 144.960179



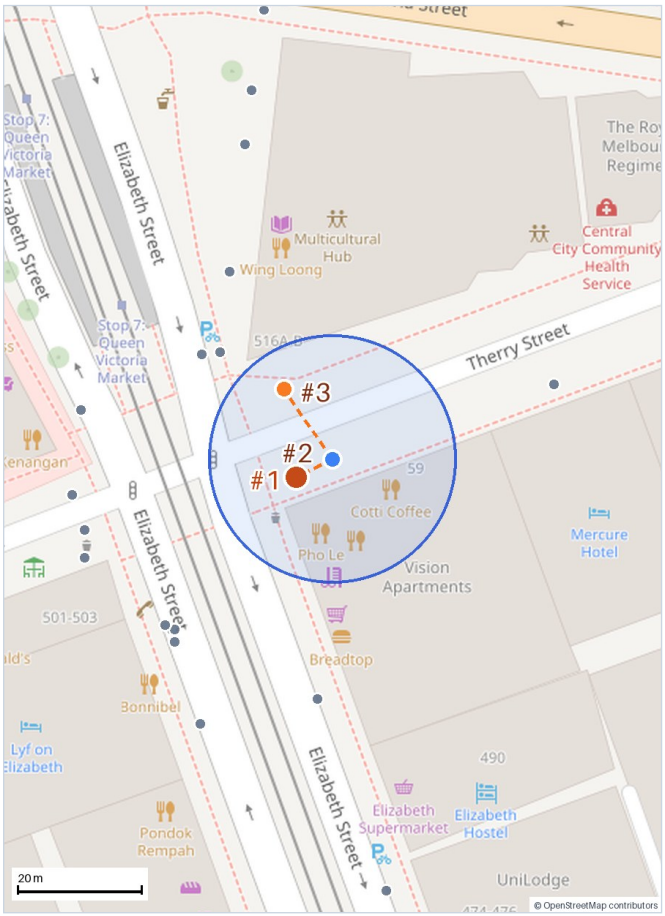

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1581165**	**Grated OFK**	**6.5 m**	**45%**
2	1148458	Grated OFK	6.5 m	45%
3	1148457	Grated OFK	13.7 m	9%


Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1581165

Report #7

19 Oct 2026, 6:29:58 PM · GPS ±7 m · -37.807896, 144.960470

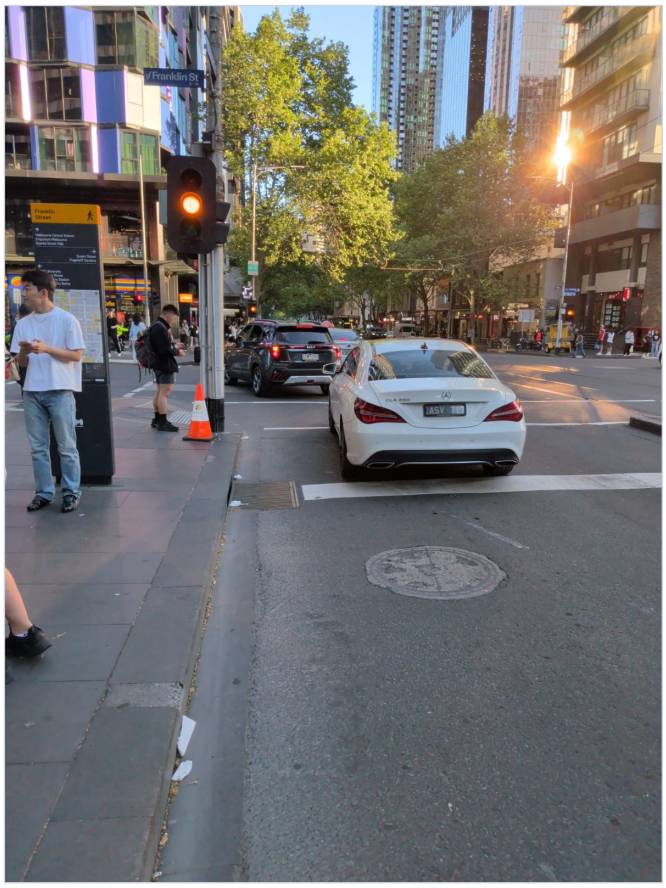

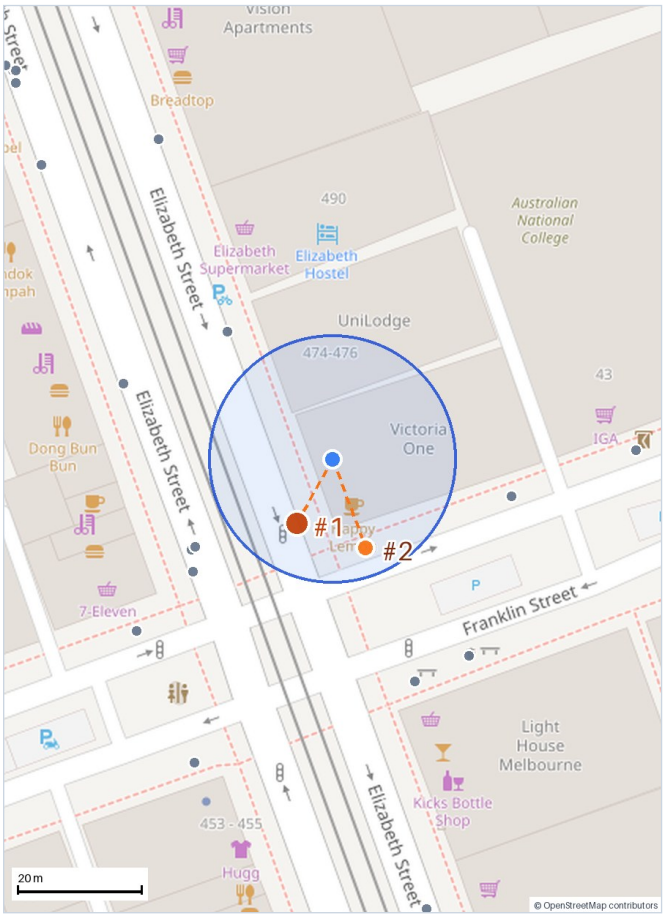

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1148250**	**Grated OFK**	**11.9 m**	**69%**
2	1148459	Grated OFK	15.2 m	31%

Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1148250

Report #8

19 Oct 2026, 6:31:34 PM · GPS ±15 m · -37.809895, 144.961343



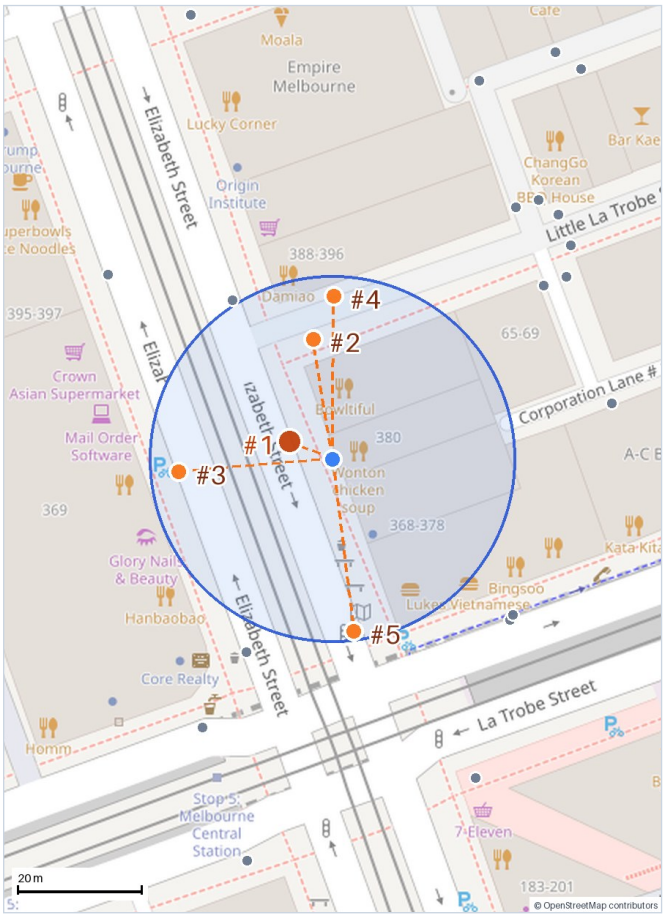

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1148256**	**Grated OFK**	**7.5 m**	**46%**
2	1148376	Grated OFK	19.5 m	22%
3	1143878	Grated OFK	24.8 m	13%
4	1148378	Grated OFK	26.2 m	11%
5	1148257	Grated OFK	27.9 m	9%


Grade: was the #1 candidate the drain that was photographed?


☐ Correct ☑ Almost correct ☐ Not correct

Actual asset no.: 1148378

Report #9

19 Oct 2026, 6:32:55 PM · GPS ±16 m · -37.811610, 144.961246

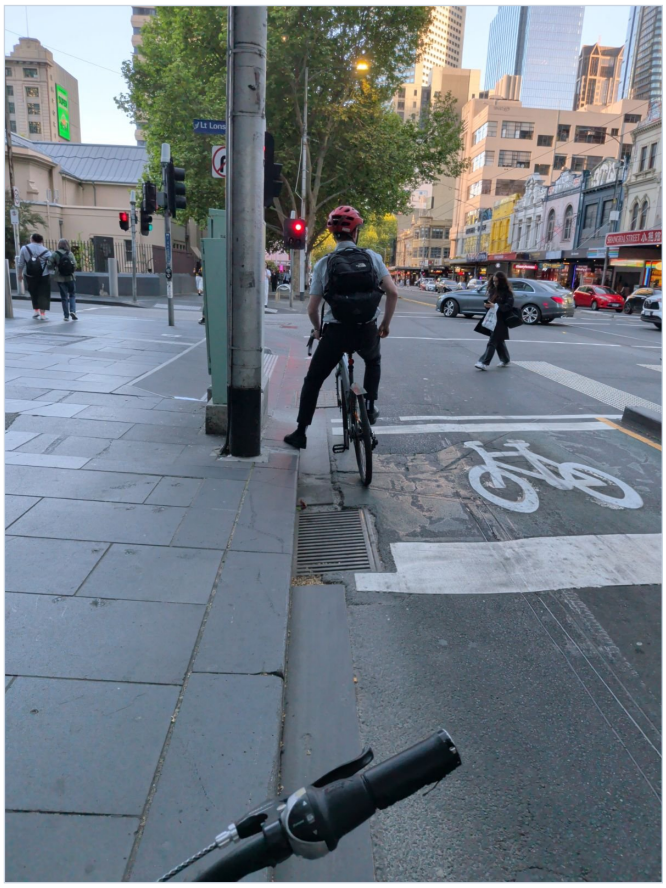

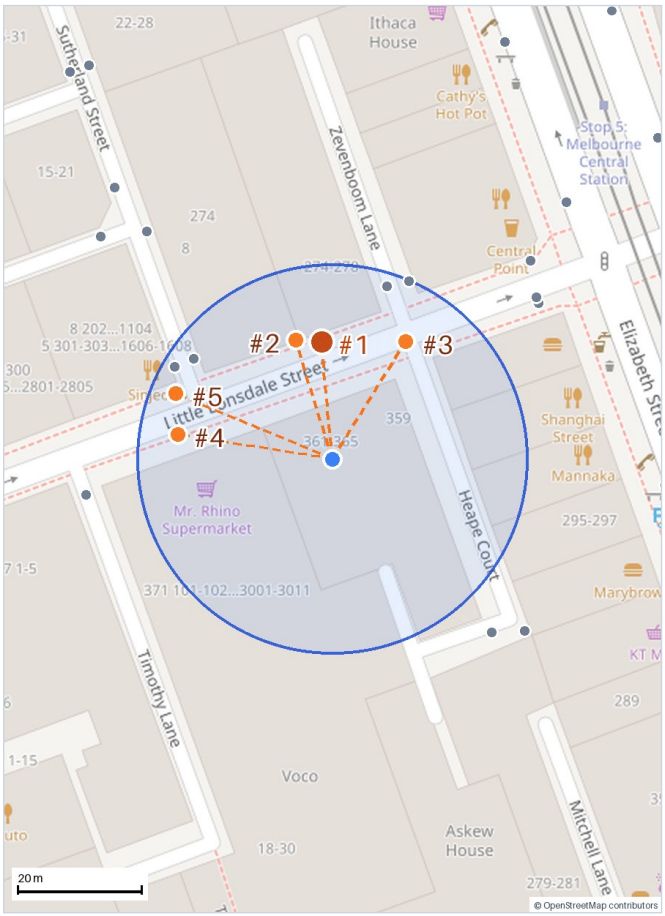

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1554076**	**Grated OFK**	**19.0 m**	**27%**
2	1800941	Grated OFK	20.0 m	25%
3	1140888	Grated Manhole	22.3 m	20%
4	1140891	Grated OFK	25.2 m	15%
5	1572377	Double Grated OFK	27.3 m	12%

Grade: was the #1 candidate the drain that was photographed?


☐ Correct ☐ Almost correct ☑ Not correct

Actual asset no.:

Report #10

19 Oct 2026, 6:35:44 PM · GPS ±10 m · -37.813978, 144.963123



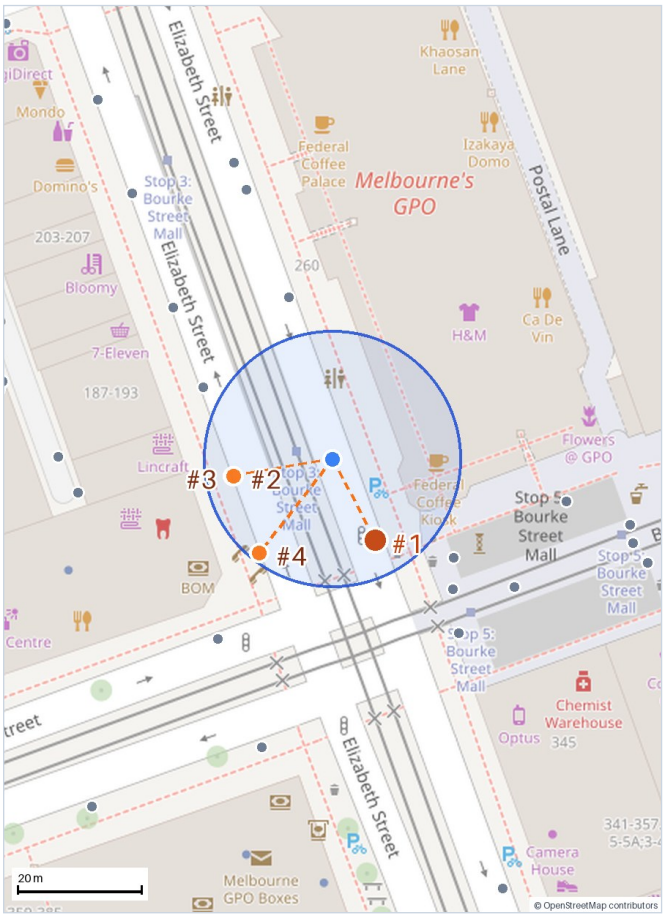

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1141078**	**Grated OFK**	**14.8 m**	**32%**
2	1575344	Grated OFK	16.1 m	26%
3	1364235	Grated OFK	16.3 m	26%
4	1141120	Grated OFK	19.1 m	16%


Grade: was the #1 candidate the drain that was photographed?


☑ Correct ☐ Almost correct ☐ Not correct

Actual asset no.: 1141078

Report #11

19 Oct 2026, 6:37:02 PM · GPS ±9 m · -37.815036, 144.964157

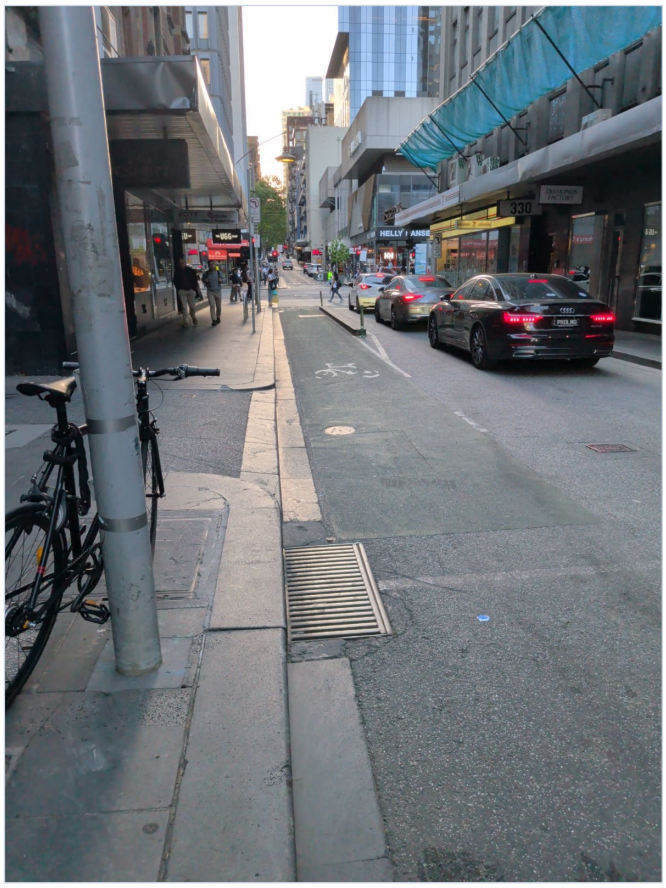

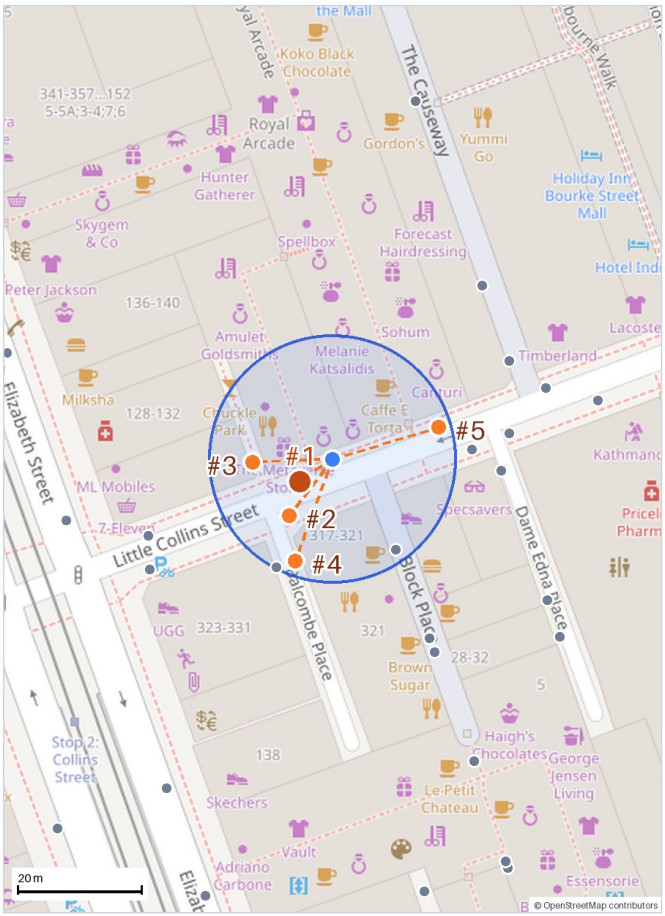

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1739360**	**Grated OFK**	**6.4 m**	**40%**
2	1142892	Grated OFK	11.5 m	24%
3	1599107	Lane Type	12.8 m	20%
4	1142890	Grated OFK	17.6 m	9%
5	1739359	Grated OFK	17.8 m	8%


Grade: was the #1 candidate the drain that was photographed?


☐ Correct ☑ Almost correct ☐ Not correct

Actual asset no.: 1142892

Report #12

19 Oct 2026, 6:39:16 PM · GPS ±8 m · -37.817121, 144.964703

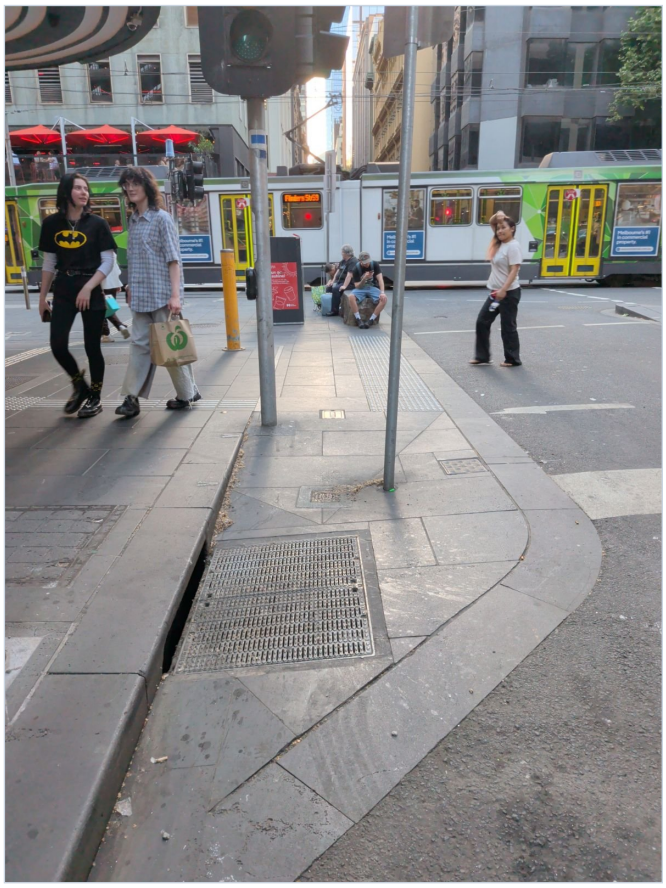

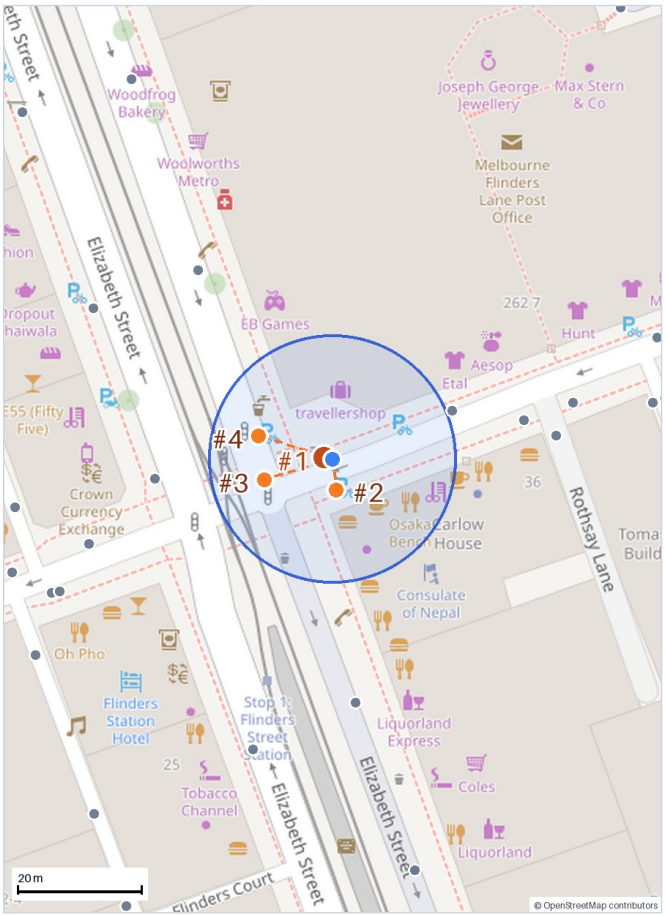

Left: submitted photo. Right: report location (blue dot) and search radius (blue circle); candidates #1 to #5 in orange (#1 darker and larger); other surface inlets in grey.

Candidate inlets

#	Asset no.	Type	Distance	Score
1	**1143233**	**Grated OFK**	**1.4 m**	**38%**
2	1143231	Grated OFK	5.0 m	33%
3	1142951	Grated Manhole	11.4 m	16%
4	1142950	Grated OFK	12.4 m	13%

Grade: was the #1 candidate the drain that was photographed?

☐ Correct ☑ Almost correct ☐ Not correct

Actual asset no.: 1143231