



SITE INVESTIGATION FACTUAL REPORT




Mapletree Cottage, Pebmarsh, Halstead, CO9
2NA.


GHG
06/03/2026

*PLEASE NOTE THAT OUR SOIL TESTING IS UNDERTAKE VIA A SEPARATE UKAS
ACCREDITED LAB*

SITE LAYOUT PLAN

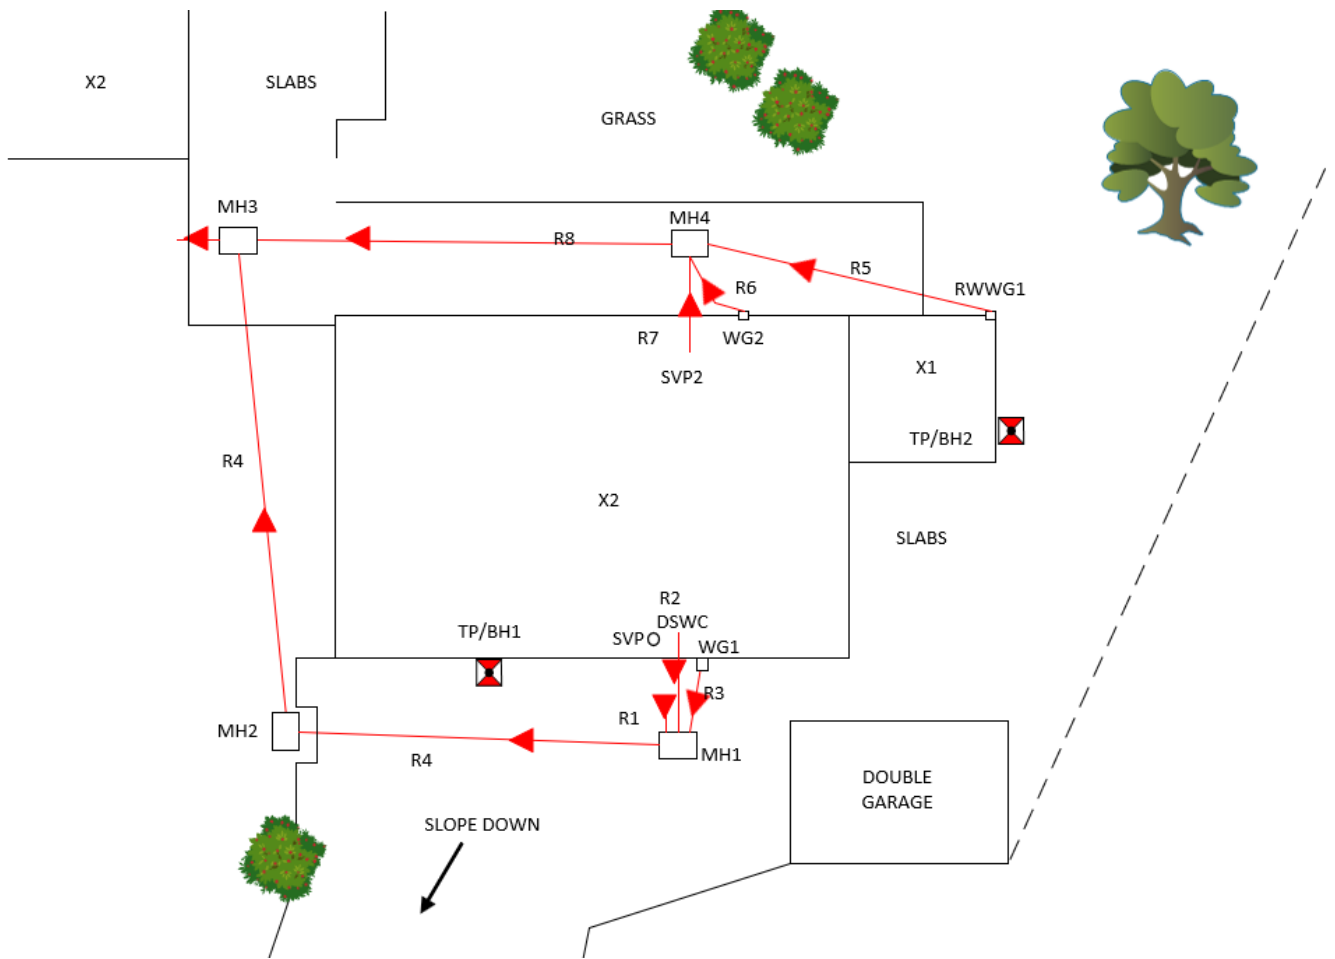

Trial Pit No: 1	Date: 06/03/2026	Site: Mapletree
Excavation Method: Hand Tools	Ground Level MOD	Client: GHG
Co-ordinates: SP		Weather During Survey: Dry

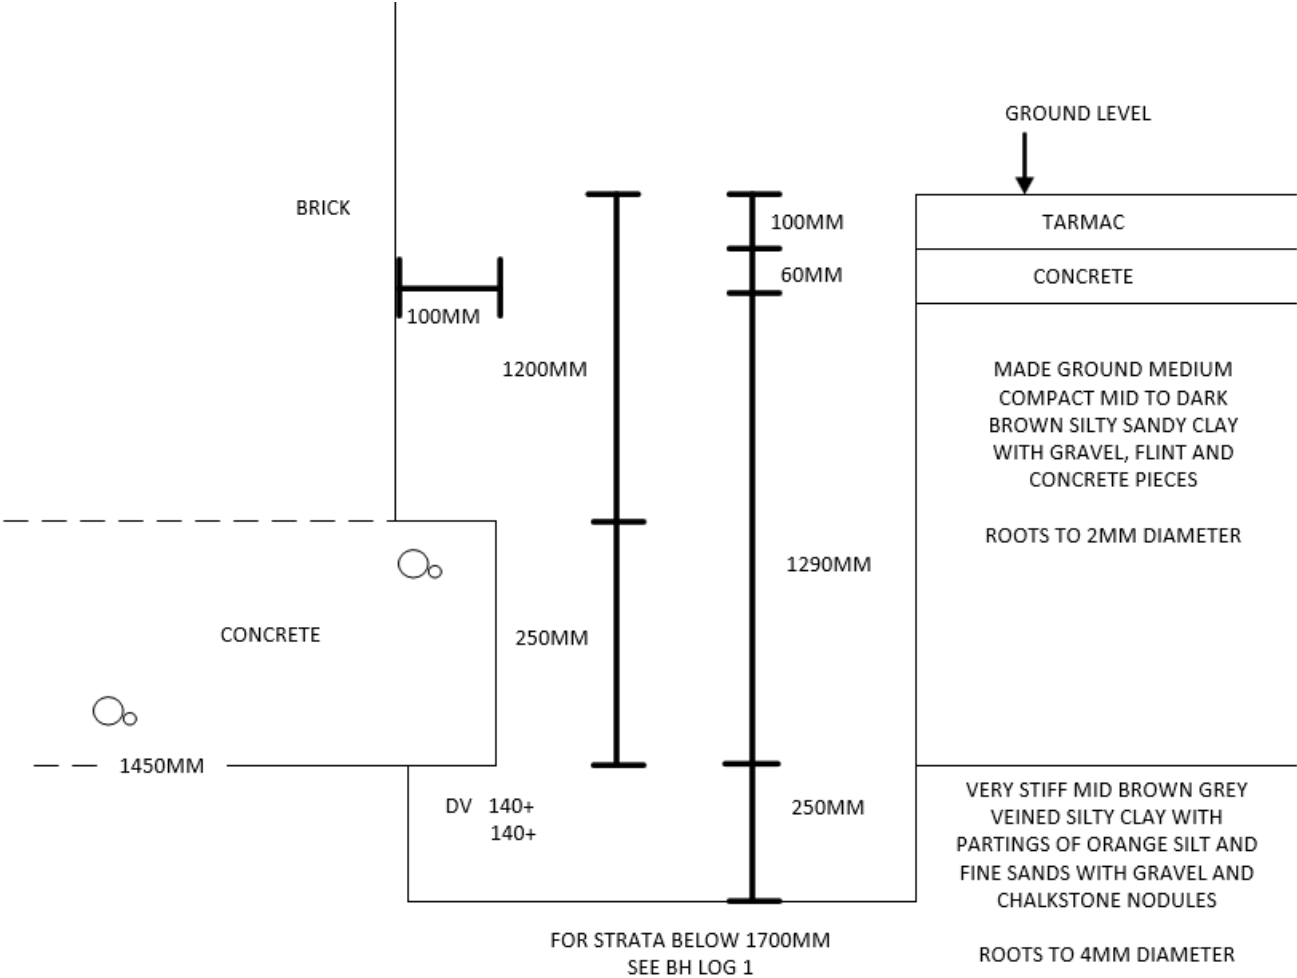

REMARKS:			KEY: D: SMALL DISTURBED SAMPLE J: JAR SAMPLE B: BULK DISTURBED SAMPLE V: PILCON VANE (kPa) U: UNDISTURBED SAMPLE (U100) M: MACKINTOSH PROBE W: WATER SAMPLE N: STANDARD PENETRATION TEST BLOW COUNT
LOGGED BY: SP	CHECKED BY:	APPROVED BY:	NOT TO SCALE



Borehole		1			Sheet:	1 of 1	Site:	Maple Tree House				
					Job No:	DW5603						
					Date:	06/03/2026						
Boring Method:		Hand Auger		Ground Level:			Client:	DW Solutions				
Diameter (mm):		75	Weather:		dry							
Depth	Soil Description						Samples and Tests					
(m)							Thickness	Legend	Depth	Type	Result	
0.00	See Trial Pit						1.70					
1.70	Very Stiff mid brown, grey veined silty CLAY with partings of orange silt and fine sand with gravel and chalkstone nodules.						1.30	x				
								x				
								x				
								x				
								x	2.00	DV	150+	
								x		150+		
								x				
								x				
								x				
								x	2.50	DV	150+	
								x		150+		
								x				
								x				
								x				
3.00	End of BH								3.00	DV	150+	
										150+		
Remarks: BH ends at 3.0m. BH dry and open on completion.						Key: D - Disturbed Sample B - Bulk Sample W - Water Sample Roots J - Jar Sample Roots V - Pilcon Shear Vane (kPa) Roots M - Mackintosh Probe Depth to Water (m) TDTD - Too Dense To Drive				To	Max	
										Depth	Dia	
										(m)	(mm)	
										1.80	2	
Logged: AC		Checked:		Approved:		Version		V1.0 28/01/16		N.T.S.		

Borehole		2	Sheet:		1 of 1	Site:	Maple Tree House				
			Job No:		DW5603						
			Date:		06/03/2026						
Boring Method:		Hand Auger		Ground Level:		Client:	DW Solutions				
Diameter (mm):		75	Weather:		Dry						
Depth	Soil Description					Thickness	Legend	Samples and Tests			
(m)								Depth	Type	Result	
0.00	See Trial Pit					0.80					
0.80	Very Stiff mid brown, grey veined silty CLAY with partings of orange silt and fine sand with gravel and chalkstone nodules.					2.20	x _ x				
							x _ x				
							x _ x	1.00	DV	150+	
							x _ x			150+	
							x _ x				
							x _ x				
							x _ x				
							x _ x	1.50	DV	150+	
							x _ x			150+	
							x _ x				
							x _ x				
							x _ x	2.00	DV	150+	
							x _ x			150+	
							x _ x				
							x _ x				
							x _ x	2.50	DV	150+	
							x _ x			150+	
							x _ x				
							x _ x				
							3.00	End of BH			
										150+	
Remarks: BH ends at 3.0m. BH dry and open on completion.					Key: D - Disturbed Sample B - Bulk Sample W - Water Sample Roots J - Jar Sample Roots V - Pilcon Shear Vane (kPa) Roots M - Mackintosh Probe Depth to Water (m) TDTD - Too Dense To Drive				To	Max	
									Depth	Dia	
									(m)	(mm)	
									1.30	2	
Logged: AC		Checked:		Approved:		Version		V1.0 28/01/16		N.T.S.	

Our Ref : DWS603
 Location : Maple Tree House
 Client : D.W Solutions
 Address : 39 Elmscroft Gardens, Potters Bar, Herts, EN6 2JP

Laboratory Summary Results

Date Sampled: 06/03/2026
 Date Received : 11/03/2026
 Date Tested : 17/03/2026
 Date of Report : 19/03/2026

Sample Ref		Type	# Moisture Content (%) [1]	# Soil Fraction > 0.425mm (%) [2]	# Liquid Limit (%) [3]	# Plastic Limit (%) [4]	~ Plasticity Index (%) [5]	~ Liquidity Index [5]	~ Modified Plasticity Index (%) [6]	~ Soil * Class [7]	# Filter Paper Contact Time (d)	# Soil Sample Suction (kPa) [8]	# Oedometer Strain [9]	~ Estimated * Heave Potential (Dd) (mm) [10]	In situ * Shear Vane Strength (kPa) [11]	Organic * Content (%) [12]	pH Value [13]	Sulphate Content		* Class [16]
TP/BH No	Depth (m)																	SO3 (g/l) * [14]	SO4 (mg/l) [15]	
1	U/S 1.45	D	21	<5	44	20	24	0.03	24	CI					> 150					
	2.0	D	17	8	45	20	25	-0.13	23	CI					> 150					
	2.5	D	16	<5											> 150					
	3.0	D	17	<5	47	20	27	-0.10	27	CI					> 150					

Test Methods / Notes

[1] BS 1377 - Part 2 : 2022 : Clause 4
 [2] Estimated if <5%, otherwise measured
 [3] BS 1377 - Part 2 : 2022 : Clause 5
 [4] BS 1377 - Part 2 : 2022 : Clause 6
 [5] BS 1377 - Part 2 : 2022 : Clause 6
 [6] BRE Digest 240 : 1993
 [7] BS 5930 : 2018 : Figure 8 - Plasticity Chart for the classification of fines soils

[8] Building Research Establishment Information Paper 4/93

[9] In Accordance with Documented In-House Method No. JHLP01: May 2011

[10] Estimated Heave Potential (Dd)

[11] Values of shear strength were determined in situ by CTS using

a Pilon hand vane or Geonor vane (GV).

[12] BS 1377 : Part 3 : 2018 + A1 2021 Clause 4 - Tested By CTS Leicester

[13] BS 1377 : Part 3 : 2018 + A1 2021 Clause 12 - Tested By CTS Leicester

[14] Sulphate content as SO3 as required by BS 1377: Part 3: 1990 has been provided for information purposes - Tested By CTS Leicester

[15] BS 1377 : Part 3 : 2018 + A1 2021 Clause 7.6 - Tested By CTS Leicester

[16] BRE Special Digest One (Concrete in Aggressive Ground) August 2005

Note that if the SO4 content falls into the DS-4 or DS-5 class, it would be prudent to consider the sample as falling into the DS-4M or DS-5M class respectively unless water soluble magnesium testing is undertaken to prove otherwise.

PSD Chart - BS 1377: Part 2 : 1990, Test No 9.2

~ Calculations performed using subcontracted data.

* These tests are not UKAS accredited

These tests have been subcontracted and carried out by PSL (Part of the Phenna Group)

Full reports can be provided upon request.

Key

D Disturbed sample (small)
 B Disturbed sample (bulk)
 U Undisturbed sample
 W Groundwater sample
 ENP Essentially Non-Plastic by inspection
 U/S Underside of Foundation

Test results reported relate only to the items tested.

This report shall not be reproduced except in full without approval of the laboratory.

The laboratory does not apply a conformity statement to test reports as standard, unless specifically requested by the customer.

Opinions and interpretations expressed herein are outside of the scope of UKAS accreditation.

Construction Testing Solutions Ltd - Lawness Barns, Mountmessing Road, Billericay, Essex, CM12 0TS

Version: BH V2 SUBCON - 16.04.2023

Our Ref : DWS603

Location : Maple Tree House

Client : D.W Solutions

Address : 39 Elmscroft Gardens, Potters Bar, Herts, EN6 2JP

Laboratory Summary Results

Date Sampled : 06/03/2026

Date Received : 11/03/2026

Date Tested : 17/03/2026

Date of Report : 19/03/2026

Sample Ref.		Type	# Moisture Content (%) [1]	# Soil Fraction > 0.425mm (%) [2]	# Liquid Limit (%) [3]	# Plastic Limit (%) [4]	~ Plasticity Index (%) [5]	~ Liquidity Index [5]	~ Modified Plasticity Index (%) [6]	~ Soil Class [7]	# Filter Paper Contact Time (d)	# Soil Sample Suction (kPa) [8]	# Oedometer Strain [9]	~ Estimated * Heave Potential (Dd) (mm) [10]	In situ * Shear Vane Strength (kPa) [11]	Organic * Content (%) [12]	pH Value [13]	Sulphate Content		* Class [16]
TP/BH No.	Depth (m)																	SO ₃ (g/l) [14]	SO ₄ (mg/l) [15]	
2	U/S 0.60	D	19	8	46	20	26	-0.03	24	CI					> 150					
	1.0	D	19	<5	45	20	25	-0.05	25	CI					> 150					
	1.5	D	17	<5											> 150					
	2.0	D	16	<5	44	20	24	-0.18	24	CI					> 150					
	2.5	D	16	8											> 150					
	3.0	D	17	<5	45	20	25	-0.12	25	CI					> 150					

Test Methods / Notes

[1] BS 1377 - Part 2 : 2022 : Clause 4

[2] Estimated if <5%, otherwise measured

[3] BS 1377 - Part 2 : 2022 : Clause 5

[4] BS 1377 - Part 2 : 2022 : Clause 6

[5] BS 1377 - Part 2 : 2022 : Clause 6

[6] BRE Digest 240 : 1993

[7] BS 5930 : 2018 : Figure 8 - Plasticity Chart for the classification of fines soils

[8] Training Research Establishment Instruction Paper 4/93

[9] In Accordance with Documented In-House Method No. IHLTP01: May 2011

[10] Estimated Heave Potential (Dd)

[11] Values of shear strength were determined in situ by CTS using

a Pilon hand vane or Geomir vane (GV).

[12] BS 1377 : Part 3 : 2018 + A1 2021 Clause 4 - Tested By CTS Leicester

[13] BS 1377 : Part 3 : 2018 + A1 2021 Clause 12 - Tested By CTS Leicester

[14] Sulphate content as SO₃ as required by BS 1377: Part 3: 1990 has been provided for information purposes - Tested By CTS Leicester

[15] BS 1377 : Part 3 : 2018 + A1 2021 Clause 7.6 - Tested By CTS Leicester

[16] BRE Special Digest One (Concrete in Aggressive Ground) August 2005

Note that if the SO₄ content falls into the DS-4 or DS-5 class, it would be prudent to consider the sample as falling into the DS-4M or DS-5M class respectively unless water soluble magnesium testing is undertaken to prove otherwise.

PSD Chart - BS 1377: Part 2 : 1990, Test No 9.2

~ Calculations performed using subcontracted data.

* These tests are not UKAS accredited

These tests have been subcontracted and carried out by PSL (Part of the Phenna Group)

Full reports can be provided upon request.

Key

D Disturbed sample (small)
 B Disturbed sample (bulk)
 U Undisturbed sample
 W Groundwater sample
 ENP Essentially Non-Plastic by inspection
 U/S Underside of Foundation

Test results reported relate only to the items tested.

This report shall not be reproduced except in full without approval of the laboratory.

The laboratory does not provide a conformity statement to test reports as standard, unless specifically requested by the customer.


Opinions and interpretations expressed herein are outside of the scope of UKAS accreditation.

Construction Testing Solutions Ltd - Lawness Barns, Mountmessing Road, Billericay, Essex, CM12 0TS

Version: BH V2 SUBCON - 16.04.2023

Moisture Content Profiles

Our Ref : DWS603
 Location : Maple Tree House
 Work carried out for: D.W Solutions

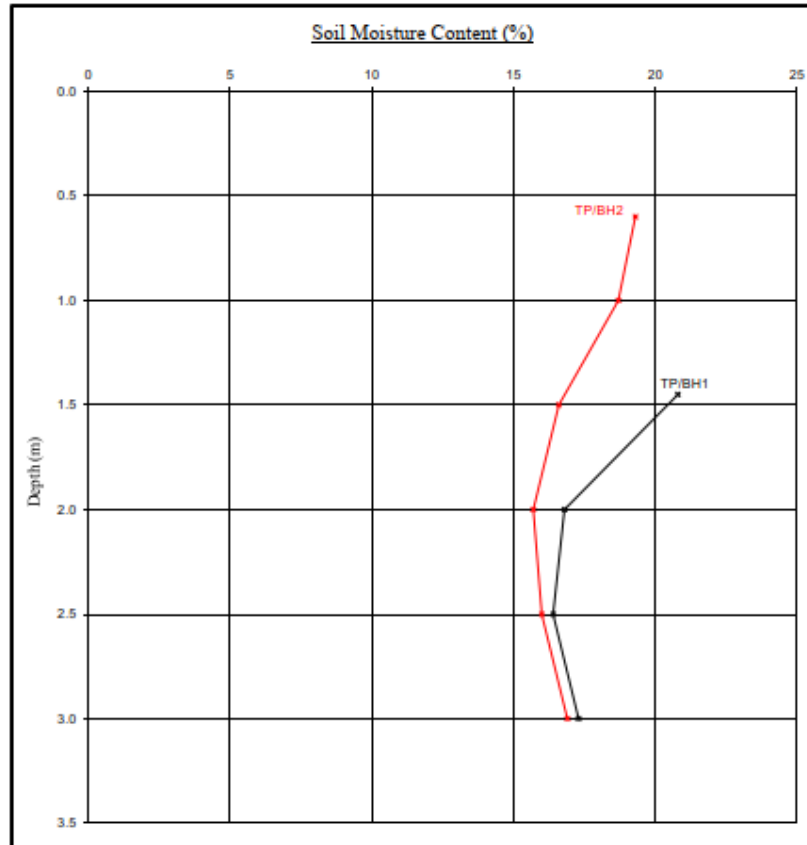


Notes

1. If plotted, 0.4 LL and PL+2 (after Driscoll, 1983) should only be applied to London Clay (and similarly overconsolidated clay) at shallow depths.
2. Unless specifically noted the profiles have not been related to a site datum.

Shear Strength Profiles

Date Sampled : 06/03/2026
 Date Received : 11/03/2026
 Date Tested : 17/03/2026
 Date of Report : 19/03/2026

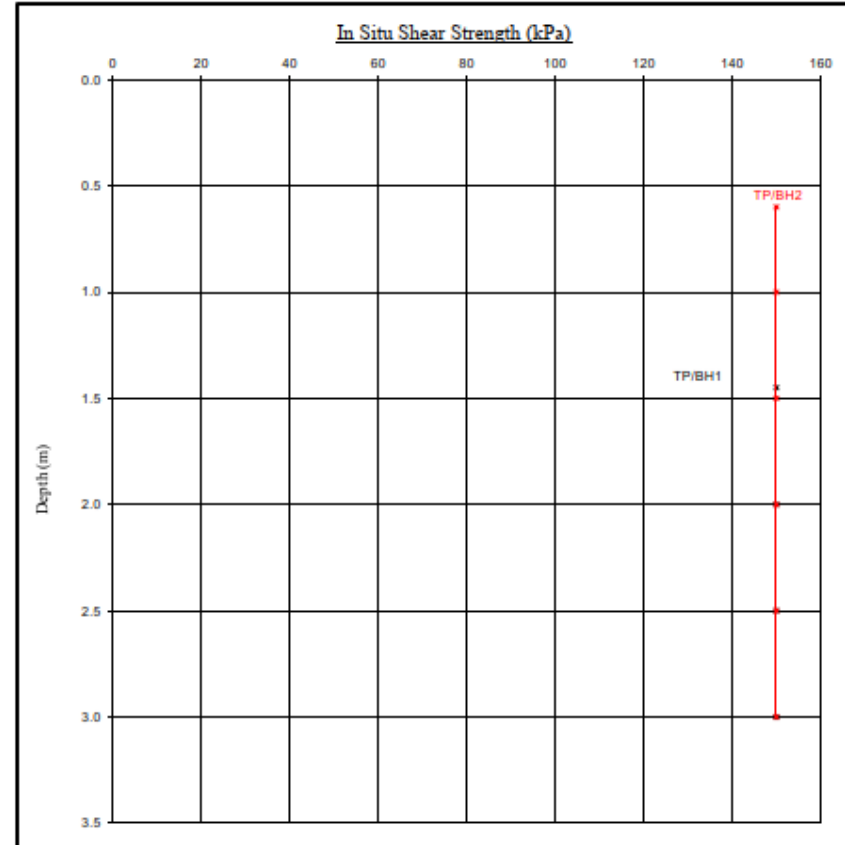

Note

1. Unless otherwise stated, values of Shear Strength were determined in situ by CTS using a Pilcon Hand Vane the calibration of which is limited to a maximum reading of 130 kPa.
2. Unless specifically noted the profiles have not been related to a site datum.

DW Solutions
1st and 2nd floor
2 West Street
Ware
Hertfordshire
SG12 9EE

Intec
Parc Menai, Bangor,
Gwynedd, North Wales
LL57 4FG
Tel: 01248 672652
Fax: 01248 672601

ROOT IDENTIFICATION

Maple Tree,

Client Reference: DWS
Report Date: 30 March 2026
Our Ref: R67184

Sub Sample	Species Identified		Root Diameter	Starch
TP1:				
USF	<i>Salix</i> spp. *	1	3 mm	Abundant
BH1:				
1.6m	<i>Salix</i> spp. *	2	1.5 mm	Moderate
TP2:				
USF	<i>Acer</i> spp.	3	2 mm	Abundant
BH2:				
1.3m	<i>Acer</i> spp.		<1 mm	Moderate
1.3m	<i>Salix</i> spp. *		<1 mm	Moderate

Comments:

- 1 - Plus 1 other also identified as *Salix* spp.
- 2 - Plus 1 other also identified as *Salix* spp.
- 3 - Plus 2 others also identified as *Acer* spp.

Salix spp. are willows.

Acer spp. are maples, including sycamore, Norway maple, and Japanese maples.

* EPSL research has developed a unique ability to differentiate Willows from Poplars. No other laboratory in the UK can currently provide this service. We now offer this benefit at no extra cost.

Signed: M D Mitchell

Unless we are otherwise instructed in writing, the above sample material will normally be disposed of 6 years after the date of this report.



Registered in England No. 295427 Registered Office: Unit 4 Linnet Court, Cawledge Business Park, Alnwick, NE66 2GD

INVESTOR IN PEOPLE

