

Flexural performance of reinforced concrete beams subjected to accelerated non-uniform corrosion

Jin Huang (✉ hkking721@zjsru.edu.cn)

Zhejiang Shuren University

Dezhong Yu

Zhejiang Shuren University

Yunzhong Cao

Zhejiang Shuren University

Chuanqing Fu

Zhejiang University of Technology

Research Article

Keywords: Non-uniform corrosion, accelerated corrosion, RC beam, cracking behavior, flexural performance degradation

Posted Date: August 14th, 2023

DOI: <https://doi.org/10.21203/rs.3.rs-3061256/v1>

License: © ⓘ This work is licensed under a Creative Commons Attribution 4.0 International License.

[Read Full License](#)

Version of Record: A version of this preprint was published at Materials and Structures on January 25th, 2024. See the published version at <https://doi.org/10.1617/s11527-023-02292-9>.

Flexural performance of reinforced concrete beams subjected to accelerated non-uniform corrosion

Jin Huang ^{a*}, Dezhong Yu ^a, Yunzhong Cao ^a, Chuanqing Fu ^b

^aCollege of Urban Construction, Zhejiang ShuRen University, Hangzhou, 310015, China

^bCollege of Civil Engineering and Architecture, Zhejiang University of Technology, Hangzhou, 310014, China

Abstract: In this study, a modified accelerated corrosion method based on the traditional galvanic method was adopted to generate non-uniform corrosion of reinforcement. The flexural performance of corroded RC beams was experimentally investigated, aiming to study the influence of longitudinal reinforcements corrosion induced by two different accelerated corrosion methods on the degradation of flexural capacity of RC beams. The corrosion-induced and load-induced cracking behaviors, as well as the degradation of flexural performance of beam specimens corroded by these two different methods were studied. The test results showed that the longitudinal reinforcements subjected to the modified accelerated corrosion method demonstrates a considerably higher circumferential and longitudinal non-uniformity, while the traditional accelerated corrosion method induces a rather uniform corrosion. For the corrosion-induced crack, the non-uniform reinforcement corrosion induced by the modified accelerated corrosion method was closer to the one after exposure to the natural environment. The non-uniformity of corrosion aggravates the propagation of both corrosion-induced and load-induced cracks, leading to the change of flexural failure mode. And the uniform corrosion induced by the traditional accelerated corrosion method underestimates the degradation of shear capacity of RC beam, especially in the cases of corrosion degree no less than 15%.

Keywords: Non-uniform corrosion; accelerated corrosion; RC beam; cracking behavior; flexural performance degradation

1. Introduction

Since the late 1960s, the corrosion of reinforcement has been regarded as one of the most intractable problems that threaten the safety of reinforced concrete (RC) structures [1–3]. More than half of the structural failure worldwide are found to be closely related to this issue, according to an incomplete field survey [2,3]. In general, the degradation of mechanical performance of corroded RC structures is mainly attributed to the considerable reduction in cross-section of reinforcement [4,5], the poorer integrity of the structural members due to the corrosion-induced cracking or spalling [6,7], and the weakened bond performance of reinforcement to the surrounding concrete [8,9]. Besides, among the detrimental factors, the ingress of chloride ions through the connected pores, micro channels, etc., to reach the surface of reinforcement has been widely acknowledged as the most predominant cause to facilitate the corrosion process [10–12]. As such, over the past few decades, substantial efforts have been devoted to tackle the issue of chloride-induced reinforcement corrosion upon various experimental studies [13–15].

Considering the fact that conducting an actual corrosion test in natural environment is time-consuming, an alternative of using accelerated corrosion techniques, such as galvanic method and artificial climate exposure method, is more commonly adopted [14,15]. For the galvanic method, whilst it can generate reinforcement

corrosion to a targeted level with a high accuracy in a short time, only the uniform corrosion along the circumference and the longitudinal can be obtained in most cases [16]. This is, however, quite different from the corrosion patterns induced by the natural environment [17,18]. Instead, for the artificial climate exposure method, it has been experimentally evidenced to reproduce the corrosion patterns more realistically [19]. In practice, to implement this method, a multi-functional environmental chamber is generally needed and more time is required in comparison with the galvanic method [20]. Therefore, it is encouraged to develop a preferable method to combine the advantages of these two methods and generate non-uniform reinforcement corrosion in a short time.

To this end, based on the traditional galvanic method, a modified accelerated corrosion method was proposed by the authors, in which the auxiliary electrode was replaced by a pre-embedded stainless wire close to the targeted reinforcements [21,22]. Such an attempt was further applied to evaluate the bond degradation of reinforcement to the concrete caused by the non-uniform reinforcement corrosion [23]. The results demonstrated that compared to the uniformly corroded specimen, the bond performance of the specimens with non-uniform corrosion degraded much more significantly, accompanied with a more serious cracking behavior as expected [24]. However, given the different stress states and mechanisms of force transfer, it remains unclear how would the flexural performance of RC beams be affected when the non-uniform reinforcement corrosion is taken into consideration.

The objective of this study is to compare the cracking behaviors and the degradation of flexural performance of beam specimens subject to two different accelerated corrosion methods, i.e., the modified galvanic method proposed by the authors and the traditional galvanic method. The emphases will be placed on the development of cracks induced by reinforcement corrosion and external load, and the degradation of the flexural stiffness, ultimate bearing capacity, and ductility.

2. Experimental program

2.1 Materials

The mixture proportion of the concrete is given in **Table 1**. The ordinary Portland cement CEM I 42.5 was used as the binder. The natural gravel with a continuous grading range of 5-20 mm was used as the coarse aggregate, and the river sand with the fineness modulus of 2.6 was used as the fine aggregate. The average compressive strength of the concrete cubes (150 mm × 150 mm × 150 mm) at the age of 28 d was 30.3 MPa.

As to the reinforcement, the ribbed steel bar HRB 400 with the diameter of 12 mm was used as longitudinal reinforcement in tension zone, while the plain steel bar HPB 300 with the diameter of 8 mm was applied in compression zone. In addition, the plain steel bar HPB 300 with the diameter of 6 mm was used as stirrups at an interval of 70 mm.

Table 1

Mixture proportions of concrete (kg/m³).

Cement	Fine aggregate	Coarse aggregate	Water	Water-to-cement ratio
460	512	1252	175	0.38

2.2 Specimens preparation

To compare the cracking behaviors and the degradation of flexural performance of RC beams resulted from different reinforcement corrosion conditions; nine specimens with an identical dimension of 1000 mm × 100 mm × 150 mm were designed. Among them, one corrosion-free beam was specified as the control specimen (B-0-0), and the rest eight specimens were corroded using two different accelerated corrosion techniques (described in section

2.3), respectively. The detailed dimensions of the specimens are illustrated in **Fig. 1**.

For each specimen, six strain gages were stuck on two tensile longitudinal reinforcements within the pure bending regions. After installing the reinforcement cage into the wooded mold, as well as the stainless wire, if any, all the beams were cast with a needle vibrator. The specimens were then demolded after 24 h, followed by 28 d moist curing with the relative humidity being 90% and the temperature being $20 \pm 5^\circ\text{C}$.

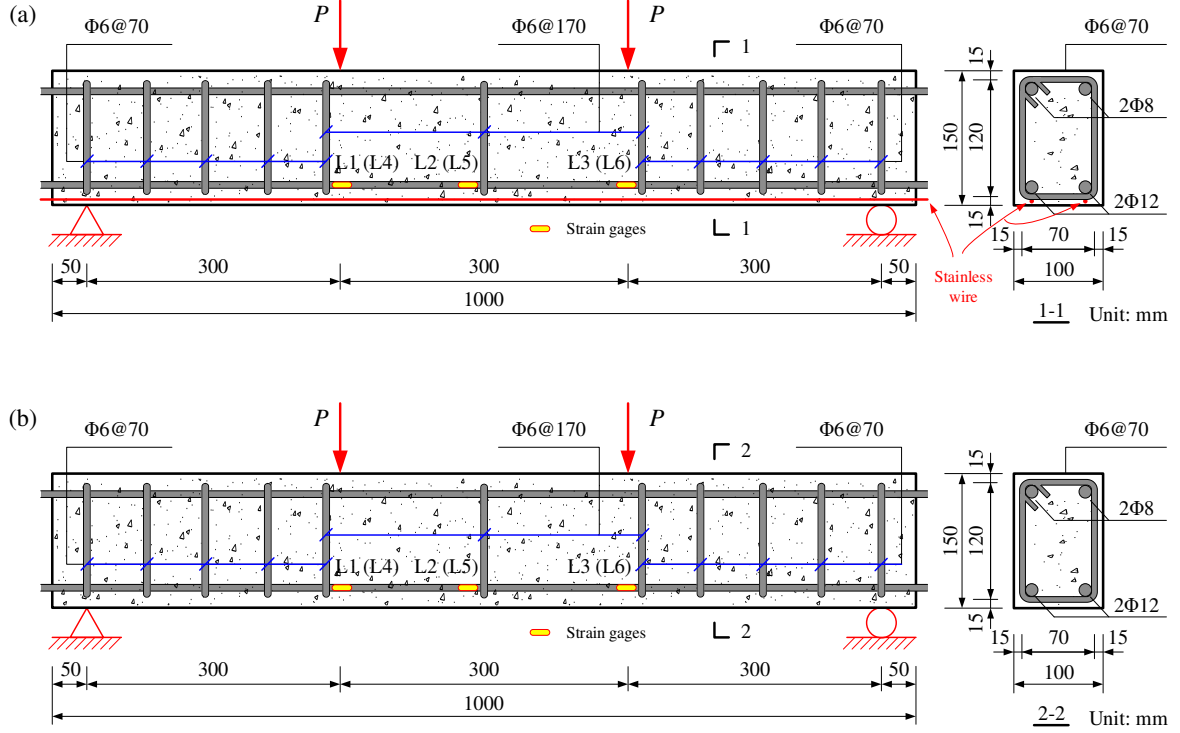


Fig. 1 Dimensions of the specimens subjected to (a) modified accelerated corrosion with auxiliary electrode, and (b) traditional accelerated corrosion.

2.3 Accelerated corrosion techniques

As mentioned above, two accelerated corrosion techniques were adopted in this study to generate different reinforcement corrosion characteristics, namely, uniform corrosion and non-uniform corrosion. Particularly, for the non-uniform corrosion of reinforcement, a modified technique based on the traditional galvanic method was proposed, in which an additional stainless wire with a diameter of 0.5 mm was used as auxiliary electrode, as shown in **Fig. 1 (a)**.

Fig. 2 schematically illustrates the principle for the accelerated non-uniform corrosion method. The longitudinal reinforcement to be corroded was considered as the anode, and the stainless steel wire was used as the cathode. The diameter of the stainless steel is far less than that of the longitudinal reinforcement, i.e., 0.5 mm in the present study. In this regard, the distribution of current density under impressed current is influenced by the distance (i.e., l_0 , l_1 , l_2 to l_n in **Fig. 2**) to the stainless wire, which varies depending on the location (i.e., D_0 , D_1 , D_2 to D_n in **Fig. 2**) around the circumference of the longitudinal reinforcement. During the period of impressing current, the point D_0 on the surface of longitudinal reinforcement that is closest to the stainless wire experiences the highest current density and therefore shows the most severe corrosion. Conversely, the point on the surface of longitudinal reinforcement that is opposite the stainless steel wire is not or less corroded due to the ion channel being blocked by the longitudinal reinforcement itself.

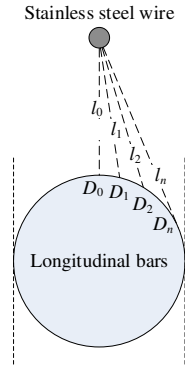


Fig. 2 Illustration for the position of longitudinal reinforcements and stainless steel wire in the accelerated non-uniform corrosion method

Fig. 3 demonstrates the setup for the accelerated corrosion, regarding the modified accelerated corrosion system shown in **Fig. 3(c)**, the impressed current was provided by a controllable direct current (DC) power supply at a rated current density of $100 \mu\text{A}/\text{cm}^2$, and the anode of DC source was connected to the longitudinal reinforcement while the cathode was connected to the pre-embedded stainless wire. In order to facilitate the observation of the development of corrosion-induced cracks during the process of electrification, and to avoid the seepage of rust along the expansion cracks, the tensile bottom surface of the beam specimen is facing upward. To facilitate the corrosion process, the specimen was semi-immersed into a 3.5% (by mass) NaCl solution, and the top surface of the beam was covered sponge (periodically wetted by 3.5% NaCl solution) and water-retaining plastic covering in sequence. as shown in **Fig. 3(b)**. For the traditional accelerated corrosion system, it is very similar to the above mentioned modified one except for the arrangement of the cathode, in which it was replaced by an external copper bar (**Fig. 3(d)**). It should be noted that to exclude the influence of the corrosion of stirrups in the following test, the contact points between longitudinal reinforcements and stirrups are separated by insulating tape, as shown in **Fig. 3(a)**.

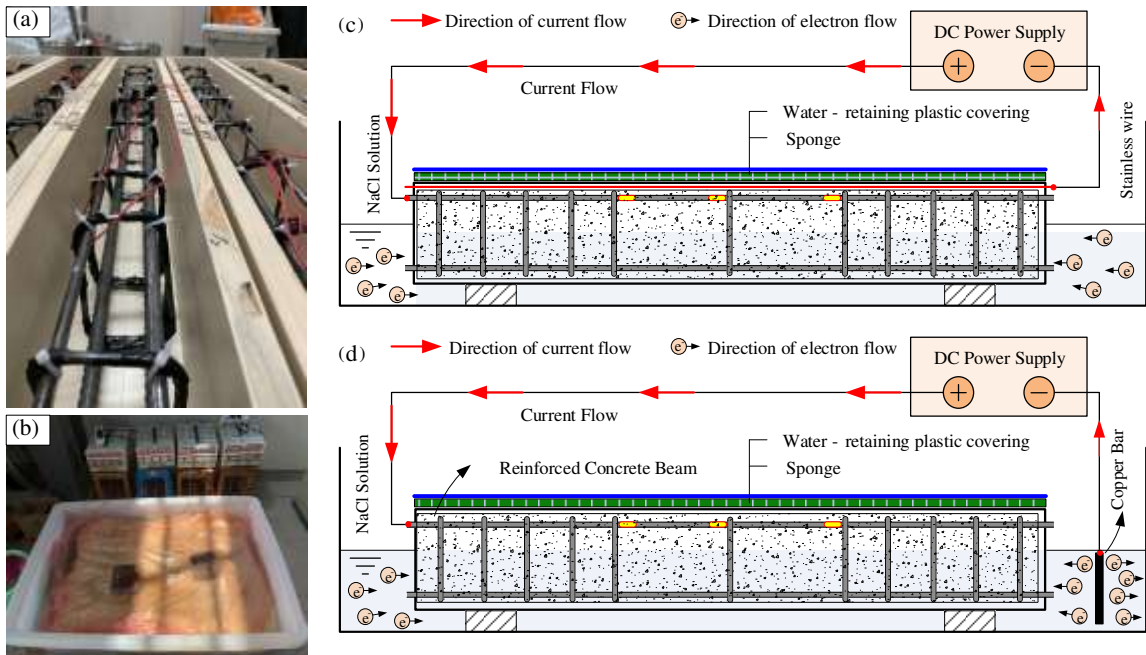


Fig. 3 Test setup for the accelerated corrosion, (a) reinforcement cage, (b) actual experimental setup, (3) illustration of the accelerated non-uniform corrosion method, and (4) illustration of the traditional accelerated corrosion method.

The field survey has shown that according to the magnitude of induced damage to the concrete, the corrosion level of reinforcement can be categorized into three degrees: minor corrosion (0-5%), moderate corrosion (5-12%), and severe corrosion (more than 12%) [25,26]. Hence, in this study, four typical corrosion levels, i.e. 5%, 10%, 15% and 20%, were considered, and the respective duration of the accelerated corrosion process to achieve the targeted level of reinforcement corrosion η_d was determined as per the Faraday's law [27],

$$\Delta m = \frac{I \times t \times M}{n \times F_a} \quad (1)$$

$$\eta_d = \frac{\Delta m}{m_i} \times 100\% \quad (2)$$

where Δm is the mass loss, I is the current (A), t is the duration of accelerated corrosion process (s), n is number of equivalents transferred per mol of iron ($n = 2$), M is the molecular mass of iron ($M = 56$ g), F_a is the Faraday's constant ($F_a = 96500$ A·s), and m_i is the initial mass of the reinforcement before corrosion. The actual corrosion level η_a was calculated as the weight loss percentage of the original state, that is,

$$\eta_a = \frac{\Delta m}{m_i} \times 100\% = \frac{m_i - m_f}{m_i} \times 100\% \quad (3)$$

where m_f is the final mass of the corroded reinforcement. This value can be obtained by weighting the steel reinforcements extracted from corresponding specimen after the four-point bending test, before which the corrosion products should be removed by mechanical and chemical cleaning as per the standard ASTM G1-03 [28]. Once the designed duration of impressing current reached, as shown in **Table 2**.

Table 2

Electrification time (h) of steel bars

Steel bars	Target corrosion degree			
	5%	10%	15%	20%
C 12	1080	2160	3240	4320

In this study, a grid of 25 mm × 38 mm was created on transparent plastic paper and placed on the surfaces of beam specimens. The progression of corrosion-induced cracks on these surfaces was then periodically mapped, and the width of each crack was measured using a crack visualizer with an accuracy of 0.01 mm, as shown in **Fig. 4**. In addition, to document the specimens clearly, they were labeled as B-N/U-xx in the following, in which B represents the beam, N/U denotes the corrosion mode (non-uniform or uniform corrosion), and xx is the targeted corrosion level (5%, 10%, 15% or 20%). For example, the nomenclature of B-N-10 refers to the specimen subjected to non-uniform corrosion with a targeted corrosion level of 10%.



Fig. 4 Measurement of corrosion-induced cracks

2.4 Loading test

Upon the completion of the corrosion process when reaching the targeted corrosion levels, all the beam specimens were moved out of the containers and naturally dried for a few days. After that, the surfaces of the beam specimens were white-washed with latex for recording the load-induced cracks during the subsequent loading test.

Prior to formal loading, it is recommended that the beam specimen be preloaded to establish close contact between the support and the specimen, as well as to ensure that all test equipment components are firmly in place, as shown in **Fig. 5(a)**. Additionally, it is important to verify that the measuring apparatus is functioning properly and that the load-deflection relationship remains stable. Two stages were applied for the loading process of beam specimens. As shown in **Fig. 5(b)**, the beams were loaded with an increment of 20% ultimate bearing capacity at early stages. Following the initial load-induced crack, the loading process was regulated by displacement, with a rate of 0.4 mm/min. A portable microscope with a resolution of 0.01mm was used to measure the width of load-induced cracks at each interval of loading, as illustrated in **Fig. 5(c)**

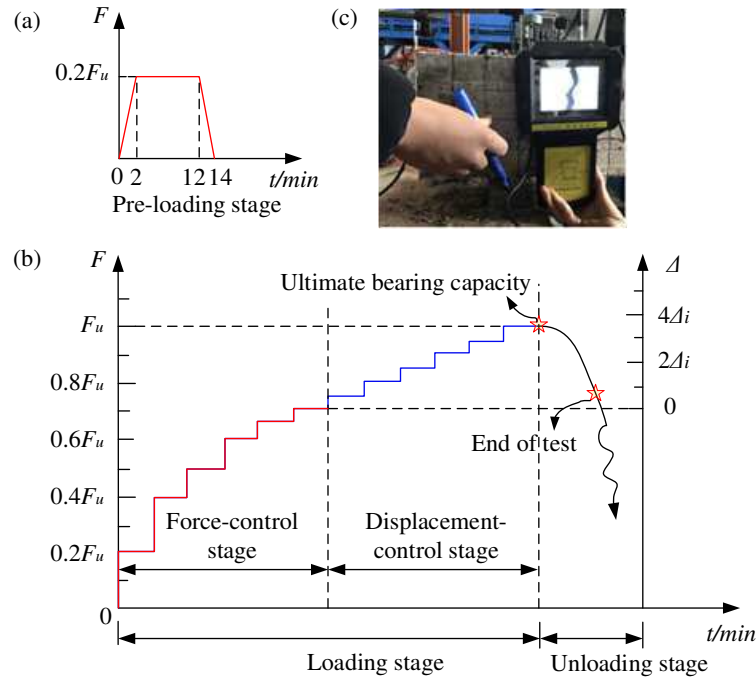


Fig. 5 Loading process, where F_u is the ultimate bearing capacity and Δ_i is the displacement increment at displacement-control stage.

For each beam specimen, the four-point bending test shown in **Fig. 6(a)** was performed to evaluate its flexural behavior. The beam was simply supported at two points near the ends, and the external load was applied by a hydraulic actuator and then distributed by a rigid I-beam. During the test, three reading meters with an accuracy of 0.01 mm were used to measure the displacements at the both ends and the mid-span deflection. Moreover, to measure the evolution of concrete strain, on the back side of the beam, six strain gauges were evenly stuck along the height at the interval of 30 mm, as illustrated in **Fig. 6(c)**.

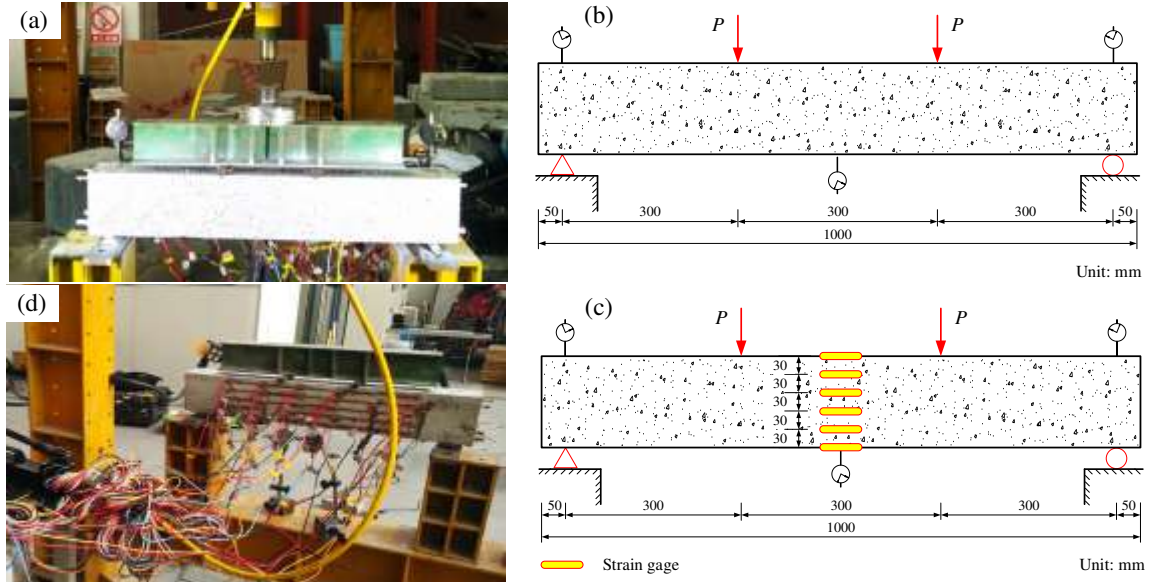


Fig. 6 Setup for the four-point bending test.

2.5 Measurement of corrosion degree

After failure, the longitudinal reinforcements were removed from the beam specimens. The ASTM G1-03[28] mechanical cleaning process using a bristle brush was performed twice. It is important to note that the same cleaning process was applied to the un-corroded longitudinal reinforcements in the control beam specimen, and the mass loss due to cleaning was negligible. The actual corrosion level η_a was calculated as the weight loss percentage of the original state, the results of which were listed in **Table 3**. To examine the corrosion morphology as well as the distribution of cross-sectional area of longitudinal reinforcements, a 3D laser scanner (Roland LPX 3D Laser Scanner) was utilized after mechanical cleaning process of the longitudinal reinforcements. The scanning speed was 37 mm/s, with a positioning accuracy of 0.02 mm.

Table 3

Summary of the four-point bending test results.

Specimens	η_a / %	Failure mode	P_y / kN	P_u / kN	Δ_y / mm	Δ_u / mm	K_e / kN/mm	β
B-0-0	0.00	Y	47.13	50.27	4.61	15.46	10.22	3.35
B-N-05	4.60	Y	48.84	52.23	4.54	15.72	10.76	3.46
B-N-10	9.64	Y	41.76	45.45	4.97	14.71	8.40	2.96
B-N-15	14.50	Y	36.59	42.27	6.44	14.35	5.68	2.23
B-N-20	19.33	R	27.58	30.43	8.36	9.97	3.30	1.19
B-U-05	4.71	Y	49.21	51.28	4.60	15.85	10.70	3.43
B-U-10	9.39	Y	44.72	46.37	5.13	16.13	8.72	3.14
B-N-15	14.60	Y	43.36	44.24	7.09	16.03	6.12	2.26
B-U-20	19.52	B	-	39.21	-	10.64	-	-

Note: 1. For the failure mode: Y is yielding of tensile reinforcement, R is rupture of tensile reinforcement, and B is bond failure of tensile reinforcement to the concrete.

2. P_y and P_u are the loading bearing capacities of the specimen at yielding stage and failure stage, respectively; while Δ_y and Δ_u are the mid-span deflections at the corresponding stages.

3. K_e is the elastic stiffness of the beam, and β represents the ductility ratio, i.e., $\beta = \Delta_u / \Delta_y$.

3 Experimental results and discussion

3.1 Corrosion morphology of longitudinal reinforcements

Based on the 3D scan results, the cross-section with the minimum area over the entire length of each corroded longitudinal reinforcements was extracted as shown in **Fig. 7**. For longitudinal reinforcements subjected to the accelerated non-uniform corrosion method, in the case of minor corrosion (i.e. $\eta_a = 4.60\%$ in **Fig. 7(a)**), the corrosion mainly initiated from the side facing the stainless steel wire, while the back side of the longitudinal reinforcements was rarely corroded. As the corrosion spreads, more severe corrosion emerged on the side facing the stainless steel wire, resulting in a non-uniform corrosion pattern around the circumference of longitudinal reinforcements. In contrast, for longitudinal reinforcements subjected to the traditional accelerated corrosion method, relatively uniform corrosion occurred around the circumference of longitudinal reinforcements. The maximum pitting depth (d_s) increased progressively with increasing degree of corrosion. It is noteworthy that longitudinal reinforcements subjected to accelerated non-uniform corrosion produced significantly greater d_s values than those for uniformly corroded longitudinal reinforcement under the same degree of corrosion.

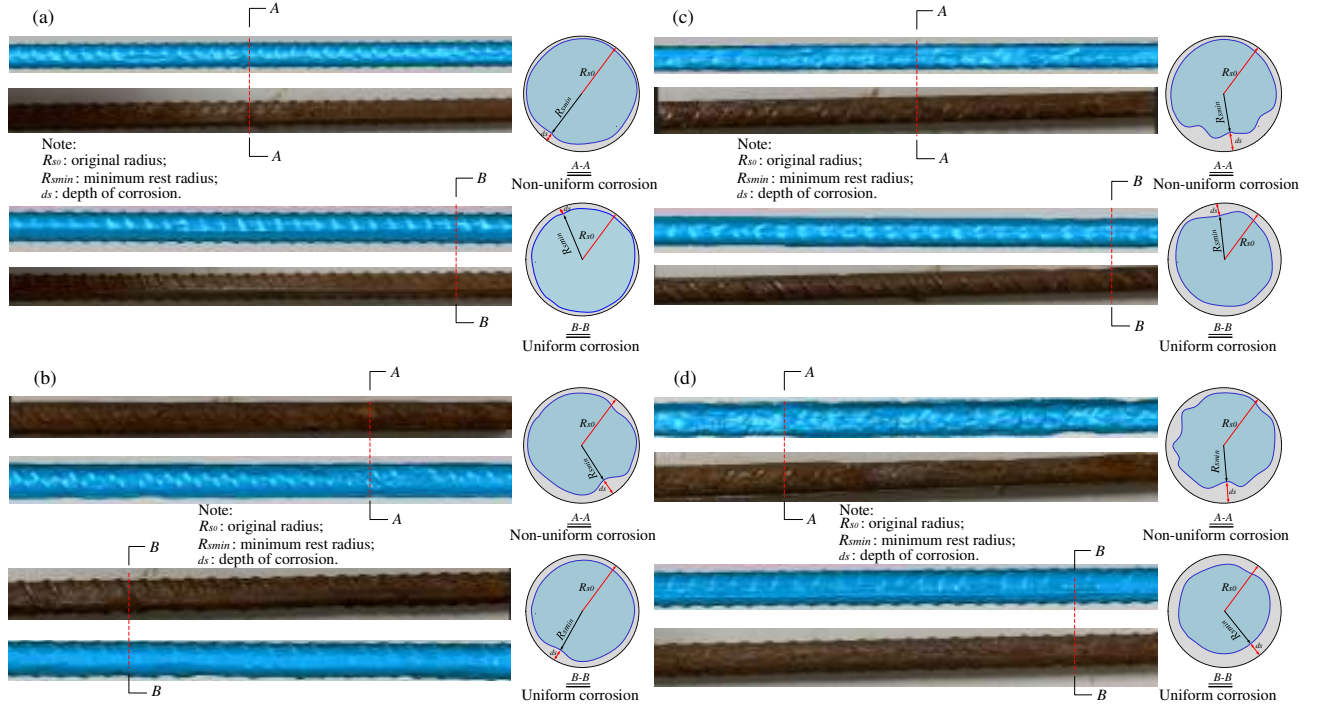


Fig. 7 Corrosion morphology around the circumference of longitudinal reinforcements in the cases of (a) $\eta_a = 4.6\%$, (b) $\eta_a = 9.5\%$, (c) $\eta_a = 14.5\%$, (d) $\eta_a = 19.4\%$ subjected to non-uniform and uniform accelerated corrosion methods.

In addition to the circumferential non-uniformity, the distribution of the residual cross-sectional area along the length of the longitudinal reinforcements differs between the two accelerated corrosion methods. In the case of minor corrosion (i.e. $\eta_a = 4.6\%$ in **Fig. 8(a)**). There was no significant difference in the residual cross-sectional area distribution between non-uniformly corroded and uniformly corroded longitudinal reinforcements. With increasing corrosion degree, a significant longitudinal heterogeneity in the residual cross-sectional area of corroded longitudinal reinforcements emerged under the accelerated non-uniform corrosion method, the residual cross-sectional areas of the longitudinal reinforcements become smaller and more irregular, as shown in **Fig. 8(d)**.

Two parameters were introduced to describe the non-uniformity of longitudinal reinforcements in terms of both circumferential and longitudinal with increasing corrosion degree.

$$\chi = \frac{R_{s,0}}{R_{s,\min}} \quad (3)$$

$$r = \frac{A_{s,\text{ave}}}{A_{s,\min}} \quad (4)$$

Where: $R_{s,0}$ and $R_{s,\min}$ are the origin value and minimum value radius of the cross-section of origin and corroded longitudinal reinforcements, $A_{s,\text{ave}}$ and $A_{s,\min}$ are the average value and minimum value of the residual cross-sectional area of corroded longitudinal reinforcements, respectively.

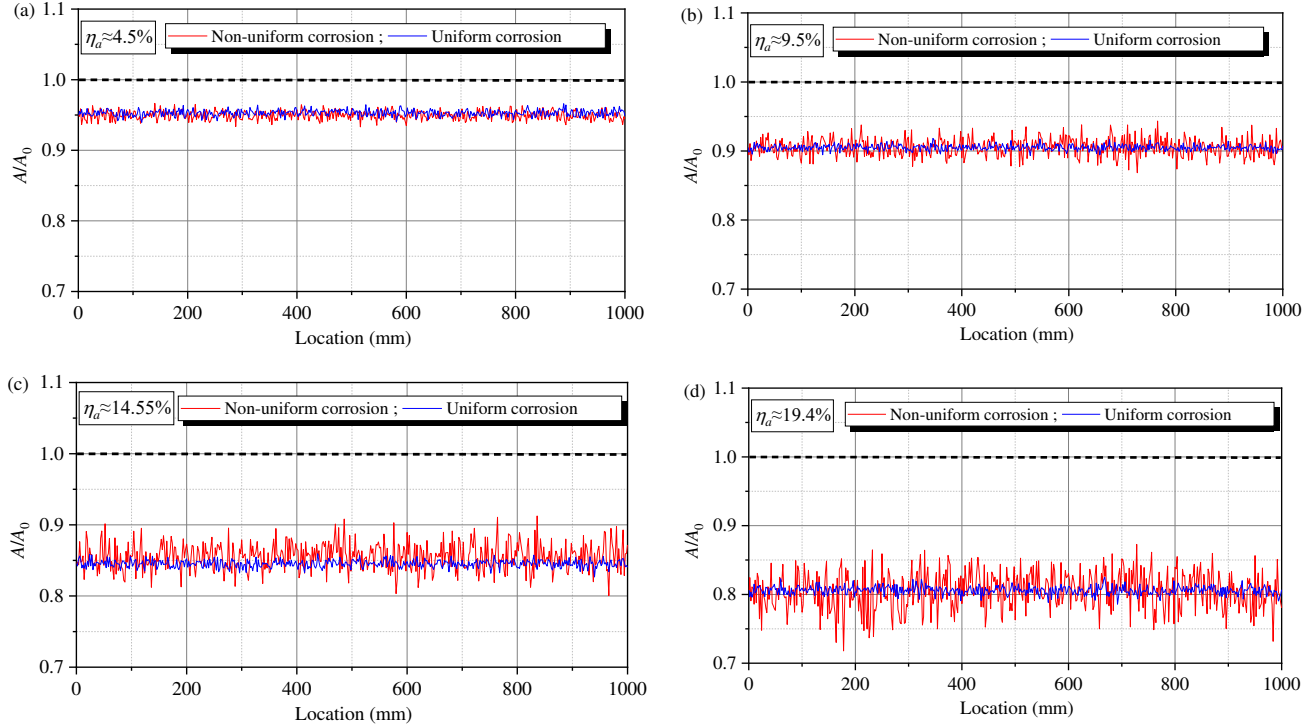


Fig. 8 Distribution of residual cross-sectional area of longitudinal reinforcements relative to its original in RC beams subjected to non-uniform and uniform accelerated corrosion methods.

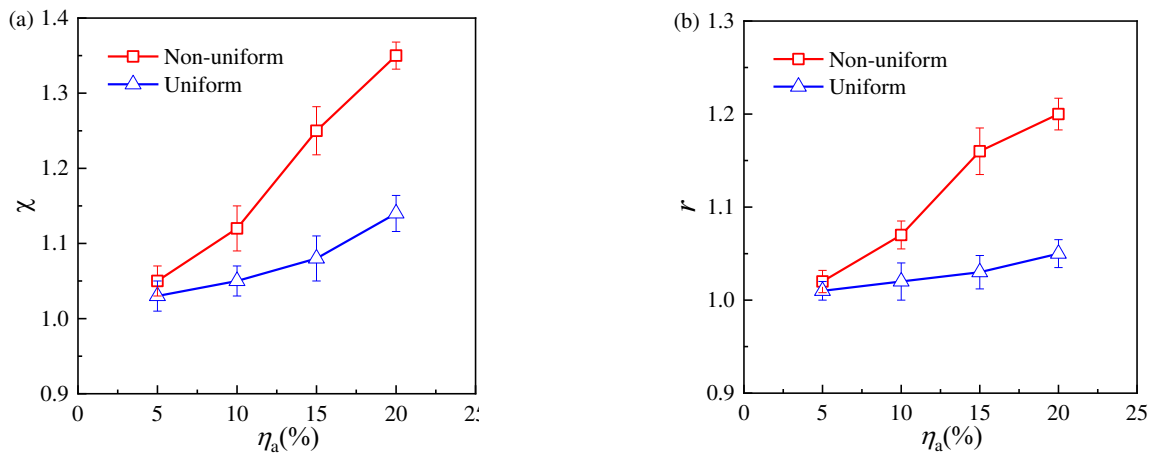


Fig. 9 The values of (a) the non-uniformity of longitudinal reinforcements circumferentially (χ) and (b) the non-uniformity of longitudinal reinforcements longitudinally (r) with increasing corrosion degree.

As can be seen in **Fig. 9(a)**, the value of χ for longitudinal reinforcements subjected to the traditional accelerated corrosion method was less than 1.1. By performing the accelerated non-uniform corrosion method the

value of χ reached 1.35, indicating a non-uniformity around the circumferential of longitudinal reinforcements. And, the value of r increases from roughly 1.05 for the traditional accelerated corrosion method to 1.25 for the accelerated non-uniform corrosion method. As shown in **Fig. 9(b)**, indicating a non-uniformity along the length of longitudinal reinforcements.

3.2 Corrosion-induced cracking

Physically, as the accelerated corrosion process prolongs, the volume expansion of the corrosion products of the reinforcement will produce circumferential tensile stress in the surrounding concrete. With the increasing of corrosion degree, when the accumulated tensile stress of corrosion products in concrete exceeds its tensile strength, the concrete around the reinforcement will produce internal cracks, and then gradually expand to the surface of concrete, forming rust-expanding cracks along the length of the reinforcement [30].

The corrosion-induced cracking behaviors of all specimens are shown in **Fig. 10**, in which the maximum width, location, number, and direction of the cracks resulted from two accelerated corrosion methods are emphatically compared. From the comparison, the following observations can be seen:

(1) The development of corrosion-induced cracks is basically along the longitudinal reinforcements, and the maximum width and the number of the cracks increase accordingly, as the corrosion level increases.

(2) The cracks of the specimens subjected to the non-uniform corrosion method are more likely to emerge on the bottom surface and their widths are found to be much bigger than those on the other two side surfaces; while for those specimens by uniform corrosion method, the corrosion-induced cracks is more even, in terms of both the maximum width and the crack distribution.

(3) When comparing specimens with the same level of corrosion, it was observed that the non-uniformly corroded specimen consistently exhibited a larger maximum crack width than the uniformly corroded specimen. These cracks were predominantly observed on the bottom surface near the beam ends, indicating a clear directionality.

(4) The distribution of corrosion-induced cracks in the non-uniform corrosion specimens shows more random and disconnected patterns, indicating a more random non-uniform corrosion along the length of the longitudinal reinforcements. While for those specimens by uniform corrosion method, the corrosion-induced cracks always occurs in a continuous patterns.

According to the above descriptions about the corrosion-induced cracking behaviors, it can be seen that the non-uniform corrosion of longitudinal reinforcements obtained from the accelerated non-uniform corrosion method is closer to the actual corrosion situation of reinforcement embedded in RC members after years of natural climate exposure, and the above observation can be briefly explained as follows: the accelerated non-uniform corrosion method resulted in a greater pitting depth around the circumference of reinforcement, lead to a greater circumferentially non-uniform corrosion of longitudinal reinforcements, as shown in **Fig. 9(a)**. The accumulation of corrosion products on the side facing the stainless steel wire therefore induced a wider width of crack, compared with that induced by the uniform corrosion of longitudinal reinforcements. And for corrosion characteristics of the longitudinal reinforcements in the length direction, a significant longitudinal heterogeneity in the residual cross-sectional area of corroded longitudinal reinforcements emerged under the accelerated non-uniform corrosion method, as shown in **Fig. 9(b)**. The accelerated non-uniform corrosion method can cause significant fluctuations in the residual cross-sectional area of longitudinal reinforcements along their length. These fluctuations can lead to discontinuities in the corrosion-induced cracks.

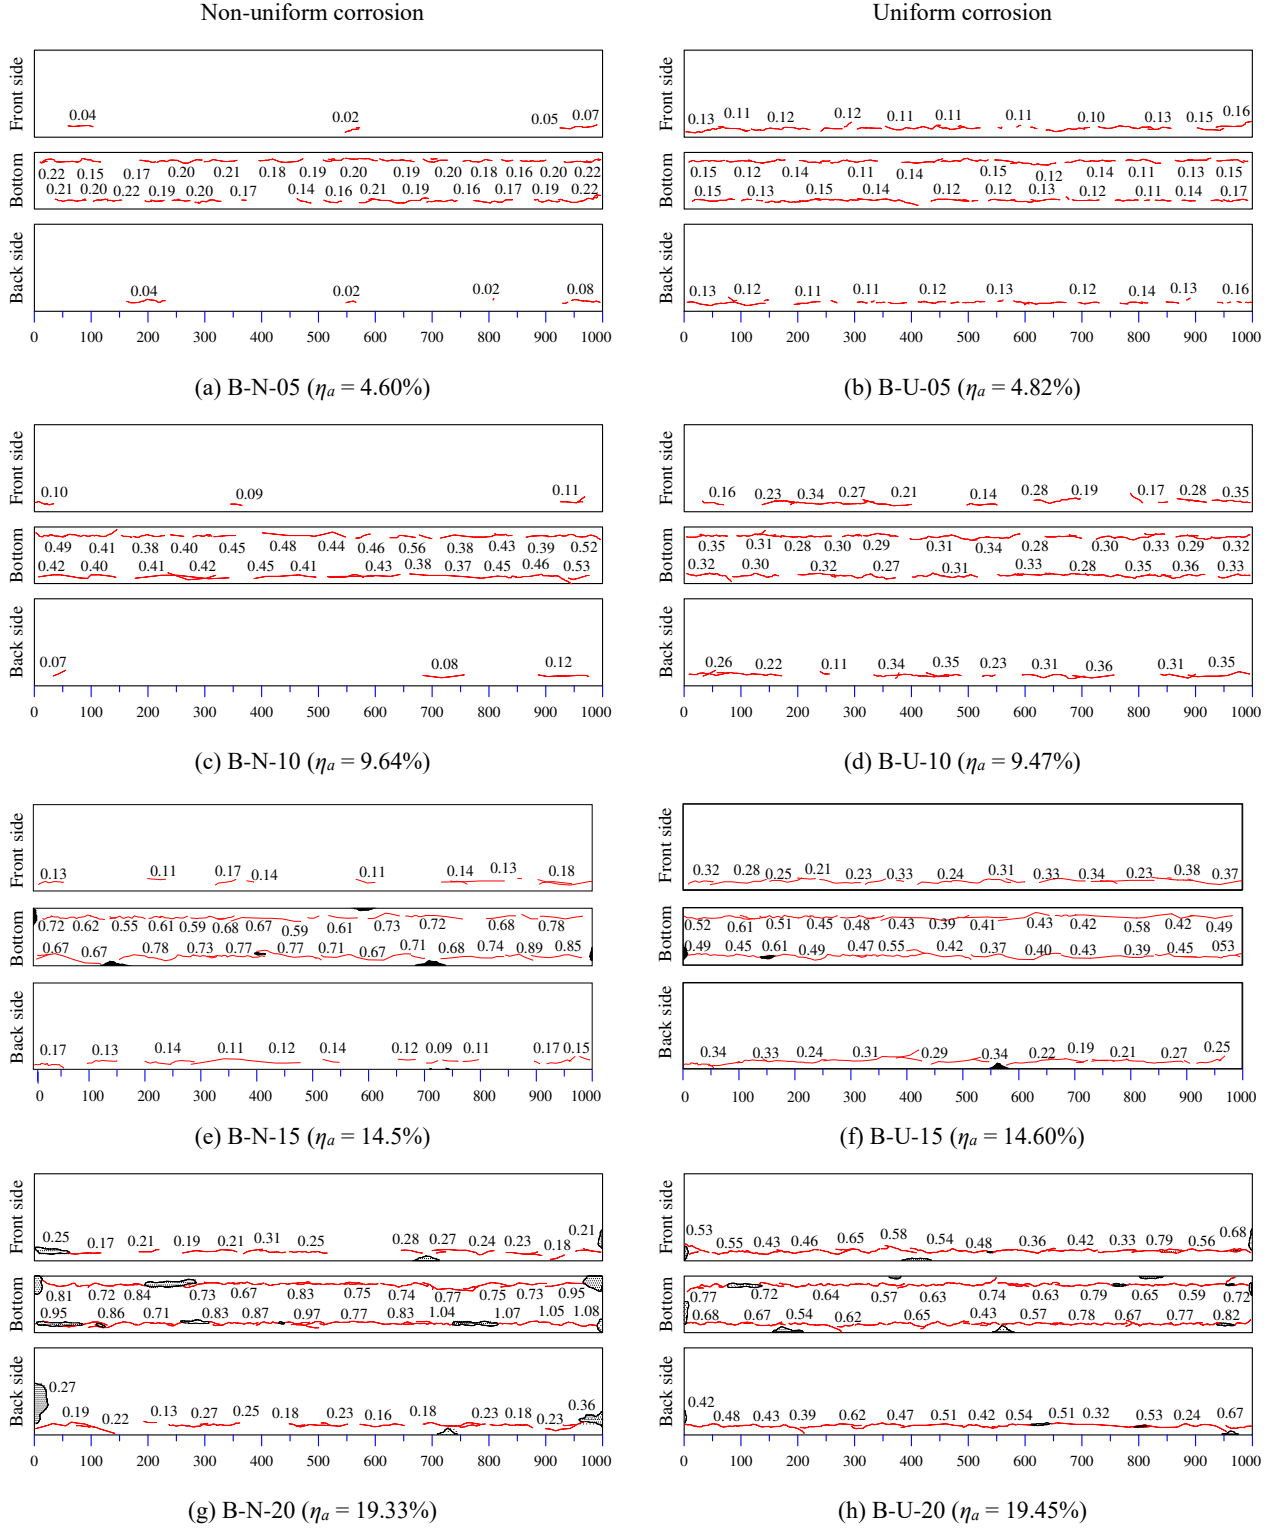


Fig. 10 Cracking maps of corroded RC beams subjected to different accelerated corrosion methods.

3.3 Flexural failure mechanism of RC beams

3.3.1 Crack propagation during loading process

The maximum crack width was recorded at each interval of loading. The relationship between the maximum crack width and the applied load is shown in **Fig. 11**, from which it can be inferred that:

(1) Corrosion levels have a significant impact on the evolution of maximum crack width and cracking load in corroded specimens. When compared to the corrosion-free specimen (B-0-0), the cracking resistance is slightly enhanced in the case of minor corrosion (i.e., B-U-05 and B-N-05). This can be attributed to the beneficial improvement resulting from the expansive rust being restrained within the interface between the reinforcement and concrete, which yields a stronger bond strength [31].

(2) Further increasing the corrosion level, the maximum crack width is observed to become larger, particularly in cases where the steel bars have undergone severe corrosion ($\eta_a \geq 12\%$). In such cases, corrosion of steel bars can lead to various issues, including expansion cracking of the protective layer, release of radial pressure at the interface between bar and concrete, lubricating effect of loose rusting products, and rusting of the cross ribs of the steel bars. These factors can weaken the bond performance and cracking resistance.

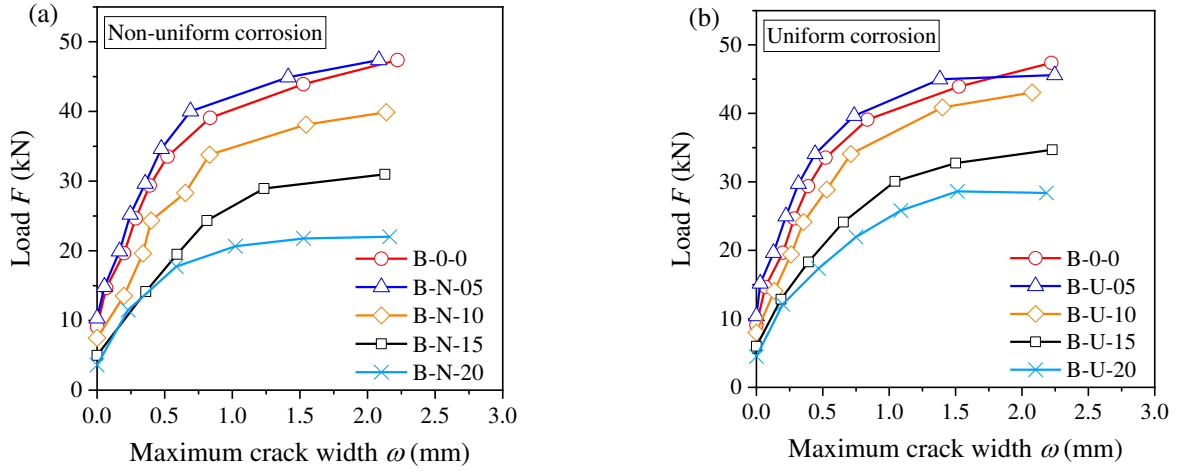


Fig. 11 Load-maximum crack width relationship of specimens subject to four-point bending test, (a) non-uniform corrosion, and (b) uniform corrosion.

Interestingly, for minor corrosion (i.e. specimens B-U-05 and B-N-05), the curves of maximum crack width with load are similar for both uniform and non-uniformly corroded specimens, as shown in **Fig. 12**. However, in the case of moderate or severe corrosion (i.e., specimens B-U-10, B-N-10, B-U-15, B-N-15, B-U-20, B-N-20), the maximum crack width of the non-uniformly corroded specimens at the same load level is relatively large. It indicates that, simulating reinforcement corrosion scenarios using accelerated uniform corrosion methods is challenging, as it fails to account for the degradation mechanisms of RC members in actual structures. Neglecting non-uniformity can lead to an underestimation of the extent of crack extension.

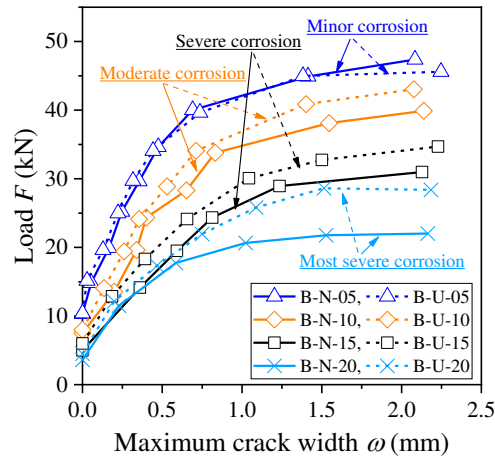


Fig. 12 Comparison of load-maximum crack width curves for two different accelerated corrosion methods

3.3.2 Failure modes and flexural strength of RC beams

During the four-point bending tests, the beam specimens failed in three different ways due to variations in reinforcement corrosion levels and characteristics. These included yielding of tensile reinforcement, rupture of tensile reinforcement, and bond failure of tensile reinforcement to the surrounding concrete.

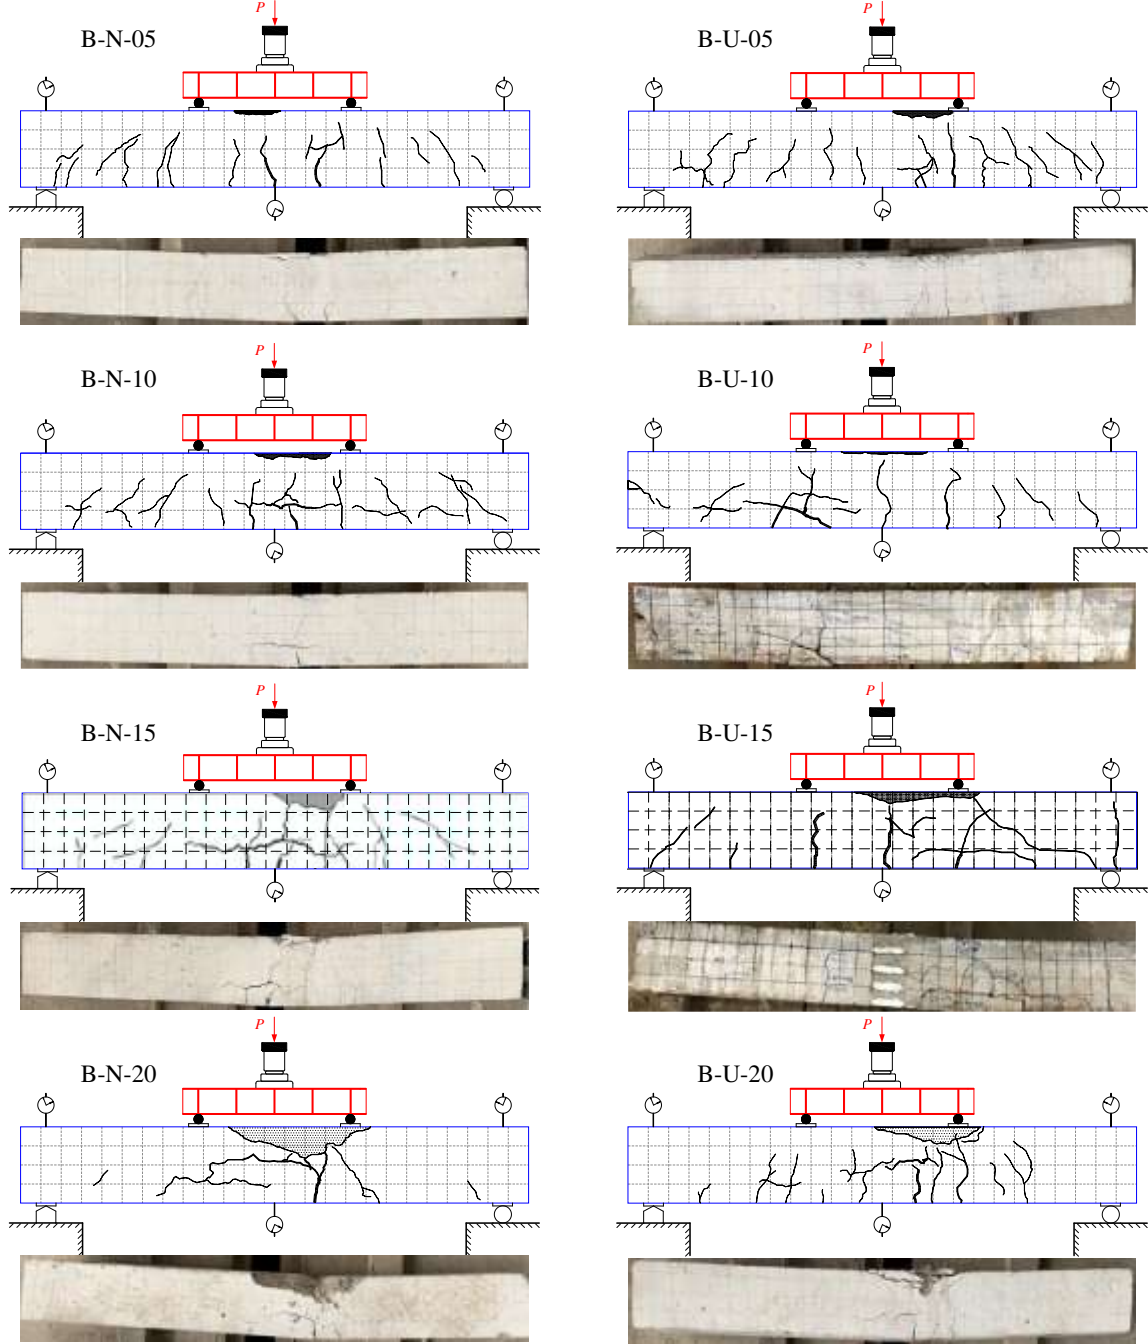


Fig. 13 Load-induced cracks and failure modes of RC beams.

To be more specifically, the first failure mode, i.e. yielding of tensile reinforcement, was observed for the majority of specimens, including the beams with minor corrosion ($\eta_d = 5\%$), moderate corrosion ($\eta_d = 10\%$) and severe corrosion ($\eta_d = 15\%$). As shown in **Fig. 13**, for beam specimens B-N-05 and B-U-05 with a minor corrosion degree, vertical flexural cracks first appear within the pure-bending region. Subsequently, diagonal cracks form between the supports and load points. The vertical flexural cracks are distributed evenly and propagate gradually

towards the raising neutral axis as the external load increases. For the specimens B-N-10 and B-U-10 with moderate corrosion degree, they exhibited similar cracking behaviors as those with minor reinforcement corrosion, except for the occurrence of several disconnected transverse cracks along the longitudinal reinforcements. Further increasing the corrosion level to the severe degree, the distribution of the load-induced vertical flexural cracks within the pure-bending region trended to be relative sparser and uneven ((i.e. specimens B-N-15 and B-U-15). At the ultimate stage, the tensile reinforcements in these beam specimens eventually yielded (as shown in **Fig. 14**) and the vertical flexural cracks extended nearly to the top surface of the beam. Additionally, a small portion of the concrete in the compression zone was crushed in the pure-bending region.

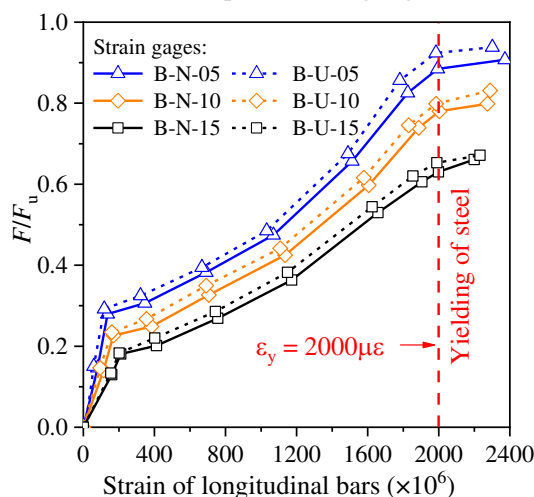


Fig. 14 The relationships between the load and the strain of longitudinal tensile reinforcements.

In cases where severe corrosion occurs ($\eta_d = 20\%$), two different failure modes were observed in specimens with two different accelerated corrosion methods. For the non-uniformly corroded specimen B-N-20, a much more brittle failure characterized by the rupture of tensile reinforcements was finally observed at the ultimate loading stage, probably due to the random occurrence of minimum section of corroded reinforcements [32], as demonstrated in **Fig. 15(a)**, the fracture was observed in the corroded tensile reinforcement after breaking the beam specimen. However, for the specimen B-U-20, because of the severe uniform reinforcement corrosion along the span of the beam, the bond strength of tensile reinforcements to the surrounding concrete was significantly weakened [33]. Thus, at the ultimate loading stage, when the concrete protective layer or stirrups restraint was sufficient, the concrete in front of the cross ribs of the reinforcement was crushed or sheared off between them, as a result, the tensile reinforcement was pulled out of the specimen and the space between the two cross ribs was tightly filled with concrete powder [34]. As can be seen in **Fig. 15(b)**, the concrete powder was discovered between the two cross ribs of corroded tensile reinforcement after the beam specimen was broken.

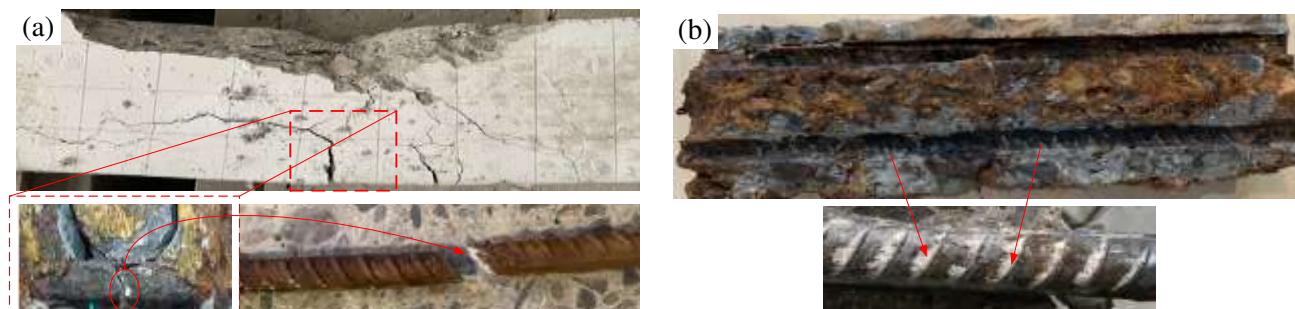


Fig. 15 Details demonstrating the failure of specimens (a) B-N-20 and (b) B-U-20

To investigate the strains distribution of concrete along the height of the of the cross-section within the pure bending region during loading, a series of test campaigns were conducted on beam specimens with varying levels and characteristics of corrosion. For better comparison, only two corrosion levels, $\eta_d = 5\%$ and 20% , representing the situations of minor corrosion and most severe corrosion are illustrated, respectively. It can be seen from **Fig. 16** that for the specimen subject to either corrosion method, the strain remains at almost linear distribution along the height of the cross-section in the case of minor corrosion ($\eta_d = 5\%$), even when approaching the ultimate bearing capacity. However, when the specimens suffer a most severe corrosion ($\eta_d = 20\%$), the plane section assumption is experimentally evidenced to be no longer valid. For specimen B-N-20, the strain of the concrete below the neutral axis could not be measured due to the rupture of the strain gauges as it approached the ultimate bearing capacity. On the other hand, for specimen B-U-20, although the strain at the bottom region is still measurable, it deviates from the linear distribution along the sectional depth. This is due to the pulled out of tensile reinforcements from the concrete, which prevents them from working together as a unit to resist the loads, the test results verified the bond failure of the tensile reinforcement to the surrounding concrete during the loading of specimen B-U-20 from another perspective.

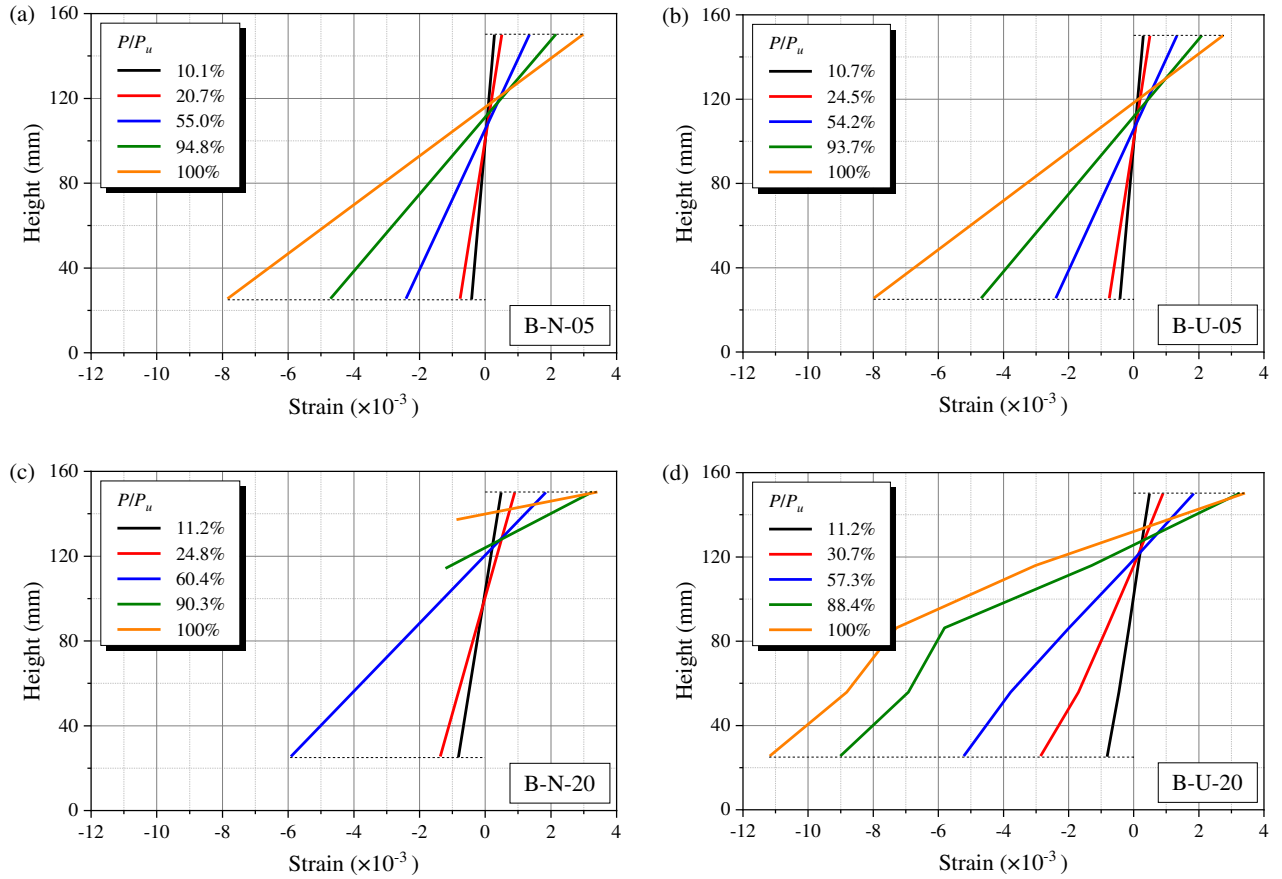


Fig. 16 Strain distribution of concrete along the height in the cases of different reinforcement corrosion levels. (a) and (b): $\eta_d = 5\%$; (c) and (d): $\eta_d = 20\%$.

The load-mid-span displacement curves for specimens subjected to various accelerated corrosion methods are displayed in **Fig. 17**, including the control specimen B-0-0, which is free from corrosion and included for comparison purposes. Based on the data presented in **Table 2**, several observations can be made:

(1) Regardless of the corrosion methods, the reinforcement corrosion shows a beneficial effect on improving the ultimate bearing capacity in the case of minor corrosion level; while it exerts an adverse effect with a higher

corrosion level, and the degradation becomes more and more pronounced as the level of reinforcement corrosion propagates.

(2) For the elastic stiffness of beam specimens, the reinforcement corrosion exhibits an obvious detrimental effect, this is mainly due to the deterioration of bond strength caused by corrosion, which weakens the integrity of the specimen

(3) The minor or moderate reinforcement corrosion cannot affect the ductility of the beam specimens greatly, while a dramatic degradation in this respect occurs when the corrosion level reaches the severe degree, leading to a much more brittle failure.

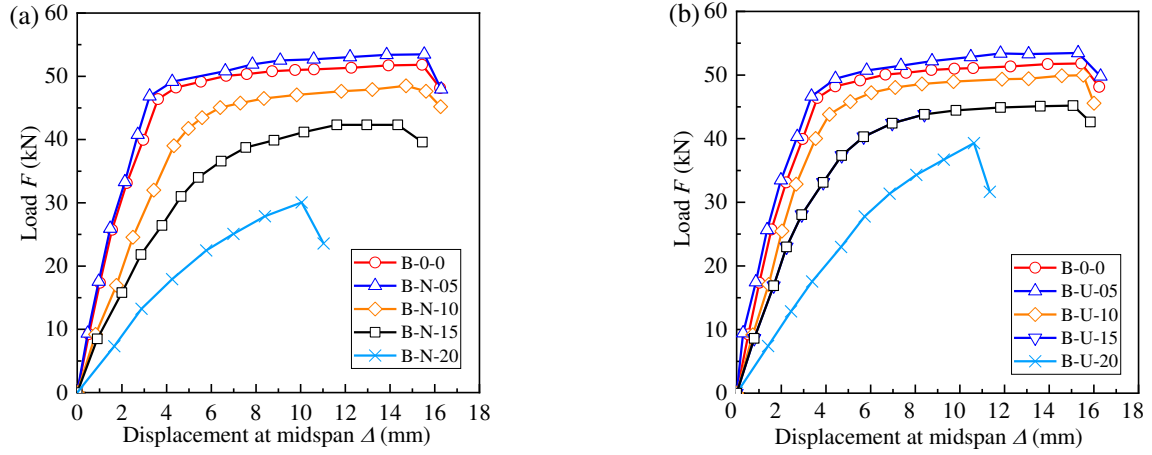


Fig. 17 Load-mid-span deflection relationship of specimens subject to four-point bending test, (a) non-uniform corrosion, and (b) uniform corrosion.

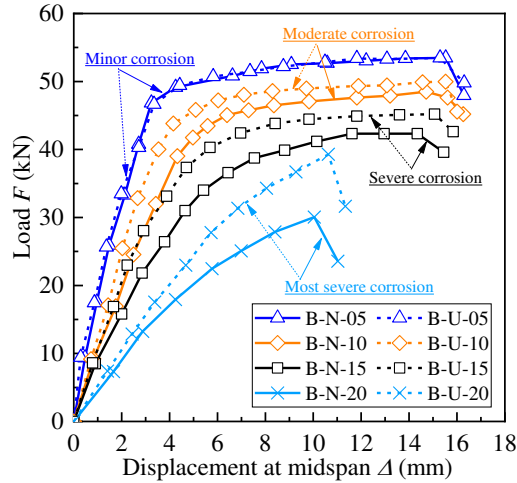


Fig. 18 Comparison of load-mid-span displacement curves for two different accelerated corrosion methods

As demonstrate in **Fig. 18**, for specimens with minor corrosion (B-U-05 and B-N-05), the load-mid-span displacement for uniform and non-uniformly corroded specimens are similar. According to Ref. [32], it has been observed that reinforcements with minor corrosion exhibit similar corrosion morphology and mechanical properties irrespective of whether they are uniformly or non-uniformly corroded. Furthermore, the bond strength of the reinforcement to the surrounding concrete remains essentially the same for different corrosion methods with minor corrosion degree, and more details on this can be found in Ref. [35]. As corrosion progresses to moderate or severe levels (B-U-10, B-N-10, B-U-15, B-N-15, B-U-20, B-N-20), the stiffness of the uniformly corroded specimens are significantly greater than that of the non-uniformly corroded specimens, and the mid-span displacement of the

uniformly corroded specimens are smaller compared to the non-uniformly corroded specimens at the same level of corrosion. According to Ref. [36], the bond strength of non-uniformly corroded specimens with the same degree of corrosion tended to degrade more severely compared to uniformly corroded specimens. As a result, the non-uniformly corroded beam specimens exhibited weakened integrity and relatively lower elastic stiffness. This observation is consistent with the extension of cracks caused by loading of non-uniformly corroded specimens shown in **Fig. 12**. Summary of the test results is listed in **Table 3**.

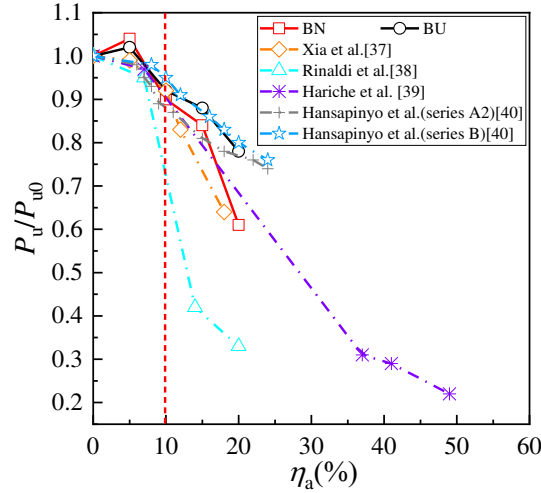


Fig. 19 Degradation model of flexural capacity versus the corrosion degree of tensile reinforcement for RC beams.

Fig. 19 illustrates the flexural bearing capacity degradation of corroded beams under accelerated uniform and non-uniform corrosion in this study. The results are compared to those obtained from previous literature [37–40]. It is worth noting that the corrosion characteristic of steel reinforcements in Xia [37] and Rinaldi’s [38] models exhibit non-uniform corrosion, while the steel reinforcements in other models display uniform corrosion. It can be seen that there is no significant difference in the cases of corrosion degree is less than 10%. However, when the corrosion degree reaches 15% or higher, the flexural bearing capacity of beams subjected to accelerated non-uniform corrosion decreases significantly.

4 Conclusions

A comparative experimental study was conducted to investigate the cracking behaviors and the flexural performance of beam specimens subject to two different accelerated corrosion methods. Based on the test results, the following conclusions can be drawn:

(1) Compared to the traditional accelerated corrosion method, the modified method using an additional stainless wire as the auxiliary electrode is able to closely reproduce the non-uniform reinforcement corrosion as the one formed in natural environments, manifesting as more random and disconnected cracks on the beam surfaces.

(2) The formation of the corrosion-induced cracks on the specimens subjected to the modified corrosion method exhibit an obvious directionality. Unlike the equally distributed cracks on the uniformly corroded specimens, their cracks trends to emerge on the surface that is closer to the side where a more serious corrosion occurs, in the case of identical concrete cover.

(3) As the level of reinforcement corrosion increases, the total amount of load-induced cracks reduces accordingly, and they trend to emerge within the pure-bending region. Compared to the control beam, the specimens with severe reinforcement corrosion finally failed in a much more brittle manner with the rapid development of the main crack.

(4) In the case of severe reinforcement corrosion, the failure of the uniformly corroded specimen is more likely to be the bond failure between reinforcement and concrete matrix, while the failure of the non-uniformly corroded specimen is mainly attributed to the rupture of reinforcement, because of the random occurrence of minimum cross section.

(5) Non-uniform corrosion leads to a more significant decrease in the flexural capacity of RC beams compared to uniform corrosion, particularly when the corrosion level exceeds 15%. This is in agreement with the propagation of load-induced crack caused by the two different corrosion methods.

Acknowledgements

This research project received financial support from the Basic Scientific Research Business Expenses of Zhejiang Universities Professional Funding Projects (Grant No.2023XZ014), and the National Natural Science Foundation of China (Grant Nos. 51978620 , 51678529 and 51279181) are gratefully acknowledged.

Conflict of interest statement

The authors declare that they have no known competing financial interests or personal relationships that could have appeared to influence the work reported in this paper.

Data availability

Data will be made available on request.

References

- [1] Broomfield J. Corrosion of steel in concrete. London: E&FN Spon; 1997.
- [2] El-Reedy MA. Steel-reinforced concrete structures: Assessment and Repair of corrosion. CRC press, 2017.
- [3] Huang L, Ye H, Jin X, Jin N, Xu Z. Corrosion-induced shear performance degradation of reinforced concrete beams. *Construction and Building Materials*, 2020, 248: 118668.
- [4] Ann KY, Song HW. Chloride threshold level for corrosion of steel in concrete. *Corrosion Science*, 2007, 49(11): 4113-4133.
- [5] Khan I, François R, Castel A. Prediction of reinforcement corrosion using corrosion induced cracks width in corroded reinforced concrete beams. *Cement and concrete research*, 2014, 56: 84-96.
- [6] Jin L, Liu M, Zhang R, Du X. Cracking of cover concrete due to non-uniform corrosion of corner rebar: A 3D meso-scale study. *Construction and Building Materials*, 2020, 245: 118449.
- [7] Coronelli D, Hanjari K Z, Lundgren K. Severely corroded RC with cover cracking, *Journal of Structural Engineering*, 2013, 139(2): 221-232.
- [8] Jiang C, Wu Y F, Dai M J. Degradation of steel-to-concrete bond due to corrosion, *Construction and Building Materials*, 2018, 158: 1073–1080.
- [9] Lin H, Zhao Y, Özbolt J, Hans-Wolf R. The bond behavior between concrete and corroded steel bar under repeated loading. *Engineering Structures*, 2017, 140: 390-405.
- [10] Montemor M F, Simoes A M P, Ferreira M G S. Chloride-induced corrosion on reinforcing steel: from the fundamentals to the monitoring techniques. *Cement and Concrete Composites*, 2003, 25(45): 491-502.
- [11] Ma Y, Li Y, Wang F. Corrosion of low carbon steel in atmospheric environments of different chloride content. *Corrosion Science*, 2009, 51(5): 997-1006.
- [12] Zhang S, Hou L, Du H, Wei H, Liu B, Wei Y. A study on the interaction between chloride ions and CO₂ towards carbon steel corrosion. *Corrosion Science*, 2020, 167: 108531.
- [13] Ye H, Fu C, Jin N, Jin X. Performance of reinforced concrete beams corroded under sustained service loads: A comparative study of two accelerated corrosion techniques. *Construction and Building Materials*, 2018, 162: 286-297.
- [14] Yuan Y, Ji Y, Shah S P. Comparison of two accelerated corrosion techniques for concrete structures. *ACI Structural Journal*, 2007, 104(3): 344.
- [15] Hong S, Zheng F, Shi G, Li J, Luo X, Xing F, Tang L, Dong B. Determination of impressed current efficiency during accelerated corrosion of reinforcement. *Cement and Concrete Composites*, 2020, 108: 103536.
- [16] Dekoster M, Buyle-Bodin F, Maurel O, Delmas Y. Modelling of the flexural behaviour of RC beams subjected to localised and uniform corrosion. *Engineering Structures*, 2003, 25(10): 1333-1341.
- [17] Vidal T, Castel A, Francois R. Corrosion process and structural performance of a 17 year old reinforced concrete beam stored in chloride environment. *Cement and Concrete Research*, 2007, 37(11): 1551-1561.
- [18] Fu C, Jin N, Ye H, Jin X, Dai, W. Corrosion characteristics of a 4-year naturally corroded reinforced concrete beam with load-induced transverse cracks. *Corrosion Science*, 2017, 117: 11-23.
- [19] Dai K, Liu C, Lu D, Yu X. Experimental investigation on seismic behavior of corroded RC columns under artificial climate environment and electrochemical chloride extraction: A comparative study. *Construction and Building Materials*, 2020, 242: 118014.
- [20] Li C. Initiation of chloride-induced reinforcement corrosion in concrete structural members-experimentation. *Structural Journal*, 2001, 98(4): 502-510.
- [21] Fu C, Jin N, Ye H, Liu J, Jin X. Non-uniform corrosion of steel in mortar induced by impressed current method: An experimental and numerical investigation. *Construction and Building Materials*, 2018, 183: 429-438.
- [22] Chen J, Fu C, Ye H, Jin X. Corrosion of steel embedded in mortar and concrete under different electrolytic

- accelerated corrosion methods. *Construction and Building Materials*, 2020, 241: 117971.
- [23] Fu C, Fang D, Ye H, Huang L, Wang J. Bond degradation of non-uniformly corroded steel rebars in concrete. *Engineering Structures*, 2021, 226: 111392.
 - [24] Zhu W, Dai J, Poon C. Prediction of the bond strength between non-uniformly corroded steel reinforcement and deteriorated concrete. *Construction and Building Materials*, 2018, 187: 1267-1276.
 - [25] Zhu W, François R, Coronelli D, Cleland D. Effect of corrosion of reinforcement on the mechanical behaviour of highly corroded RC beams. *Engineering Structures*, 2013, 56: 544-554.
 - [26] Nygaard P, Geiker M. A method for measuring the chloride threshold level required to initiate reinforcement corrosion in concrete, *Materials. and Structures*, 2005, 38: 489–494.
 - [27] Chen D, Mahadevan S. Chloride-induced reinforcement corrosion and concrete cracking simulation. *Cement and Concrete Composites*, 2008, 30(3): 227-238.
 - [28] ASTM G1-03. Standard practice for preparing, cleaning, and evaluating corrosion test specimens, ASTM West Conshohocken, PA, 2003.
 - [29] Wang X, Song X, Zhang M, Du X. Experimental comparison of corrosion unevenness and expansive cracking between accelerated corrosion methods used in laboratory research, *Construction and Building Materials*. 2017,153: 36–43.
 - [30] Huang L, Jin X, Fu C, Ye H, Dong X. Stochastic characteristics of reinforcement corrosion in concrete beams under sustained loads. *Computers and Concrete*, 2020, 25(5): 447-460.
 - [31] Fédération Internationale du Béton (fib), Bond of reinforcement in concrete: state-of-art report, Lausanne, Switzerland: International Federation for Structural Concrete, 2000.
 - [32] Zhang JJ, Huang J, Fu CQ, Huang L, Ye HL. Characterization of steel reinforcement corrosion in concrete using 3D laser scanning techniques. *Construction and Building Materials*, 2021,270: 121402.
 - [33] Bhargava K, Ghosh AK. Suggested empirical models for corrosion-induced bond degradation in reinforced concrete, *Journal of Structural Engineering*, 2008, 134: 221–230.
 - [34] Cabrera JG. Deterioration of concrete due to reinforcement steel corrosion, *Cement and Concrete Composites*. 1996, 18: 47–59.
 - [35] Lim S, Akiyama M, Frangpol DM, Experimental investigation of the spatial variability of the steel weight loss and corrosion cracking of reinforced concrete members: novel X-ray and digital image processing techniques, *Structure and Infrastructure Engineering*, 2017, 13: 118–134.
 - [36] Tang F, Lin Z, Chen G, Three-dimensional corrosion pit measurement and statistical mechanical degradation analysis of deformed steel bars subjected to accelerated corrosion. *Construction and Building Materials*. 2014, 70: 104–117.
 - [37] Xia J, Jin WL, Li LY. Effect of chloride-induced reinforcing steel corrosion on the flexural strength of reinforced concrete beams. *Magazine of Concrete Research*, 2012, 64: 471–485.
 - [38] Rinaldi Z, Imperatore S, Valente C. Experimental evaluation of the flexural behavior of corroded P/C beams. *Construction and Building Materials*, 2010, 24: 2267–2278.
 - [39] Hariche L, Ballim Y, Bouhicha M. Effects of reinforcement configuration and sustained load on the behaviour of reinforced concrete beams affected by reinforcing steel corrosion. *Cement and Concrete Composites*, 2012, 34: 1202–1209.
 - [40] Hansapinyo G,Vimonsatit V,Matsushima M.Critical amount of corrosion and failure behavior of flexural reinforced concrete beams. *Construction and Building Materials*, 2021, 270: 121448.