



Xiaomi Note3 water damage no booting, the light is not on.


Maintenance process: after removing shielding cover, it is found that the marked power supply pm660L has traces of corrode. after cleaning, replace the pm660L, and test that the startup current is normal.

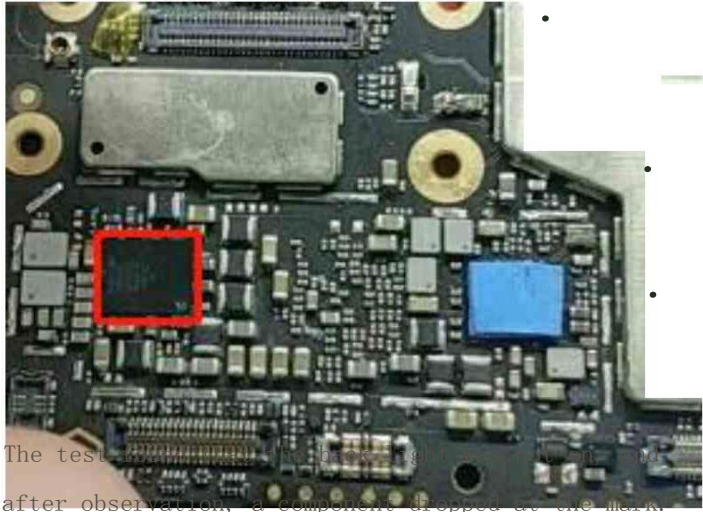



The test shows that the backlight was not on, and after observation, a component dropped at the mark. Through the drawing, it was known that the drop was the booster diode on the backlight circuit, which must be replaced, and it cannot be installed in the reverse position. Find the diode on the circuit with the same principle to replace it. The test shows that it is normal, and the fault is solved!

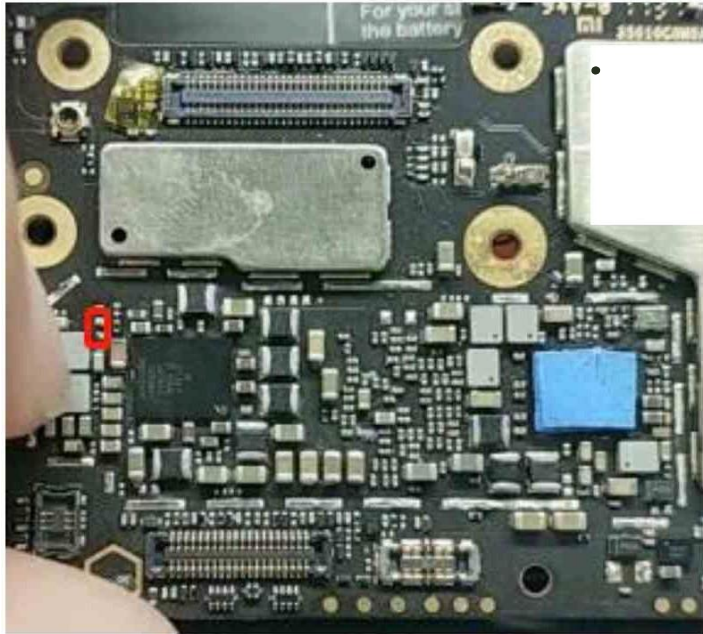

Drop diode position diagram

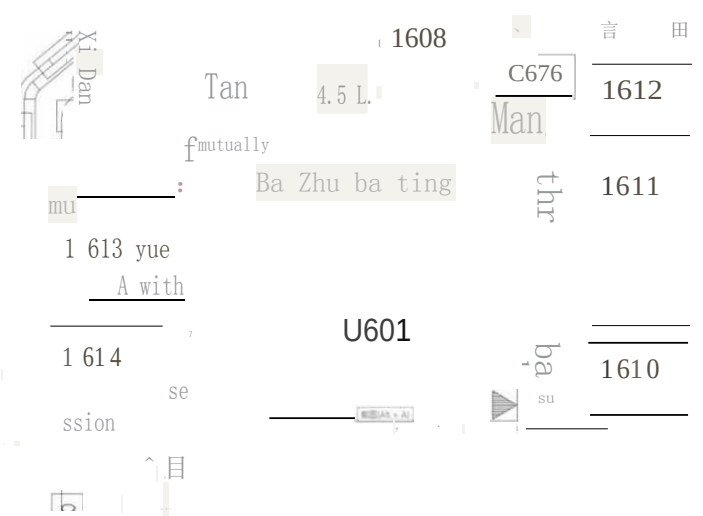


Back light line schematic

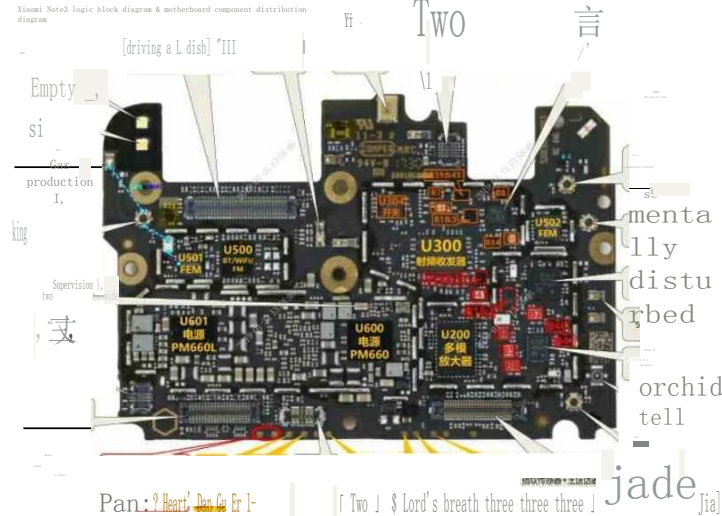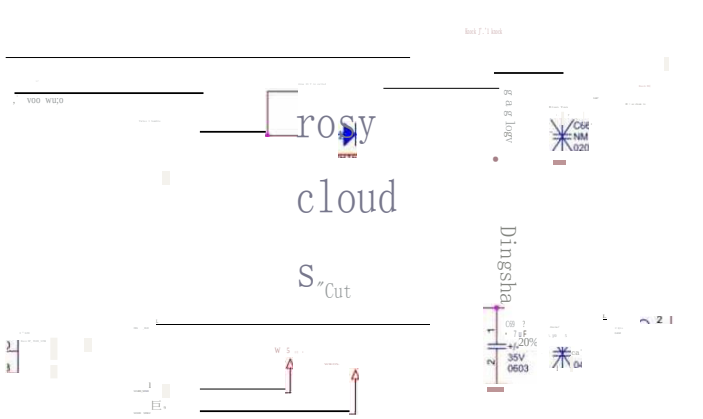

Component annotation diagram

Xiaomi Note3 Logic and Torsion Block Diagram & Distribution Diagram of Main Board Components

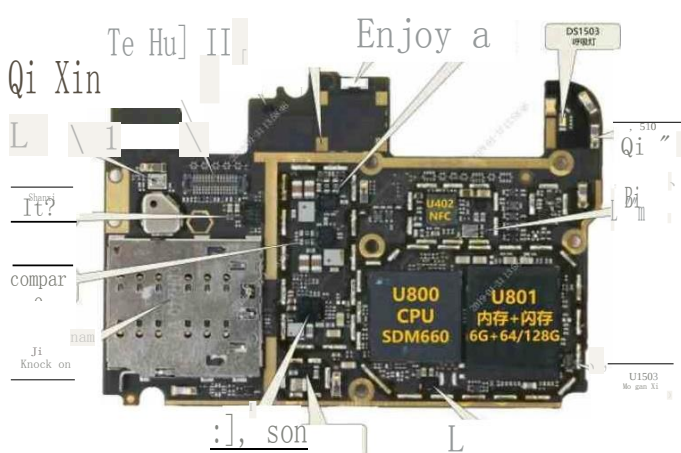

子便签发