


3/3077/94

8 (7)

~~Set II~~

Set I

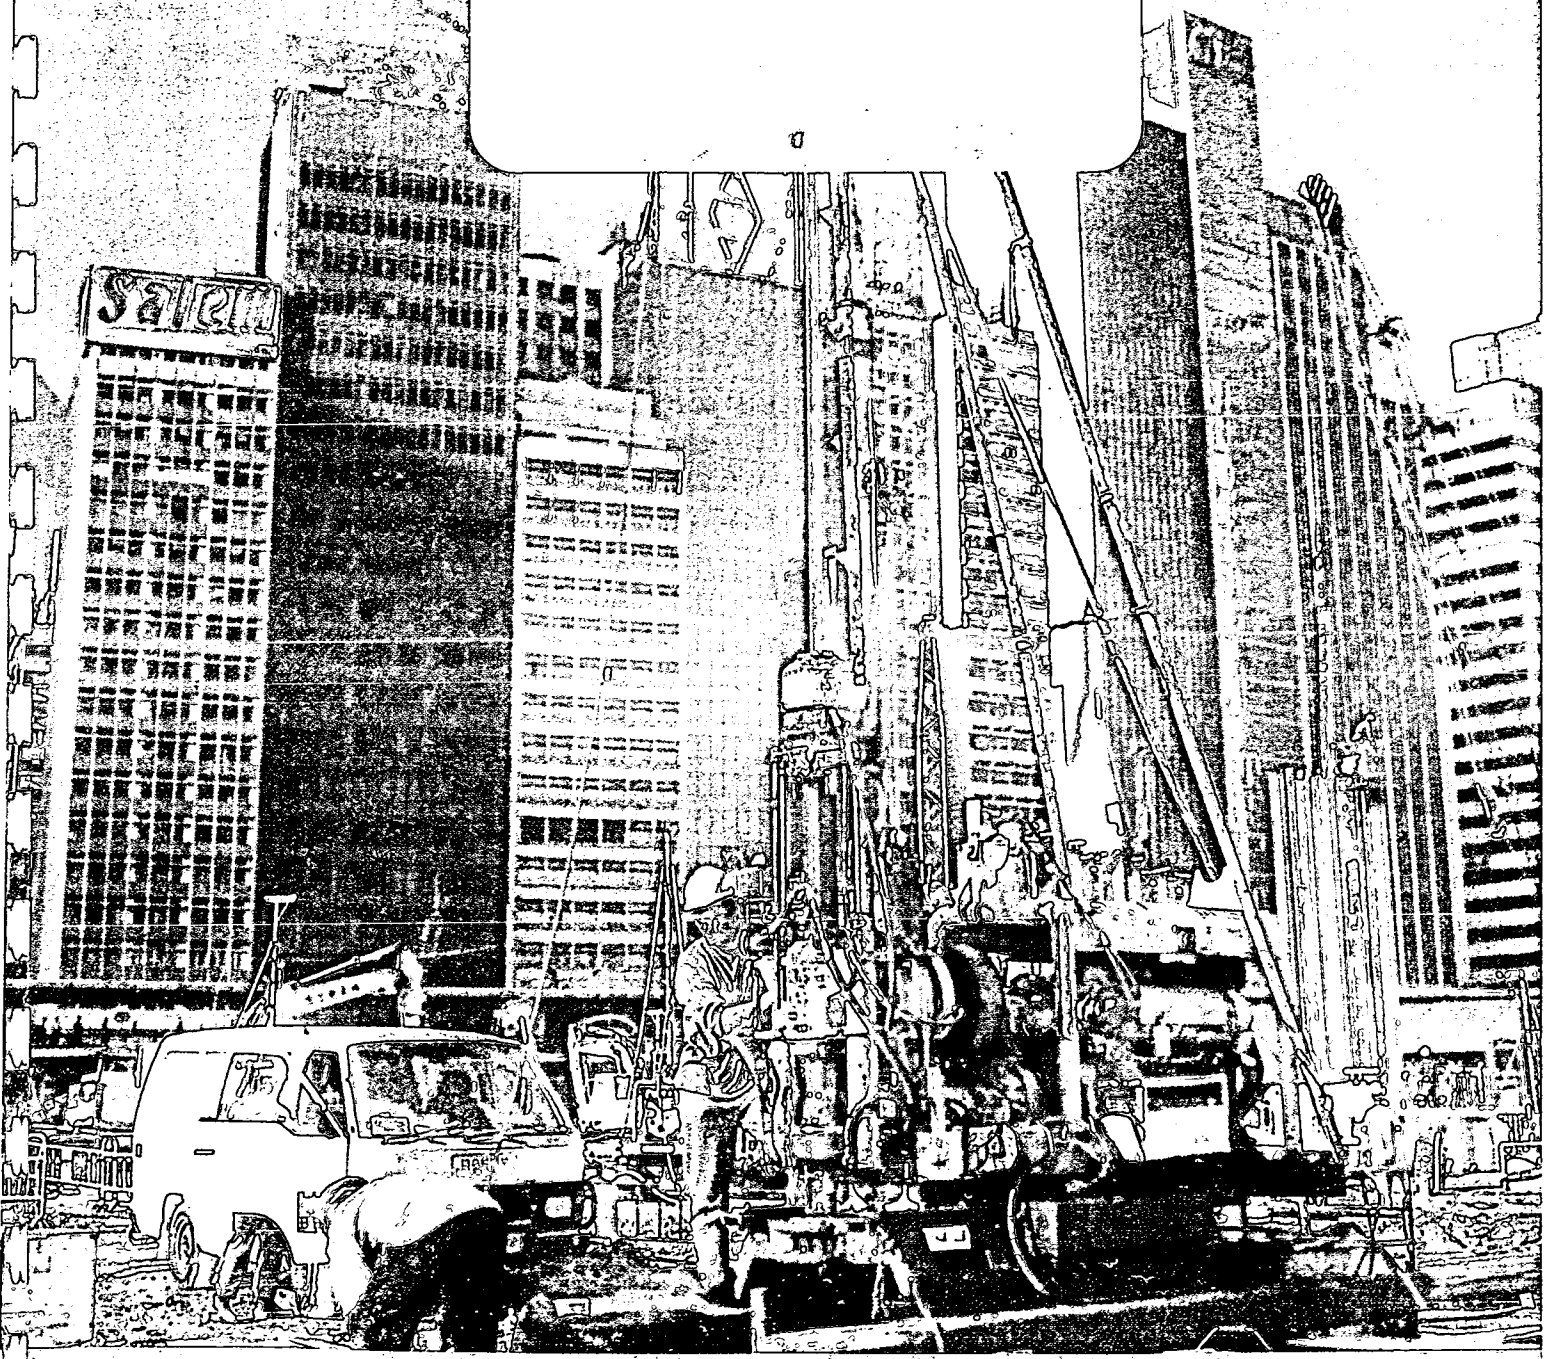

**BACHY
SOLETANCHE**

泰國地基建築公司

BACHY SOLETANCHE GROUP
SOIL & FOUNDATION SPECIALISTS



ISO 9001: 1994
Certificate No: CC295

LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

SITE INVESTIGATION
FOR
DIAPHRAGM WALL AND BARRETTES

(HOLE NOS. DH7, DH19, DH34,
DH40, DH42, DH47 & DH55)

Ref 3/3017/94

SEPTEMBER, 1996

RECEIVED BY
ENGINEERING DEPT.
20/9/96

SEP 23 3 48 PM '96

RECEIVED BY

CONTRACTOR

BACHY SOLETANCHE GROUP
15/F., CARNARVON PLAZA
20-20C CARNARVON ROAD
TSIM SHA TSUI
KOWLOON
HONG KONG

ENGINEER

MAUNSELL CONSULTANTS ASIA LTD
14/F., 1 KOWLOON PARK DRIVE
KOWLOON
HONG KONG



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH7

CONTRACT

SHEET 1 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. ACKER-35

E 839894.47
N 816508.90

DATE from 30/1/96 to 31/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.05 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	SX							INSPECTION PIT	3.85	0.00			Concrete Slab.
2									2.05	2.00			Brown, gravelly silty medium to coarse SAND. (FILL)
3	SX 3.00m PX												Wash boring. (No recovery)
4													
5													
6													
7													
8													
9													
10													

- ▲ SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- ▨ SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- ▨ MAZIER SAMPLE (70mm)
- ▨ PISTON SAMPLE
- ▲ WATER SAMPLE
- ▲ PIEZOMETER TIP
- STANDPIPE
- ┆ STANDARD PENETRATION TEST
- ┆ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 01/02/96

APPROVED C.LUN

DATE 02/02/96

REMARKS
Hole termination depth at 30.37m.
Inspection Pit from 0.00m to 2.00m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH7

CONTRACT

SHEET 2 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. ACKER-35

E 839894.47
N 816508.90

DATE from 30/1/96 to 31/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.05 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 4.
12													
13													
14													
15													
16													
17													
18	PX 18.00m HX												
19													
20													

- SMALL DISTURBED SAMPLE
- ▮ LARGE DISTURBED SAMPLE
- ▮ SPT LINER SAMPLE
- ▮ U76 UNDISTURBED SAMPLE
- ▮ U100 UNDISTURBED SAMPLE
- ▮ MAZIER SAMPLE (70mm)
- ▮ PISTON SAMPLE
- Δ WATER SAMPLE
- ▮ PIEZOMETER TIP
- Δ STANDPIPE
- ▮ STANDARD PENETRATION TEST
- ▮ PERMEABILITY TEST
- ▮ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 01/02/96

APPROVED C.LUN

DATE 02/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH7

CONTRACT

SHEET 3 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. ACKER-35

E 839894.47
N 816508.90

DATE from 30/1/96 to 31/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.05 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
30/01/96													AS SHEET 2 OF 4.
21													
22													
23													
24	HX 23.70m		70	50	50	NR NI 4.0 NR		T2 -101	-19.65 -19.80 -19.90 -20.15 -20.27	23.70 23.85 23.95 24.20 24.32		IV IV/III III IV III/II	Moderately strong, brownish pink spotted black and white, moderately to slightly decomposed medium to coarse grained GRANITE with widely to medium spaced and occasionally closely spaced, very narrow to extremely narrow, rough planar, limonite, manganese, chlorite and kaolin stained joints, dipping 10°-20°, 40°-50°, 60°-75°.
25			90	90	84	5.8		T2 -101					
26			100	100	100	2.3		T2 -101		25.18 25.36			23.70m-23.85m & 24.20m-24.32m: no recovery.
27			100	100	98			T2 -101		26.76 27.35			23.85m-23.95m: weak to moderately weak, brownish pink spotted black and white, highly to moderately decomposed medium to coarse grained GRANITE.
28										28.05			
29			100	100	100	2.6		T2 -101					
30			100	100	100			T2 -101		29.41			

- SMALL DISTURBED SAMPLE
- ▮ LARGE DISTURBED SAMPLE
- ▮ SPT LINER SAMPLE
- ▮ U76 UNDISTURBED SAMPLE
- ▮ U100 UNDISTURBED SAMPLE
- ▮ MAZIER SAMPLE (70mm)
- ▮ PISTON SAMPLE
- Δ WATER SAMPLE
- ▲ PIEZOMETER TIP
- Δ STANDPIPE
- ┆ STANDARD PENETRATION TEST
- ┆ PERMEABILITY TEST
- ∇ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 01/02/96

APPROVED C.LUN

DATE 02/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH7

CONTRACT

SHEET 4 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. ACKER-35

E 839894.47
N 816508.90

DATE from 30/1/96 to 31/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.05 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
B1/O			100	100	100	2.6		T2-101	-26.32	30.37	++ ++ ++	III	AS SHEET 3 OF 4. End of hole at 30.37m.
31													
32													
33													
34													
35													
36													
37													
38													
39													
40													

- | | |
|-------------------------|---------------------------|
| SMALL DISTURBED SAMPLE | WATER SAMPLE |
| LARGE DISTURBED SAMPLE | PIEZOMETER TIP |
| SPT LINER SAMPLE | STANDPIPE |
| U76 UNDISTURBED SAMPLE | STANDARD PENETRATION TEST |
| U100 UNDISTURBED SAMPLE | PERMEABILITY TEST |
| MAZIER SAMPLE (70mm) | IN-SITU VANE SHEAR TEST |
| PISTON SAMPLE | |



LOGGED FRANK CHAN

DATE 01/02/96

APPROVED C.LUN

DATE 02/02/96

REMARKS

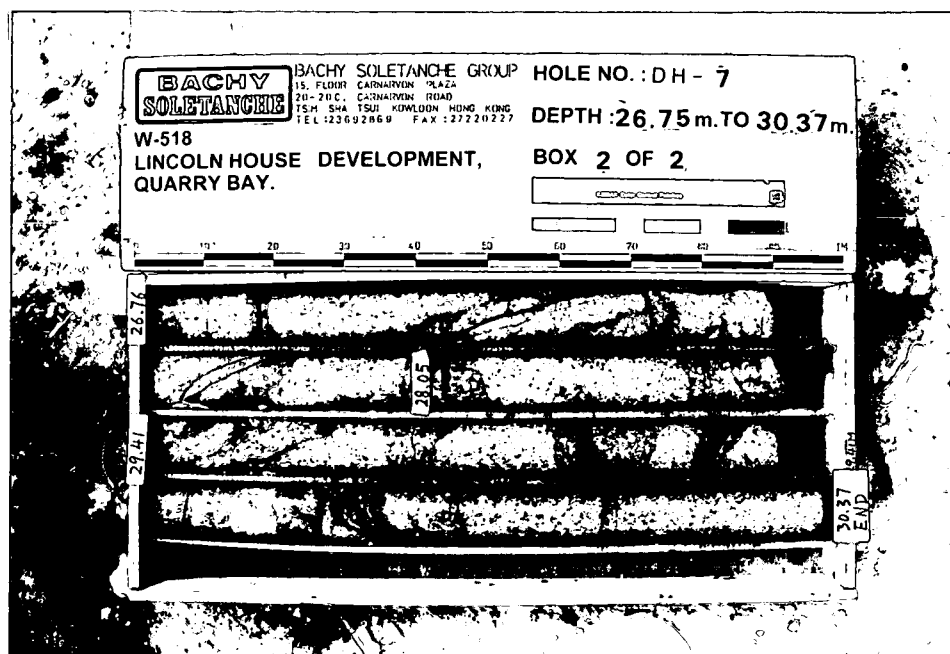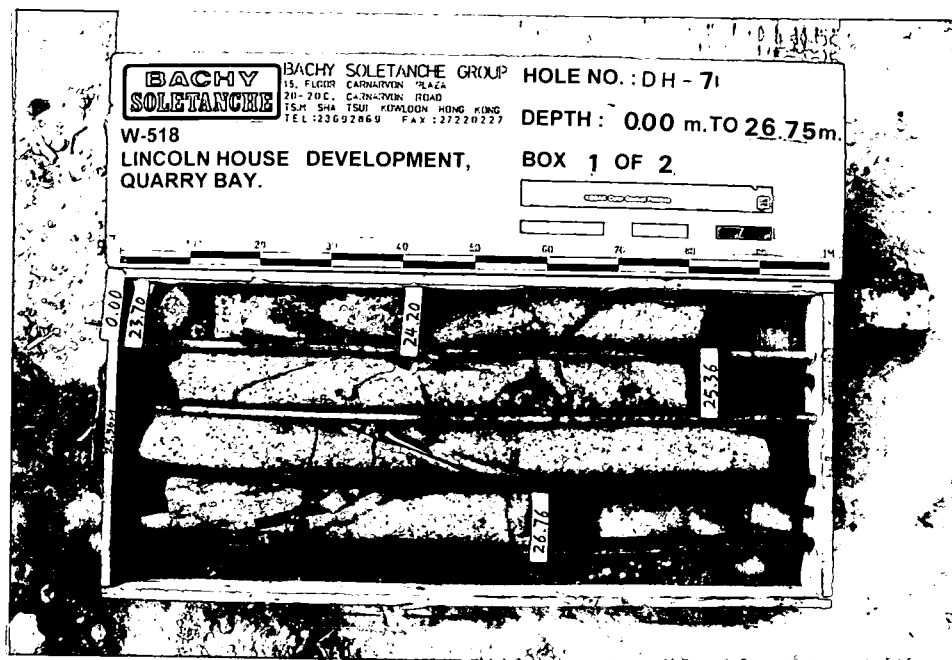

						BACHY SOLETANCHE GROUP SOIL & FOUNDATIONS SPECIALISTS						DRILLHOLE RECORD CONTRACT						HOLE NO. DH19 SHEET 1 of 4					
PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY																							
METHOD ROTARY										CO-ORDINATES								W.O. W-518					
MACHINE & No. YBM 36										E 839894.96 N 816541.61								DATE from 26/3/96 to 30/3/96					
FLUSHING MEDIUM WATER										ORIENTATION Vertical								GROUND-LEVEL 4.51 mPD					
Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description										
1	PX		70					↑ PX		1.00			Angular red brick and concrete fragments with some grey, silty SAND.(FILL)										
2	PX 2.00m HX		53					↓ PX	2.51	2.00			Wash Boring.(No Recovery)										
3																							
4																							
5																							
6																							
7																							
8																							
9																							
10																							
- SMALL DISTURBED SAMPLE - LARGE DISTURBED SAMPLE - SPT LINER SAMPLE - U76 UNDISTURBED SAMPLE - U100 UNDISTURBED SAMPLE - MAZIER SAMPLE (70mm) - PISTON SAMPLE - WATER SAMPLE - PIEZOMETER TIP - STANDPIPE - STANDARD PENETRATION TEST - PERMEABILITY TEST - IN-SITU VANE SHEAR TEST								LOGGED F.CHAN		REMARKS Hole termination depth at 30.37m													
DATE 01/04/96																							
APPROVED C.LUN																							
DATE 02/04/96																							

		BACHY SOLETANCHE GROUP SOIL & FOUNDATIONS SPECIALISTS		DRILLHOLE RECORD		HOLE NO. DH19								
				CONTRACT		SHEET 2 of 4								
PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY														
METHOD ROTARY				CO-ORDINATES E 839894.96 N 816541.61		W.O. W-518								
MACHINE & No. YBM 36						DATE from 26/3/96 to 30/3/96								
FLUSHING MEDIUM WATER				ORIENTATION Vertical		GROUND-LEVEL 4.51 mPD								
Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description	
11													Wash Boring.(No Recovery)	
12														
13														
14														
15														
16														
17														
18														
19	HX 19.30m NX		50					T2 -101	-13.99 -14.79	18.50 19.30	o o			Sub-rounded COBBLES and GRAVELS of moderately decomposed granite and tuff with some brown, silty SAND.(ALLUVIUM)
20														Wash Boring.(No Recovery)
SMALL DISTURBED SAMPLE LARGE DISTURBED SAMPLE SPT LINER SAMPLE U76 UNDISTURBED SAMPLE U100 UNDISTURBED SAMPLE MAZIER SAMPLE (70mm) PISTON SAMPLE WATER SAMPLE PIEZOMETER TIP STANDPIPE STANDARD PENETRATION TEST PERMEABILITY TEST IN-SITU VANE SHEAR TEST								LOGGED <u>F.CHAN</u>		REMARKS				
								DATE <u>01/04/96</u>						
								APPROVED <u>C.LUN</u>						
								DATE <u>02/04/96</u>						



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH19

CONTRACT

SHEET 3 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. YBM 36

E 839894.96
N 816541.61

DATE from 26/3/96 to 30/3/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.51 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
21													Wash Boring.(No Recovery)
22													
23													
24	NX 24.30m												
25			100	83	37	20.0		T-76	-19.79	24.30		IV/III	Moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with widely to medium spaced and occasionally closely spaced, very narrow, rough planar, limonite, manganese stained and kaolin coated joints, dipping 10°-20°, 30°-40° and vertical joints.
26			92	92	76	2.7		T-76	-20.09	24.60		III	
27			100	100	85	2.7		T-76	25.09	25.09			
28			100	100	100	2.1		T-76	25.70	25.70			
29			100	100	72	11.2		T-76	27.12	27.12			Weak to moderately weak, brownish pink spotted black and white, highly to moderately decomposed medium to coarse grained GRANITE at 24.30m-24.60m.
30			100	100	97	3.1		T-76	28.64	28.64			
			100	100	100			T-76	29.57	29.57			

• SMALL DISTURBED SAMPLE	△ WATER SAMPLE
▬ LARGE DISTURBED SAMPLE	▲ PIEZOMETER TIP
▨ SPT LINER SAMPLE	△ STANDPIPE
▩ U76 UNDISTURBED SAMPLE	↓ STANDARD PENETRATION TEST
▩ U100 UNDISTURBED SAMPLE	┃ PERMEABILITY TEST
▨ MAZIER SAMPLE (70mm)	∇ IN-SITU VANE SHEAR TEST
▩ PISTON SAMPLE	

LOGGED F.CHAN
DATE 01/04/96
APPROVED C.LUN
DATE 02/04/96

REMARKS

No Recovery at 24.60m-24.64m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH19

CONTRACT

SHEET 4 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. YBM 36

E 839894.96
N 816541.61

DATE from 26/3/96 to 30/3/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical



GROUND-LEVEL 4.51 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.O.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
			100	100	100			174	-25.86	30.37	++ ++ ++	III	End of hole at 30.37m.
31													
32													
33													
34													
35													
36													
37													
38													
39													
40													

- SMALL DISTURBED SAMPLE
- ▮ LARGE DISTURBED SAMPLE
- ▨ SPT LINER SAMPLE
- ▩ U76 UNDISTURBED SAMPLE
- ▩ U100 UNDISTURBED SAMPLE
- ▩ MAZIER SAMPLE (70mm)
- ▩ PISTON SAMPLE
- Δ WATER SAMPLE
- ▲ PIEZOMETER TIP
- ◻ STANDPIPE
- ⊥ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST

LOGGED F.CHAN
DATE 01/04/96
APPROVED C.LUN
DATE 02/04/96

REMARKS

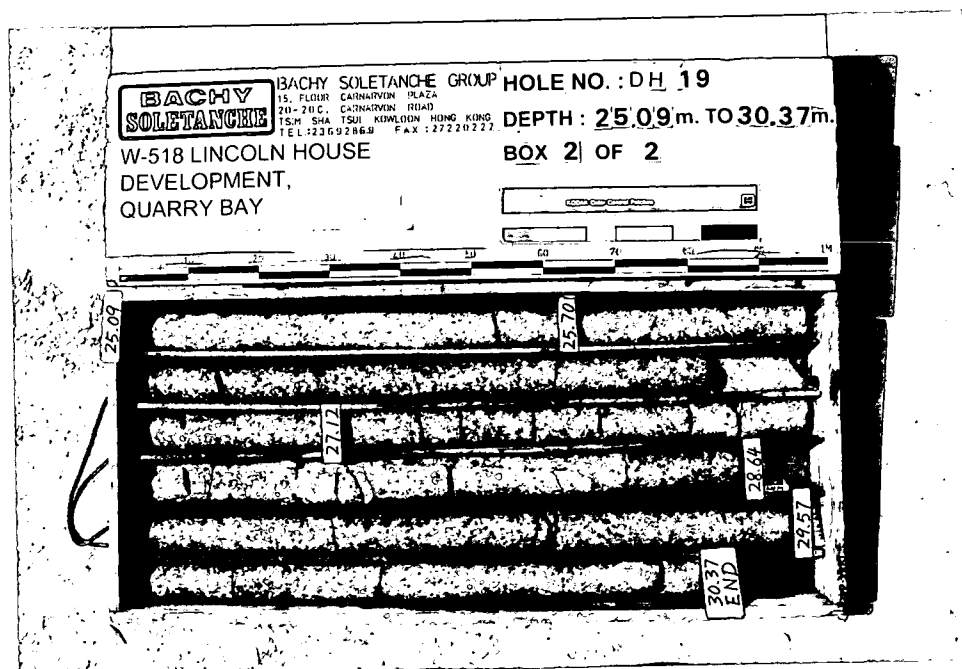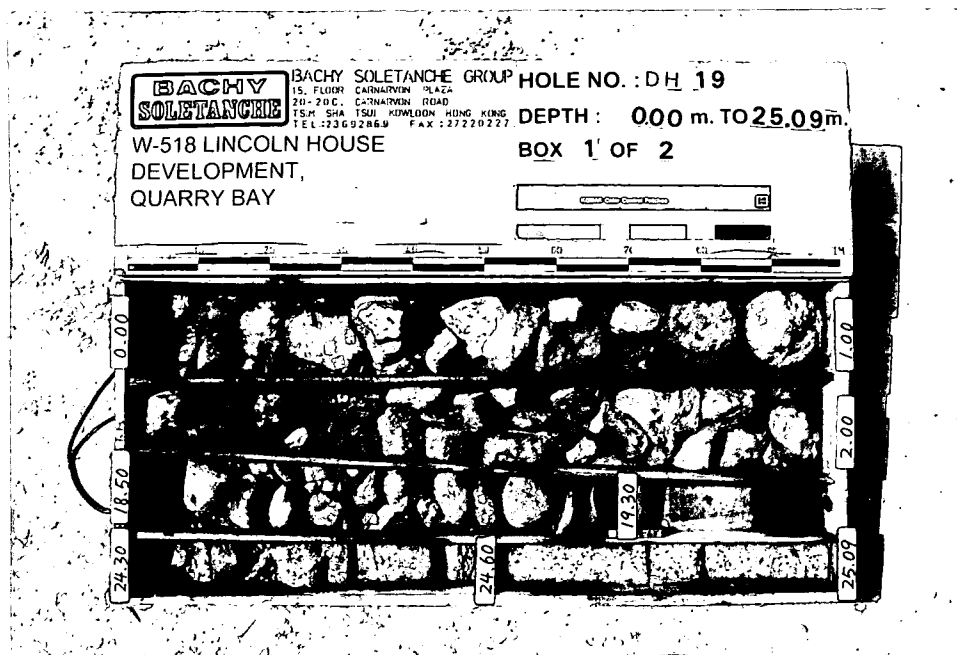



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH34

CONTRACT

SHEET 1 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. SM400-04

E 839909.29
N 816568.22

DATE from 3/2/96 to 6/2/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.54 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	SX							INSPECTION PIT	3.34	0.00			Concrete Slab.
2			100					SX	2.74	0.80			Brown, gravelly silty medium to coarse SAND. (FILL)
3													Concrete with Cobbles and Gravels of moderately decomposed granite. (FILL)
4													
5			100					SX					
6	SX 6.30m								-2.76	6.30			
7	PX 7.30m		71					PX		7.00			Angular Boulders, Cobbles and Gravels of moderately decomposed granite with some brown, silty SAND and some concrete fragments. (FILL)
8	HX		80					T2 -101		7.50			6.74m-7.00m, 7.20m-7.50m, 7.50m-7.74m & 8.05m-8.45m: boulders.
9			100					T2 -101		8.60			
10			100					T2 -101	-5.46	9.00			Wash boring. (No recovery)

- SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- MAZIER SAMPLE (70mm)
- PISTON SAMPLE
- WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- STANDARD PENETRATION TEST
- PERMEABILITY TEST
- IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 07/02/96

APPROVED C.LUN

DATE 08/02/96

REMARKS

Hole termination depth at 32.53m.
Inspection Pit from 0.00m to 0.80m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH34

CONTRACT

SHEET 2 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. SM400-04

E 839909.29
N 816568.22

DATE from 3/2/96 to 6/2/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.54 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 4.
12													
13													
14													
15													
16													
17													
18													
19													
20													

- SMALL DISTURBED SAMPLE
- ▬ LARGE DISTURBED SAMPLE
- ▬ SPT LINER SAMPLE
- ▬ U76 UNDISTURBED SAMPLE
- ▬ U100 UNDISTURBED SAMPLE
- ▬ MAZIER SAMPLE (70mm)
- ▬ PISTON SAMPLE
- ▲ WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- ↓ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 07/02/96

APPROVED C.LUN

DATE 08/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH34

CONTRACT

SHEET 3 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. SM400-04

E 839909.29
N 816568.22

DATE from 3/2/96 to 6/2/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.54 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
21	HX 21.50m NX		100					T2-101	-17.46 -17.96	21.00 21.50			AS SHEET 2 OF 4. Sub-rounded Cobbles and Gravels of moderately decomposed tuff and granite with some brown, silty SAND. (ALLUVIUM) Wash boring. (No recovery)
22													
23													
24													
25													
26	NX 26.60m												
27			100	96	93	1.9		T-76	-23.12	26.66 26.76		III	Moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with widely to medium spaced and occasionally closely spaced, very narrow to extremely narrow, rough planar, limonite, manganese stained, kaolin coated joints, dipping 10°-20°, 30°-50°.
28													
29			100	100	100			T-76					
30			100	90	75			T-76		29.57			

- SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- MAZIER SAMPLE (70mm)
- PISTON SAMPLE
- WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- STANDARD PENETRATION TEST
- PERMEABILITY TEST
- IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 07/02/96

APPROVED C.LUN

DATE 08/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH34

CONTRACT

SHEET 4 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. SM400-04

E 839909.29

DATE from 3/2/96 to 6/2/96

N 816568.22

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.54 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
31 05/02/96			100	90	75	NI		↑ T-74		30.15	+	III	AS SHEET 3 OF 4.
32 06/02/96			100	100	96	3.4		↓ T-76		31.07	+		
									-28.99	32.53	+		End of hole at 32.53m.
33													
34													
35													
36													
37													
38													
39													
40													

- SMALL DISTURBED SAMPLE
- ▬ LARGE DISTURBED SAMPLE
- ▬ SPT LINER SAMPLE
- ▬ U76 UNDISTURBED SAMPLE
- ▬ U100 UNDISTURBED SAMPLE
- ▬ MAZIER SAMPLE (70mm)
- ▬ PISTON SAMPLE
- ▲ WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- ↓ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∇ IN-SITU VANE SHEAR TEST



LOGGED FRANK CHAN



DATE 07/02/96

APPROVED C.LUN

DATE 08/02/96

REMARKS

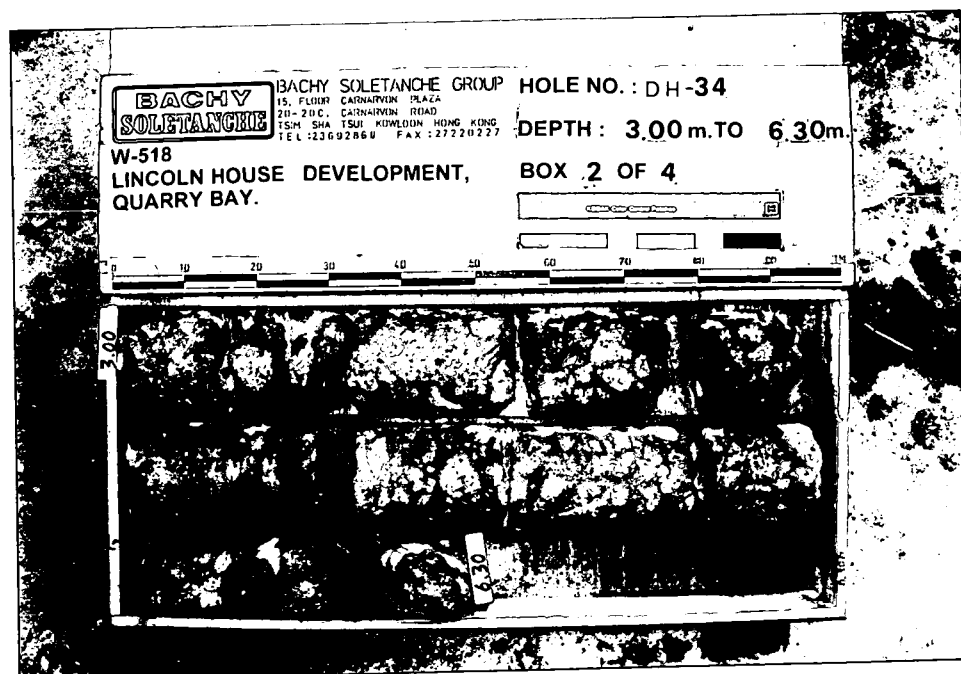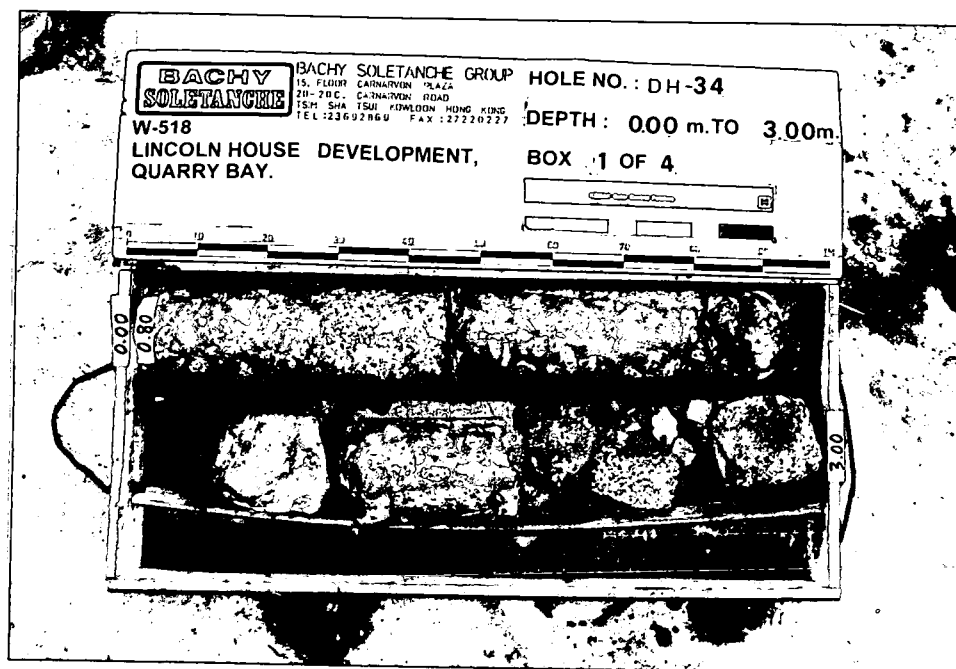

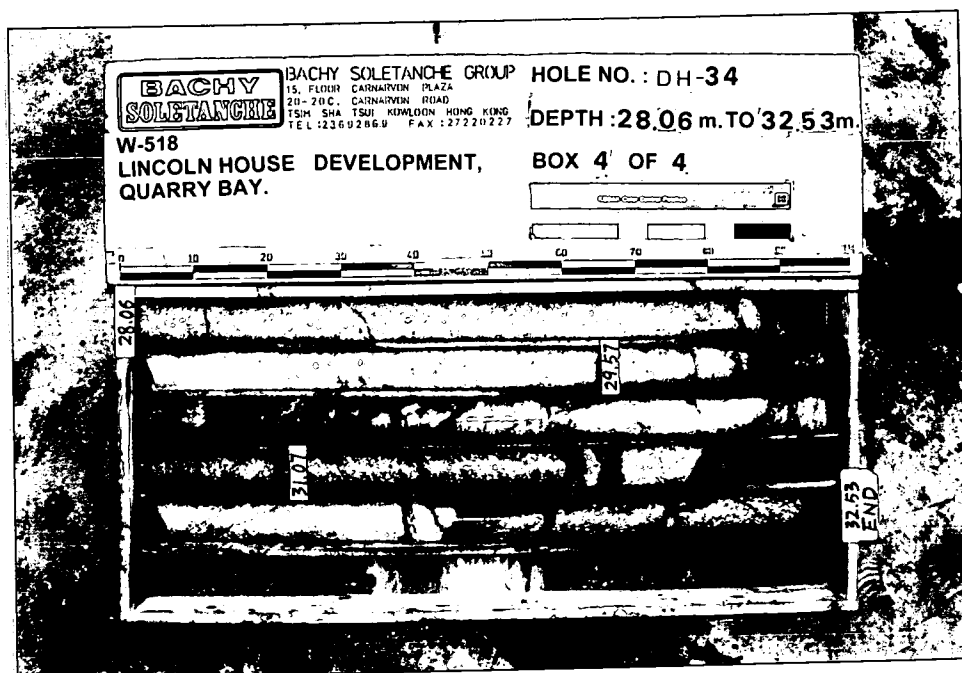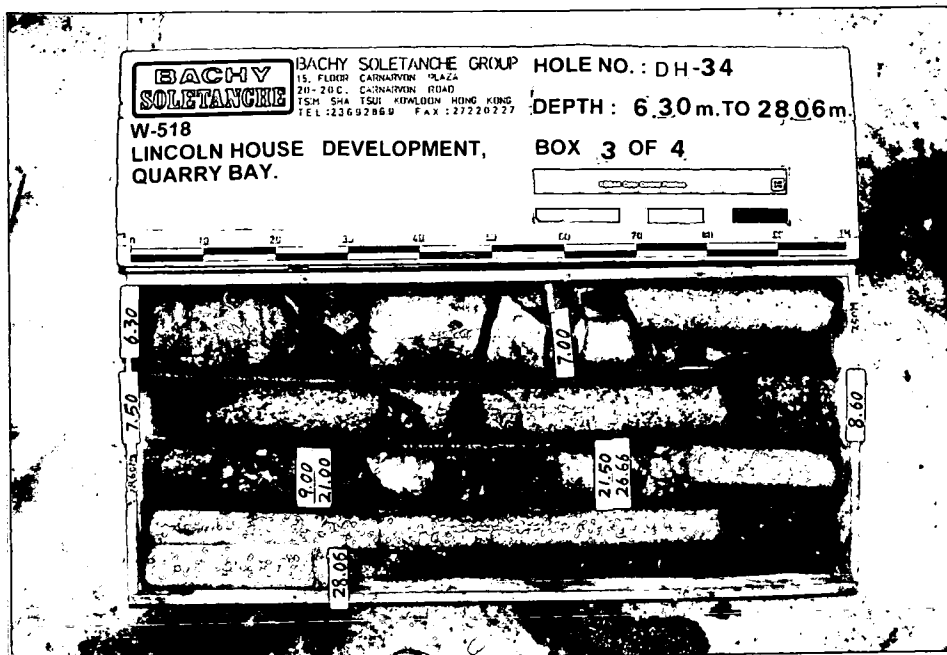



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH40

CONTRACT

SHEET 1 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-61

E 839926.61

DATE from 8/2/96 to 12/2/96

N 816559.28

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.92 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	SX							INSPECTION PIT	3.72	0.00			Concrete Slab.
										0.20			Brown, gravelly silty medium to coarse SAND. (FILL)
2	SX 1.80m		56					SX	2.92	1.00			Angular GRAVEL and COBBLES of moderately decomposed granite and tuff with some brown, silty SAND and some red bricks and concrete fragments. (FILL)
3	PX		67					T2 -101		1.80			
4										2.70			
5			55					T2 -101					
6			85					T2 -101		4.20			
7			69					T2 -101		5.30			
8	PX 7.50m		100					T2 -101		6.10			
9	HX		88					T2 -101		6.70			
10			88					T2 -101		7.80			
									-4.68	8.60			Wash boring. (No recovery)

- SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- MAZIER SAMPLE (70mm)
- PISTON SAMPLE
- Δ WATER SAMPLE
- ▲ PIEZOMETER TIP
- Δ STANDPIPE
- ↓ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∇ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 13/02/96

APPROVED C.LUN

DATE 14/02/96

REMARKS

Hole termination depth at 29.95m.
Inspection Pit from 0.00m to 1.00m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH40

CONTRACT

SHEET 2 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-61

E 839926.61
N 816559.28

DATE from 8/2/96 to 12/2/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 3.92 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 3.
12													
13													
14													
15													
16													
17													
18													
19													
20													

- | | |
|-------------------------|---------------------------|
| SMALL DISTURBED SAMPLE | WATER SAMPLE |
| LARGE DISTURBED SAMPLE | PIEZOMETER TIP |
| SPT LINER SAMPLE | STANDPIPE |
| U76 UNDISTURBED SAMPLE | STANDARD PENETRATION TEST |
| U100 UNDISTURBED SAMPLE | PERMEABILITY TEST |
| MAZIER SAMPLE (70mm) | IN-SITU VANE SHEAR TEST |
| PISTON SAMPLE | |

LOGGED FRANK CHAN

DATE 13/02/96



APPROVED C.LUN



DATE 14/02/96

REMARKS

		BACHY SOLETANCHE GROUP SOIL & FOUNDATIONS SPECIALISTS		DRILLHOLE RECORD CONTRACT		HOLE NO. DH40 SHEET 3 of 3	
PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY							
METHOD ROTARY				CO-ORDINATES		W.O. W-518	
MACHINE & No. LY-61				E 839928.61 N 818559.28		DATE from 8/2/96 to 12/2/96	
FLUSHING MEDIUM WATER				ORIENTATION Vertical		GROUND-LEVEL 3.92 mPD	
Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests
21							
22							
23							
24							
25	HX 24.41m						
26			83	83	51	NR	T2 -101
27			100	100	84	3.9	T2 -101
28			100	100	78	5.4	T2 -101
29			100	100	100	1.8	T2 -101
30			100	100	100		T2 -101
AS SHEET 2 OF 3. Moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with widely to medium spaced and occasionally closely spaced, very narrow to extremely narrow, rough planar, limonite, manganese stained and kaolin coated joints, dipping 10°-20° & 70°-80°. 24.41m-24.70m: no recovery. 25.26m-25.58m: weak to moderately weak, brownish pink spotted black and white, highly to moderately decomposed medium to coarse grained GRANITE. End of hole at 29.95m.							

SMALL DISTURBED SAMPLE LARGE DISTURBED SAMPLE SPT LNER SAMPLE U76 UNDISTURBED SAMPLE U100 UNDISTURBED SAMPLE MAZIER SAMPLE (70mm) PISTON SAMPLE	WATER SAMPLE PIEZOMETER TIP STANDPIPE STANDARD PENETRATION TEST PERMEABILITY TEST IN-SITU VANE SHEAR TEST	LOGGED <u>FRANK CHAN</u> DATE <u>13/02/96</u> APPROVED <u>C.LUN</u> DATE <u>14/02/96</u>	REMARKS
---	--	---	---------

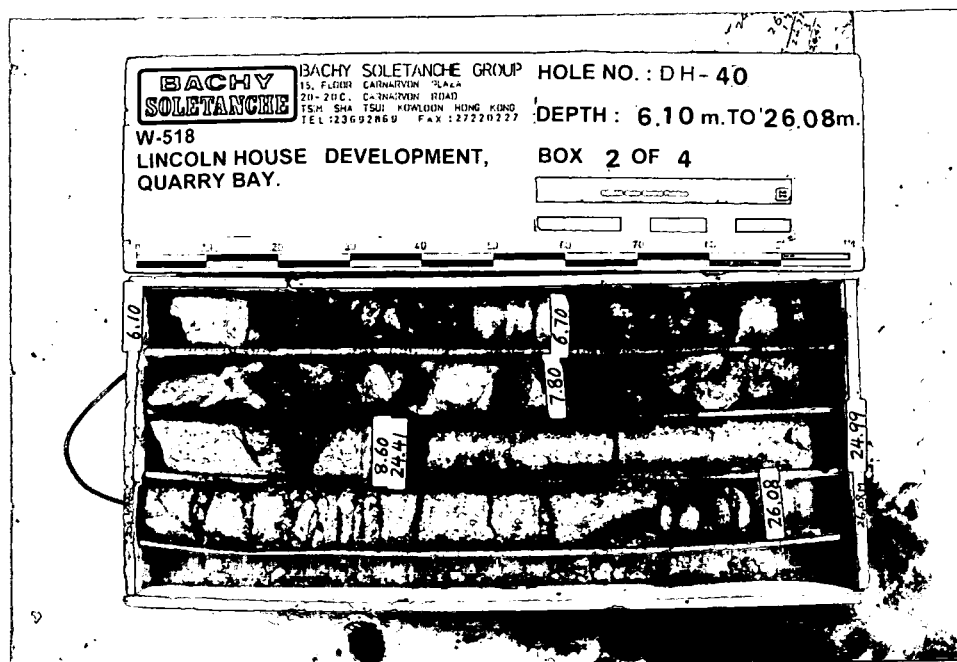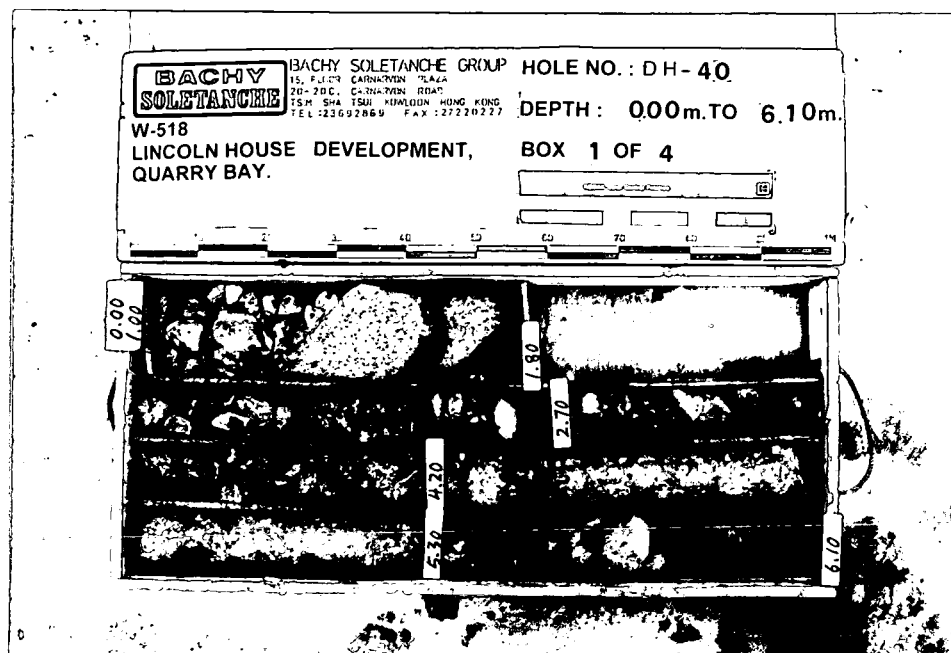

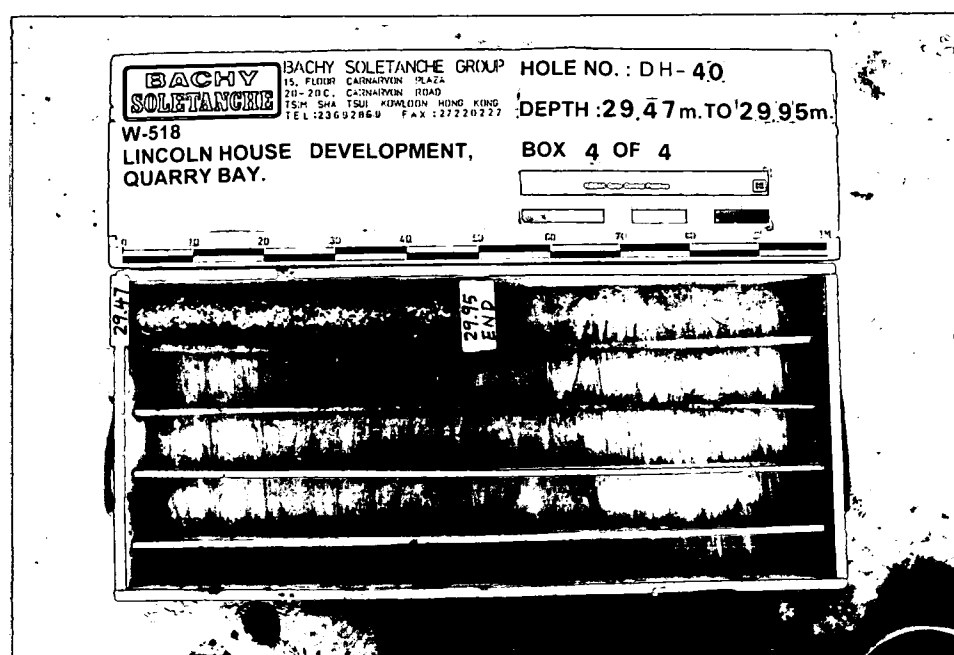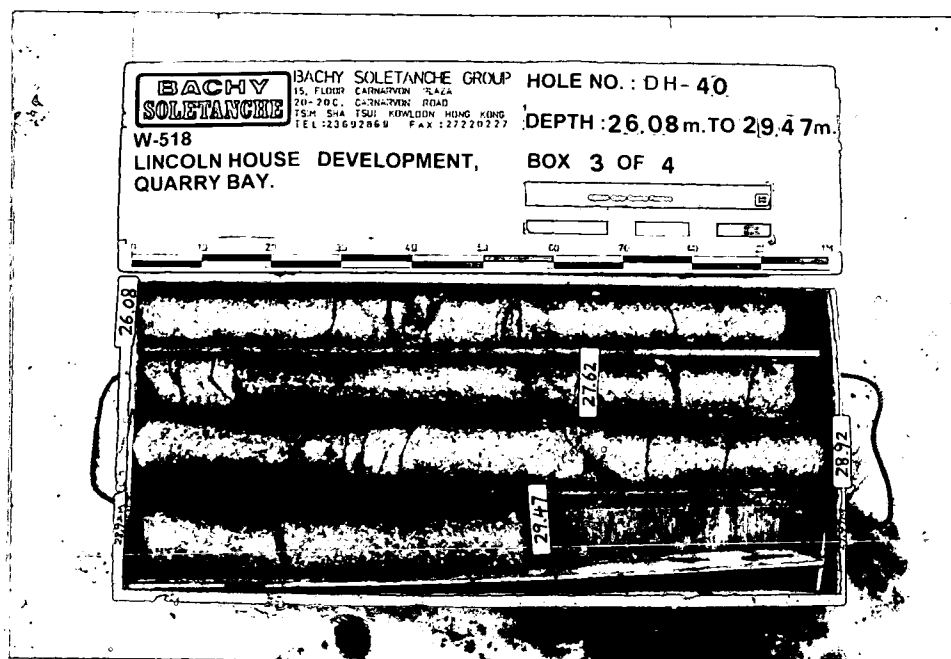



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH42

CONTRACT

SHEET 1 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-09

E 839929.71
N 816552.96

DATE from 27/1/96 to 30/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.36 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.O.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	SX							INSPECTION PIT	4.16	0.00			Concrete Slab.
									3.56	0.80			Brown, gravelly silty medium to coarse SAND. (FILL)
	SX 1.40m		67					SX		1.40			Concrete with cobbles and gravels of moderately decomposed granite and some red bricks. (FILL)
	PX		50					T2 -101	2.76	1.60			Wash boring. (No recovery)
2													
3													
4									0.36	4.00			Angular Boulders, Cobbles and Gravels of moderately decomposed granite with some brown, silty SAND and some red bricks. (FILL)
5			60					T2 -101		5.00			
			100					T2 -101		5.50			
			67					T2 -101		5.80			
6			100					T2 -101		6.20			5.80m-6.10m: boulder.
			100					T2 -101	-2.14	6.50			
7													Wash boring. (No recovery)
8													
9													
10													

• SMALL DISTURBED SAMPLE	△ WATER SAMPLE
■ LARGE DISTURBED SAMPLE	▲ PIEZOMETER TIP
▨ SPT LINER SAMPLE	□ STANDPIPE
■ U76 UNDISTURBED SAMPLE	↓ STANDARD PENETRATION TEST
■ U100 UNDISTURBED SAMPLE	⊥ PERMEABILITY TEST
▨ MAZIER SAMPLE (70mm)	∇ IN-SITU VANE SHEAR TEST
▨ PISTON SAMPLE	

LOGGED FRANK CHAN

DATE 31/01/96

APPROVED C.LUN

DATE 01/02/96

REMARKS

Hole termination depth at 34.99m.
Inspection Pit from 0.00m to 0.80m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH42

CONTRACT

SHEET 2 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-09

E 839929.71
N 816552.96

DATE from 27/1/96 to 30/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.36 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 4.
12													
13													
14													
15	PX												
15.00m	HX												
29/01/96													
16													
17													
18													
19													
20													

- SMALL DISTURBED SAMPLE
- ▮ LARGE DISTURBED SAMPLE
- ▮ SPT LINER SAMPLE
- ▮ U76 UNDISTURBED SAMPLE
- ▮ U100 UNDISTURBED SAMPLE
- ▮ MAZIER SAMPLE (70mm)
- ▮ PISTON SAMPLE
- △ WATER SAMPLE
- ▲ PIEZOMETER TIP
- STANDPIPE
- ↓ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN
DATE 31/01/96
APPROVED C.LUN
DATE 01/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH42

CONTRACT

SHEET 3 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-09

E 839929.71

DATE from 27/1/96 to 30/1/96

N 816552.96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.36 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
21													AS SHEET 2 OF 4.
22													
23													
24													
25													
26													
27													
28													SEE SHEET 4 OF 4.
29	HX 29.00m		100	75	33	10.0		T2 -101	-24.64 -24.74	29.00 29.10 29.40	IV/III III		
30			100	100	81	4.4		T2 -101					

• SMALL DISTURBED SAMPLE	△ WATER SAMPLE
▬ LARGE DISTURBED SAMPLE	▲ PIEZOMETER TIP
▨ SPT LINER SAMPLE	□ STANDPIPE
▩ U76 UNDISTURBED SAMPLE	⊥ STANDARD PENETRATION TEST
▩ U100 UNDISTURBED SAMPLE	⊥ PERMEABILITY TEST
▩ MAZIER SAMPLE (70mm)	∨ IN-SITU VANE SHEAR TEST
▩ PISTON SAMPLE	

LOGGED FRANK CHAN

DATE 31/01/96

APPROVED C.LUN

DATE 01/02/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH42

CONTRACT

SHEET 4 of 4

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. LY-09

E 839929.71

DATE from 27/1/96 to 30/1/96

N 816552.96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.36 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
31			100	100	81	4.4		T2 -101		30.30	+	III	Moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with widely to medium spaced and occasionally closely spaced, very narrow to extremely narrow, rough planar, limonite, manganese, chlorite and kaolin stained joints, dipping 10°-20°, 50°-65°. 29.00m-29.10m: weak to moderately weak, brownish pink spotted black and white, highly to moderately decomposed medium to coarse grained GRANITE.
						10.9				30.94	+		
32			100	100	93			T2 -101		32.15	+		
			100	100	100	4.9		T2 -101		32.82	+		
33			100	100	90			T2 -101		33.19	+		
								T2 -101		33.49	+		
34			100	100	95	2.2		T2 -101			+		
											+		
35									-30.63	34.99	+		
											+		
36													End of hole at 34.99m.
37													
38													
39													
40													

- SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- MAZIER SAMPLE (70mm)
- PISTON SAMPLE
- WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- STANDARD PENETRATION TEST
- PERMEABILITY TEST
- IN-SITU VANE SHEAR TEST




LOGGED FRANK CHAN

DATE 31/01/96

APPROVED C.LUN

DATE 01/02/96

REMARKS

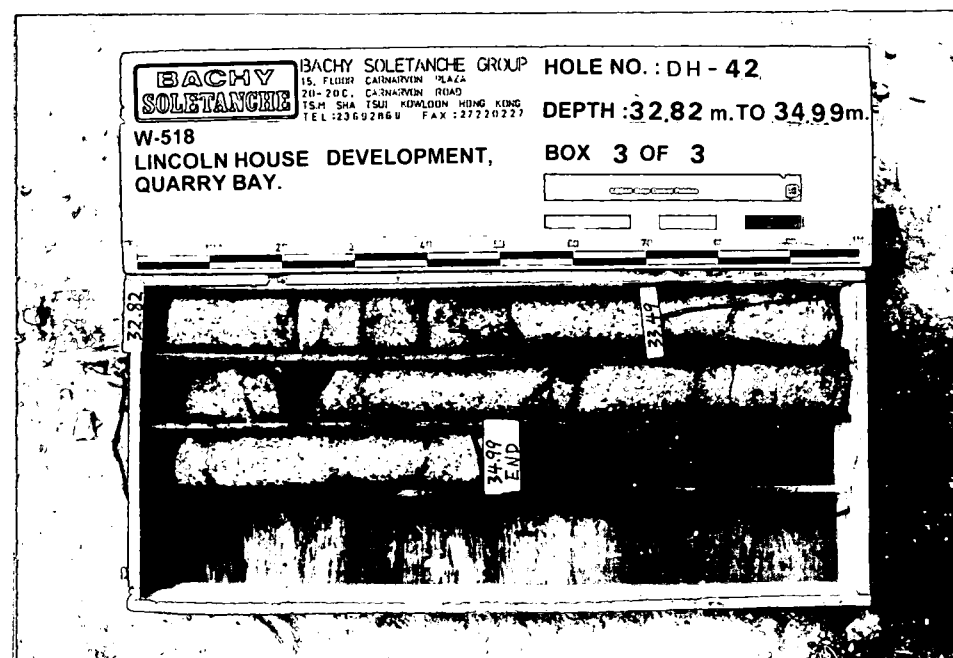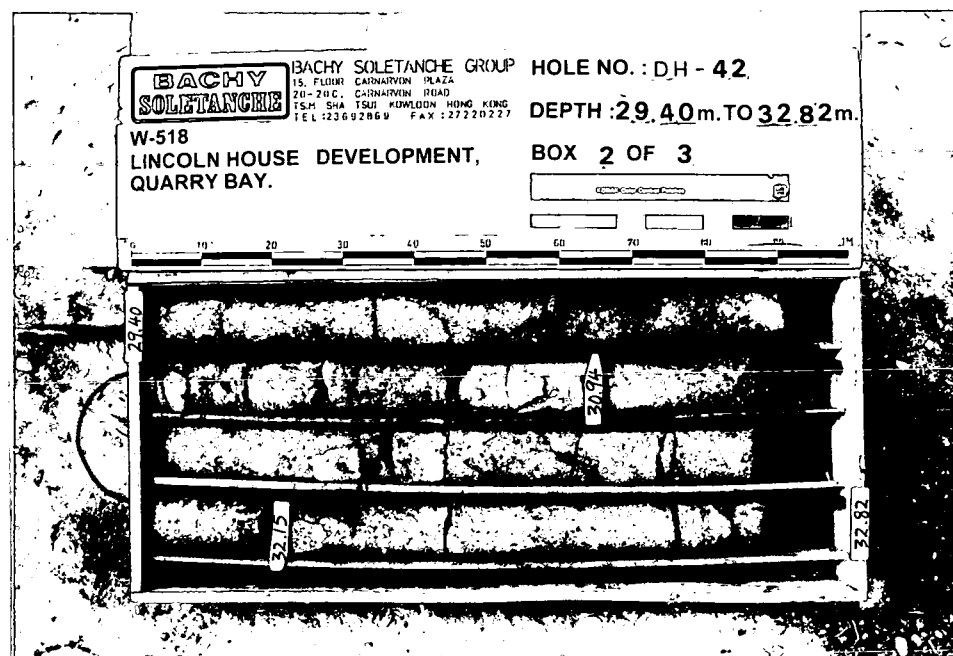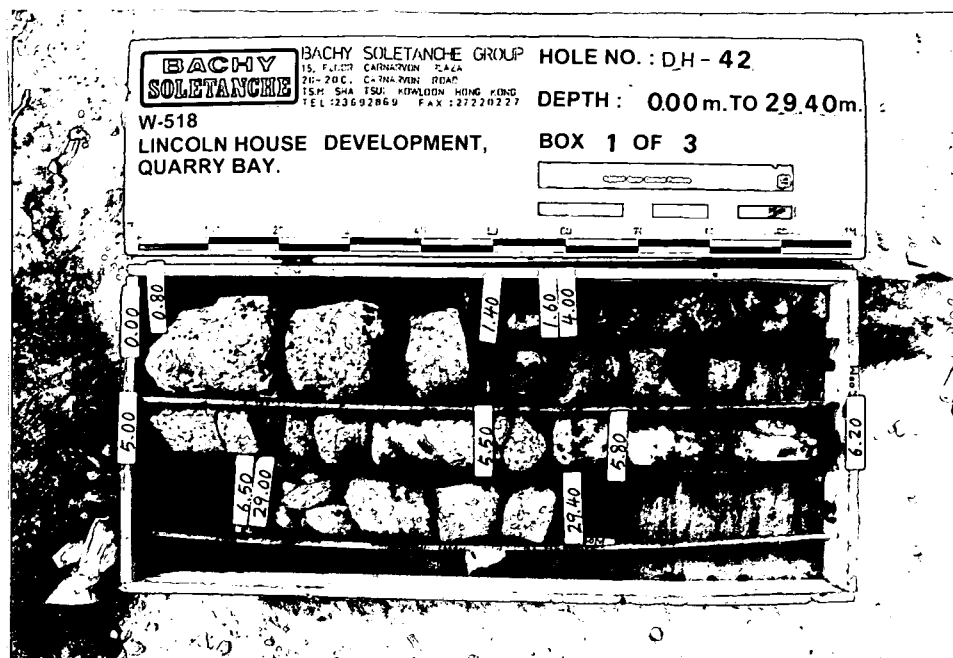

		BACHY SOLETANCHE GROUP SOIL & FOUNDATIONS SPECIALISTS		DRILLHOLE RECORD		HOLE NO. DH47							
				CONTRACT		SHEET 1 of 3							
PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY													
METHOD ROTARY				CO-ORDINATES E 839929.28 N 816537.84		W.O. W-518							
MACHINE & No. D2G-22						DATE from 14/2/96 to 15/2/96							
FLUSHING MEDIUM WATER				ORIENTATION Vertical		GROUND-LEVEL 4.33 mPD							
Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	HX		16					HX	4.13	0.20	△ △		Concrete Slab. Concrete with GRAVELS and COBBLES of moderately decomposed granite with some brown silty SAND and red bricks. (FILL)
2									1.83	2.50			
3								T2 -101	1.43	2.90			Wash boring. (No recovery)
4			29					T2 -101		4.10			Angular GRAVEL, COBBLES and BOULDERS of moderately decomposed granite with some brown, silty SAND. (FILL) 3.87m-4.10m: boulder.
5	HX 5.00m NX		28					T2 -101		-0.67			Wash boring. (No recovery)
6													
7													
8													
9													
10													

• SMALL DISTURBED SAMPLE △ WATER SAMPLE
┆ LARGE DISTURBED SAMPLE ▲ PIEZOMETER TIP
▨ SPT LINER SAMPLE □ STANDPIPE
■ U76 UNDISTURBED SAMPLE ┆ STANDARD PENETRATION TEST
▨ U100 UNDISTURBED SAMPLE ┆ PERMEABILITY TEST
▨ MAZIER SAMPLE (70mm) ∨ IN-SITU VANE SHEAR TEST
▨ PISTON SAMPLE

LOGGED FRANK CHAN

DATE 16/02/96

APPROVED C.LUN

DATE 17/02/96

REMARKS
Hole termination depth at 28.85m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH47

CONTRACT

SHEET 2 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. D2G-22

E 839929.28
N 816537.84

DATE from 14/2/96 to 15/2/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.33 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 3.
12													
13													
14													
15													
16													
17													
18													
19			100	100	69	6.1			-14.39	18.72	+	III	
20			46	46	14	>20.0			-15.38	19.71	+	IV/III	

• SMALL DISTURBED SAMPLE	△ WATER SAMPLE
▬ LARGE DISTURBED SAMPLE	▬ PIEZOMETER TIP
▨ SPT LINER SAMPLE	▨ STANDPIPE
▩ U76 UNDISTURBED SAMPLE	↓ STANDARD PENETRATION TEST
▩ U100 UNDISTURBED SAMPLE	┃ PERMEABILITY TEST
▨ MAZIER SAMPLE (70mm)	▽ IN-SITU VANE SHEAR TEST
▨ PISTON SAMPLE	

LOGGED FRANK CHAN

DATE 16/02/96

APPROVED C.LUN

DATE 17/02/96

REMARKS

Moderately weak to moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with medium to closely spaced, narrow, rough planar, limonite and



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH47

CONTRACT

SHEET 3 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. D2G-22

E 839929.28

DATE from 14/2/96 to 15/2/96

N 816537.84

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.33 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
21	NX 20.55m		46	46	14	NR		T-74	-16.22	20.55		IV	manganese stained joints, dipping 10°-20° & 40°-50°.
22			58	58	50	5.6		T-74	-17.12	21.45		III	19.71m-19.91m & 23.14m-23.35m: weak to moderately weak, brownish pink spotted black and white, highly to moderately decomposed medium to coarse grained GRANITE.
23			31	31	17	NR		T-74	-18.81	23.14		IV	19.91m-20.55m & 21.45m-23.14m: no recovery.
24			100	100	67	3.2		T-74	-19.02	23.35		IV/III	
25			100	100	35	13.3		T-74	-21.27	25.88		III	Moderately weak to moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE with widely to medium spaced, very narrow, rough planar, limonite, manganese stained and kaolin coated joints, dipping 10°-20°, 40°-60° & 70°-80°.
26			100	100	100	1.5		T-74	-26.12	26.12		III/II	Moderately strong to strong, brownish pink, moderately to slightly decomposed, medium grained GRANITE with medium spaced rough planar joints.
27			100	100	98			T-74	-26.81	26.81			
28			100	100	100	3.9		T-74	-27.32	27.32			
29									-24.52	28.85			End of hole at 28.85m.
30													

- SMALL DISTURBED SAMPLE
- ▮ LARGE DISTURBED SAMPLE
- ▮ SPT LINER SAMPLE
- ▮ U76 UNDISTURBED SAMPLE
- ▮ U100 UNDISTURBED SAMPLE
- ▮ MAZIER SAMPLE (70mm)
- ▮ PISTON SAMPLE
- Δ WATER SAMPLE
- ▴ PIEZOMETER TIP
- Δ STANDPIPE
- ┃ STANDARD PENETRATION TEST
- ┃ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST



LOGGED FRANK CHAN

DATE 16/02/96

APPROVED C.LUN

DATE 17/02/96

REMARKS

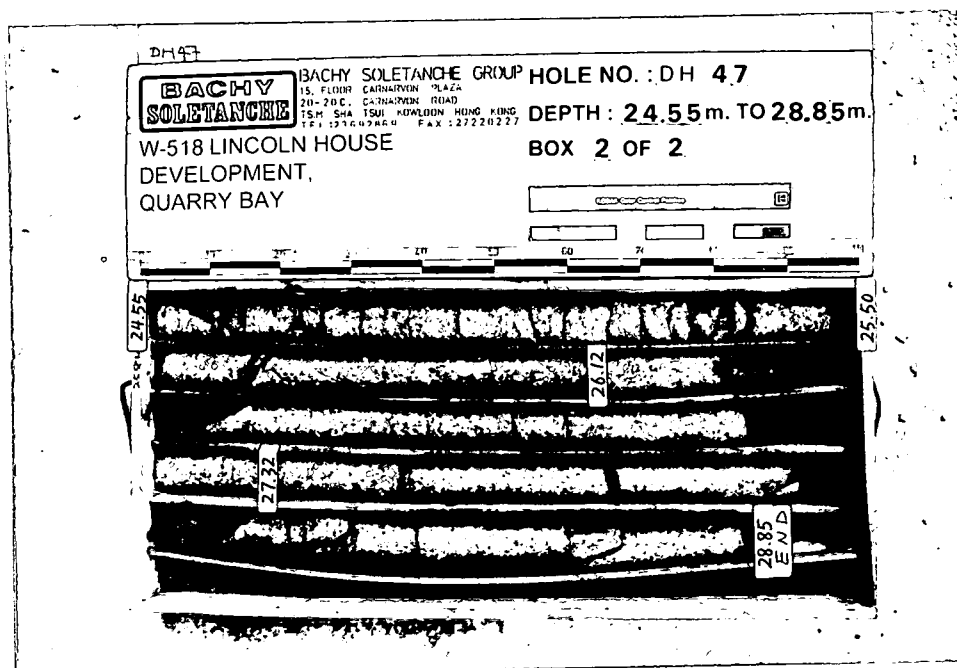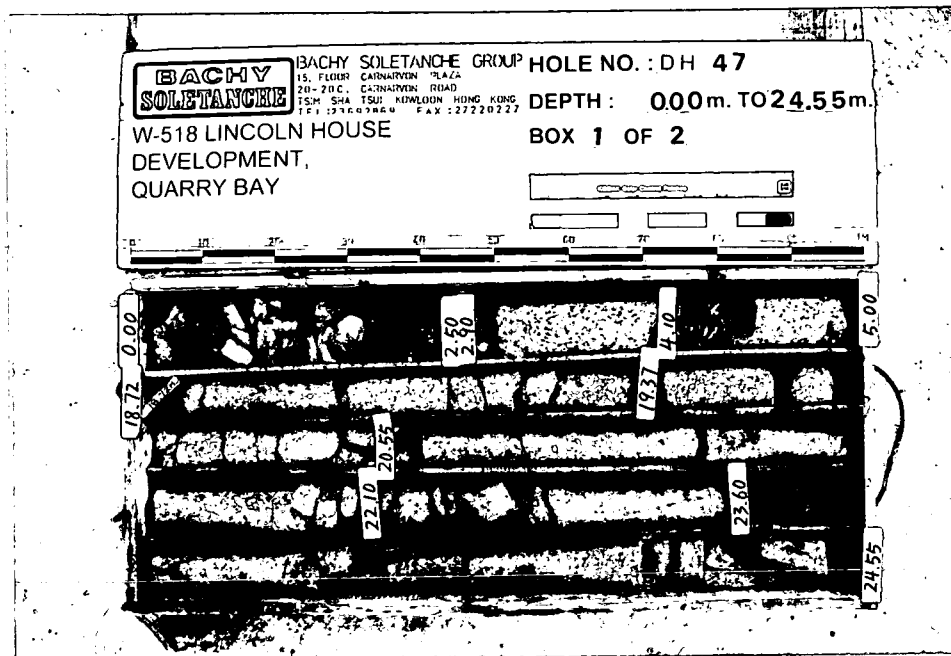



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH55

CONTRACT

SHEET 1 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. CMC-57

E 839928.78

DATE from 27/1/96 to 29/1/96

N 816516.83

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.42 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
1	SX								4.22	0.20			Concrete Slab. Brown, gravelly silty medium to coarse SAND. (FILL)
2									2.42	2.00			
3	SX 3.00m PX												Wash boring. (No recovery)
4													
5													
6													
7													
8	PX 7.50m HX												
9													
10													

- SMALL DISTURBED SAMPLE
- ▬ LARGE DISTURBED SAMPLE
- ▨ SPT LINER SAMPLE
- ▩ U76 UNDISTURBED SAMPLE
- ▩ U100 UNDISTURBED SAMPLE
- ▨ MAZIER SAMPLE (70mm)
- ▩ PISTON SAMPLE
- Δ WATER SAMPLE
- ▲ PIEZOMETER TIP
- ◻ STANDPIPE
- ⊥ STANDARD PENETRATION TEST
- ⊥ PERMEABILITY TEST
- ∨ IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 30/01/96

APPROVED C.LUN

DATE 31/01/96

REMARKS

Hole termination depth at 24.15m.



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH55

CONTRACT

SHEET 2 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. CMC-57

E 839928.78

N 816516.83

DATE from 27/1/96 to 29/1/96

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.42 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
11													AS SHEET 1 OF 3.
12													
13													
14													
15													Moderately weak to moderately strong, brownish pink spotted black and white, moderately decomposed medium to coarse grained GRANITE. (CORESTONE) Wash boring. (No recovery)
16													
17			100	100	90	6.7		T2 -101	-11.89 -12.49	16.31 16.91	++ ++ ++	III	
18													
19	HX 19.01m												SEE SHEET 3 OF 3.
20			100	100	100	2.2		T2 -101	-14.59 19.93	19.01	++ ++ ++ ++	II	

- SMALL DISTURBED SAMPLE
- LARGE DISTURBED SAMPLE
- SPT LINER SAMPLE
- U76 UNDISTURBED SAMPLE
- U100 UNDISTURBED SAMPLE
- MAZIER SAMPLE (70mm)
- PISTON SAMPLE
- WATER SAMPLE
- PIEZOMETER TIP
- STANDPIPE
- STANDARD PENETRATION TEST
- PERMEABILITY TEST
- IN-SITU VANE SHEAR TEST

LOGGED FRANK CHAN

DATE 30/01/96

APPROVED C.LUN

DATE 31/01/96

REMARKS



BACHY SOLETANCHE GROUP
SOIL & FOUNDATIONS SPECIALISTS

DRILLHOLE RECORD

HOLE NO. DH55

CONTRACT

SHEET 3 of 3

PROJECT LINCOLN HOUSE DEVELOPMENT, QUARRY BAY

METHOD ROTARY

CO-ORDINATES

W.O. W-518

MACHINE & No. CMC-57

E 839928.78

DATE from 27/1/96 to 29/1/96

N 816516.83

FLUSHING MEDIUM WATER

ORIENTATION Vertical

GROUND-LEVEL 4.42 mPD

Drilling Progress	Casing size	Water level (m) Shift start/end	Total core Recovery %	Solid core Recovery %	R.Q.D.	Fracture Index	Tests	Samples	Reduced Level	Depth (m)	Legend	Grade	Description
21			100	100	100			T2 -101		20.31	++	II	Strong, pinkish grey spotted black and white, slightly decomposed medium to coarse grained GRANITE with widely spaced, extremely narrow, rough planar, limonite stained and clean joints, dipping 10°-20°, 75°-85°.
22			100	100	100	0.0		T2 -101		21.70	++		
23			100	100	100			T2 -101		23.01	++		
24			100	100	100	2.6		T2 -101		24.15	++		
25													End of hole at 24.15m.
26													
27													
28													
29													
30													

SMALL DISTURBED SAMPLE	WATER SAMPLE
LARGE DISTURBED SAMPLE	PIEZOMETER TIP
SPT LINER SAMPLE	STANDPIPE
U76 UNDISTURBED SAMPLE	STANDARD PENETRATION TEST
U100 UNDISTURBED SAMPLE	PERMEABILITY TEST
MAZIER SAMPLE (70mm)	IN-SITU VANE SHEAR TEST
PISTON SAMPLE	

LOGGED FRANK CHAN

DATE 30/01/96

APPROVED C.LUN

DATE 31/01/96

REMARKS

