

## Report

- **Reference:** 31420
- **Name:** Essa Yakoub
- **Emirate:** Dubai
- **Inspected on:** 2025-09-23

## Vehicle

- **Title:** Nissan PATROL
- **Model year:** 2021
- **Manufacturing year:** 2021
- **Chassis number:** JN8BY2NY4M9345338
- **Odometer:** 115,224km
- **Condition:** Used
- **Gearbox:** Automatic
- **Fuel type:** Gasoline
- **Cylinders:** 6
- **Engine size:** 4.0 L

## Additional specs

- **Regional specs:** GCC
- **Exterior color:** White
- **Interior color:** Black
- **Interior type:** Fabric
- **Steering side:** Left hand
- **Drivetrain:** 4x4
- **Wheels:** 20" alloy
- **Keys:** 1
- **Doors:** 5
- **Seats:** 7

## Warranty / Services

- **Warranty :** Not available
- **With service history :** Third party

## Inspector summary

### Body

- 3 Accident reported, full body painted, flooded vehicle.
- Front and rear bumper required repair and repainted

### Exterior

- Body dents and scratches.
- Both side door moulding chrome have dents.

### Interior

- Normal wear and tear, underseats rusty
- Left side folding mirror not working

### Mechanical

- Front brake pads remaining percentage 60%, Rear brake pads remaining percentage 70%
- Recommended to do major service including spark plugs, gear oil and filter gasket, All filters includes Air, AC, Fuel filter, change front and rear differential and transfer case oil.
- Severe rust and mud underneath see photo attached.
- Change all tyres and perform wheel alignment and wheel balancing
- Need to do steam washing and apply underneath rust removal and treatment.


### Electrical

- For tyre and battery report see diagnostic attachment.
- Tyre pressure light is ON


**For any questions regarding this report, please contact AutoHub Operations Manager**








 [+971 54 289 8396](tel:+971542898396) (Phone or WhatsApp)

Available Daily (except Saturday) from 10:00 AM to 2:00 PM and 3:00 PM to 8:00 PM

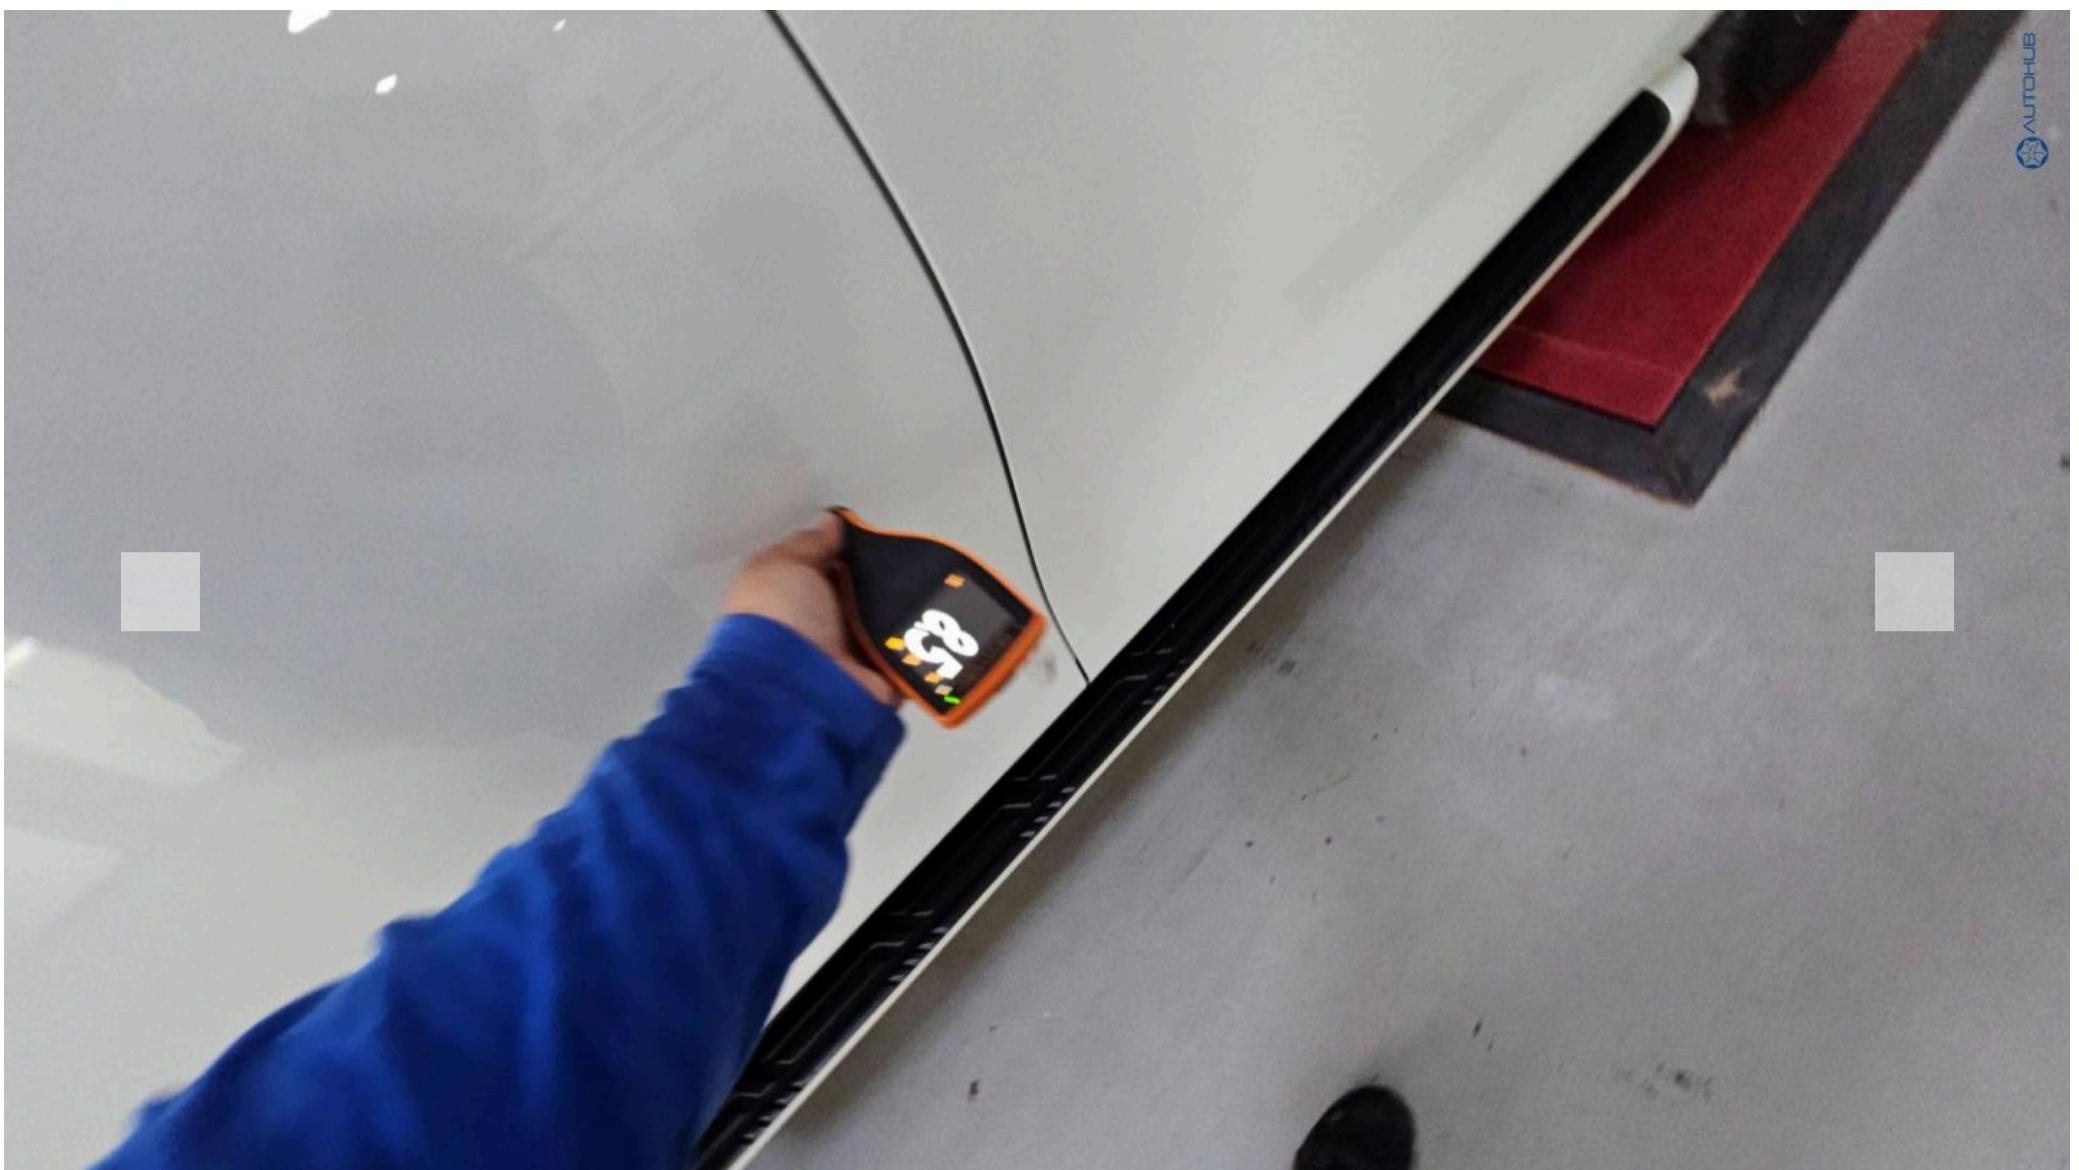





## Exterior

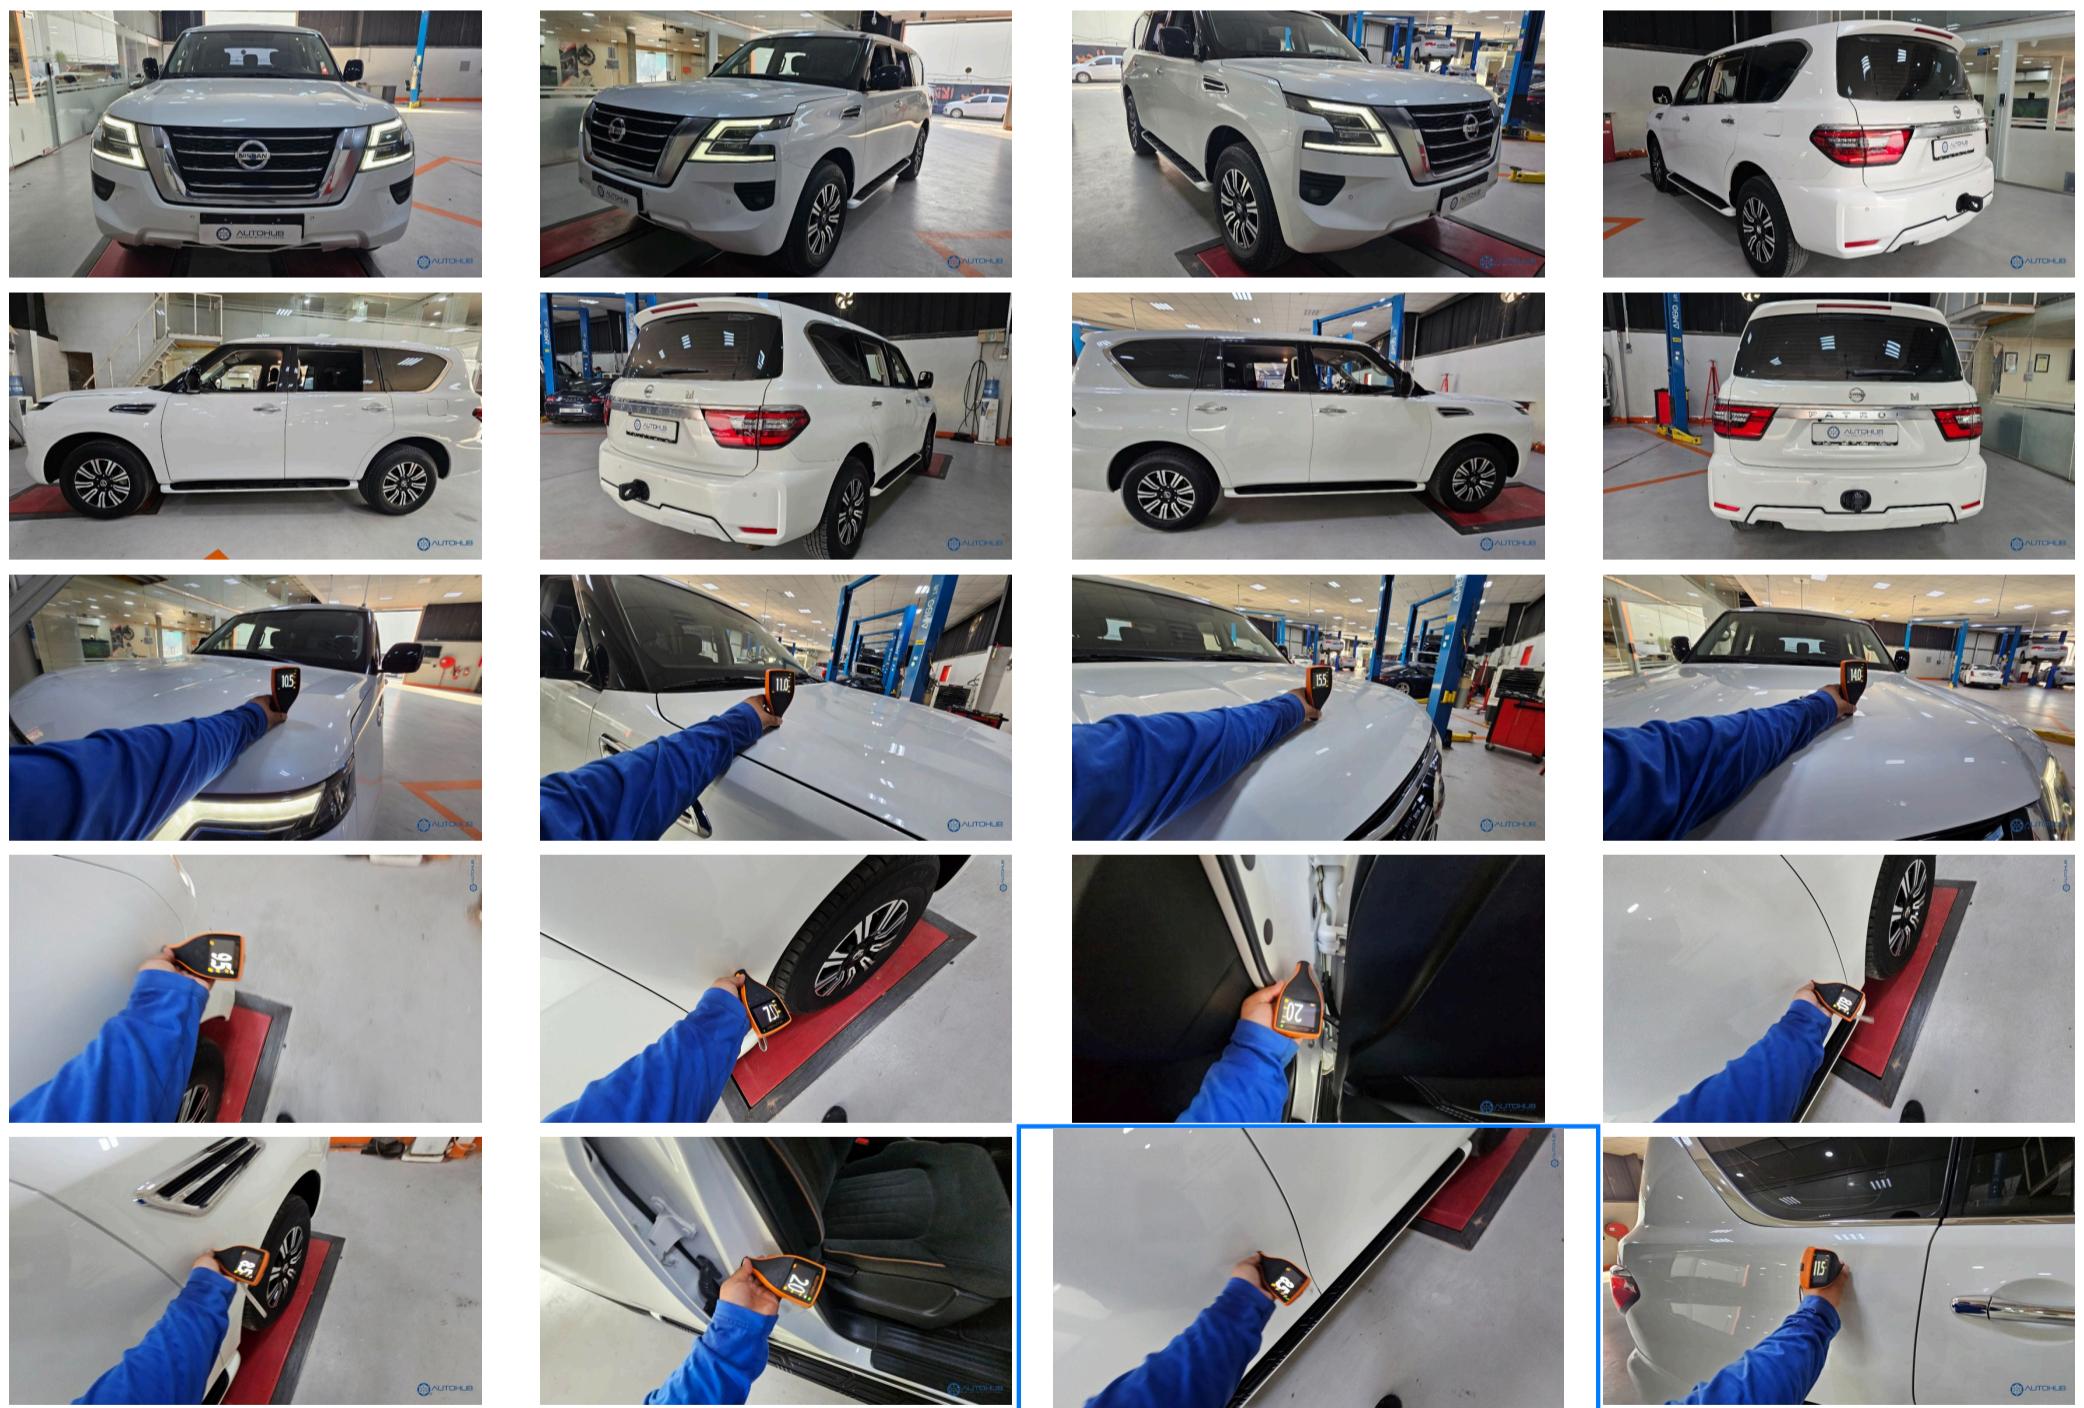

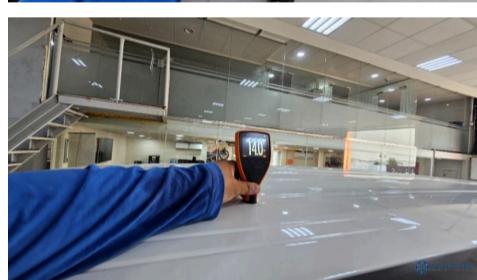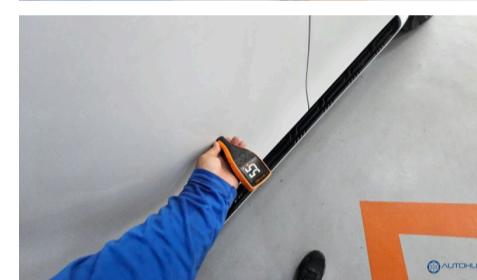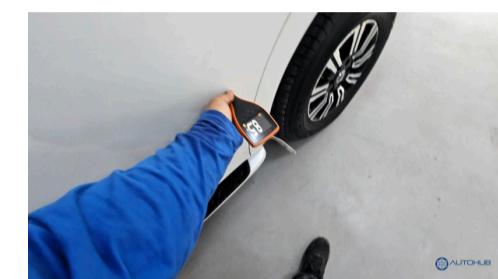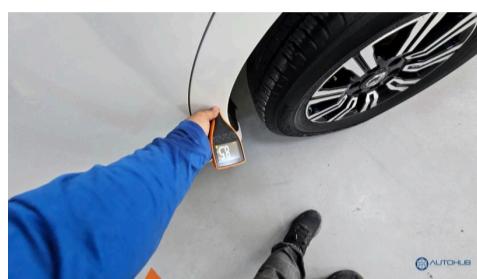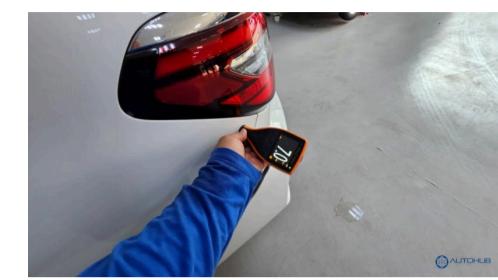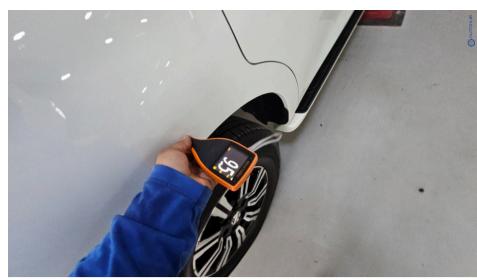

## Interior







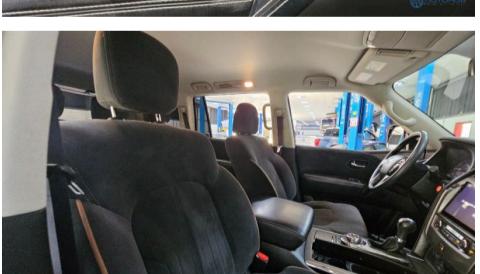


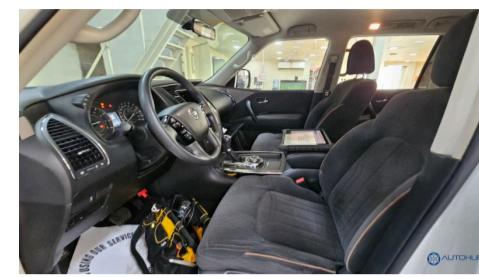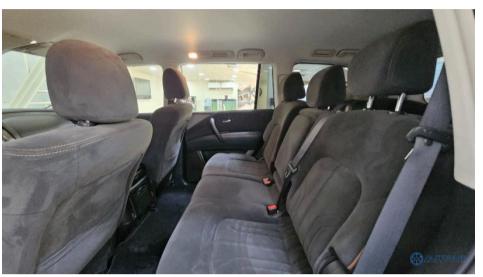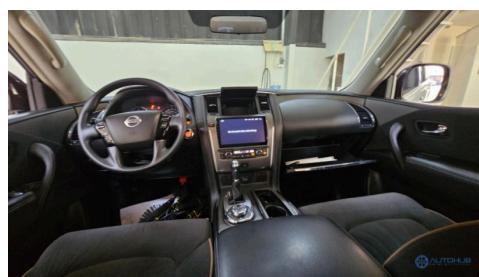


## Tires



## Mechanical

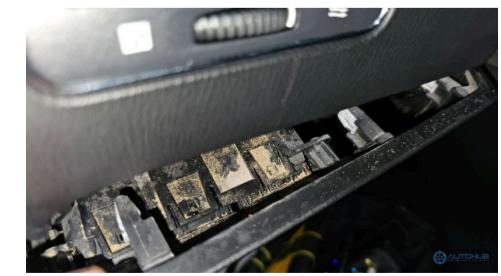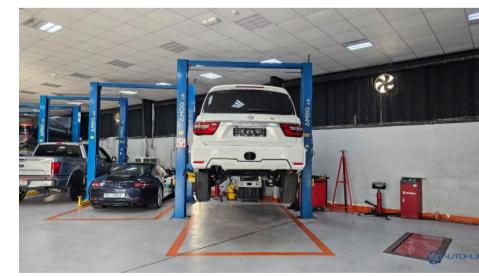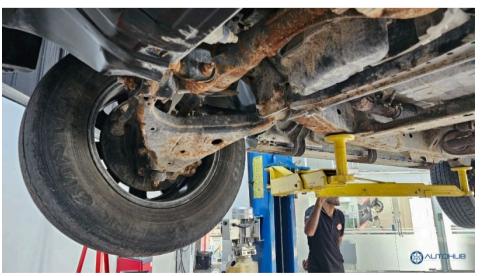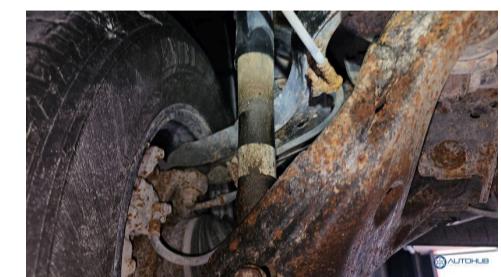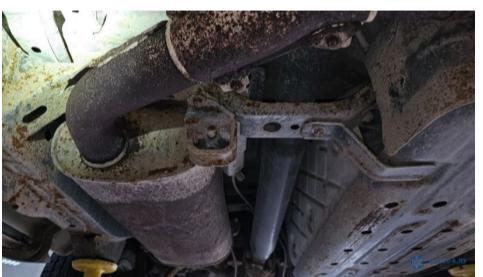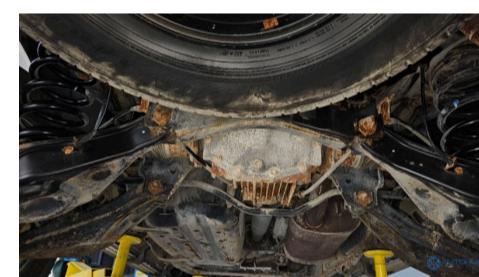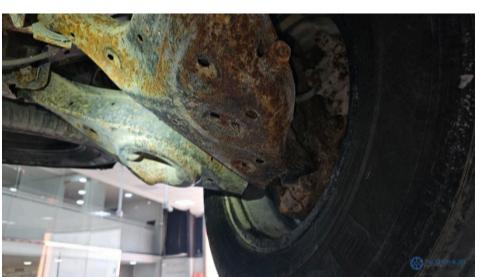

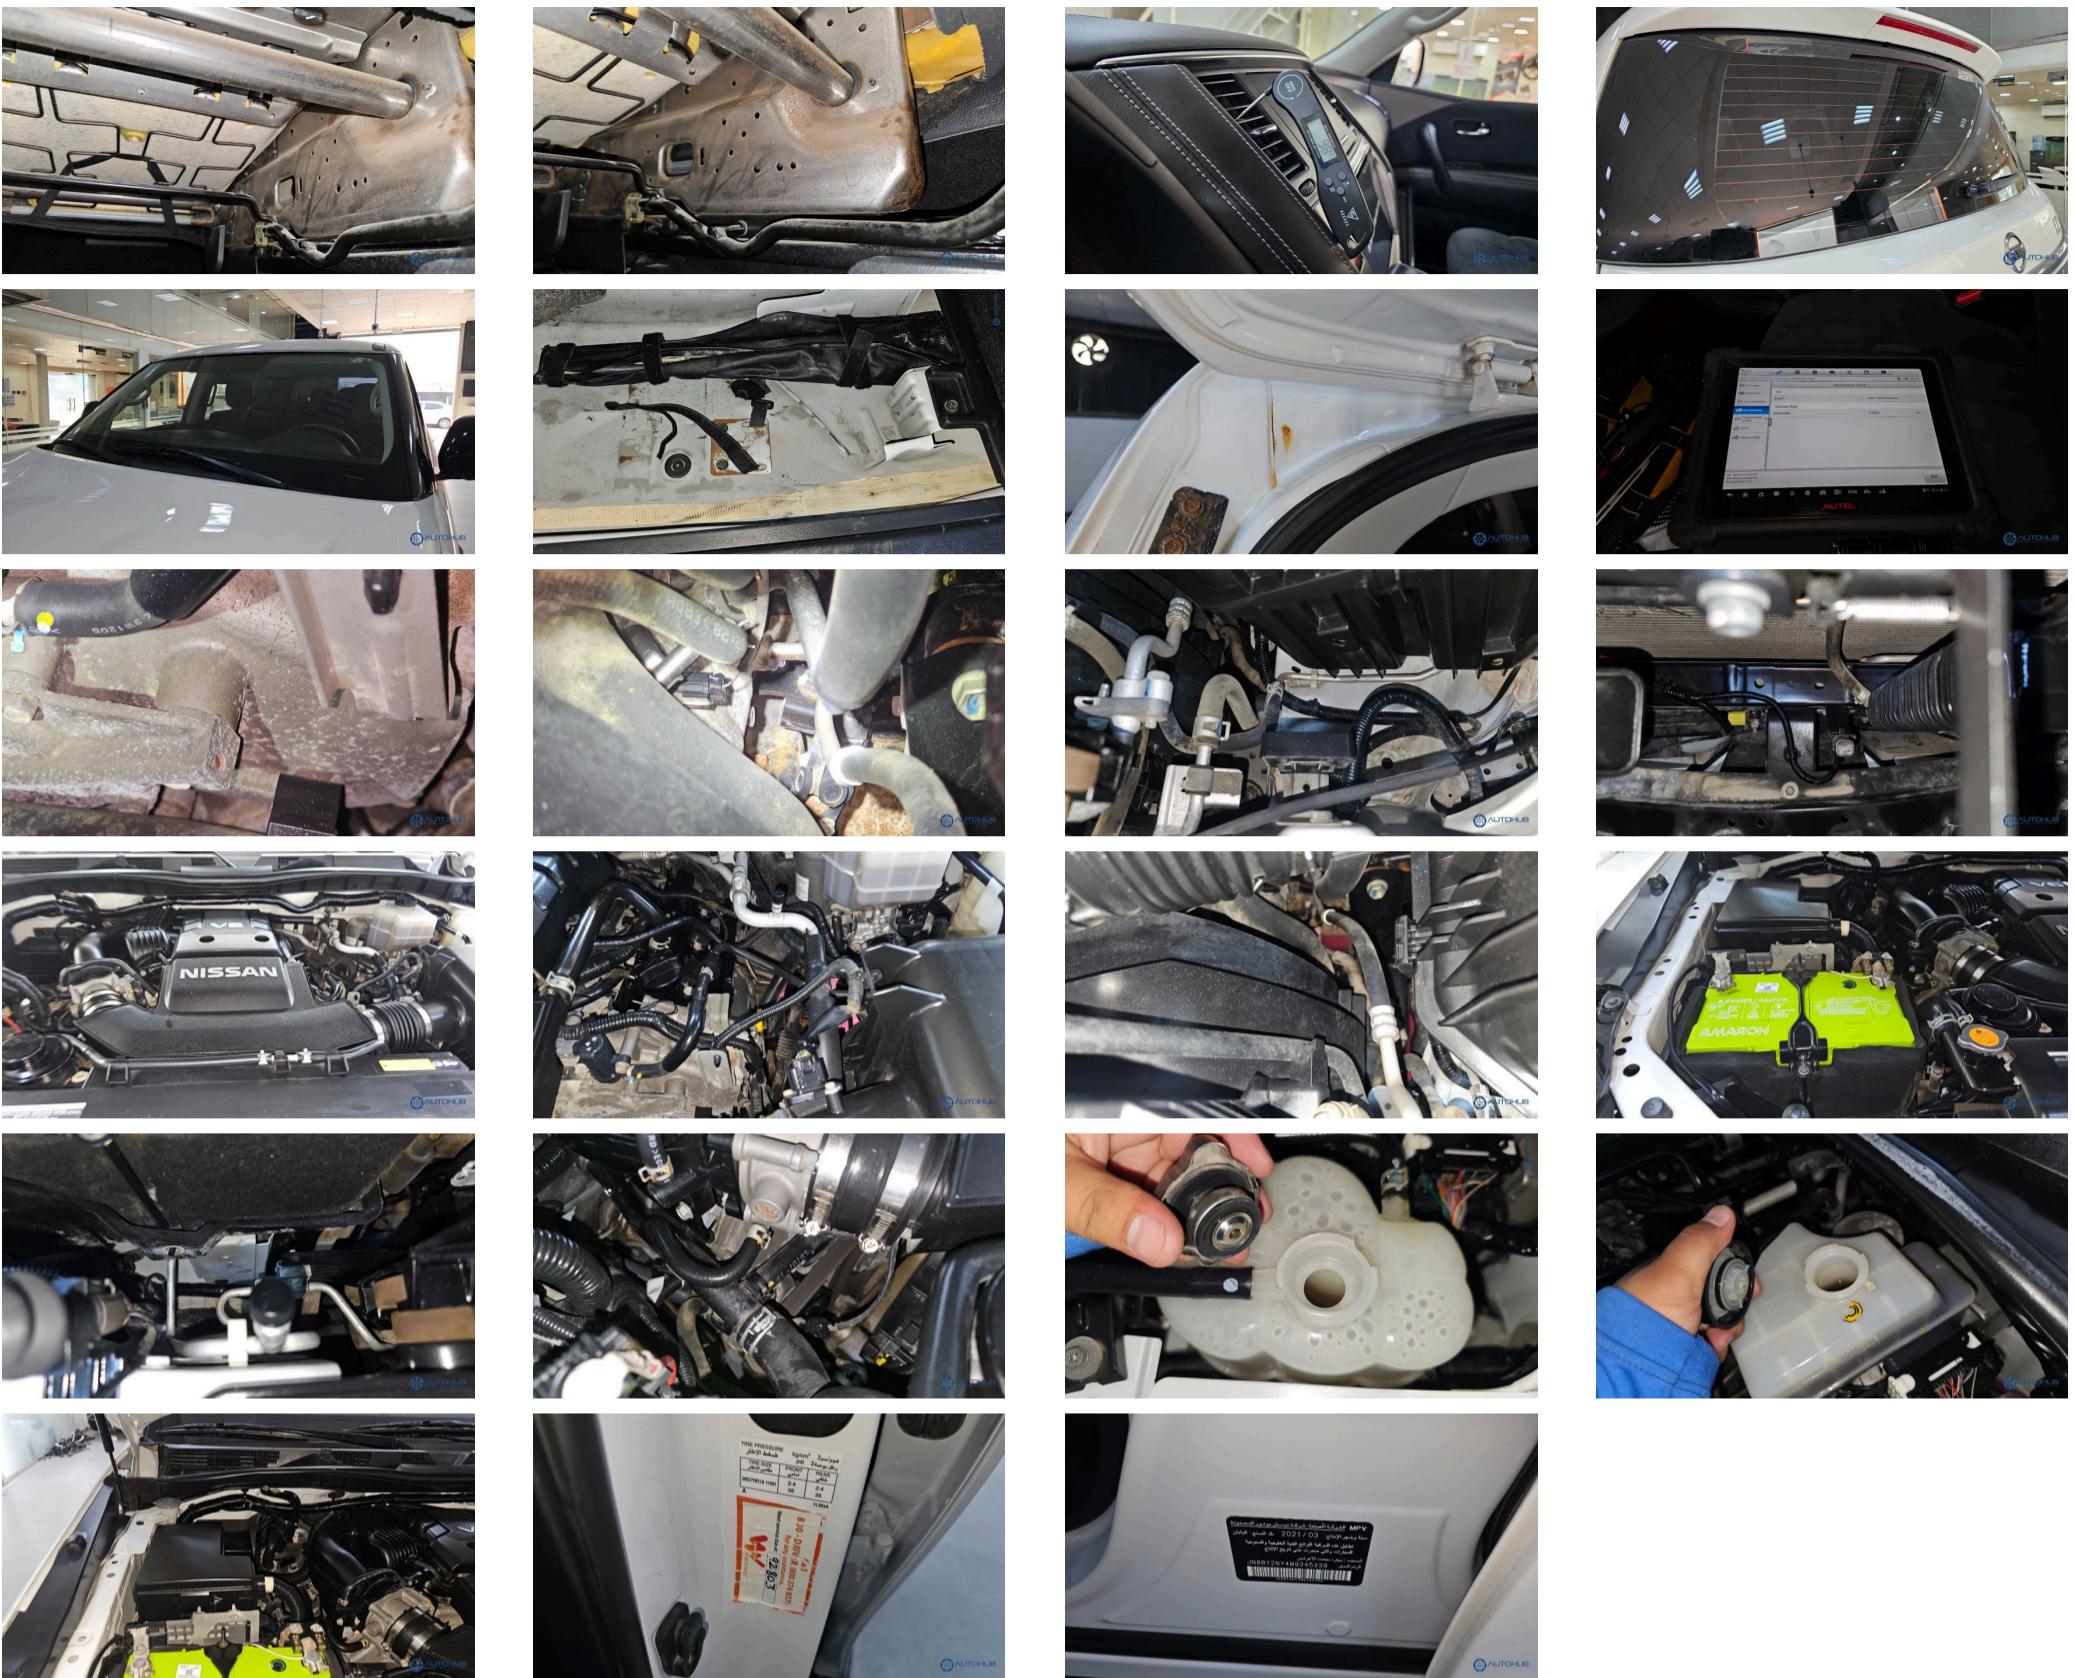

## Video

[View Video](#)

Click to access the inspection video link

## Vehicle Diagnostic Reports

### Before Test Drive Report

A pre-drive computer diagnostic report that provides a full scan of the vehicle's electronic systems to establish baseline conditions.

[↑ Download Report](#)

### After Test Drive Report

A post-drive diagnostic report highlighting any detected fault codes or irregularities in the vehicle's systems after road testing.

[↑ Download Report](#)

### Battery Report

### Tire Report

A battery health assessment report detailing voltage, charge status, starting power, and internal resistance.

[↑ Download Report](#)

A report on tire tread depth and brake disc wear, including visual inspection notes and safety-based recommendations.

[↑ Download Report](#)

## Vehicle specifications

### Performance

- ✓ Differential Lock

### Safety

- ✓ Child Safety Seats (ISOFIX)
- ✓ Front Parking Sensors
- ✓ Rear Parking Sensors
- ✓ Anti-Lock Brakes (ABS)
- ✓ EBD
- ✓ Alarm
- ✓ Traction Control System
- ✓ Anti Glare Rear View Mirror
- ✓ Tire Pressure Monitor

### Interior - Entertainment

- ✓ Digital Driver Display
- ✓ Bluetooth Interface
- ✓ AUX Audio System
- ✓ USB
- ✓ Touch Screen

### Interior - Comfort

- ✓ Dual-Zone Climate Control AC
- ✓ Keyless Entry
- ✓ Keyless Start
- ✓ Power Steering
- ✓ Cruise Control
- ✓ Power Front Windows
- ✓ Power Rear Windows
- ✓ Power Locks
- ✓ Power Mirrors

Power Folding Mirrors      Left side not working

Fabric Seats

## Exterior

Roof Carrier

LED Headlight

# Inspection Checklist

## Body Exterior

Glass

Door locks / operation

Fuel filler cover / Petrol cap

## Electric Controls

Ignition lock / Starting system

Battery charging system

Headlights

Rear lights

Horn

Window operation

Wipers / Jet washers

## Exhaust System

Inlet manifold

Outlet manifold

Pipes

Silencer(s)

Head shields and mountings

Joints and couplings

## Convenience

Keys and remote controls

## Brakes

Disc and pads      Rusty

## Road Test

Engine - performance      Need service and perform oil flushing

- ✓ Engine - excessive smoke
- ✓ Evidence of overheating
- ✓ Gearbox operation and noise level
- ✓ Instruments and controls functioning
- ✗ Suspension noise                                  Worn out
- ✓ Road holding stability
- ✗ Warning lights                                      tyre pressure light is on

## Wheels and Tyres

- ✗ Front right tyre                                  Uneven wear
- ✗ Front left tyre                                  Uneven wear
- ✗ Back right tyre                                  Uneven wear
- ✗ Back left tyre                                  Uneven wear

## Interior and Luggage Compartment

- ✓ Seat belts
- ✓ Internal mirrors
- ✓ Boot / Tailgate lock

## Engine Compartment

- ✓ Coolant level
- ✓ Coolant leaks
- ✓ Radiator cap
- ✓ Hoses and pipes
- ✓ Drive belts
- ✓ Engine oil level
- ✓ External engine leaks
- ✓ Fuel pump and pipes
- ✓ Cold starting
- ✓ Fast idle when engine cold
- ✓ Noise level when engine cold
- ✓ Excess smoke

## Suspension, Underframe and Steering

- ✓ Engine underside leaks

✓ Steering joints and ball joints

✓ Steering rack

✓ Chassis members

✓ Power steering

✓ Wheels, hubs and bearings

✓ Pipes and hoses

✗ Dampers and bushes                          Worn out


✗ Sub frames and mountings                          Severe rust

✗ Evidence of floor / chassis corrosion                          Severe rust

#### Clutch and Transmission

✗ Transmission                          Need servicing

## Damage points

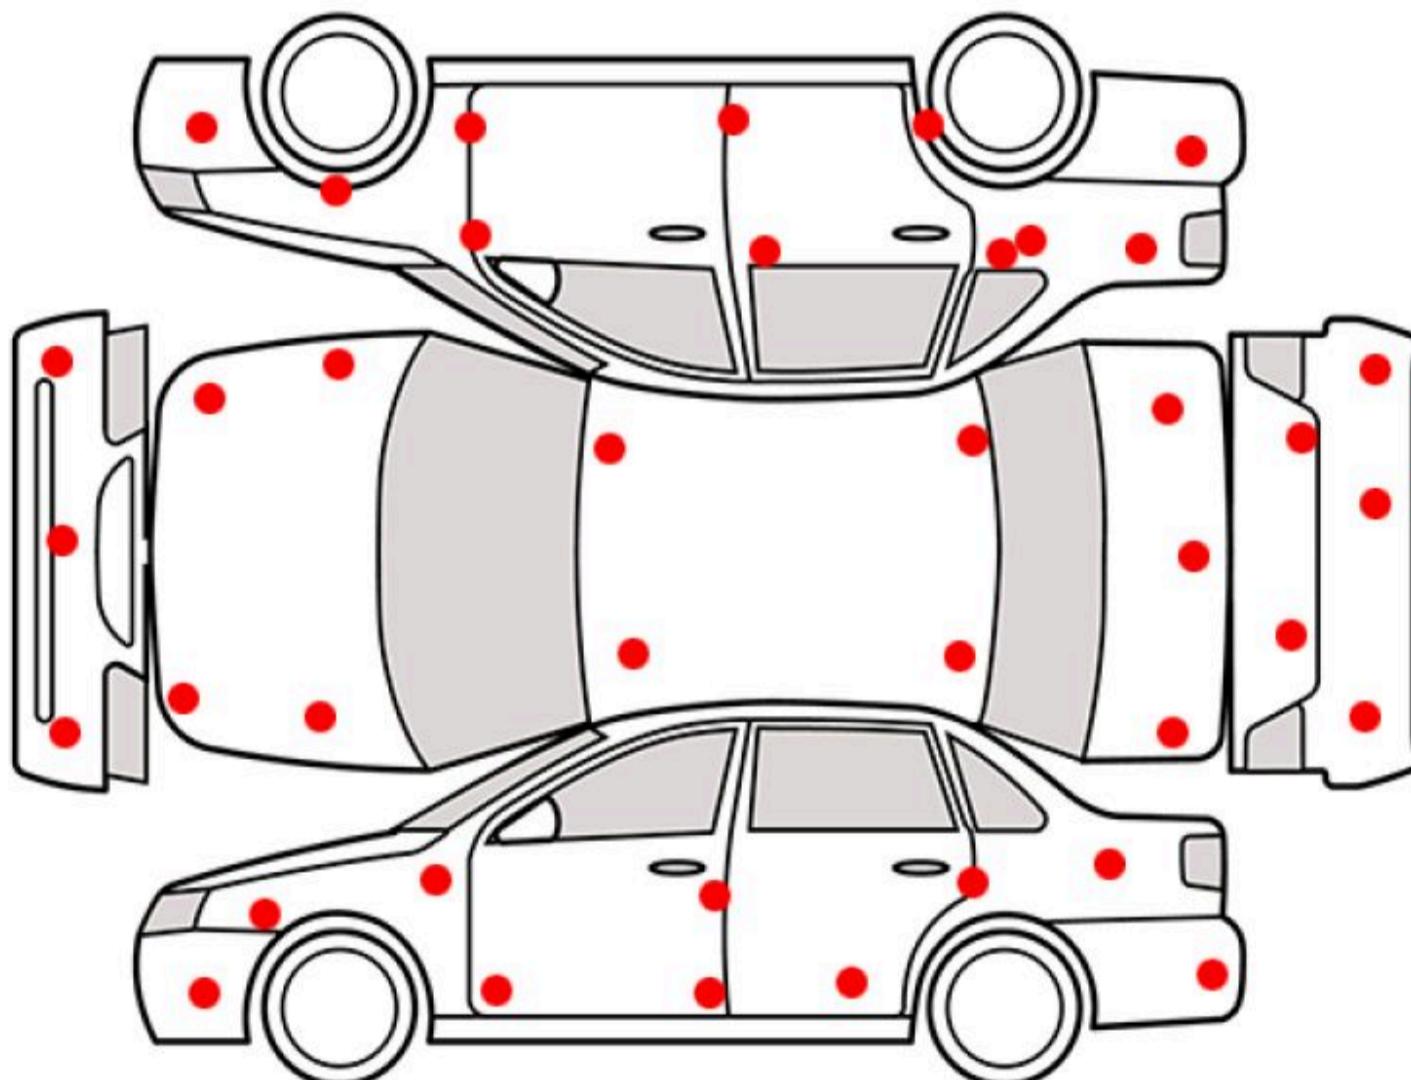


Dent

RE-Painted

Faded

Broken

Scratch

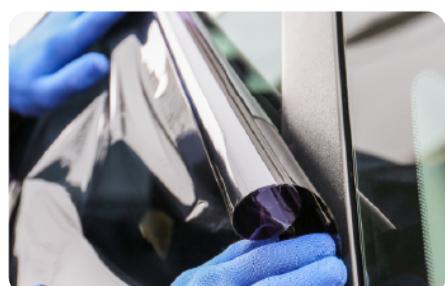

**20%**  
**OFF**

Use Code: REP20

**WINDOW TINTING**

As a valued AutoHub customer, you get an exclusive 20% discount on window tinting! Simply mention the code when you contact us to book your service or enter it when booking online. This offer is available for a limited time!

[Redeem the offer](#)

## إخلاء مسؤولية | Inspection Disclaimer ▲

### English

This inspection report reflects the condition of the vehicle at the time of inspection only. It is intended to assist you in evaluating the vehicle's general condition. It does not constitute a warranty, guarantee, or recommendation to buy or sell the vehicle.

- Scope of inspection:** The inspection is strictly limited to the items listed in this report. It is a visual, non-invasive, and non-mechanical inspection. Components are not dismantled, and internal parts are not examined.
- Exclusions:** The inspection does not include the vehicle's service history, accident history, or recall notices. AutoHub also does not verify mileage, features, or specifications provided by the seller.
- Hidden or intermittent issues:** While AutoHub uses standardized inspection methods, certain defects may remain undetected, especially intermittent or hidden problems not apparent at the time of inspection.
- Future condition:** Mechanical and electrical components can fail at any time. AutoHub is not responsible for any issues, defects, or failures that occur after the inspection has been completed.
- Liability:** AutoHub shall not, under any circumstances, be liable to compensate or reimburse the customer for repair costs, whether arising from undetected issues, later failures, or differences between this report and subsequent assessments by third parties.
- Use of report:** This report is prepared exclusively for the client who ordered the inspection. It may be shared with others, but AutoHub accepts no responsibility or liability if relied upon by any third party. The report is provided for information only and should not be considered a guarantee or warranty.

### العربية

هذا التقرير يعكس حالة المركبة في وقت الفحص فقط. الغرض منه مساعدتك على تقييم الحالة العامة للمركبة، ولا يُعتبر ضماناً أو كفالة أو توصية بالشراء أو البيع.

- نطاق الفحص:** الفحص يقتصر فقط على البنود المذكورة في هذا التقرير. هو فحص بصري غير تدخلي وغير ميكانيكي. لا يتم تفكيك أي أجزاء، ولا يتم فحص المكونات الداخلية.
- الاستثناءات:** الفحص لا يشمل سجل الصيانة للمركبة أو تاريخ الحوادث أو إشعارات الاستدعاء. كما أن أوتوهاب لا تتحقق من عداد الكيلومترات أو المواصفات أو المزايا المذكورة من قبل البائع.
- الأعطال المخفية أو المقطعة:** على الرغم من استخدام أوتوهاب أساليب فحص معيارية، قد تبقى بعض العيوب غير مكتشفة، خصوصاً المشاكل المقطعة أو المخفية التي لا تظهر وقت الفحص.
- الحالة المستقبلية:** المكونات الميكانيكية والكهربائية قد تتعرض للاختلال في أي وقت. أوتوهاب غير مسؤولة عن أي أعطال أو مشاكل تظهر بعد انتهاء الفحص.
- المسؤولية:** لا تتحمل أوتوهاب، تحت أي ظرف من الظروف، مسؤولية تعويض أو سداد تكاليف الإصلاح الناتجة عن أعطال غير مكتشفة أو فروقات بين هذا التقرير وأي تقييم لاحق من طرف ثالث.
- استخدام التقرير:** هذا التقرير معد حصرياً للعميل الذي طلب الفحص. يمكن مشاركته مع أطراف أخرى، ولكن أوتوهاب لا تتحمل أي مسؤولية إذا تم الاعتماد عليه من قبل طرف ثالث. التقرير مقدم لغرض المعلومات فقط ولا يجب اعتباره ضماناً أو كفالة.

Still need support? Please [contact us](#) for any additional inquiries

*Thank you for your business*