


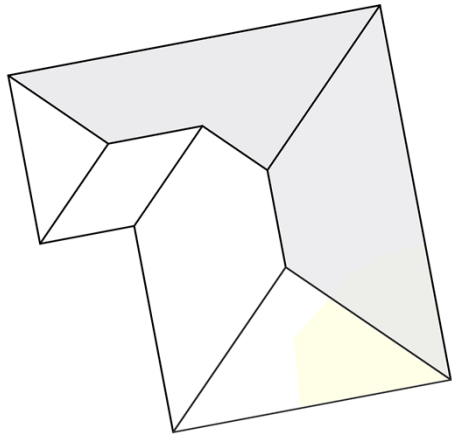

In this 3D model, facets appear as semi-transparent to reveal overhangs.

Contents

Lengths	1
Pitch (Degrees)	2
Pitch (on 12)	3
Rafters	4
Azimuth	5
Area	6
Roof Obstructions	7
Imagery	8
Roofing Report Summary	11

Property Address

11911 Stout Oak Trail
Austin, TX 78750

Measurements

Area:	2642.8 sq ft
Roof Facets:	6
Predominant Pitch:	18°
Number of Stories:	<=1
Ridges/Hips:	162.1 ft
Valleys:	17.7 ft
Rakes:	0 ft
Eaves:	216 ft
Estimated Attic:	2507.2 sq ft
Roof Obstructions:	9
Roof Obstructions Perimeter:	58 ft
Roof Obstructions Area:	32 sq ft

Prepared for

Carlos Hernandez
Kstylez Roofing & Construction
16801 Radholme Court Suite D
Round Rock, TX 78664
512-910-8009

Lengths

Ridges = 27.6 ft

Hips = 134.5 ft

Valleys = 17.7 ft

Rakes = 0 ft

Eaves = 216 ft


Flashing = 0 ft

Step flashing = 0 ft

Parapets = 0 ft



Areas of the structure highlighted in yellow were obstructed from view in our aerial imagery. As such the accuracy of the measurements provided only in the yellow highlighted area may be compromised. See disclaimer below.

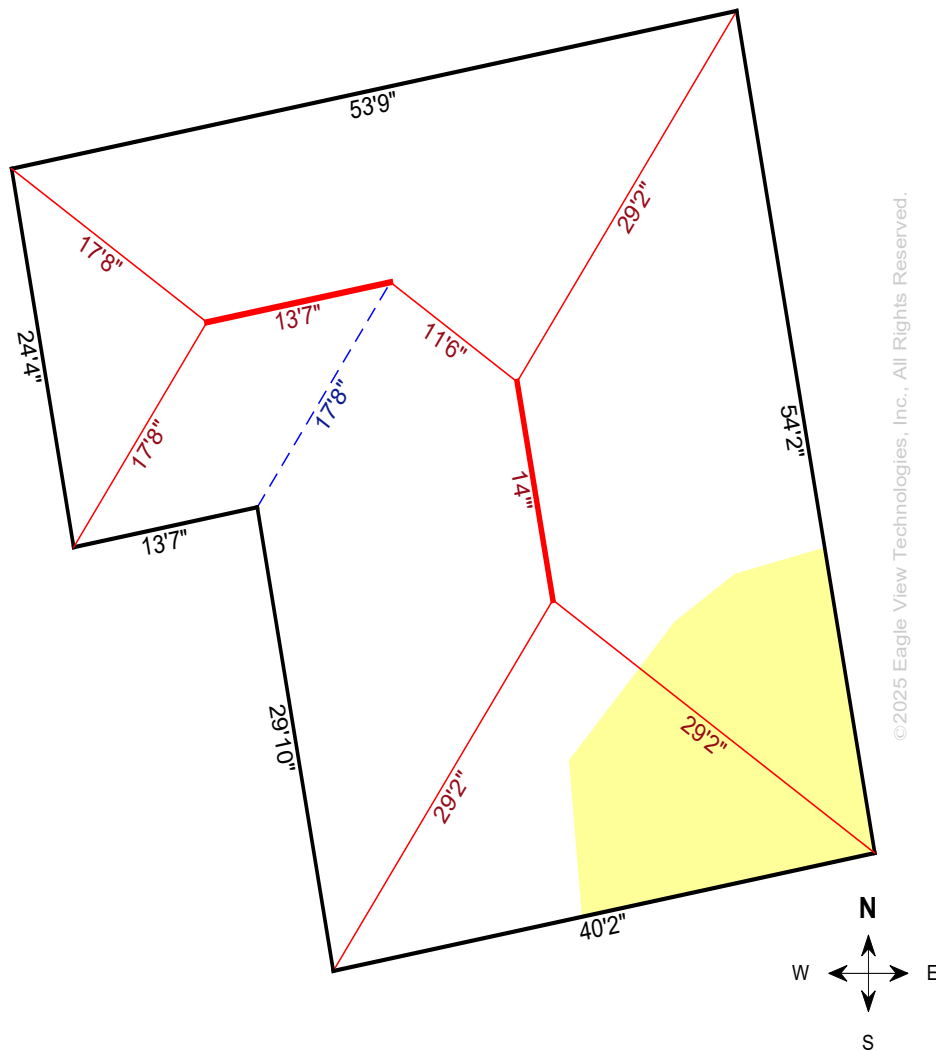

Disclaimer: This report was produced using EagleView Overhang Technology. Due to a variety of reasons including, but not limited to: tree coverage, poor image quality or other blockages; this report DOES NOT offer an accuracy guarantee. EagleView recommends that anyone using this report field verify the yellow - shaded sections.

September 30, 2025

Property Address:


11911 Stout Oak Trail, Austin, TX 78750

Report: 67676640



Pitch (Degrees)

Pitches are labeled for facet areas larger than 20 square feet. In some cases, pitch labels have been removed for readability. Flat facets are labeled 'F'.

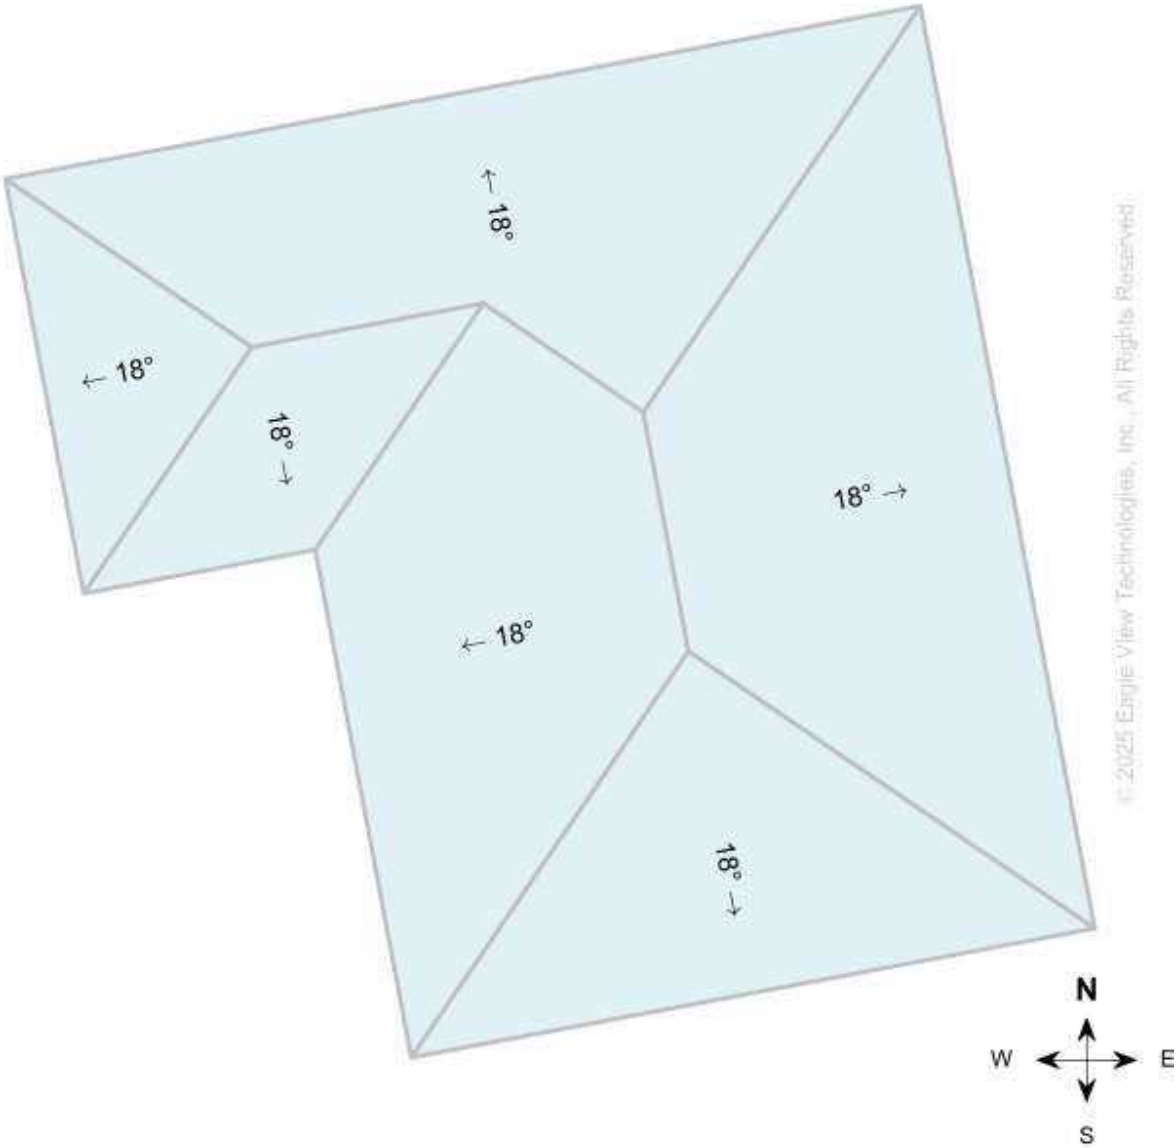


September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Pitch (on 12)

Pitches are labeled for facet areas larger than 20 square feet. In some cases, pitch labels have been removed for readability. Flat facets are labeled 'F'.

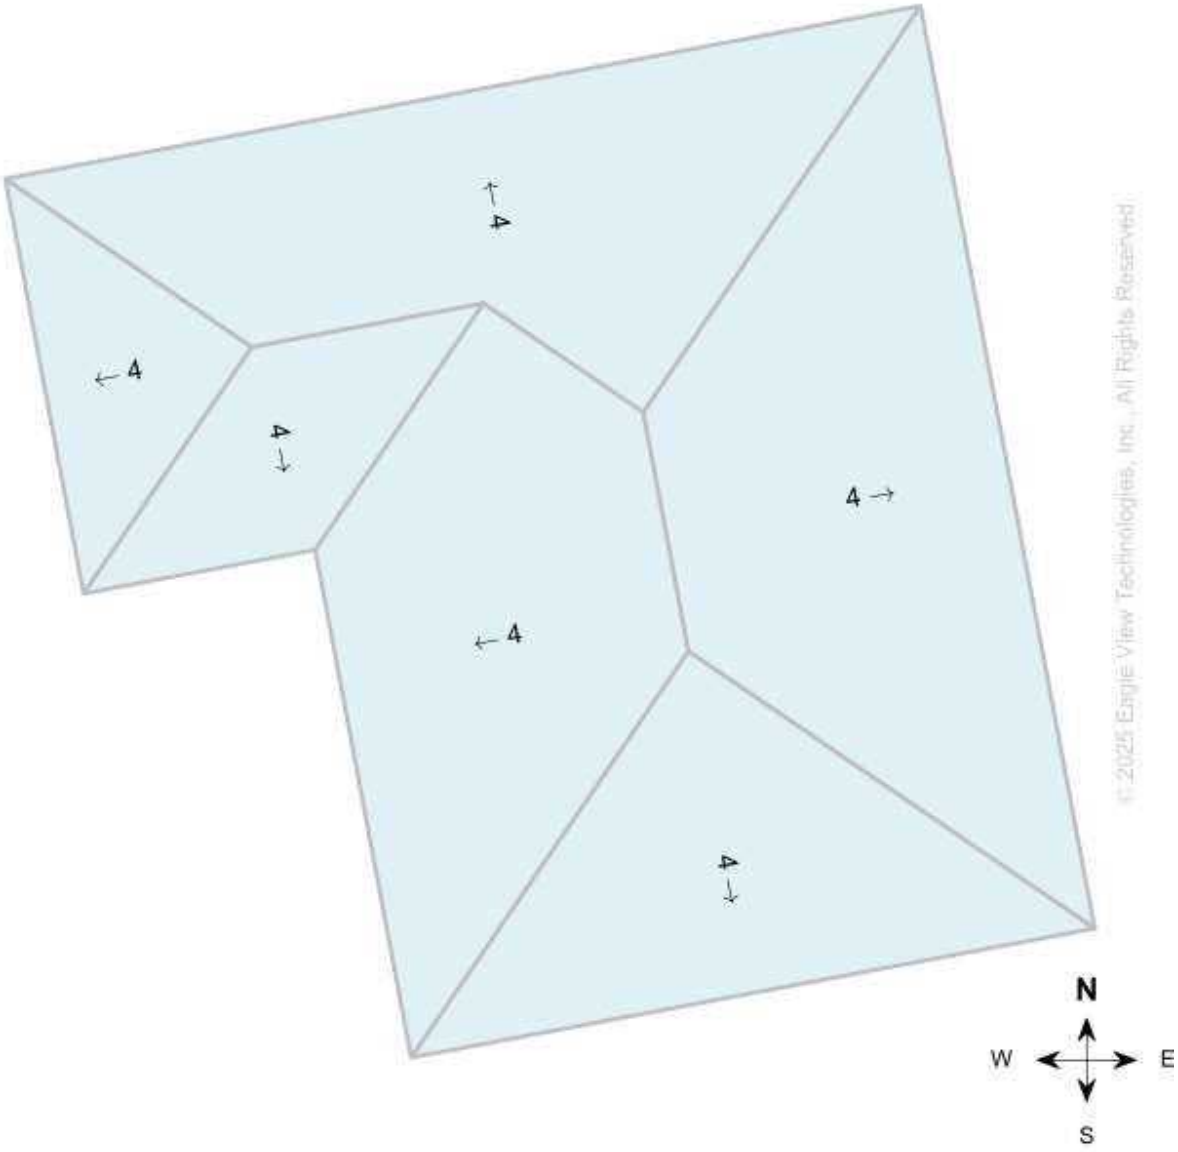


September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Rafters

Rafter lengths (rounded to the nearest whole number) over 5 feet. In some cases, segment labels have been removed for readability. Some numbers are prefaced by “+” signs to avoid confusion when rotated (e.g. +6 and +9).

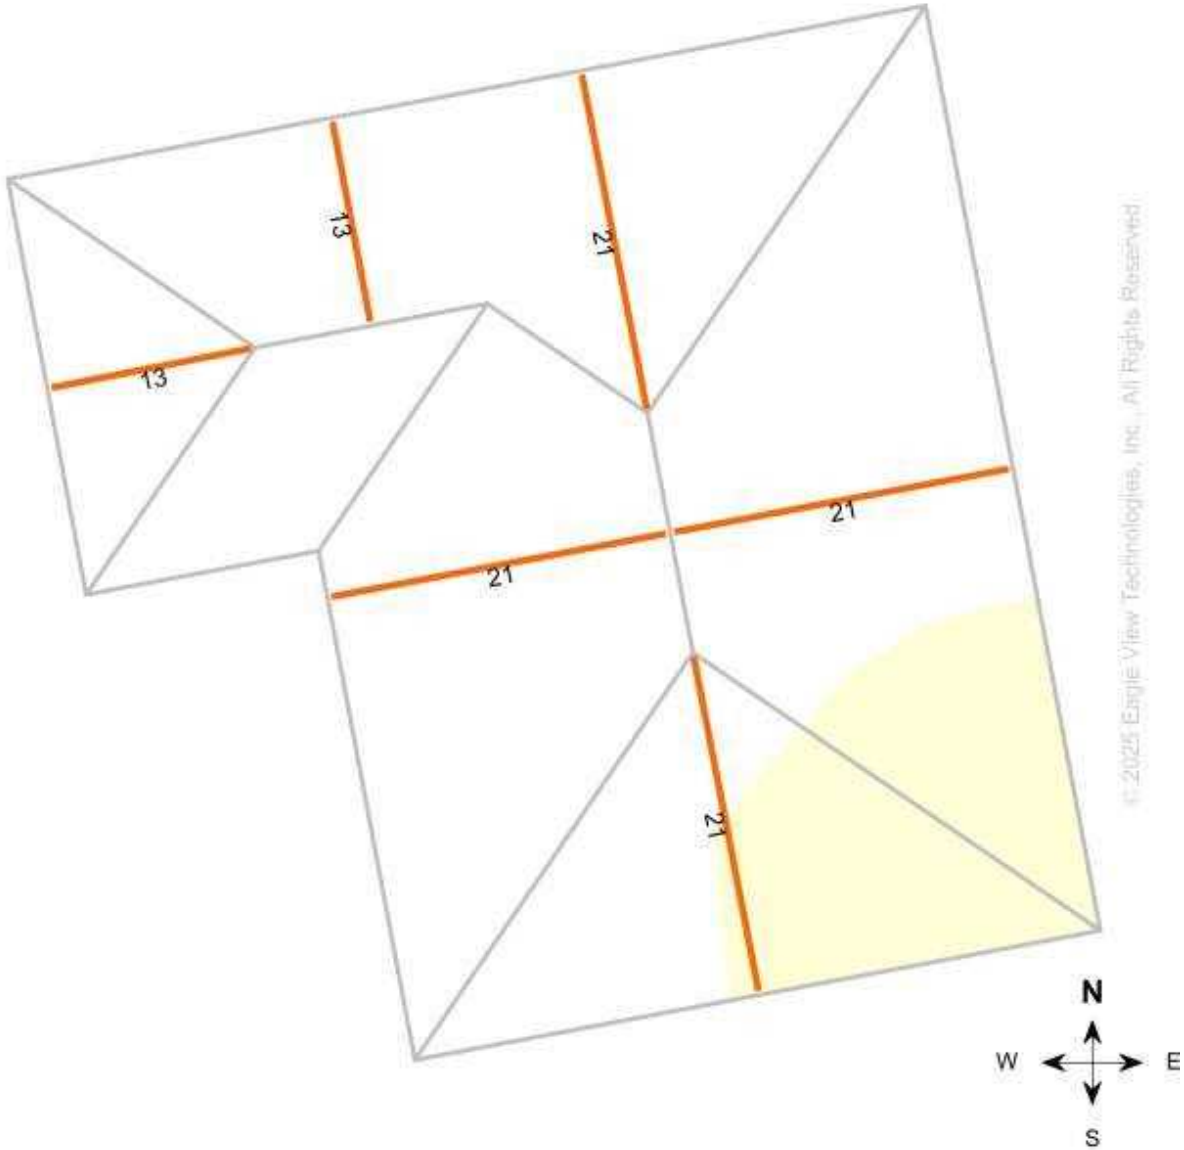


September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Azimuth

The azimuth is the orientation of the structure to true north. In this diagram roof facet directions are labeled in degrees, with 0° (360°) as true north. Flat facets are labeled as 'F'.

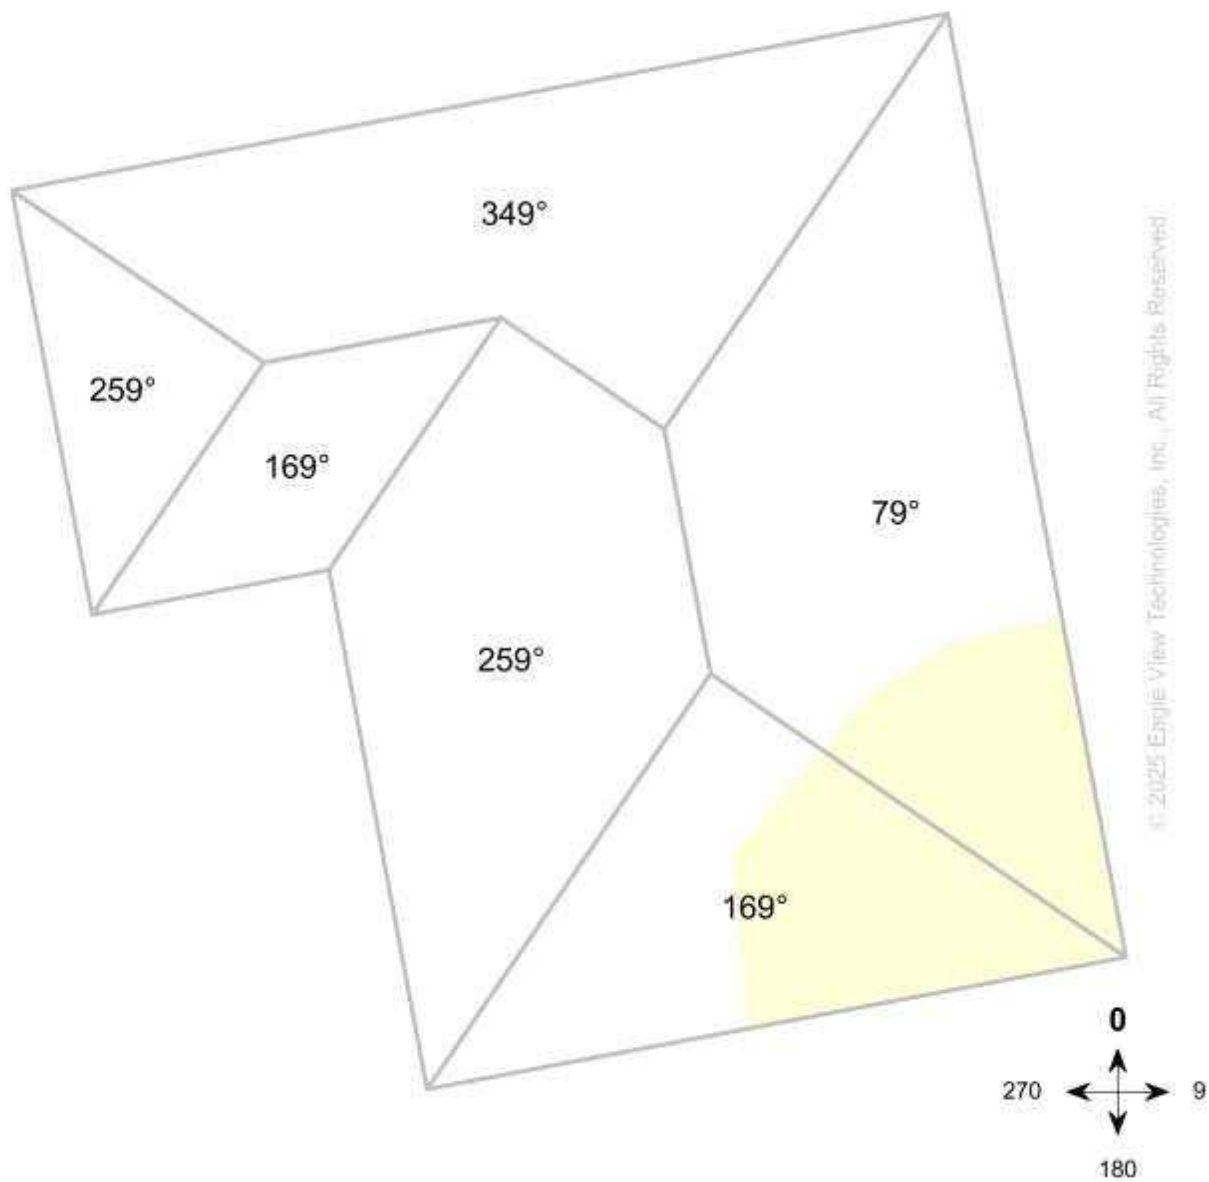


September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Area


The area is measured in square feet per roof facet. The values have been rounded to the nearest foot square.

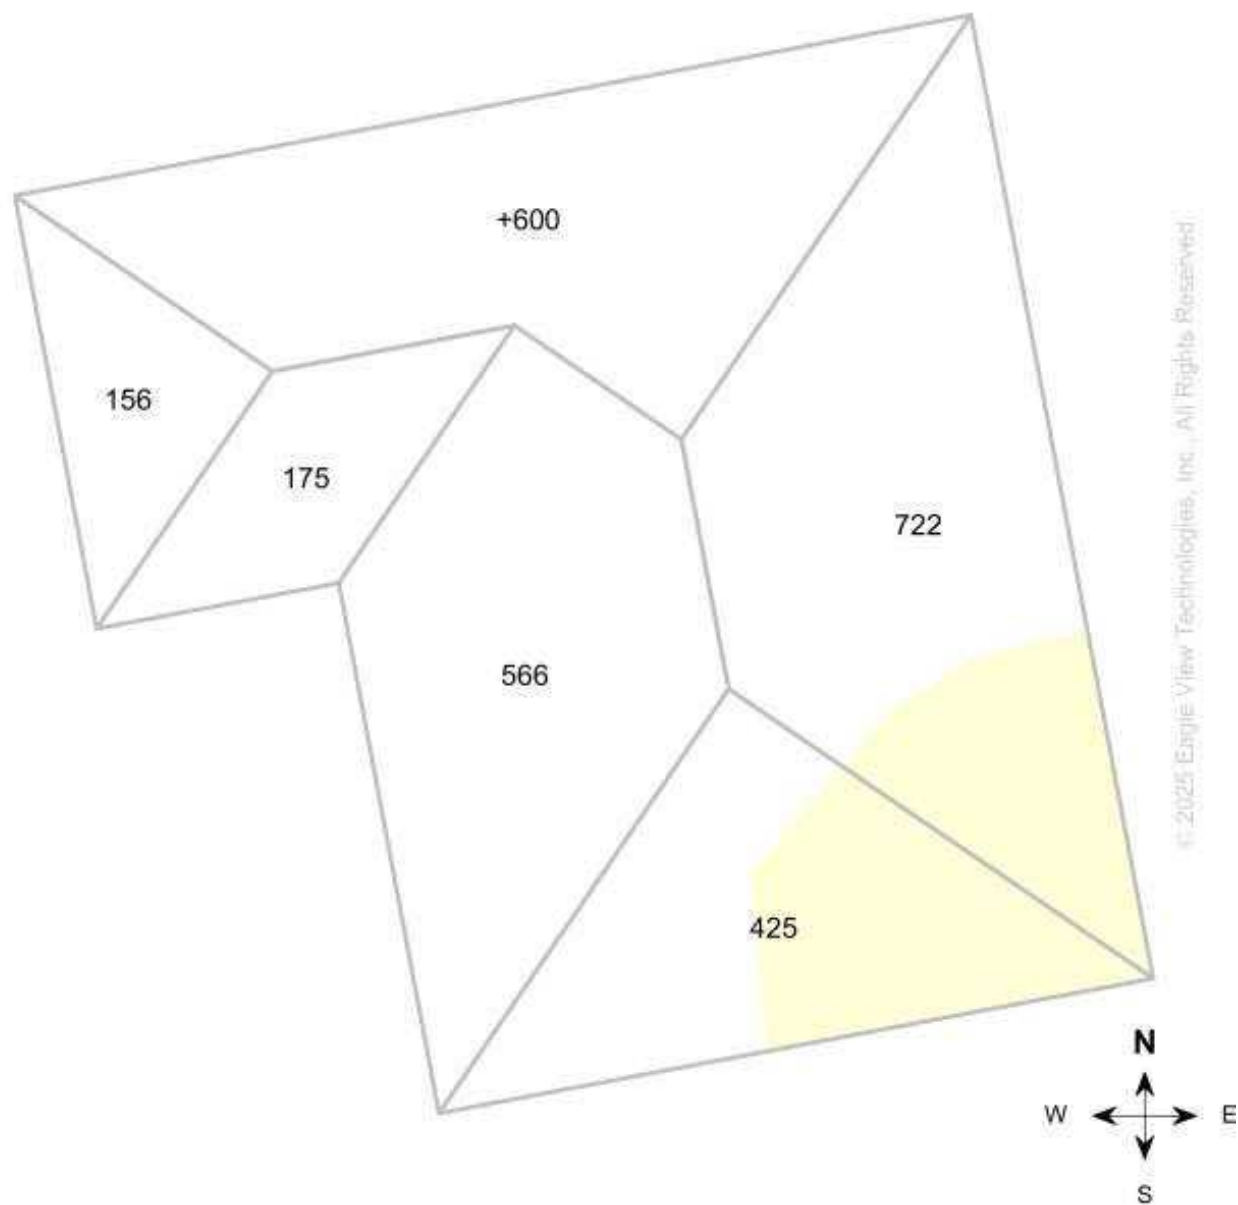

September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Roof Obstructions

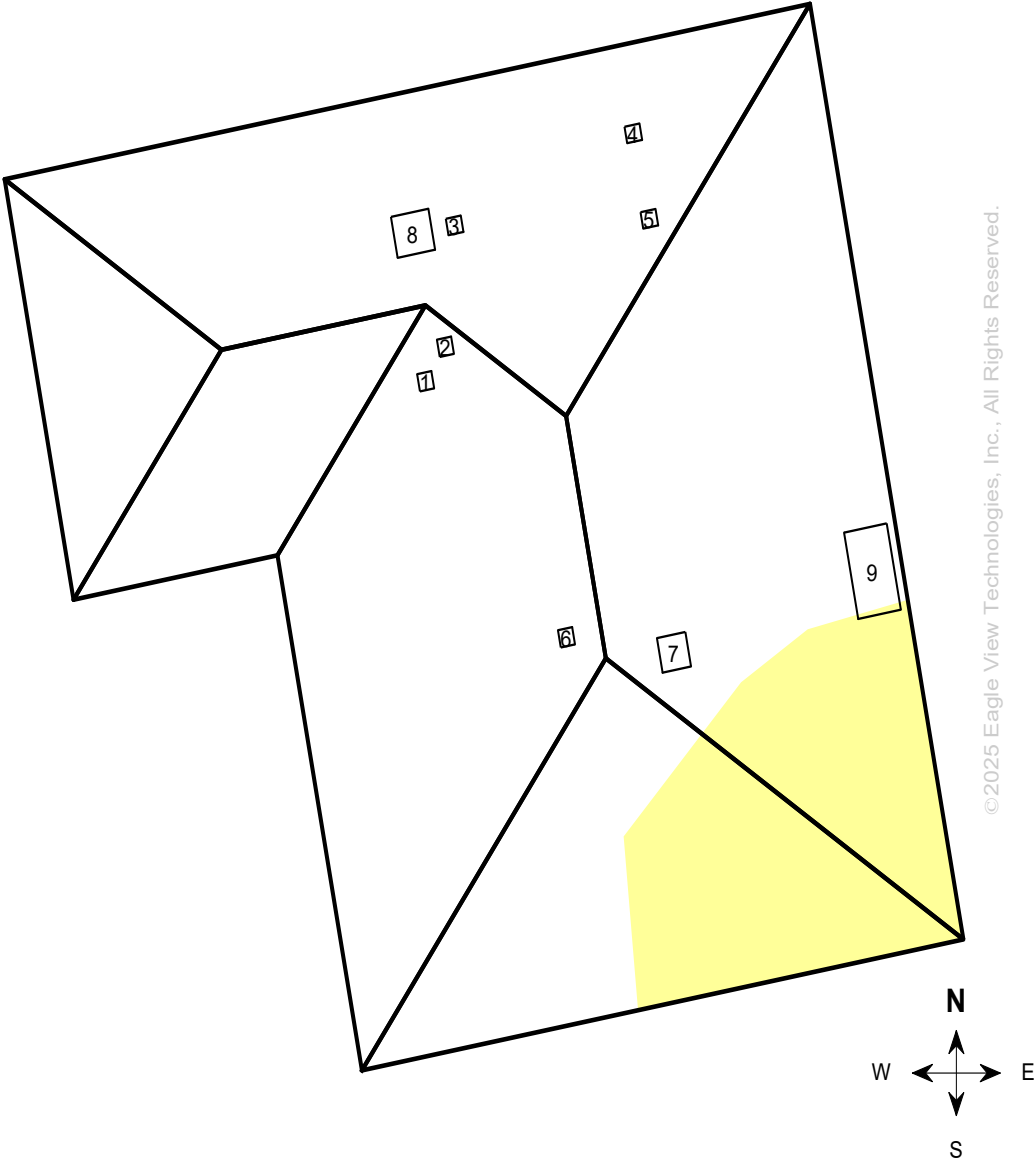

© 2025 Eagle View Technologies, Inc., All Rights Reserved.


September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Imagery

These are images of the property taken from multiple angles.

TOP VIEW

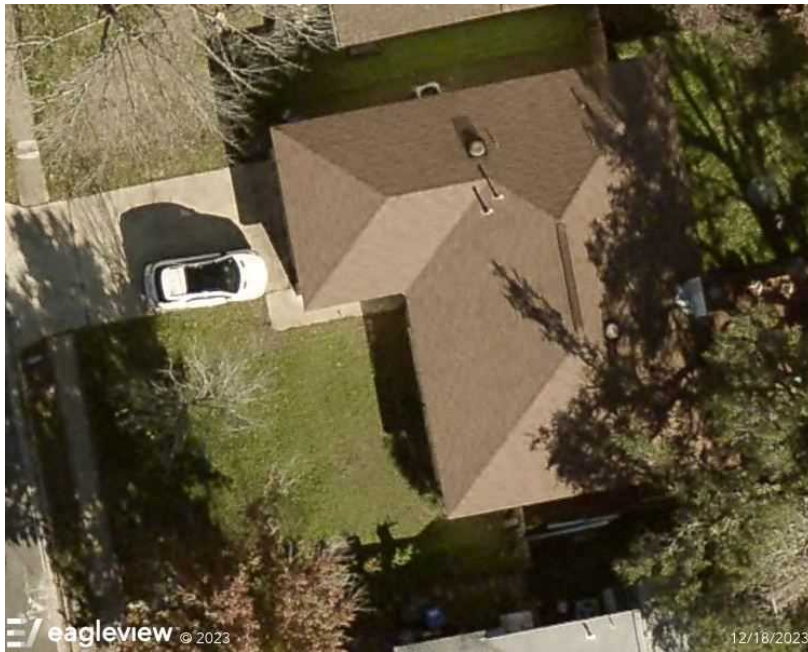


NORTH SIDE




September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



SOUTH SIDE

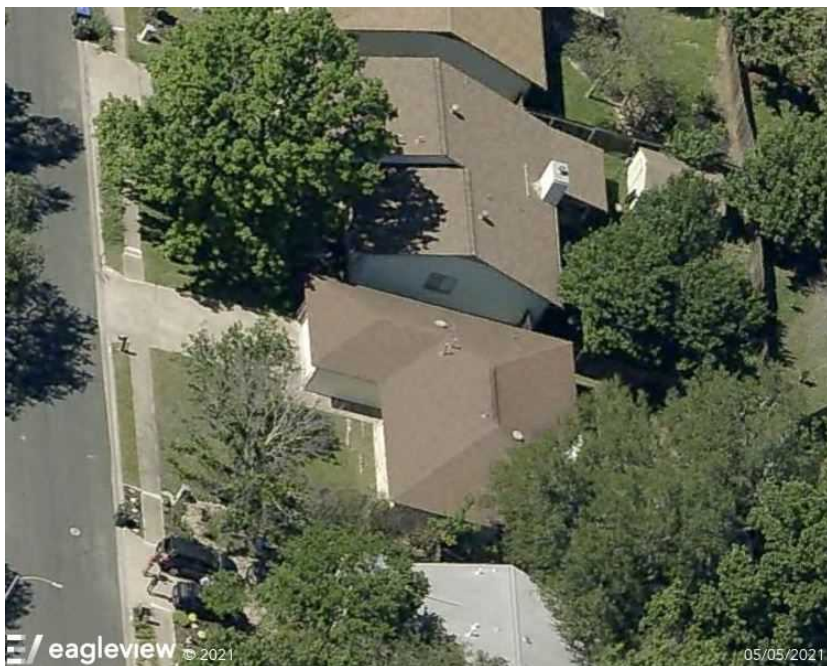

EAST SIDE

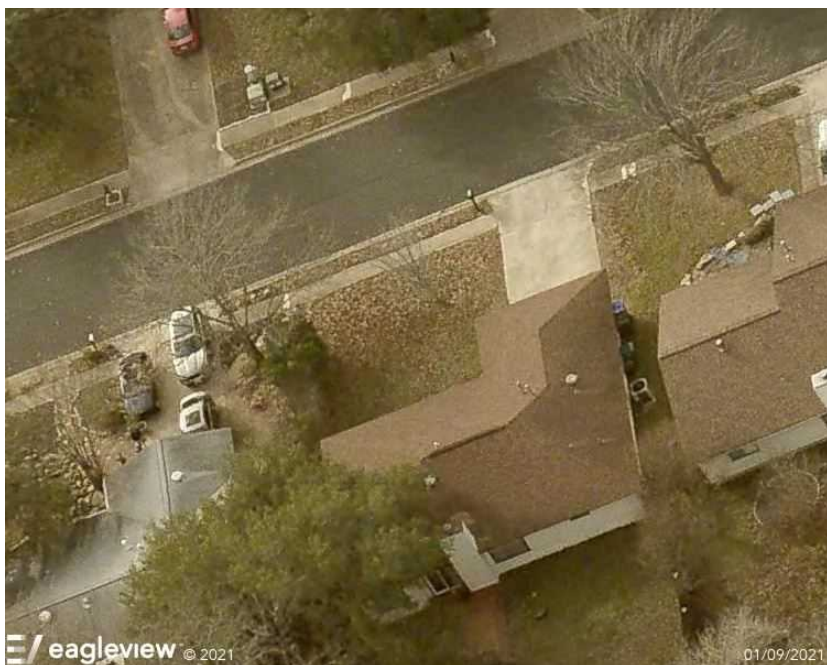

September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



WEST SIDE



September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640



Copyright © 2008-2025 EagleView Technologies, Inc. – All Rights Reserved – Covered by U.S. Patent Nos. 8,078,436; 8,145,578; 8,170,840; 8,209,152; 8,515,125.
Other Patents Pending.

ROOFING REPORT SUMMARY

All Structures

Areas per Pitch	
Roof Pitches	4/12
Area (sq ft)	2642.8
% of Roof	100%

The table above lists each pitch on this roof and the total area and percent (both rounded) of the roof with that pitch.


Structure Complexity		
Simple	Normal	Complex

Waste Calculation									
NOTE: This waste calculation table is for asphalt shingle roofing applications. All values in table below only include roof areas of 3/12 pitch or greater. For total measurements of all pitches, please refer to the Lengths, Areas, and Pitches section below.									
Waste %	0%	5%	10%	13%	15%	17%	20%	25%	30%
Area (Sq ft)	2643	2776	2908	2987	3040	3093	3172	3304	3436
Squares *	26.66	28.00	29.33	30.00	30.66	31.00	32.00	33.33	34.66
	Measured				Suggested				

* Squares are rounded up to the 1/3 of a square

Additional materials needed for ridge, hip, and starter lengths are not included in the above table. The provided suggested waste factor is intended to serve as a guide—actual waste percentages may differ based upon several variables that EagleView does not control. These waste factor variables include, but are not limited to, individual installation techniques, crew experiences, asphalt shingle material subtleties, and potential salvage from the site. Individual results may vary from the suggested waste factor that EagleView has provided. The suggested waste is not to replace or substitute for experience or judgment as to any given replacement or repair work.

All Structures Totals

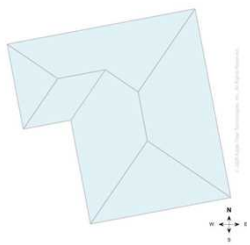

Total Roof Facets = 6
Total Roof Obstructions = 9

Lengths, Areas and Pitches

Ridges = 27.6 ft (2 Ridges)
Hips = 134.5 ft (6 Hips)
Valleys = 17.7 ft (1 Valleys)
Rakes[†] = 0 ft (0 Rakes)
Eaves/Starter[‡] = 216 ft (6 Eaves)
Drip Edge (Eaves + Rakes) = 216 ft (6 Lengths)
Parapet Walls = 0 (0 Lengths)
Flashing = 0 ft (0 Lengths)
Step flashing = 0 ft (0 Lengths)
Total Roof Obstructions Area = 32 sq ft
Total Roof Area Less Roof Obstructions = 2610.8 sq ft
Total Roof Obstructions Perimeter = 58 ft
Predominant Pitch = 4/12
Total Area (All Pitches) = 2642.8 sq ft

Property Location

Longitude = -97.8149572
Latitude = 30.4568831

Notes

This was ordered as a residential property. There were no changes to the structure in the past four years.

[†] Rakes are defined as roof edges that are sloped (not level).
[‡] Eaves are defined as roof edges that are not sloped and level.

September 30, 2025
Property Address:
11911 Stout Oak Trail, Austin, TX 78750
Report: 67676640

