




INSPECTION STANDARD (HT LAB)



☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	30-05-2022			
Part Name:-Axle Shaft		Part No.:- .0000172276	Inspection Standard Number		SIP/4488/220		
Customer :- Comer Industries		Change Level.:-00	Part Stage		HT Lab.		
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured To HV1 On 520HV(On 52 HRC)On a Cross Section Of The Tothing At a Half Tooth Height On Gear Tooth	▶	0.6mm~0.9mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness Checked On Cross Section Of a Tooth in The Middle Tooth Base Of Gear	*	340 HB Min (37 HRC Min)	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Micro Case	*	Tempered Martensite+ RA<20% Max	Microscope	1Pc/Lot	HT Lab Report	A
5.	Core Micro	*	LCM+Bainitic Structure	Microscope	1Pc/Lot	HT Lab Report	A

Space For Sketch:

Material- 20MnCr5

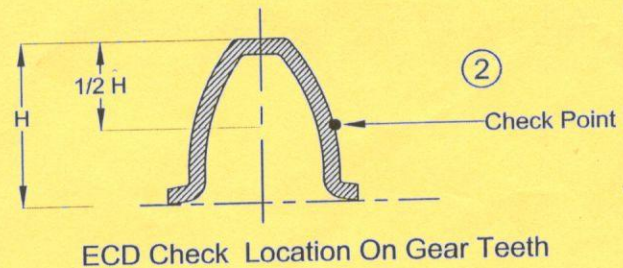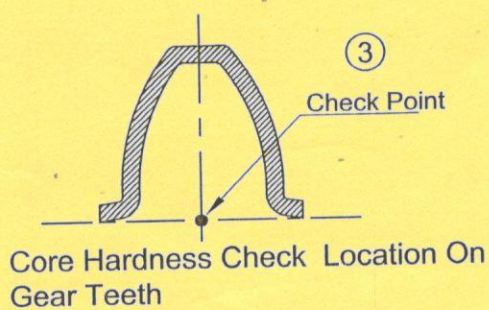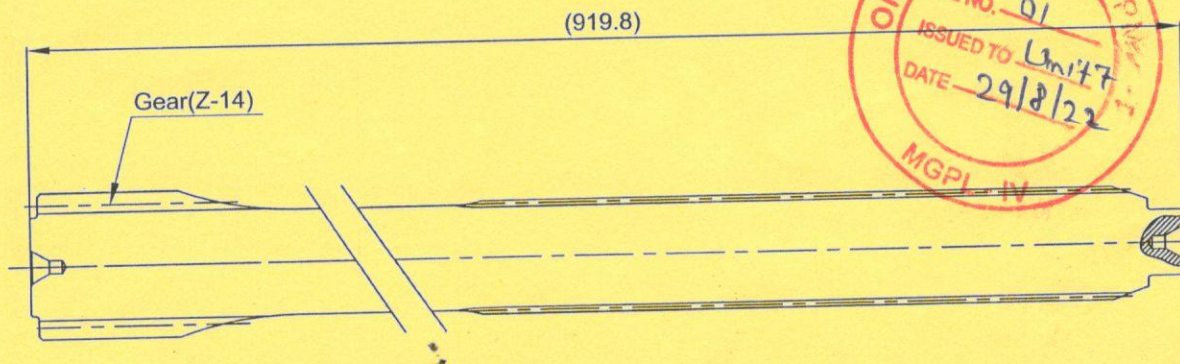

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For Process ▲ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change