



INSPECTION STANDARD (HT LAB)

Page 01 of 01





142

MILESTONE:

☐ . Prototype	☐ Pre-Launch	☒ Production	Date (Original)	09-07-2022			
Part Name:- Output Shaft		Part No.: -0.875.3001.00	Inspection Standard Number	SIP/4492/200			
Customer :- Çomer Industries		Change Level.: -00	Part Stage	HT Lab.			
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness To Be Checked On ECD Check Points	*	58~62 HRC	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured At HV1 On 550 Vickers On Both Spline A & B	*	0.6mm~1.0 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD Measured At HV1 On 550 Vickers On Ø49.2	*	0.6mm~1.0 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardnes Checked Perpendicularly From The Outer Edge Of 5.0mm On Spline A & B	*	27~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Core Hardnes Checked Perpendicularly From The Outer Edge Of 5.0mm On Ø49.2	*	27~45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Micro Case	*	Tempered Martensite + RA 20% Max	Microscope	1Pc/Lot	HT Lab Report	A
7.	Core Micro	*	LCM+Baintic Structure	Microscope	1Pc/Lot	HT Lab Report	A

Space For Sketch:

Material- 20MnCr5

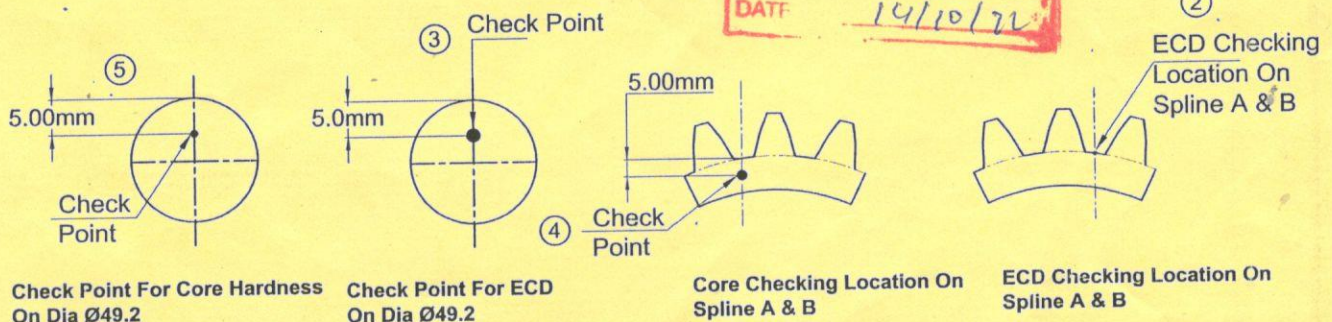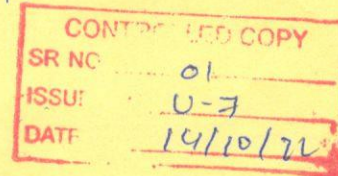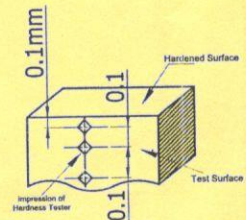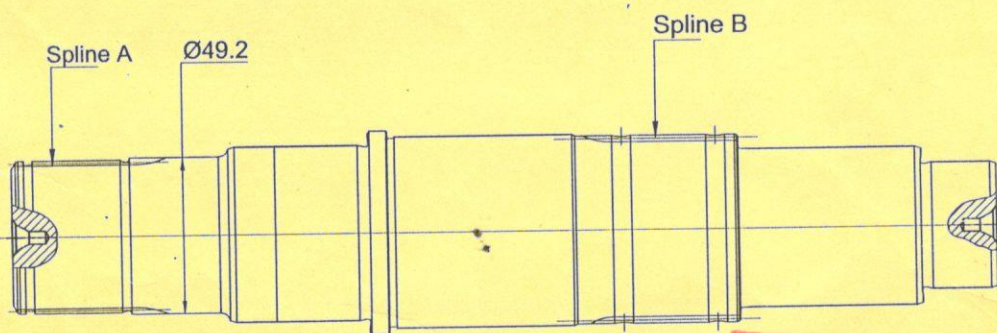

Reaction Plan: A-यदि Inspection करते समय कम्पोंनेट खराब मिले तो खराब कम्पोंनेट को Rejection का टैग लगाकर Rejection टेबल पर रखे और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change