






INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	01/09/2021			
Part Name:- Gear-Transfer 36T STD Ratio		Part No.:- 336/Y0236	Inspection Standard Number	SIP/P0006/180			
Customer :- JCB India		Change Level.:-00	Part Stage	HT Lab			
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59~63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measure at 540 HV	*	1.0~1.25 mm	Micro Vicker / Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Micro Case	*	Tempered Martensite+c RA<10%	Microscope	1Pc/Lot	HT Lab Report	A
4.	Core Micro	*	LCTM+ Baintic Structure	Microscope	1Pc/Lot	HT Lab Report	A
5.	Surface Hardness on Bore Diameter Ø51.94/51.97	*	No Greater Than 45 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Surface Hardness on Thread end to be softened Back so that the Max. Hardness over Length 33.0	*	40 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A

SKETCH:-

Material Grade:- 20MnCr5

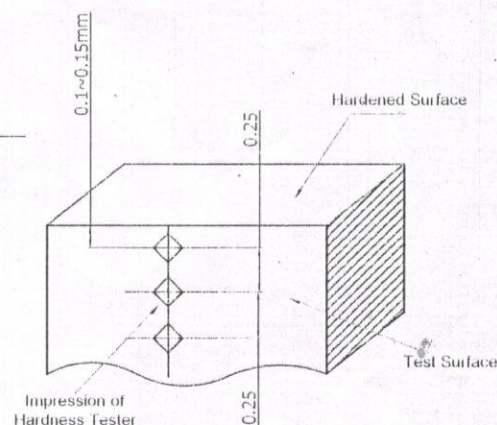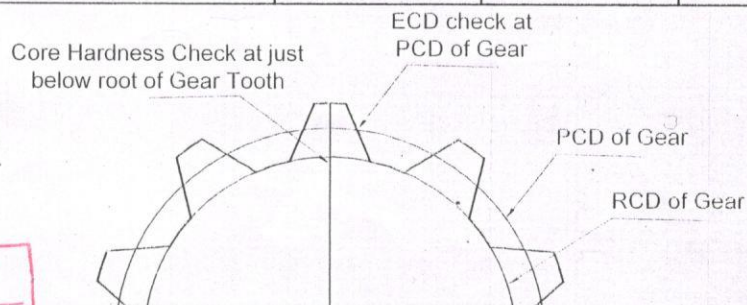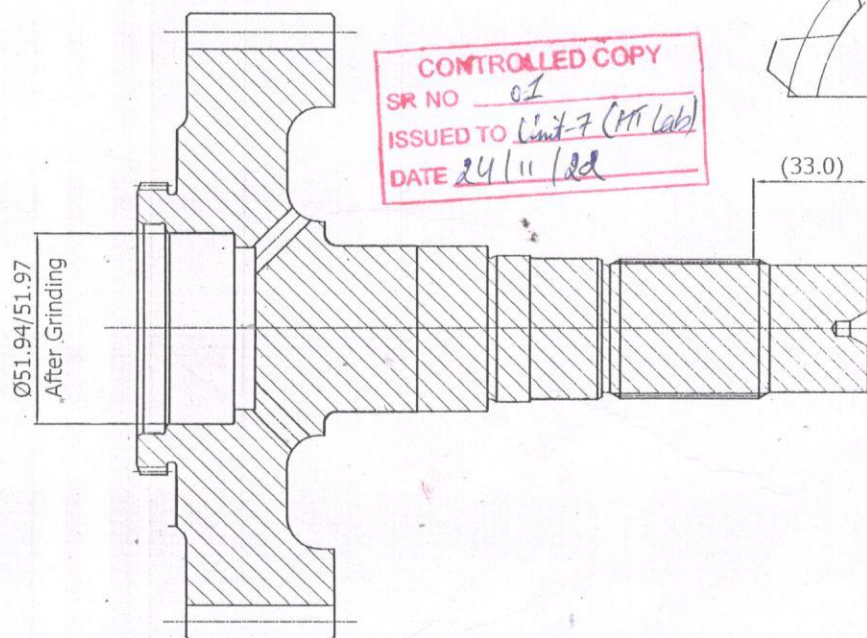

Note:- For Other Detail see Std No:- 9995/0001

ECD Checking Pattern Details

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में

Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change