



INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	08/08/15
Part Name:- Shaft Pinion Rear Axle-RH Z-11		Part No.:-D10245400	Inspection Standard Number	SIP/4135/130
Customer :- ESCORTS		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness (On Spline Teeth)	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	Surface Hardness (On Ground Diameter)	*	54 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD At 513 HV (At Gear & Spline PCD)	*	1.2~1.5 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	ECD At 513 HV (On Ground Dia)	*	0.9 mm Min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Case Micro	*	Tempered Martensitec RA<20%	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	LCTM + Bannite	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH


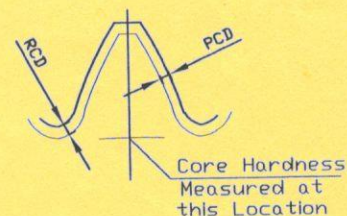
Material -20Mn5Cr5-S

Figure 1- 1

CONTROLLED COPY
SR. NO. 01
ISSUED TO unit 7
DATED 30/11/2019

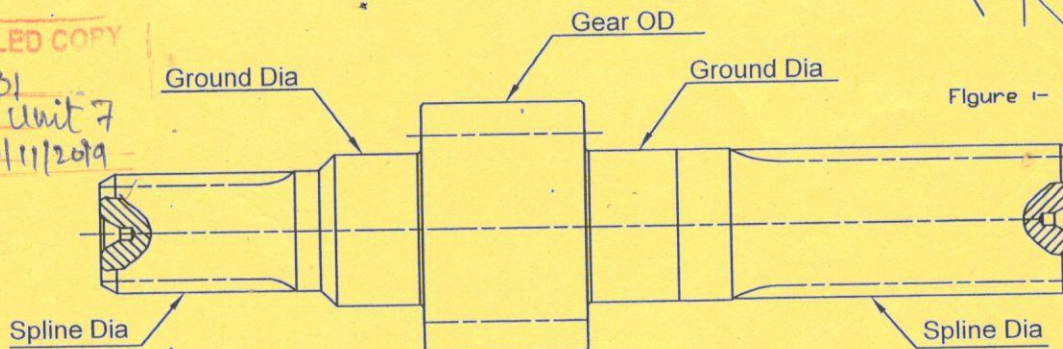

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing, ☒ * Special Characteristics For Process, ☒ Δ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By: