





INSPECTION STANDARD (HT LAB)

FILESTORE


☐ Prototype	☒ Pre-Launch	☐ Production	Date (Original)		02/11/2023		
Part Name:- Spur Pinion 3RD		Part No.:- 93677254		Inspection Standard Number		SIP/31005/190	
Customer :- TMTL		Change Level.:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58-62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Check 550HV5 At Gear PCD	*	0.8~1.1 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness at Gear PCD	*	42 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Core Hardness at Gear RCD	*	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Micro Case	*	Tempered Martensite:± RA<12%, Carbide (Globular) Upto 5% Max.	Microscope (100x~500x)	1Pc/Lot	FMT-HT-39	A
6.	Micro Core	*	LCM+Bainitic Structure, Ferrite Upto 5%	Microscope (100x~500x)	1Pc/Lot	FMT-HT-39	A
7.	IGO / NMTP	*	20 Micron Max.	Microscope (100x~500x)	1Pc/Lot	FMT-HT-39	A

OPTIONAL SKETCH

Material- 20MnCr5

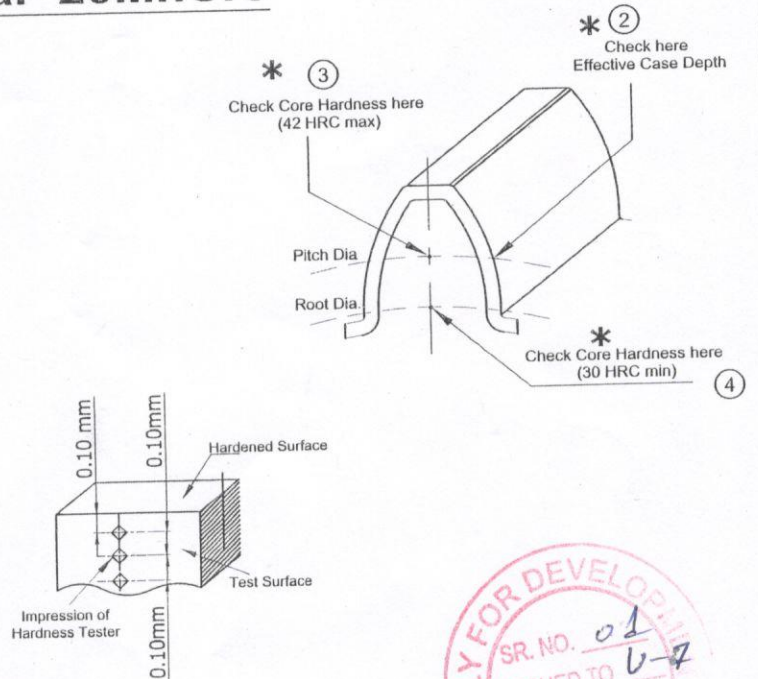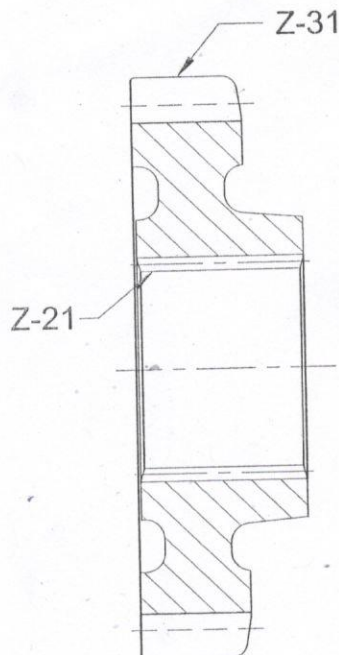

Transverse For Hardness Check
(Take Every Impression At a Distance Of 0.1mm)

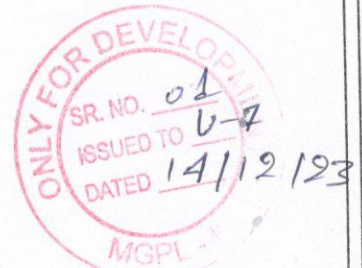

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends:		 Special Characteristics as Per Drawing	 Special Characteristics For Process	 Special Characteristics For Safety			
Change Details							
Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change