



INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	13/04/18			
Part Name:- Shaft Pinion Rear Axle RH Z-11		Part No.:- D10743510A		Inspection Standard Number		SIP/4259/00	
Customer:- ESCORTS		Change Level.:-00		Part Stage		HT Lab.	
Sr.No	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness On Spline Teeth	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	Surface Hardness On Ground Diameter	*	54 HRC min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD At Gear PCD & Spline Root Up To 513 HV	*	1.0~1.3 mm min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	ECD On Ground Diameter. Up To 513 HV	*	0.8 mm min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness	*	32~43 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Micro Case	*	Tempered Martensite+ RA<20%	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	Bainite+Free Ferrite	Microscope	1Pc/Lot	FMT-HT-39	A
8.	Process & Other Quality Requirements as per ESCORTS STD. No. MS-4						

CONTROLLED COPY
SR. NO. 02
ISSUED TO Unit 7
DATED 22/05/22

OPET. SKTCH

Material:-20Mn5Cr5-S


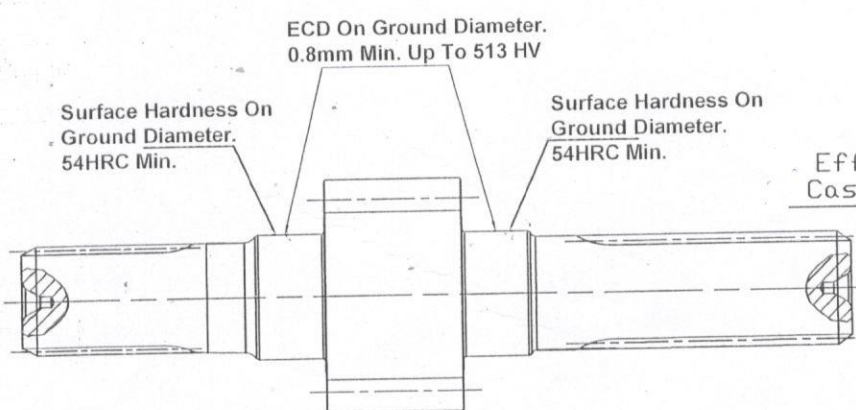


Figure i-1 Core Hardness Measured at this Location

Effective Case Depth

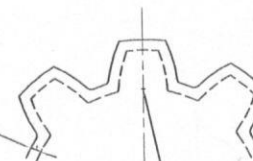


Figure i-2

Core Hardness Measured at this Location

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: Special Characteristics as Per Drawing Special Characteristics For Process Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change