

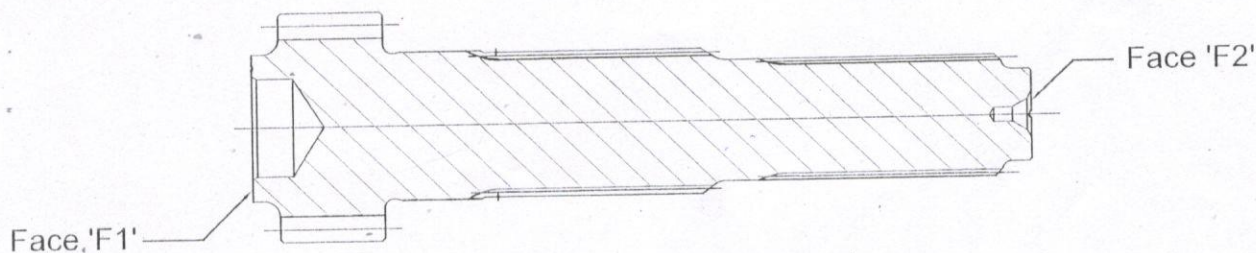
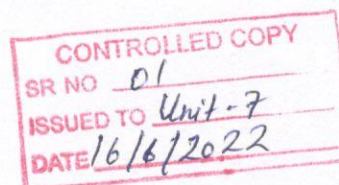


INSPECTION STANDARD (HT LAB)

☐ Prototype	☒ Pre-Launch	☒ Production	Date (Original)	02/09/18
Part Name:- Shaft-Sun Gear		Part No.:- 1410C07901 (A)	Inspection Standard Number	SIP/4272/200
Customer :- TAFE		Change Level.:- A	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	ECD Measured To 526HV 0.5 / 516HV 1	*	1.0~1.3 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	Core Hardness	*	26~43 HRC (A)	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	Case Depth of Face F1 & F2	*	0.5 Min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Micro Case	*	Tempered Martensite+ RA<15%	Microscope	1Pc/Lot	FMT-HT-39	A
6.	Core Micro	*	LCTM+Bainitic	Microscope	1Pc/Lot	FMT-HT-39	A

Space For Sketch:-

Material-En353

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
19/1/2021	A	New Customer Drawing Received Part No.1410C07901 was 2510C18701 & Core Hardness 26~43 HRC Was 26~38 HRC as Per ECN 1537 on Dated 14/01/2021	Customer Drawing Changed				

Prepared By: *manpreet*

Checked By:

Approved By: *[Signature]*