





INSPECTION STANDARD (HT LAB)

Page 01 of 01


☐ Prototype		☐ Pre-Launch	☒ Production	Date (Original)	19.09.2022		
Part Name:- Ring Gear Z-77			Part No.:- CA139738	Inspection Standard Number	SIP/11000/190		
Customer :- CARRARO			Change Level.:- A	Part Stage	HT Lab.		
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC Ⓐ	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured At 544HV1 At PCD	*	0.7mm~1.1mm	Micro Vicker Hardness Tester/ Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness At PCD	*	45 HRC Max. Ⓐ	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness At RCD	*	36 HRC Min. Ⓐ	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Case Micro	*	Tempered Martensite+ RA 20% Max& No Carbides Shall Be Allowed	Microscope At 100X~500X	1Pc/Lot	HT Lab Report	A
6.	Core Micro	*	LCM+Bainitic Structure	Microscope At 100X~500X	1Pc/Lot	HT Lab Report	A
7.	Oxidation Layer	*	15 Micron Max.	Microscope At 100X~500X	1Pc/Lot	HT Lab Report	A

Space For Sketch:

Material:-20MnCr5(EN-10084)

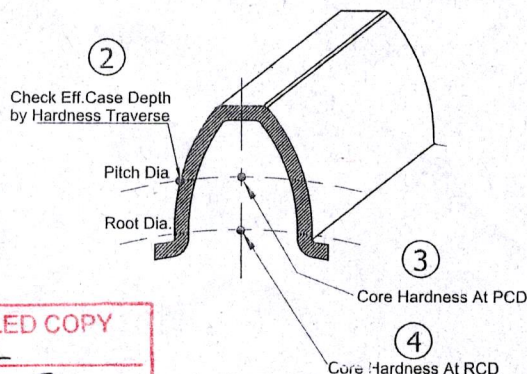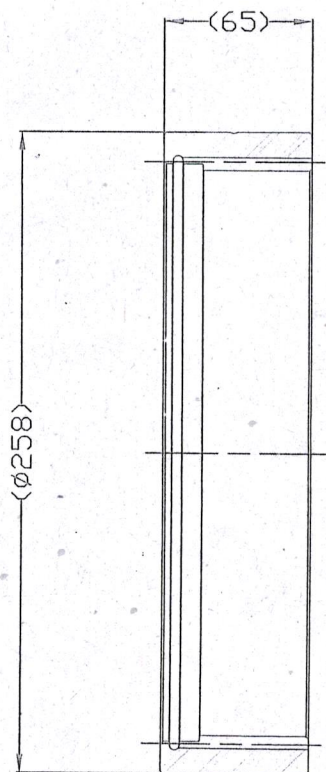

CONTROLLED COPY
SR NO. 01
ISSUED TO V-7
DATE 29/5/24

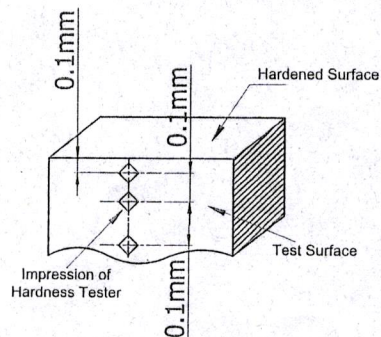

Traverse For Hardness Check
(Take Every Impression At a Distance Of 0.1mm)

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change
16/05/24	A	Revised Metallurgical Parameter Surface Hardness Change 58~62 Was 57~61 Core Hardness At PCD 45 HRC Max. Was 42 Max. Core Hardness At RCD 36 HRC Min. Was 31 Min. As Per ECN No. 30/24 On Date: 16/05/2024	Customer Change				

Prepared By:

Checked By: