



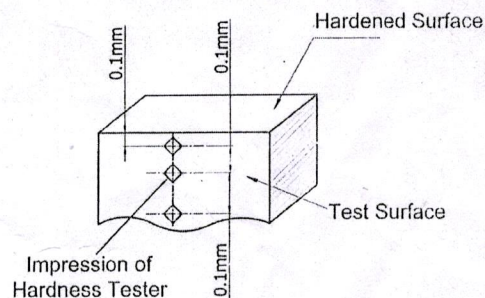
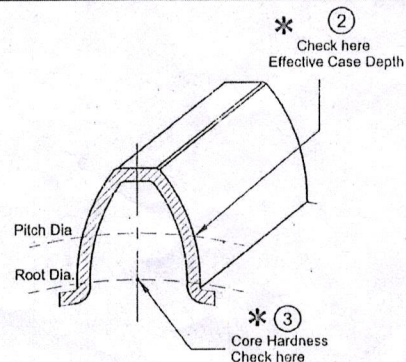
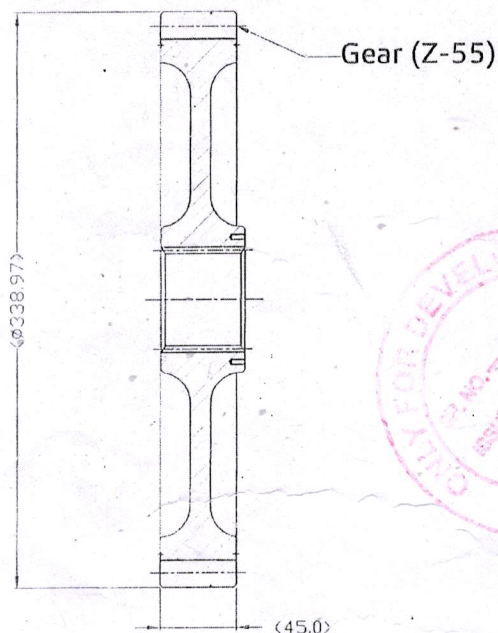
INSPECTION STANDARD (HT LAB)

Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	25/07/2024
Part Name:- Bull Gear Z-55	Part No.:- 300670427A	Inspection Standard Number	SIP/20003/220	
Customer :- ITL	Change Level.:-00	Part Stage	HT Lab.	

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Measured Up To 530 HV at 1 kg. Load at Gear PCD (Z-55)	*	1.15~1.35 mm	Micro Vicker/Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Core Hardness on RCD	*	30~39 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Micro Case	*	Tempered Martensite+ RA<15% Retained Austenite No Carbide Network Required	Microscope (100X~500X)	1Pc/Lot	HT Lab Report	A
5.	Micro Core	*	Bainite/Sorbite Free Ferrite <10%	Microscope (100X~500X)	1Pc/Lot	HT Lab Report	A

SPACE FOR SKETCH:-

Material :- 20MnCr5**Transverse For Hardness Check**

Note: - Gear To Be Cut Center Of Gear Width For Inspection.

Reaction Plan: A-यदि Inspection करते समय कम्पोनेट खराब मिले तो खराब कम्पोनेट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety**Change Details**

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Taran

Checked By:

[Signature]

Approved By:

[Signature]

FMT-ENGG-39, REV No.:00, DATE:21.02.17