



INSPECTION STANDARD (HT LAB)




Page 01 of 01

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	02/01/2024
Part Name:- Layshaft SS670 XLR 2WD		Part No.:- 459-S6868	Inspection Standard Number	SIP/21021/ 220
Customer :- JCB (UK)		Change Level.:-00	Part Stage	HT Lab.

Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness	*	59-63 HRC	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	ECD Check 540HV5 At Gear PCD (Z-28)	*	0.75~1.1 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	ECD Check 540HV5 At Gear PCD (Z-16)	*	0.75~1.1 mm	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	ECD Check 540HV5 At Grinding Dia. (Ø44.97)	*	0.5 mm Min.	Vicker Hardness Tester/Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Core Hardness at Gear RCD (Z-28)	*	450vdh5 max. (45HRC)	Vicker Hardness Tester/ Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
6.	Core Hardness at Gear RCD (Z-16)	*	450vdh5 max. (45HRC)	Vicker Hardness Tester/ Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
7.	Hardness Check at Thread Portion	*	45 HRC Max.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
8.	Micro Case	*	Tempered Martensite+ RA 10% Max.	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A
9.	Micro Core	*	LCM+Bainitic Structure,	Microscope (100x~500x)	1Pc/Lot	HT Lab Report	A

SPACE FOR SKETCH :-

Material- 20MnCr5

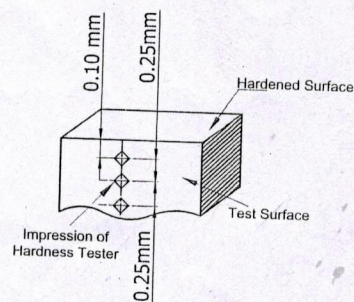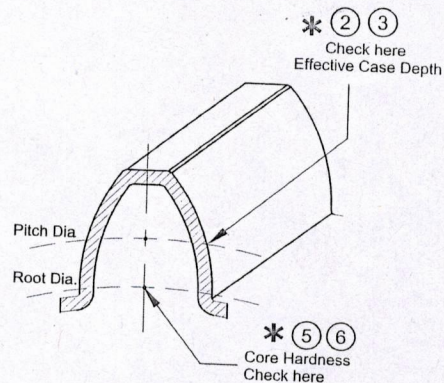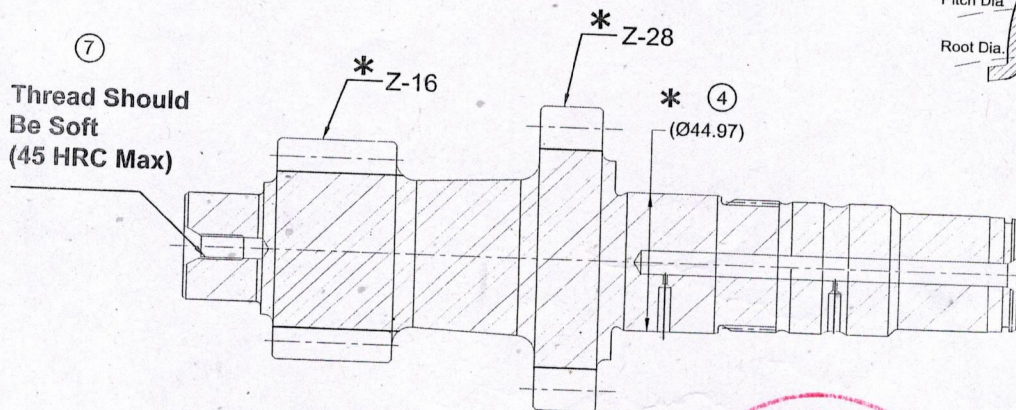

Note :- Thread Should Be Free From Carburisation.

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें।

Legends: ☒ Special Characteristics as Per Drawing ☒ Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details							
Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change