


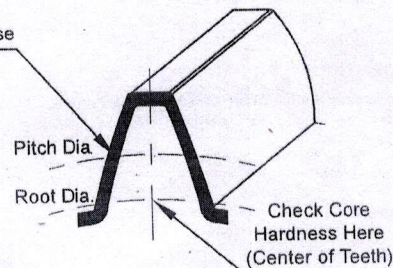


INSPECTION STANDARD (HT LAB)

☐ Prototype		☒ Pre-Launch		☐ Production		Date (Original)		17/03/2025		
Part Name:- Intermediate Gear			Part No.:- 86716900			Inspection Standard Number			SIP/40001/270	
Customer :- AGCO			Change Level:- 00			Part Stage			HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods		Inspection Frequency	Control Method	Reaction Plan			
			Product Specification	Inspection Method						
1.	Surface Hardness	▶	58-63 HRC (After Gear Grinding)	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A			
2.	Effective Case Depth 550 HV1	▶	0.95 - 1.20 mm (Before Gear Grinding)	Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A			
3.	Effective Case Depth 550 HV1	▶	0.8 - 1.1 mm (After Gear Grinding)	Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A			
4.	Core Hardness	▶	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A			
5.	Case Micro Structure	*	Tempered Martensite+RA ≤ 20% max	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A			
6.	Core Micro Structure	*	Low Carbon Martensite+Bainite	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A			
7.	IGO	*	0.035 Max.	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A			

Sketch:-

Z-47

Check ECD by
Hardness Traverse

Gear Profile

Material:- SAE 8620H

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For Process ▲ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By:

FMT-ENGG-39_REV No.:00 DATE:21.02.17