




INSPECTION STANDARD (HT LAB)

Page 01 of 01


☐ Prototype	☒ Pre-Launch	☐ Production	Date (Original)	17/03/2025			
Part Name:- Driven Gear Z-23		Part No.:- ACX4032730		Inspection Standard Number		SIP/40002/270	
Customer :- AGCO		Change Level:- 00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Product Specification	Methods	Inspection Frequency	Control Method	Reaction Plan
1.	Surface Hardness	▶	58-63 HRC (After Gear Grinding)	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
2.	Effective Case Depth 550 HV1	▶	0.95 - 1.20 mm (Before Gear Grinding)	Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
3.	Effective Case Depth 550 HV1	▶	0.8 - 1.10 mm (After Gear Grinding)	Micro Vicker Hardness Tester	1Pc/Lot	HT Lab Report	A
4.	Core Hardness	▶	30 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	HT Lab Report	A
5.	Case Micro Structure	*	Tempered Martensite+RA≤ 20% max	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A
6.	Core Micro Structure	*	Low Carbon Martensite+Bainite	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A
7.	IGO	*	0.035 Max.	Microscope (100X-500X)	1Pc/Lot	HT Lab Report	A

Sketch:-

Z-23

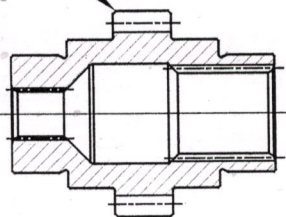

Check ECD by
Hardness Traverse

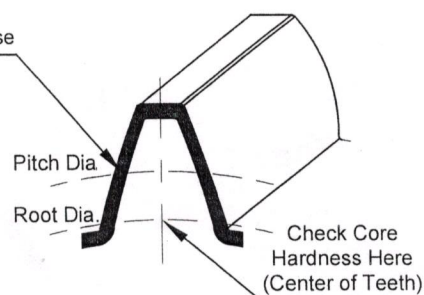

Gear Profile



Material:- SAE 8620H

Reaction Plan: A-यदि Inspection करते समय कम्पोंनेंट खराब मिले तो खराब कम्पोंनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ▶ Special Characteristics as Per Drawing * Special Characteristics For Process ⚠ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change