



INSPECTION STANDARD (HT LAB)

☐ Prototype	☐ Pre-Launch	☒ Production	Date (Original)	08/08/15			
Part Name:- Shaft Pinion Rear Axle-LH Z-11		Part No.:-D10245410		Inspection Standard Number		SIP/4136/130	
Customer :- ESCORTS		Change Level:-00		Part Stage		HT Lab.	
Sr.No.	Parameter	Special Char. Class	Methods				Reaction Plan
			Product Specification	Inspection Method	Inspection Frequency	Control Method	
1.	Surface Hardness (On Spline Teeth)	*	58~62 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
2.	Surface Hardness (On Ground Diameter)	*	54 HRC Min.	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
3.	ECD At 513 HV (At Gear & Spline PCD)	*	1.2~1.5 mm	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
4.	ECD At 513 HV (On Ground Dia)	*	0.9 mm Min.	Vicker Hardness Tester	1Pc/Lot	FMT-HT-39	A
5.	Core Hardness	*	32~41 HRC	Rockwell Hardness Tester	1Pc/Lot	FMT-HT-39	A
6.	Case Micro	*	Tempered Martensitec RA<20%	Microscope	1Pc/Lot	FMT-HT-39	A
7.	Core Micro	*	LCTM + Bannite	Microscope	1Pc/Lot	FMT-HT-39	A

OPEN SKTCH


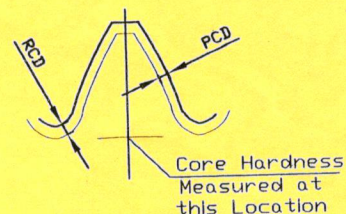
Material -20Mn5Cr5-S

Figure 1- 1

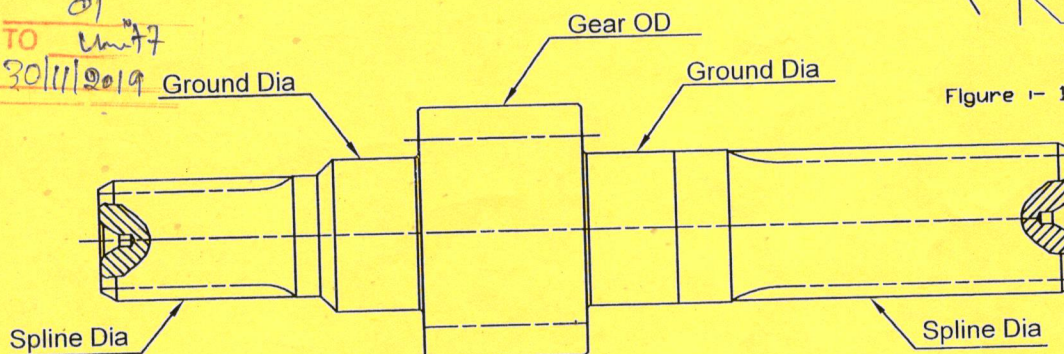

Reaction Plan: A-यदि Inspection करते समय कम्पोनेंट खराब मिले तो खराब कम्पोनेंट को Rejection का टैग लगाकर Rejection टेबल पर रखें और उसके बारे में Department के Incharge को बतायें ।

Legends: ☒ Special Characteristics as Per Drawing * Special Characteristics For Process ☒ Special Characteristics For Safety

Change Details

Date	Rev. No.	Change	Reason for Change	Date	Rev. No.	Change	Reason for Change

Prepared By:

Checked By:

Approved By:

FMT-ENG-39, REV No.:00, DATE:21.02.17