Hindawi Publishing Corporation International Journal of Corrosion Volume 2012, Article ID 496321, 16 pages doi:10.1155/2012/496321

Review Article

Effects of Air Pollution on Materials and Cultural Heritage: ICP Materials Celebrates 25 Years of Research

Johan Tidblad,¹ Vladimir Kucera,¹ Martin Ferm,² Katerina Kreislova,³ Stefan Brüggerhoff,⁴ Stefan Doytchinov,⁵ Augusto Screpanti,⁵ Terje Grøntoft,⁶ Tim Yates,⁷ Daniel de la Fuente,⁸ Ott Roots,⁹ Tiziana Lombardo,¹⁰ Stefan Simon,¹¹ Markus Faller,¹² Lech Kwiatkowski,¹³ Joanna Kobus,¹³ Costas Varotsos,¹⁴ Chris Tzanis,¹⁴ Linda Krage,¹⁵ Manfred Schreiner,¹⁶ Michael Melcher,¹⁶ Ivan Grancharov,¹⁷ and Nadya Karmanova¹⁸

- ¹ Swerea KIMAB AB, Drottning Kristinas väg 48, 11428 Stockholm, Sweden
- ² IVL Swedish Environmental Research Institute, P.O. Box 5302, 400 14 Gothenburg, Sweden
- ³ SVUOM Ltd., U Mestanského Pivovaru 934 /4, 17000 PRAHA 7, Czech Republic
- ⁴ Deutsches Bergbau-Museum Bochum, Herner Straße 45, 44787 Bochum, Germany
- ⁵ ENEA, C. R. Casaccia via Anguillarese 301, S. Maria di Galeria 00123, Rome, Italy
- ⁶ Norwegian Institute for Air Research (NILU), Instituttveien 18, P.O. Box 100, 2027 Kjeller, Norway
- ⁷ Building Research Establishment (BRE Ltd.), Bucknalls Lane, Watford WD25 9XX, UK
- ⁸ CENIM (CSIC), Avenida Gregorio del Amo 8, 28040 Madrid, Spain
- ⁹ Estonian Environmental Research Centre, Estonian Environmental Research Institute, Marja street 4D, 10617 Tallinn, Estonia ¹⁰Laboratoire Interuniversitaire des Systèmes Atmosphériques (LISA), UMR-CNRS 7583, Université Paris Est Créteil 61,
- avenue du Général de Gaulle, 94010 Créteil Cedex, France
 ¹¹Rathgen-Forschungslabor, Staatliche Museen zu Berlin, Schlossstraße 1a, 14059 Berlin, Germany
- ¹²EMPA, Ueberlandstraße 129, 8600 Duebendorf, Switzerland
- ¹³Institute of Precision Mechanics, Duchnicka 3, 01-796 Warsaw, Poland
- ¹⁴Climate Research Group, Division of Environmental Physics and Meteorology, Faculty of Physics, University of Athens, University Campus Bldg. Phys. V, 15784 Athens, Greece
- ¹⁵Department of Silicate Material Technology, Faculty of Materials Science and Applied Chemistry, Riga Technical University, Azenes Street 14/24, 1048 Riga, Latvia
- ¹⁶Institute of Science and Technology in Art, Academy of Fine Arts, Schillerplatz 3, 1010 Vienna, Austria
- ¹⁷University of Chemical Technology and Metallurgy, Bul. Kl. Ohridski 8, 1756 Sofia, Bulgaria
- ¹⁸International Cooperation Section, JSC "SRI Atmosphere", 7, Karbyshev Street, St. Petersburg 194021, Russia

Correspondence should be addressed to Johan Tidblad, johan.tidblad@swerea.se

Received 19 July 2011; Accepted 9 September 2011

Academic Editor: Blanca M. Rosales

Copyright © 2012 Johan Tidblad et al. This is an open access article distributed under the Creative Commons Attribution License, which permits unrestricted use, distribution, and reproduction in any medium, provided the original work is properly cited.

An overview is given of all results from the International Co-operative Programme on Effects on Materials including Historic and Cultural Monuments (ICP Materials), which was launched in 1985. Since then, about twenty different materials have been exposed repeatedly in a network of test sites consisting of more than twenty sites with an extensive environmental characterisation and more than sixty official reports have been issued. Recent results on trends in corrosion, soiling, and pollution show that corrosion of carbon steel, zinc, and limestone is today substantially lower than 25 years ago, but while corrosion of carbon steel has decreased until today, corrosion of zinc and limestone has remained more or less constant since the turn of the century. Unique data are given on measured HNO₃ concentrations from 2002-2003, 2005-2006, and 2008-2009, and the relative average decrease was about the same from 2002-2003 to 2005-2006 as it was from 2005-2006 to 2008-2009.

1. Introduction

ICP Materials or "the International Co-operative Programme on Effects on Materials including Historic and Cultural Monuments" was launched in 1985 and had its first Task Force Meeting in March 10-11, 1986, Watford, United Kingdom. Since then, more than sixty reports in the official report series have been issued [1–66].

The history of ICP Materials [67] begins, however, with the history of the Convention on Long-range Transboundary Air Pollution (CLRTAP, LRTAP Convention or simply "the Convention"). In 1979, the Member States of the United Nations Economic Commission for Europe (UNECE) adopted the Convention as a response to acid rain, brought on by contamination of the air, killing forests and lakes even in remote places far from industrial facilities [68]. The Convention has been extended by eight protocols that identify specific measures to be taken by their 51 Parties to cut their emissions of air pollutants [69]. Worth mentioning in this context are the 1985 Protocol on the Reduction of Sulphur Emissions or their Transboundary Fluxes by at least 30 per cent, the 1994 Protocol on Further Reduction of Sulphur Emissions, and the 1999 Protocol to Abate Acidification, Eutrophication and Ground-level Ozone. The last of these is also named the "Gothenburg Protocol" or the "multipollutants/multi-effects protocol".

Already in 1980, Vladimir Kucera was approached by UNECE with a request to provide a short summary of the state of knowledge concerning the effects of sulphur compounds on materials. The reason for selecting Sweden was most likely due to Sweden's well-received case study for the United Nations conference on the human environment published in 1971 [70]. This led to the development of a proposal in 1983 for an international exposure program where Sweden declared its willingness to be lead country. A decision to launch the program was made by the Executive Body of the Convention during its third session in Helsinki, July 1985. Later the same year an unofficial planning meeting took place in Stockholm, December 1985 with participation from research subcentres from the countries Czechoslovakia, Norway, Federal Republic of Germany, and United Kingdom.

The first phase of ICP Materials (1987–1995) was marked by a focus on development of dose-response functions where long-term data on corrosion and pollution is required. During this time, SO₂ concentrations were still relatively high but decreasing, so it was in 1996 realised that a new exposure programme was needed, the multipollutant exposure (1997–2001). The aim of this program was to quantify not only the effect of SO₂, but also other important "new" pollutants such as HNO₃ and particulate matter. In connection with this, an EU proposal was submitted by the group with the aim of strengthening the multipollutant exposure. This proposal was, however, rejected but was successfully resubmitted and in 2002 the 40-month MULTI-ASSESS project could start with the first extensive measurements of HNO₃ and PM in the program [71].

In 1996, there was also a turning point with the first ICP Materials workshop "Economic Evaluation of Air Pollution Damage to Materials," January 23–25, 1996, Stockholm, Sweden. This emphasis on the use of results for policy purposes was further strengthened with the launch of a subcentre for the assessment of stock of materials at risk and cultural heritage in 2005, together with the close cooperation with the 2004–2007 EU 6FP CULT-STRAT project on management strategies that resulted in a textbook on the effects of air pollution on materials and cultural heritage [72], and even more with the significant involvement of ICP Materials in the revision of the Gothenburg protocol, 2011.

The aim of the present paper is first to present a complete overview of all results that are available from the ICP Materials programme, including references to original data and publications. During the last 25 years, there are many individual results that are more or less well known, and even though these results have been published to varying degrees they are now for the first time presented in one single paper. The second aim is to give new results on trends in corrosion, soiling, and pollution. The exposure of materials for trend analysis has been one of the key activities of ICP Materials from the beginning in 1987, with the addition of limestone for corrosion and modern glass for soiling as new trend materials in 2005, in addition to the original trend materials: carbon steel and limestone. Regarding pollution, the focus in this paper will be on N pollutants, especially HNO₃, where unique data from the period 2002–2009 are presented.

2. Exposure of Materials (1987–2009)

A wide range of materials has been exposed over the years and an overview of the performed corrosion exposures for the period 1987–2009 for individual materials/materials groups are given in Figure 1. Note that modern glass is not included in the figure since it is a material exposed for evaluation of soiling (see Section 6.3). The main exposure with the widest range of materials was the original 8-year exposure (1987–1995). This was later complemented in the multipollutant 4-year exposure (1997–2001). Since 2000, only so-called trend exposures, that is, repeated one-year exposures with the aim of establishing trends in corrosion and pollution, have been performed for selected indicator materials. The individual materials are described in more detail in the following with references to original publications and data sources.

Recently, soiling is also included as an important effect on materials next to corrosion, and since 2005 modern glass has been exposed in sheltered position as a trend material for evaluation of soiling effects.

2.1. Carbon Steel. The subcentre responsible for evaluation of carbon steel was SVUOM, Czech Republic. Several materials, including carbon steel, were in addition to the unsheltered exposure also exposed under shelter, but not in all exposures. One-year data of unalloyed carbon steel

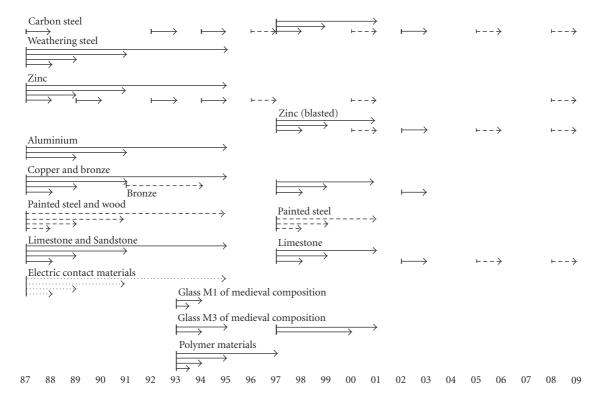


FIGURE 1: Overview of performed corrosion exposures within ICP Materials (solid arrows: unsheltered and sheltered exposure; dashed arrows: unsheltered exposure; dotted arrows: sheltered exposure inside an aluminium box).

(C < 0.2%, P < 0.07%, S < 0.05%, Cu < 0.07%) exposed in unsheltered position are available for the exposure years 1987-1988, 1992-1993, and 1994-1995 [29], 1996-1997 [46], 1997-1998 [41], 2000-2001 [46], 2002-2003 [73], 2005-2006 [52], and 2008-2009 [61]. One-year data for sheltered position are available for 1987-1988, 1992-1993, and 1994-1995 [29], 1997-1998 [41], and 2002-2003 [73]. Carbon steel was not exposed for longer periods than one year in the original exposure (1987–1995) but were in addition exposed both in unsheltered and sheltered positions in the multipollutant exposure, 1997–1999 and 1997–2001 [41], see Figure 1.

- 2.2. Weathering Steel. The subcentre responsible for evaluation of weathering steel was SVUOM, Czech Republic. Weathering steel (C < 0.12%, Mn 0.3–0.8%, Si 0.25–0.7%, P 0.07–0.15%, S < 0.04%, Cr 0.5–1.2%, Ni 0.3–0.6%, Cu 0.3–0.55%, Al < 0.01%) was exposed in unsheltered as well as sheltered position in the original exposure for the periods 1987-1988, 1987–1989, 1987–1991, and 1987–1995 [22], and an analysis of the results was later presented at the International workshop on atmospheric corrosion and weathering steels, Cartagena, 2004 [74].
- 2.3. Zinc. Two variants of zinc samples have been exposed, one "traditional" suitable for corrosivity classification and one that was blasted as a surface preparation prior to exposure resulting in slightly higher corrosion rates.

The subcentre responsible for evaluation of traditional zinc was SVUOM, Czech Republic. Zinc (>98.5%) was exposed in the original exposure for the periods 1987-1988, 1987–1989, 1987–1991, and 1987–1995, both in unsheltered and sheltered positions [22]. Additional data for one-year exposures are available for unsheltered position for the years 1989-1990, 1992-1993, and 1994-1995 [29], 1996-1997, and 2000-2001 [46], and 2008-2009 [61], and for sheltered position for the years 1987-1988, 1992-1993, and 1994-1995 [29], see Figure 1.

The subcentre responsible for evaluation of blasted zinc was EMPA, Switzerland. The first exposures were the multipollutant exposures in 1997-1998, 1997-1999, and 1997-2001 where samples were exposed in unsheltered as well as sheltered positions [42]. After that, blasted zinc has replaced traditional zinc as a trend material with exposures in 2000-2001 [42], 2002-2003 [73], 2005-2006 [53], and 2008-2009 [61]. In the year 2002-2003, sheltered samples were exposed as well [73].

2.4. Aluminium. The subcentre responsible for evaluation of aluminium was SVUOM, Czech Republic. Aluminium (>99.5%) was exposed in the original exposure program for the periods 1987-1988, 1987-1989, 1987-1991, and 1987-1995, both in unsheltered and sheltered positions. However, results are only available after 2, 4, and 8 years of exposure since the corrosion attack after 1 year of exposure could not be evaluated [22].

2.5. Copper, Cast Bronze, and Pretreated Bronzes. The subcentre responsible for evaluation of copper, bronze, and pretreated bronzes was the Bavarian State Department of Historical Monuments, Germany. Copper was of quality SF Cu, DIN 1787 (Cu 99%, P 0.015–0.04%) and cast bronze Cu Sn6Pb7Zn5, ISO/R 1338 (Cu 81%, Sn 5.8%, Pb 6.7%, Zn 4.5%, Ni 1.6% + trace elements). Both copper and cast bronze were exposed in unsheltered as well as sheltered positions in the original exposure program for the periods 1987–1988, 1987–1989, 1987–1991, and 1987–1995 [23] and later also in the multipollutant exposure program for 1997-1998, 1997–1999, and 1997–2001, and last in 2002-2003 [73].

In addition, recycled 1- and 2-year bronze specimens from the original exposure were grinded and then exposed in unsheltered position as untreated, waxed, patinated, and patinated/waxed for the period 1991–1994 [31].

- 2.6. Painted Steel and Wood. The subcentre responsible for evaluation of paint coatings was NILU, Norway. Four coatings were exposed, two painted on wood and two on steel: coil coated steel with alkyd melamine, steel panel with silicon alkyd, wood panel with alkyd, and wood panel with primer and acrylate. All these were exposed in unsheltered, but not sheltered, position in the original exposure program for the periods 1987-1988, 1987–1989, 1987–1991, and 1987–1995 [25]. One of these, the steel with silicon alkyd was then later also exposed in the multipollutant exposure program for 1997-1998, 1997–1999, and 1997–2001 [45].
- 2.7. Sandstone and Limestone. The subcentre responsible for evaluation of stone materials was BRE, UK. Portland limestone and white Mansfield dolomitic sandstone were exposed in unsheltered as well as sheltered positions in the original exposure program for the periods 1987-1988, 1987–1989, 1987–1991, and 1987–1995 [24].

In subsequent exposures limestone only was exposed. It was included in the multipollutant exposure in unsheltered and sheltered positions for 1997-1998, 1997–1999, and 1997–2001 [44] and also in 2002-2003 [73]. It is now classified as one of the indicator materials and was exposed in subsequent trend exposure in unsheltered position in 2005-2006 [54] and 2008-2009 [61].

- 2.8. Electric Contact Materials. The subcentre responsible for evaluation of electric contact materials was the former Swedish Corrosion Institute, now Swerea KIMAB. Nickel, copper, silver, and tin as well as Eurocard connectors of three different qualities were exposed in sheltered positions inside an aluminium box in the original exposure program for the periods 1987-1988, 1987-1989, 1987-1991, and 1987-1995 [26]. Several publications resulted from the evaluation including but not limited to [75–79].
- 2.9. Glass of Medieval Composition. The subcentre responsible for evaluation of glass of composition representative for medieval stained glass windows was the Institute of Sciences and Technology in Art, Academy of Fine Arts, Austria. Glass of two compositions were exposed, the more sensitive M1

(SiO $_2$ 48%, K $_2$ O 25.5%, CaO 15%, MgO 3%, Al $_2$ O $_3$ 1.5%, P $_2$ O $_5$ 4%, and Na $_2$ O 3%) and M3 (SiO $_2$ 60%, K $_2$ O 15%, CaO 25%). Glass M1 was exposed for half a year (1993-1994) and one year (1993-1994) in both unsheltered and sheltered positions and in the same program glass M3 was exposed in unsheltered and sheltered positions for one (1993-1994) and two years (1993–1995) [27].

In the multipollutant exposure, only M3 was exposed for the periods 1997–2000 and 1997–2001 (3 and 4 years). However, by partly exposing samples already exposed for one and two years in the previous exposure (1993–1995) for the period 1997–2001 the final reports for sheltered [47] and unsheltered [48] exposure were able to contain results after 3, 4, 5, and 6 years of exposure. Several publications, Ph.D. and Diploma Theses resulted from these systematic investigations [80–87].

2.10. Polymer Materials. The subcentre responsible for evaluation of electric contact materials was the former Swedish Corrosion Institute, now Swerea KIMAB. Polyamide and polyethylene were exposed in unsheltered and sheltered positions for 0.5 (1993-1994), 1 (1993-1994), 2 (1993–1995), and 4 (1993–1997) years [28]. An analysis of the results was later presented at the 1st European Weathering Symposium, 2004 [88].

2.11. Modern Glass. The sub-center responsible for the evaluation of soiling on glass was LISA, France. Silica-sodalime float glass (70 to 72% of SiO₂, about 14% of Na₂O, and about 10% of CaO, and other oxides) currently used as windows glass, as well as in building facades, was exposed in sheltered position inside an aluminium box for 1 year (2005-2006 and 2008-2009).

3. Network of Test Sites

A complete list of sites used for the previously described exposures is given in Table 1. The first thirty-nine sites (1–39) were used in the original exposure (1987–1995). When the multipollutant exposure (1997–2001) was started eight, new sites were added (40–49) but at the same time several sites were removed that were part in the original exposure. One of the criteria for keeping sites was that they should be measuring ozone, which during this time changed status from optional to mandatory (see below). Subsequent individual additions/removals of test sites have been made in connection with trend exposures as specified in Table 1.

4. Measurements of Environmental Data

Environmental data has been the back-bone of the program, and the extensive environmental characterisation is perhaps what most distinguishes this corrosion program from other. In fact, some of the reported environmental data (see HNO₃ below) is unique, even from the perspective of environmental research.

NILU, Norway has been responsible for the reporting of environmental data and data for individual years have

Table 1: List of ICP Materials test sites showing number, name, country site type, and years with available data 1987–2009.

| Name | Country | Site type ^a | Available data | |
|-----------------------------|--------------------|------------------------|----------------|--|
| (1) Prague-Letnany | Czech Republic | Urban | 1987–2009 | |
| (2) Kasperske Hory | Czech Republic | Rural | 1987–1995 | |
| (3) Kopisty | Czech Republic | Industrial | 1987-2009 | |
| (4) Espoo | Finland | Urban | 1987–1995 | |
| (5) Ähtäri | Finland | Rural | 1987-2003 | |
| (6) Helsinki-Vallila | Finland | Industrial | 1987-1995 | |
| (7) Waldhof-Langenbrügge | Germany | Rural | 1987-2003 | |
| (8) Aschaffenburg | Germany | Urban | 1987-1995 | |
| (9) Langenfeld-Reusrath | Germany | Rural | 1987-2003 | |
| (10) Bottrop | Germany | Industrial | 1987-2009 | |
| (11) Essen-Leithe | Germany | Rural | 1987-1995 | |
| (12) Garmisch-Partenkirchen | Germany | Rural | 1987-1995 | |
| (13) Rome | Italy | Urban | 1987-2009 | |
| (14) Casaccia | Italy | Rural | 1987-2009 | |
| (15) Milan | Italy | Urban | 1987-2009 | |
| (16) Venice | Italy | Urban | 1987-2009 | |
| (17) Vlaardingen | Netherlands | Industrial | 1987-1995 | |
| (18) Eibergen | Netherlands | Rural | 1987–1995 | |
| (19) Vredepeel | Netherlands | Rural | 1987–1995 | |
| (20) Wijnandsrade | Netherlands | Rural | 1987–1995 | |
| (21) Oslo | Norway | Urban | 1987-2009 | |
| (22) Borregard | Norway | Industrial | 1987–1995 | |
| (23) Birkenes | Norway | Rural | 1987-2009 | |
| (24) Stockholm South | Sweden | Urban | 1987-2009 | |
| (25) Stockholm Centre | Sweden | Urban | 1987-1995 | |
| (26) Aspvreten | Sweden | Rural | 1987-2009 | |
| (27) Lincoln Cathedral | United Kingdom | Urban | 1987-2009 | |
| (28) Wells Cathedral | United Kingdom | Urban | 1987–1995 | |
| (29) Clatteringshaws Loch | United Kingdom | Rural | 1987-1988 | |
| (30) Stoke Orchard | United Kingdom | Industrial | 1987–1993 | |
| (31) Madrid | Spain | Urban | 1987–2009 | |
| (32) Bilbao | Spain | Industrial | 1987–1995 | |
| (33) Toledo | Spain | Rural | 1987–2009 | |
| (34) Moscow | Russian Federation | Urban | 1987–2003 | |
| (35) Lahemaa | Estonia | Rural | 1987–2009 | |
| (36) Lisbon | Portugal | Urban | 1987–2003 | |
| (37) Dorset | Canada | Rural | 1987–2006 | |
| (38) Research Triangle Park | USA | Rural | 1987–1995 | |
| (39) Steubenville | USA | Industrial | 1987–1995 | |
| (40) Paris | France | Urban | 1997–2009 | |
| (41) Berlin | Germany | Urban | 1997–2009 | |
| 43) Tel Aviv | Israel | Urban | 1997–2001 | |
| (44) Svanvik | Norway | Rural | 1997–2009 | |
| (45) Chaumont | Switzerland | Rural | 1997–2009 | |
| (46) London | United Kingdom | Urban | 1997–2003 | |
| (47) Los Angeles | USA | Urban | 1997–2003 | |
| (49) Antwerpen | Belgium | Urban | 1997–2001 | |
| (50) Katowice | Poland | Industrial | | |
| (51) Athens | Greece | Urban | 2000–2009 | |
| (JI) AUICIIS | GIECCE | Orban | 2005–2009 | |

TABLE 1: Continued.

| Name | Country | Site type ^a | Available data | |
|-------------|----------|------------------------|----------------|--|
| (53) Vienna | Austria | Urban | 2008-2009 | |
| (54) Sofia | Bulgaria | Urban | 2008-2009 | |

^aThe characterisation of test sites as rural/urban/industrial is in some cases a difficult decision and is not an indication of the corrosivity of the test site.

been reported for 1987–1989 [3], 1989-1990 [9], 1990-1991 [10], 1991-1992 [16], 1992-1993 [17], 1993-1994 [20], 1987–1995 [21], 1995–1998 [33], 1998-1999 [39], 1997–2001 [40], 2002-2003 [49], 2005-2006 [51], and 2008-2009 [66]. Table 2 gives an overview of the reported environmental data for the period 1987–2009.

Temperature and relative humidity have always been included as a representation of the climatic conditions. Time of wetness was included from the beginning but has not been reported since 1995, with the reason being that this parameter is not given from meteorological institutions but needs to be calculated from highly time-resolved data of temperature and relative humidity, which is not always practical. Also the additional information contained in this variable, compared to what is already included in annual averages of temperature and relative humidity, is very limited. Sunshine data was also included from the beginning but has not been reported since 2005. This is a parameter that is especially important for polymeric materials and paint coatings, which were not exposed in the 2005-2006 and 2005-2006 trend exposures.

The gaseous pollutants SO_2 and NO_2 were included from the beginning as mandatory parameters, and in connection with the multipollutant exposure more emphasis was also put on O_3 . A special campaign was launched in connection with the MULTI-ASSESS project in 2002-2003 [71], and since then HNO_3 and particulate matter has been included as mandatory parameters.

5. Dose-Response Functions

One of the main aims of ICP Materials from the beginning has been to "perform a quantitative evaluation of the effects of multipollutants such as S and N compounds, O₃ and particles, as well as climate parameters, on the atmospheric corrosion and soiling of important materials, including materials used in objects of cultural heritage". This has been done by developing dose-response functions. Of all the functions that have been developed through the years, some have been selected as suitable for mapping effects on materials. These are given in the UN ECE Manual on Methodologies and Criteria for Modelling and Mapping Critical Loads and Levels; and Air Pollution Effects, Risks and Trends [89]. As described in the manual, two sets of functions have been developed. One for the SO₂ dominating situation [90], based on data from the original exposure (1987–1995) and one for the multipollutant situation [91], based on data from the multipollutant exposure (1997–2001). The doseresponse functions given in the mapping manual are valid for unsheltered conditions, see Table 3.

6. Trends in Pollution, Corrosion, and Soiling

6.1. Trends in Pollution and Corrosion (1987-2009). The average absolute pollutant levels have changed during the period 1987-2009 not only because of changing pollutant concentrations, but also because of ICP Materials test site selection. Figure 2 shows average relative SO₂, NO₂, and O₃ concentrations at ICP Materials sites, corrected for site selection. The average trends are quite different for the gases. O₃ increased during the 1990s but has been relatively constant after this period. NO₂ has decreased and continues to decrease over the entire period, while the decrease in SO₂ ceased during 2000 to 2006 with a slight decrease in the most recent exposure in 2008-2009. Corrosion of materials has decreased during the same period, mainly due to the decreasing SO₂ concentration, but to varying degrees depending on the material. Figure 3 shows the surface recession of limestone for the exposure periods 1987-1988, 1997-1998, 2002-2003, 2005-2006, and 2008-2009.

Compared to the first exposure, the values today are obviously lower, but there is significant year to year variation and there is no obvious decrease since 1998. The same is true for zinc (Figure 4). In Figure 4, it is an obvious difference between traditional and blasted zinc, with use of the latter resulting in corrosion values on average almost twice that of traditional zinc. Therefore, blasted zinc values are shown in a different scale (Figure 4, right) in order to make a complete visual impression of the relative zinc trends. For carbon steel, however, the decrease in corrosion is in principle following an exponential decay with corrosion halving its value each 12th year in industrial/urban areas and each 16th year in rural areas (Figure 5).

6.2. Recent Trends in N Pollutants (HNO3, NO2, and Particulate NO₃⁻). Nitric acid and particulate nitrate are the most stable forms when the primary pollutants nitric oxide and nitrogen dioxide are transformed in the atmosphere. There are very few reported measurements of HNO₃ and particulate NO₃⁻ in urban air in Europe and elsewhere. Nitric acid is a strong acid and its salts are very hygroscopic. It can, therefore, lead to increased atmospheric corrosion [92]. In the EU project MULTI-ASSESS [71], a diffusive sampler was validated for HNO3 and a surrogate surface for particulate deposition was chosen for air quality measurements in connection with corrosion studies [72]. Nitric acid is rapidly adsorbed on most surfaces and, therefore, has a very high dry deposition velocity. Nanoparticles and coarse particles, but not accumulation mode particles, also deposit fast to surfaces. Nanoparticles generally represent a negligible fraction of the total airborne particle mass.

| Parameter | Symbol | Unit | 1987-1995 | 1995-2001 | 2002-2003 | 2005-2009 |
|--|---------|---|-----------|------------------|-----------|-----------|
| Temperature | Т | °C | X | X | X | X |
| Relative humidity | Rh | % | X | X | X | X |
| Time of wetness | Tow | h | X | _ | _ | _ |
| Sunshine | Sun | h | X | | _ | _ |
| Sunshine ^a | Sun | $ m MJ~m^{-2}$ | X | X | X | _ |
| SO ₂ concentration | SO_2 | $\mu \mathrm{g} \ \mathrm{m}^{-3}$ | X | X | X | X |
| NO ₂ concentration | NO_2 | $\mu \mathrm{g} \ \mathrm{m}^{-3}$ | X | X | X | X |
| O ₃ concentration | O_3 | $\mu \mathrm{g} \ \mathrm{m}^{-3}$ | (X) | (X) | X | X |
| HNO ₃ concentration | HNO_3 | $\mu\mathrm{g}~\mathrm{m}^{-3}$ | _ | $(X)^b$ | (X) | X |
| Precipitation: amount | Prec | mm | X | X | X | X |
| (i) conductivity | Cond | $\mu { m S~cm^{-1}}$ | X | X | X | (X) |
| (ii) pH | pН | _ | X | X | X | X |
| (iii) SO ₄ ²⁻ , NO ₃ ⁻ , Cl ⁻ | varies | $ m mgL^{-1}$ | X | X | X | X |
| (iv) HN4 ⁺ , Na ⁺ , Ca ²⁺ , Mg ²⁺ , K ⁺ | varies | $ m mgL^{-1}$ | (X) | (X) | (X) | (X) |
| Particulate matter | PM | $\mu \mathrm{g}\mathrm{cm}^{-2}\mathrm{month}^{-1}$ | _ | (X) ^b | (X) | X |

Table 2: Reported environmental data from ICP Materials test 1987–2009: X: mandatory; (X): optional; —: not reported.

Table 3: Materials for which dose-response functions are given for the SO₂ dominating situation (top) and the multipollutant situation (bottom) in the UNECE Mapping Manual and the required environmental data.

| Material | T | Rh | SO_2 | O ₃ | HNO ₃ | PM10 | Prec | pН | Cl- |
|---------------------------------------|---|----|--------|----------------|------------------|------|------|----|-----|
| Weathering steel | X | X | X | | | | | | |
| Zinc | X | X | X | | | | X | X | |
| Aluminium | X | X | X | | | | X | | X |
| Copper | X | X | X | X | | | X | X | |
| Bronze | X | X | X | | | | X | X | X |
| Limestone | X | | X | | | | X | X | |
| Sandstone | X | | X | | | | X | X | |
| Coil-coated steel with alkyd melamine | X | X | X | | | | X | | |
| Steel panel with alkyd | X | X | X | | | | X | | |
| Carbon steel (multipollutant) | X | X | X | | | X | X | X | |
| Zinc (multipollutant) | X | X | X | | X | | | | |
| Bronze (multipollutant) | X | X | X | | | X | X | X | |
| Limestone (multipollutant) | | X | X | | X | X | X | X | |

Therefore, deposited particulate nitrate are mainly associated with coarse particles. Coarse particles are often alkaline and can also contain sodium chloride. These properties make them a sink for nitric acid. The reaction can either take place in the atmosphere or on already deposited particles.

Nitrogen oxides are mainly emitted as nitric oxide, but a small fraction is also emitted as nitrogen dioxide. The directly emitted nitrogen dioxide fraction from vehicles has increased during the last decades partly due to modern diesel engines. Nitric oxide forms nitrogen dioxide by reaction with ozone (R1):

$$NO + O_3 \longrightarrow NO_2 + O_2$$
 (R1)

$$NO2 + OH \xrightarrow{M} HNO_3$$
 (R2)

$$NO_2 + O_3 \longrightarrow NO_3 + O_2$$

 $NO_3 + NO_2 \longleftrightarrow N_2O_5$ (R3)
 $N_2O_5 + H_2O \longrightarrow 2HNO_3$

$$2NO_2 + H_2O \longrightarrow HONO + HNO_3$$
 (R4)

The main reaction for oxidizing NO₂ to HNO₃ is the daytime gas-phase oxidation with OH radicals (R2). NO₂ can also be oxidized during nighttime by ozone through a series of reactions involving nitrate radicals and dinitrogen pentoxide (R3). Further, NO₂ adsorbed on a wet surface can recombine giving nitrous acid, HONO, and HNO₃ (R4).

HNO₃ was measured with diffusive samplers [93] and nitrate on deposited particles with a surrogate surface [94].

^aCalculated from sunshine hours and latitude.

^bOnly data at a few test sites reported.

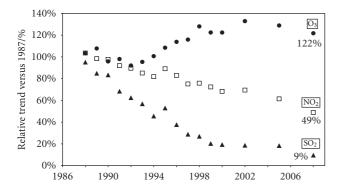


FIGURE 2: Average SO₂, NO₂ and O₃ trends relative to the year 1987 at ICP Materials test sites.


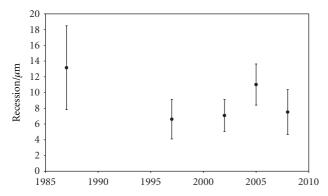


FIGURE 3: Averages and ranges (standard deviations) of limestone surface recession at ICP Materials test sites (one year exposures).

The exposure time was generally 2 months and each campaign lasted one year for the periods 2002-2003, 2005-2006, and 2008-2009. Two precursors to HNO₃, namely, NO₂ and O₃, were in the 2002-2003 exposure measured with diffusive samplers, or with other methods depending on exposure time and site. Most sites in ICP Materials used chemiluminescent and UV-instruments, respectively, to measure NO₂ and O₃. Monthly averages are available from these measurements. Some sites used, however, the same diffusive samplers as in 2002-2003.

Since only 17 stations (12 urban and 5 rural) did nitric acid measurements in all three campaigns, the nitric acid concentrations are compared between two campaigns at a time, in order to use all data and to see if there is a trend or random changes, as presented in Figure 6. The results are well correlated between the campaigns except for a few odd sites, which were excluded in the linear regression lines. The decrease in nitric acid concentrations seems to be substantial, on the average about 20% per three-year period, which would correspond to about 50% for a 10-year period, should the decrease continue at the same rate.

The concentrations of the precursors NO_2 and O_3 were also lower during the campaign 2008-2009 compared to 2002-2003, see Figure 7. As can be seen from the figure, the annual average concentration of these precursors has also decreased during this period (see also Figure 2 presented

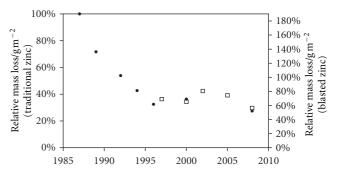

- Traditional zince
- □ Blasted zinc

FIGURE 4: Average relative zinc corrosion at ICP Materials test sites. Values for both traditional and blasted zinc have been normalised to the 1987-1988 value for traditional zinc before averaging.

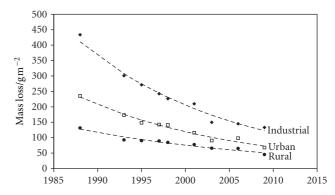


FIGURE 5: Carbon steel corrosion for industrial, urban, and rural ICP Materials test sites.

above). Since particulate nitrate requires a counter ion, it is not likely that the deposited particulate nitrate formation rate is proportional to the nitric acid concentration in air. A small decrease in particulate nitrate deposition was, however, observed between the first and latest campaigns.

To illustrate the correlation between HNO₃ concentration and its precursors, the concentrations were plotted against the latitude of the sites. Figure 8 shows that the HNO₃ concentration decreases from south to north, while the precursors' concentrations are not well correlated with latitude. This suggests that the photochemical formation of nitric acid (R2) is the most important. This is also supported by Figure 9, which shows the average seasonal variation of the HNO₃ concentration. Nitric acid and ozone both show a seasonal trend with maximum during the brightest time of the year and minima during the darkest.

At four places in the network, a rural site is quite close to a corresponding urban site. At these sites (Toledo-Madrid, Birkenes-Oslo, Aspvreten-Stockholm, and Casaccia-Rome) the HNO $_3$ concentrations are much higher at the urban sites than the rural except for Casaccia-Rome where they are quite similar. The NO $_2$ concentrations were always much lower at the nearby rural sites.

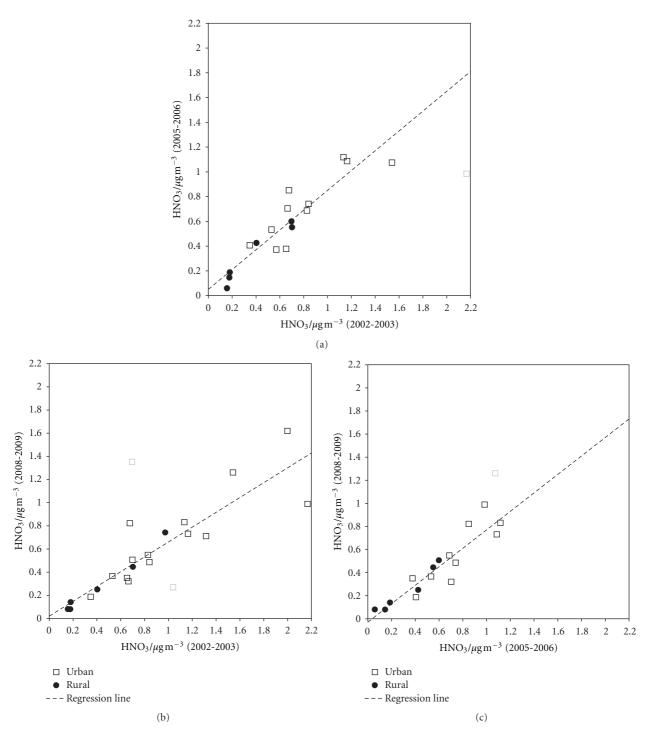


FIGURE 6: Annual average HNO₃ concentration at ICP Materials test sites for the three one-year campaigns 2002-2003, 2005-2006, and 2008-2009. The grey squares have been excluded when calculating the linear regression lines y = 0.80x + 0.05 (2005-2006 *versus* 2002-2003), y = 0.80x - 0.03 (2008-2009 *versus* 2005-2006), y = 0.64x + 0.02 (2008-2009 *versus* 2002-2003).

6.3. Recent Trends in Soiling of Modern Glass. Due to the increasing importance of particulate matter, modern glass was officially included as a trend material for soiling of materials in the 2005-2006 exposure, so this means that only two exposure periods are available. Dose-response functions are currently being evaluated [58, 95], but the

final functions will not be available until end 2013 and will include results also after four years of exposure (2008–2012). Figure 10 shows soiling of modern glass measured by the haze parameter, which is the ratio between the diffuse and direct transmitted light. Taking into account the accuracy of the measurements, it is not possible to say that soiling, on

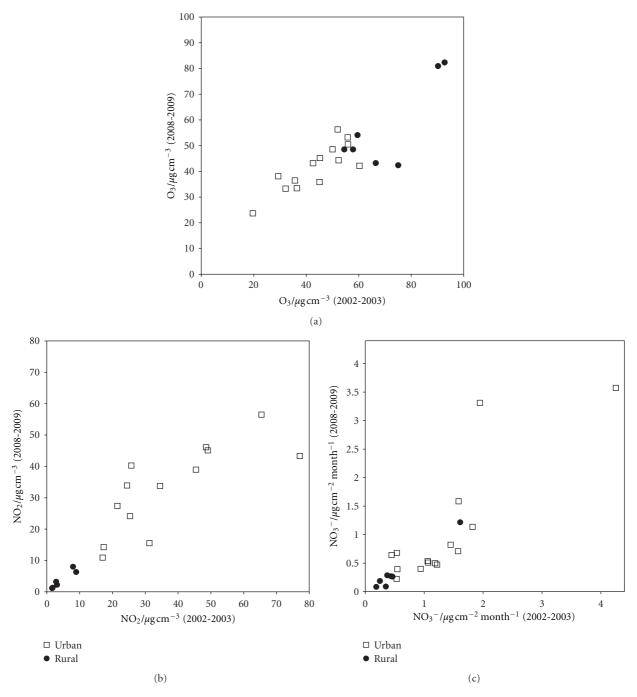


FIGURE 7: Annual average O₃ concentration, NO₂ concentration, and NO₃⁻ deposition at ICP Materials test sites for the two one-year campaigns 2002-2003, and 2008-2009.

average, has increased or decreased when comparing the two exposure periods 2005-2006 and 2008-2009.

7. Use of Results for Policy Purposes

The last main aim of ICP Materials is to "use the results for mapping areas with increased risk of corrosion and soiling, and for calculation of cost of damage caused by deterioration of materials". This was put high on the agenda in 2005 when Italy was selected as responsible for a new subcentre on the assessment of stock of materials at risk and cultural heritage, and Sweden and Italy started to share the position as chairs of ICP Materials.

The main results from ICP Materials in this area are the case studies on assessment of stock at risk and mapping areas of increased corrosion risk in Madrid [56, 96] and Italy [59, 62], and recent reviews of available data on stock of materials at risk [60] and economic evaluations [64]. Also

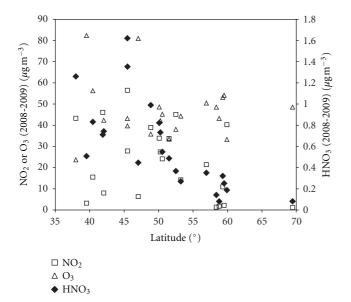


FIGURE 8: The concentration of nitric acid during 2008/09 and two of its precursors as a function of latitude.

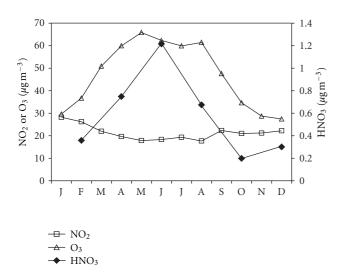


FIGURE 9: Seasonal cycle of nitric acid and two of its precursors during 2008/09.

there was a close link between ICP Materials and the CULT-STRAT project, which resulted in a book on effects of air pollution on cultural heritage, which included significant parts from the ICP Materials project, including stock at risk studies and discussion on the use of results for policy purposes [72].

At least two separate ways are possible in order to use the results for policy purposes, as outlined in the recent report on economic assessment [64]. The first, and most preferable if all data are available, is to perform a complete evaluation of cost savings (as part of a cost-benefit analysis) for materials and cultural heritage due to reductions in air pollution based on assessment of stock of materials at risk, data on maintenance practices, and costs and mapped

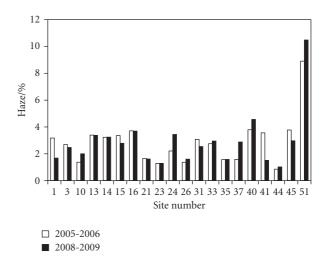


FIGURE 10: Soiling of modern glass at ICP Materials test sites (see Table 1).

areas of corrosion risk. The other approach is to use the concept of tolerable corrosion/soiling and pollution levels for indicator materials. The last approach is currently used in the evaluation of results from the working group on effect in connection with the current revision of the Gothenburg protocol [97].

Figure 11 shows a selected map [59] of calculated corrosion values for limestone. As is evident from the figure, the scale on which the original data is presented has a large impact on the results. If the scale is too coarse to capture the variation in urban areas, where cultural heritage is located, then the calculated corrosion attack can be significantly underestimated.

8. Plans for Future Exposures

A new trend exposure will start in the fall of 2011. Besides the usual trend exposures of carbon steel, zinc, limestone and modern glass, which are now part of the on-going three-year cycle of trend exposures, additional exposures will start including 4-year samples of these materials (2011–2015) as well as corresponding exposures for weathering steel, copper, and possibly aluminium. In addition, a new test site will be launched in St Petersburg. The incorporation of countries in Eastern Europe, Caucasus, and Central Asia (EECCA countries), that is, Armenia, Azerbaijan, Belarus, Georgia, Kazakhstan, Kyrgyzstan, Moldova, Russian Federation, Tajikistan, Turkmenistan, Ukraine, and Uzbekistan, is a high priority of the Convention.

9. Conclusions

An overview of available results from ICP Materials has been presented. Since the main focus of the programme has been to use the results for development of the policy process within the Convention on Long-range Transboundary Air Pollution, there are still significant parts of the results that

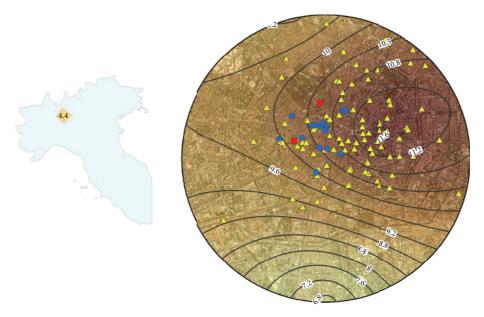


FIGURE 11: Calculated surface recession of limestone in μ m (one-year exposure), based on the dose-response function for the SO₂ dominating situation, for the Milan city centre, reported either as one single value based on the EMEP 50 km \times 50 km grid cell (left, 4.4 μ m) or as a map of the city centre based on local data (right, 6.8 to 11.6 μ m). Coloured symbols (blue, red, and yellow) in the map to the right indicate different types of cultural heritage [59].

have not been published outside the official UNECE ICP Materials report series.

Results on recent trends in corrosion, soiling, and pollution have been presented for the indicator materials carbon steel, zinc limestone, modern glass, and for the gaseous pollutants SO₂, NO₂, O₃, and HNO₃.

- (i) Carbon steel corrosion has since the beginning of exposures (1987) decreased exponentially at industrial, urban, and rural sites so that the corrosion has been halved about each 12th year for industrial/urban sites and each 16th year for rural sites.
- (ii) Zinc and limestone corrosion have decrease substantially compared to the levels in 1987, but since the turn of the century there is no obvious average trend in the ICP Materials network of test sites.
- (iii) Modern glass as an indicator for soiling has only been exposed for two periods so far, 2005-2006 and 2008-2009, and when comparing the results from these periods, there is no average difference in the results. However, more exposures are needed before longterm trends can be established.
- (iv) Nitric acid concentrations were measured in 2002-2003, 2005-2006, and 2008-2009. When comparing these three periods, the relative decrease was about the same from 2002-2003 to 2005-2006 as it was from 2005-2006 to 2008-2009, corresponding to about 50% for a 10-year period, should the decrease continue at the same rate. However, only three exposure periods are not sufficient to rule out that this apparent trend is not instead part of a natural year-to-year variation.

Acknowledgments

Coauthors to this paper are those who are currently active in the work of ICP Materials. However, during the years many researchers and organisations have come and left and the work would not have been possible without them. Since the list would otherwise most likely be incomplete, only previously involved organisations are listed here: (i) Technical Research Centre of Finland (VTT), (ii) Bavarian State Department of Historical Monuments, Germany, (iii) TNO Division of Technology for Society Department of Environmental Chemistry, the Netherlands, (iv) Institute of Physical Chemistry, Russian Academy of Sciences, Russian Federation, (v) Institute of Technology, Laboratory of Mineralogy and Petrology, Portugal, (vi) National Research Council of Canada and the Ministries of the Environment of Canada and of Ontario, (vii) United States Environmental Protection Agency, (viii) Israel Antiquities Authority, Conservation Department, and (ix) Department of Chemistry, University of Antwerp, Belgium. This compilation work was financed by the Swedish Environmental Protection Agency. However, ICP Materials has been and is financed by numerous sources and these can be found in the original papers referenced in this publication.

References

- [1] C. Leygraf and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Tech. Rep. 1, Swedish Corrosion Institute, Stockholm, Sweden, 1988.
- [2] C. Leygraf and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and

- cultural monuments," Report no. 2 Description of test sites, Swedish Corrosion Institute, Stockholm, Sweden, 1993.
- [3] J. F. Henriksen, K. Arnesen, A. Rode et al., "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 3 Environmental data report, September 1987 to August 1989, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1991.
- [4] A.T. Coote, T. J. S. Yates, S. Chakrabarti, D. J. Bigland, J. P. Ridal, and R. N. Butlin, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 4 Evaluation of decay to stone tablets: part 1. After exposure for 1 year and 2 years, Building Research Establishment (BRE), Watford, UK, 1991.
- [5] B. Stöckle, G. Pöhlmann, M. Mach, and R. Snethlage, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 5 Corrosion attack on copper and cast bronze. Evaluation after 1 and 2 years of exposu, Bavarian State Conservation Office, Münich, Germany, 1991.
- [6] P. Holler, D. Knotkova, A. Bouskova et al., "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 6. Corrosion attack on steel, zinc and aluminium. Evaluation after 1 and 2 years of exposure, National Research Institute for the Protection of Materials, Prague, Czech Republic, 1991.
- [7] J. F. Henriksen, A. Bartonova, O. Anda, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 7 Results for evaluation of decay to paint systems for wood, steel and galvanized steel after 1 and 2 years of exposure, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1992.
- [8] J. Tidblad, C. Leygraf, and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 8 Corrosion attack on electric contact materials. Evaluation after 1 and 2 years of exposure, Swedish Corrosion Institute, Stockholm, Sweden, 1991.
- [9] J. F. Henriksen, A. Bartonova, K. Arnesen, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 9 Environmental data report. September 1989 to August 1990, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1992.
- [10] J. F. Henriksen, A. Bartonova, K. Arnesen, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 10 Environmental data report. September 1990 to August 1991, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1992.
- [11] B. Stöckle, A. Reisener, and R. Snethlage, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 11 Corrosion attack on copper and cast bronze. Evaluation after 4 years of exposure, Bavarian State Conservation Office, Münich, Germany, 1993.
- [12] D. Knotkova, K. Kreislova, P. Holler, and J. Vlckova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 12 Corrosion attack on weathering steel, zinc and aluminium. Evaluation after 4 years of exposure, National Research Institute for the Protection of Materials, Prague, Czech Republic, 1993.

- [13] A. T. Coote, T. J. S. Yates, S. Chakrabarti, M. J. Murray, and R. N. Butlin, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 13 Evaluation of decay to stone tablets: part 2. After exposure for 4 years, Building Research Establishment (BRE), Watford, UK, 1993.
- [14] J. F. Henriksen, K. Arnesen, O. Anda, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 14 Evaluation of decay to paint systems for wood, steel and galvanized steel after 4 years of exposure, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1993.
- [15] J. Tidblad, C. Leygraf, and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 15 Corrosion attack on electric contact materials. Evaluation after 4 years of exposure, Swedish Corrosion Institute, Stockholm, Sweden, 1993.
- [16] J. F. Henriksen, K. Arnesen, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 16 Environmental data report. September 1991 to August 1992, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1993.
- [17] J. F. Henriksen, K. Arnesen, A. Rode et al., "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 17 Environmental data report. September 1992 to August 1993, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1993.
- [18] V. Kucera, J. Tidblad, J. F. Henriksen, A. Bartonova, and A. A. Mikhailov, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 18 Statistical analysis of 4 year materials exposure and acceptable deterioration and pollution levels, Swedish Corrosion Institute, Stockholm, Sweden, 1995.
- [19] D. Knotkova, K. Kreislova, and P. Boschek, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 19 Trends of corrosivity based on corrosion rates and pollution data, part 1, National Research Institute for the Protection of Materials, Prague, Czech Republic, 1995.
- [20] J. F. Henriksen, K. Arnesen, and A. Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 20 Environmental data report. September 1993 to August 1994, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1996.
- [21] J. F. Henriksen, A. Dahlback, K. Arnesen Rode, U. Elvedal, and A Rode, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 21 Environmental data report. September 1993 to August 1994, Norwegian Institute for Air Research (NILU), Lillestrøm, Norway, 1997.
- [22] D. Knotkova, K. Kreislova, P. Boschek, and J. Vlckova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 22 Corrosion attack on weathering steel, zinc and aluminium, Evaluation after 8 years of exposure, SVUOM Praha a. s., Prague, Czech Republic, 1998.
- [23] B. Stöckle, A. Krätschmer, M. Mach, and R. Snethlage, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report

- no. 23 Corrosion attack on copper and cast bronze. Evaluation after 8 years of exposure, Bavarian State Conservation Office, Münich, Germany, 1998.
- [24] R. N. Butlin, T. Yates, G. J. Ashall, and S. Massey, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 24 Evaluation of decay to stone tablets: part 3. After exposure for 8 years, Building Research Establishment (BRE), Watford, UK, 1998
- [25] J. F. Henriksen, O. Anda, A. Bartonova, K. Arnesen, and U. Elvedal, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 25 Evaluation of decay to paint systems for wood, steel and galvanized steel after 8 years of exposure, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 1998
- [26] J. Tidblad and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 26 Corrosion attack on electric contact materials. Evaluation after 8 years of exposure, Swedish Corrosion Institute, Stockholm, Sweden, 1998.
- [27] G. Woisetschläger and M. Schreiner, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 27 Evaluation of decay to glass samples after 1 and 2 years of exposure, Institute of Chemistry, Academy of Fine Arts, Vienna, Austria, 1998.
- [28] J. Tidblad, B. Dolezel, D. Persson, and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 28 Evaluation of decay to polymer samples after 4 years of exposure, Swedish Corrosion Institute, 1998.
- [29] K. Kreislova, D. Knotkova, and P. Boschek, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 29 Trends of corrosivity based on corrosion rates and pollution data. Part 2, SVUOM Praha a. s., Prague, Czech Republic, 1998
- [30] J. Tidblad, V. Kucera, and A. A. Mikhailov, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 30 Statistical analysis of 8 year materials exposure and acceptable deterioration and pollution levels, Swedish Corrosion Institute, Stockholm, Sweden, 1998.
- [31] B. Stöckle, A. Krätschmer, C. Gruber, and G. Pöhlmann, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 32 Results from the exposure of patinated and waxed bronze, Bavarian State Conservation Office, Münich, Germany, 1998.
- [32] A. Krätschmer and B. Stöckle, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 33 Results from XRD analysis of copper corrosion products, Bavarian State Conservation Office, Münich, Germany, 1998.
- [33] J. F. Henriksen and K. Arnesen, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 34 Environmental data report. September 1995 to October 1998, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2000.
- [34] D. Knotkova, K. Kreislova, P. Boschek, J. Kvapil, and G. Holubova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 35 Results from the multipollutant programme: corrosion attack on carbon steel after 1 and 2


- years of exposure (1997–1999), SVUOM Ltd., Prague, Czech Republic, 2001.
- [35] A. Leuenberger and M. Faller, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 36 Results from the multipollutant programme: corrosion attack on zinc after 1 and 2 years of exposure (1997–1999), Swiss Federal Laboratories for Materials Testing and Research (EMPA), Dübendorf, Switzerland, 2001.
- [36] B. Singer, E. Woznik, A. Krätschmer, and A. Doktor, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 37 Results from the multipollutant programme: corrosion attack on copper and bronze after 1 and 2 years of exposure (1997–1999), Bavarian State Department of Historical Monuments, Münich, Germany, 2001.
- [37] E. Garrod and T. Yates, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 38 Results from the multipollutant programme: corrosion attack on limestone after 1 and 2 years of exposure (1997–1999), Building Research Establishment Ltd. (BRE), Garston, UK, 2001.
- [38] J. F. Henriksen and O. Anda, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 39 Results from the multipollutant programme: corrosion attack on painted steel after 1 and 2 years of exposure (1997–1999), Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2000.
- [39] J. F. Henriksen and K. Arnesen, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 40 Environmental data report. November 1998 to October 1999, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2001.
- [40] J. F. Henriksen and K. Arnesen, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 41 Final environmental data report. November 1997 to October 2001, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2003
- [41] D. Knotkova, K. Kreislova, J. Kvapil, G. Holubova, and M. Bubenickova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 42 Results from the multipollutant programme: corrosion attack on carbon steel after 1, 2 and 4 years of exposure (1997–2001), SVUOM Ltd., Prague, Czech Republic, 2003.
- [42] D. Reiss, M. Faller, and O. Guseva, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 43 Results from the multipollutant programme: corrosion attack on zinc after 1, 2 and 4 years of exposure (1997–2001), Swiss Federal Laboratories for Materials Testing and Research (EMPA), Dübendorf, Switzerland, 2003.
- [43] B. Singer, A. Doktor, and E. Woznik, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 44 Results from the multipollutant programme: Corrosion attack on copper and bronze after 1, 2 and 4 years of exposure (1997–2001), Bavarian State Department of Historical Monuments, Münich, Germany, 2003.
- [44] E. Garrod and T. Yates, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 45 Results from the multipollutant programme: Corrosion attack on limestone after

- 1, 2 and 4 years of exposure (1997–2001), Building Research Establishment Ltd. (BRE), Garston, Watford, UK, 2003.
- [45] O. Anda and J. F. Henriksen, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 46 Results from the multipollutant programme: corrosion attack on painted steel after 1, 2 and 4 years of exposure (1997–2001), Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2003.
- [46] D. Knotkova, K. Kreislova, J. Kvapil, and G. Holubova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 47 Trends of corrosivity based on corrosion rates and pollution data. Part 3, SVUOM Ltd., Prague, Czech Republic, 2003
- [47] M. Melcher and M. Schreiner, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 48 Results from the multipollutant programme: Evaluation of the decay to glass samples of medieval composition after 3, 4, 5 and 6 years of exposure. Part A: results of the sheltered exposure, Institute of Sciences and Technologies in Art, Academy of Fine Arts, Vienna, Austria, 2003.
- [48] M. Melcher and M. Schreiner, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 49 Results from the multipollutant programme: evaluation of the decay to glass samples of medieval composition after 3, 4, 5 and 6 years of exposure. Part B: results of the unsheltered exposure, Institute of Sciences and Technologies in Art, Academy of Fine Arts, Vienna, Austria, 2004.
- [49] J. F. Henriksen, K. Arnesen, and M. Ferm, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 50 Environmental data report. November 2002 to December 2003, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2004.
- [50] J. Tidblad and V. Kucera, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 51 Technical manual for the trend exposure programme 2005-2006, Corrosion and Metals Research Institute (KIMAB), Stockholm, Sweden, 2006.
- [51] T. Grøntoft, K. Arnesen, and M. Ferm, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 52 Environmental data report. October 2005 to December 2006, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2007.
- [52] K. Kreislova, D. Knotkova, J. Kvapil, and H. Divisova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 53 Results from the 2005-2006 trend exposure programme. Corrosion attack of carbon steel after 1 year of exposure (2005-06), SVUOM Ltd., Prague, Czech Republic, 2007.
- [53] D. Reiss and M. Faller, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 54 Results from the 2005-2006 trend exposure programme. Corrosion attack of zinc after 1 year of exposure, Swiss Federal Laboratories for Materials Testing and Research (EMPA), Dübendorf, Switzerland, 2007.
- [54] T. Yates, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 55 Results from the 2005-2006 trend exposure programme. Corrosion attack of limestone after 1

- year of exposure, Building Research Establishment Ltd. (BRE), Garston, Watford, UK, 2007.
- [55] J. Tidblad, T. Grøntoft, K. Kreislova, M. Faller, and T. Yates, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 56 Trends in pollution and corrosion of carbon steel, zinc and limestone 1987–2006, Swerea KIMAB AB, Stockholm, Sweden, 2008.
- [56] D. de la Fuente, F. Viejo, J. M. Vega, and M. Morcillo, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 57 Case study on assessment of stock at risk and mapping areas of increased corrosion risk in Madrid, National Centre for Metallurgical Research (CENIM/CSIC), Madrid, Spain, 2008.
- [57] J. Tidblad, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 58 Technical manual for the trend exposure programme 2008-2009, Swerea KIMAB AB, Stockholm, Sweden, 2009.
- [58] T. Lombardo and A. Ionescu, "UNECE international cooperative programme on effects on materials, including historic and cultural monuments," Report no. 59 Soiling of exposed materials and dose-response functions for modern glass, Laboratoire Interuniversitaire des Systèmes Atmosphérique (LISA), Paris, France, 2009.
- [59] S. Doytchinov, A. Screpanti, and G. Leggeri, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 60 Combined stock at risk and mapping for selected urban areas of Italy. Italian national agency for new technologies, Energy and the Environment (ENEA), Rome, Italy, 2009.
- [60] J. Tidblad, T. Yates, S. Doytchinov, M. Faller, and K. Kreislova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 61 Assessment of stock of materials at risk including cultural heritage, Swerea KIMAB AB, Stockholm, Sweden, 2010.
- [61] J. Tidblad, K. Kreislova, M. Faller, T. Yates, T. Lombardo, and T. Grøntoft, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 62 Results from the 2008-2009 trend exposure programme, Swerea KIMAB AB, Stockholm, Sweden, 2010.
- [62] S. Doytchinov, A. Screpanti, and G. Leggeri, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 63 Combined stock at risk and mapping for Italy at the national level. Italian national agency for new technologies, Energy and the Environment (ENEA), Rome, Italy, 2010.
- [63] J. Tidblad, D. De la Fuente, M. Faller, and K. Kreislova, "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 64 Validation of dose-response functions for the SO2 dominating and multi-pollutant situation, Swerea KIMAB AB, Stockholm, Sweden, 2010.
- [64] J. Tidblad, M. Faller, T. Grøntoft et al., "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 65 Economic assessment of corrosion and soiling of materials including cultural heritage, Swerea KIMAB AB, Stockholm, Sweden, 2010.
- [65] J. Tidblad et al., "UNECE international co-operative programme on effects on materials, including historic and

- cultural monuments," Report no. 66 Trends in pollution, corrosion and soiling 1987–2009, Swerea KIMAB AB, Stockholm, Sweden, 2011.
- [66] T. Grøntoft et al., "UNECE international co-operative programme on effects on materials, including historic and cultural monuments," Report no. 67 Environmental data report. October 2008 to October 2009, Norwegian Institute for Air Research (NILU), Kjeller, Norway, 2011.
- [67] http://www.corr-institute.se/ICP-Materials/.
- [68] J. Sliggers and W. Kakebeeke, "Clearing the air. 25 years of the Convention on Long-range Transboundary Air Pollution," ECE/EB.AIR/84, UNECE, 2004.
- [69] http://www.unece.org/env/lrtap/.
- [70] B. Bolin, L. Granat, L. Ingelstam et al., "Air pollution across national boundaries. The impact on the environment of sulphur in air and precipitation," Swede's case study for the United Nations conference on the human environment, Norstedt & Sons, Stockholm, Sweden, 1971.
- [71] http://www.corr-institute.se/MULTI-ASSESS.
- [72] J. Watt, J. Tidblad, V. Kucera, and R. Hamilton, *The Effects of Air Pollution on Cultural Heritage*, Springer, 2009.
- [73] V. Kucera et al., Model for multi-pollutant impact and assessment of threshold levels for cultural heritage (MULTI-ASSESS) EU project EVK4-CT-2001-00044, Deliverable D3.1 Evaluation of corrosion attack from the broad field exposure programme, 2004.
- [74] J. Tidblad, K. Kreislova, D. Knotkova, and V. Kucera, "Exposure of weathering steels in the UN ECE ICP materials programme," in *Proceedings of the International Workshop on Atmospheric Corrosion and Weathering Steels*, Cartagena, Colombia, 2004.
- [75] J. Tidblad, C. Leygraf, and V. Kucera, "Acid deposition effects on materials. Evaluation of nickel and copper," *Journal of the Electrochemical Society*, vol. 138, no. 12, pp. 3592–3598, 1991.
- [76] J. Tidblad, C. Leygraf, and V. Kucera, "Acid deposition effects on materials. Evaluation of silver after 4 years of exposure," in *Proceedings of the 12th Scandinavian Corrosion Congress* (Eurocorr '92), vol. 179, Espoo, Finland, June 1992.
- [77] J. Tidblad, C. Leygraf, and V. Kucera, "Acid deposition effects on materials: evaluation of nickel after four years of exposure," *Journal of the Electrochemical Society*, vol. 140, no. 7, pp. 1912– 1916, 1993.
- [78] J. Tidblad, Atmospheric Corrosion of Ni, Cu, Ag and Sn by acidifying pollutants in sheltered environments. A combined statistical and surface analysis, Ph.D. thesis, Royal Institute of Technology, Stockholm, Sweden, 1994.
- [79] J. Tidblad, C. Leygraf, and V. Kucera, "Acid deposition effects of materials. Evaluation of electric contact materials after four years of exposure," *Atmospheric Corrosion (ASTM STP 1239)*, pp. 11–25, 1995.
- [80] G. Woisetschläger, SEM investigations of weathered potashlime-silica glass in the international co-operative programme on assessment and monitoring of air pollution effects of the economic commission for Europe within the united nations, diploma thesis, Vienna University of Technology, Vienna, Austria, 1995.
- [81] G. Woisetschläger, Weathering of medieval potash-lime-silca glass in the international co-operative programme on assessment and monitoring of air pollution effects of the economic commission for Europe within the united nations, Ph.D. thesis, Vienna University of Technology, Vienna, Austria, 1998.
- [82] M. Dutz, Untersuchungen der korrosionsvorgänge von natürlich verwitterten kalk-kali-silicatgläsern mittels elektronenstrahl (ESMA) und kernreaktionsanalyse (NRA), diploma thesis, Vienna University of Technology, Vienna, Austria, 1995.

- [83] M. Melcher, Weathering of low-durability potash-lime-silica glass, Ph.D. thesis, Vienna University of Technology, Vienna, Austria, 2005.
- [84] G. Woisetschläger, M. Dutz, S. Paul, and M. Schreiner, "Weathering phenomena on naturally weathered potash-limesilica-glass with medieval composition studied by secondary electron microscopy and energy dispersive microanalysis," *Microchimica Acta*, vol. 135, no. 3-4, pp. 121–130, 2000.
- [85] M. Melcher and M. Schreiner, "Statistical evaluation of potash-lime-silica glass weathering," *Analytical and Bioanalyt-ical Chemistry*, vol. 379, no. 4, pp. 628–639, 2004.
- [86] M. Melcher and M. Schreiner, "Evaluation procedure for leaching studies on naturally weathered potash-lime-silica glasses with medieval composition by scanning electron microscopy," *Journal of Non-Crystalline Solids*, vol. 351, no. 14-15, pp. 1210–1225, 2005.
- [87] M. Melcher, M. Schreiner, and K. Kreislova, "Artificial weathering of model glasses with medieval composition—an empirical study on the influence of particulates," *Physics and Chemistry of Glasses B*, vol. 49, no. 6, pp. 346–356, 2008.
- [88] J. Tidblad, V. Kucera, D. Persson, and B. Dolozel, "Decay of polymer materials. Preliminary dose-response functions after 4 years of exposure. Natural and artificial ageing of polymers," in *Proceedings of the 1st European Weathering Symposium*, pp. 321–339, Gesellschaft für Umweltsimulation, 2004.
- [89] http://www.rivm.nl/en/themasites/icpmm/manual-and-down-loads/.
- [90] J. Tidblad, V. Kucera, A. A. Mikhailov et al., "UN ECE ICP materials. Dose-response functions on dry and wet acid deposition effects after 8 years of exposure," Water, Air and Soil Pollution, vol. 130, no. 1–4, pp. 1457–1462, 2001.
- [91] V. Kucera, J. Tidblad, K. Kreislova et al., "UN/ECE ICP materials dose-response functions for the multi-pollutant situation," *Water, Air, and Soil Pollution*, vol. 7, no. 1–3, pp. 249–258, 2007.
- [92] F. Samie, J. Tidblad, V. Kucera, and C. Leygraf, "Atmospheric corrosion effects of HNO3. A comparison of laboratory and field exposed copper, zinc and carbon steel," *Journal of the Electrochemical Society*, vol. 154, no. 5, pp. C249–C254, 2007.
- [93] M. Ferm, F. De Santis, and C. Varotsos, "Nitric acid measurements in connection with corrosion studies," *Atmospheric Environment*, vol. 39, no. 35, pp. 6664–6672, 2005.
- [94] M. Ferm, J. Watt, S. O'Hanlon, F. De Santis, and C. Varotsos, "Deposition measurement of particulate matter in connection with corrosion studies," *Analytical and Bioanalytical Chemistry*, vol. 384, no. 6, pp. 1320–1330, 2006.
- [95] T. Lombardo, A. Ionescu, A. Chabas, R.-A. Lefèvre, P. Ausset, and Y. Candau, "Dose-response function for the soiling of silica-soda-lime glass due to dry deposition," *The Science of the Total Environment*, vol. 408, no. 4, pp. 976–984, 2010.
- [96] D. de la Fuente, J. M. Vega, F. Viejo, I. Díaz, and M. Morcillo, "City scale assessment model for air pollution effects on the cultural heritage," *Atmospheric Environment*, vol. 45, no. 6, pp. 1242–1250, 2011.
- [97] A. C. Le Gall, S. Doytchinov, R. Fischer et al., "A WGE analysis of the achievements, potential benefits and damages on health, materials and the environment of Gothenburg Protocol scenarios," in *Proceedings of the 8th International Conference on Acid Deposition (ACID RAIN '11)*, Beijing, China, June 2011.

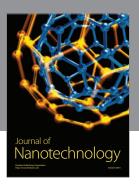















Submit your manuscripts at http://www.hindawi.com

