



AMTEC

AGRICULTURAL MACHINERY TESTING AND EVALUATION CENTER



Test Discontinuity Report

No. 2026 – 0005



**Agricultural Machinery –
Agricultural Trailer
SUPER STD-5**

Agricultural Machinery	Agricultural Trailer
Type	Semi-trailer, Mounted on Four-wheel Tractor
Brand	SUPER
Model	STD-5
Serial Number	ST-ST-2026-001
Date Issued	March 19, 2026
Test Location	Kabilang Bakood Sta. Rita, Guiguinto, Bulacan 14°51'41.915" N, 120°51'46.018" E
Items Tested	Construction, Payload Test, Traveling Speed, Noise Level
Test Requested by	SUPERTRADE MACHINERY GLOBAL INC. 937 EDSA, Philam, Quezon City, Philippines

Summary of Incident

Date of Incident	February 18, 2026
Time of Incident	05:15 p.m.
Type	Test applicant test termination due to machine breakdown
Description	The test applicant decided to terminate the ongoing bare dirt road trial of the field performance test of their agricultural trailer. During its payload test on bare dirt road, the leaf spring (the layered metal bars) has disconnected from its mounting bracket on the trailer frame (Figure 1), after 10 minutes of testing. Since the machine cannot continue its operation due to major breakdown, hence, the test was terminated.

SUMMARY

Construction Criteria	Requirement as per PAES 136:2004	AMTEC Test
Capacity, kg		
Gross Load	6252 ^a	6252 ^b
Pay Load	5000 ^a	5000 ^a
Overall width of the trailer, m, maximum	2.5	2.24
Overall length of the platform, m, maximum	6	2.93
Overall width of the platform, m	ND ^c	1.73
Distance from the foremost end of the platform to the center of the hitch point of the pullbar, m	0.9-1.4	1.39
Overall height of the trailer, m, maximum	2.2	1.84
Overall height of the platform, m, maximum ^c	1.2	0.750
Distance from the rearmost end of the platform to the center of wheel, m	0.977 ^d to 1.2	1.46
Wheel tread, mm	ND ^c	2010
Wheelbase, mm	NA	NA
Ground clearance, mm	ND ^c	330

^a As specified by the test applicant.

^b Measured payload + unladen mass as specified by the test applicant.

^c Not specified by the test applicant.

^d One-third of the platform's length.

SPECIFICATIONS

Item		Manufacturer's Specification	AMTEC Verification
1	Overall dimensions and weight		
1.1	Trailer		
1.1.1	Length, mm	ND	4760
1.1.2	Width, mm	ND	2240
1.1.3	Height, mm	ND	1840
1.1.4	Unladen mass, ton	ND	1.25 ^a
1.1.5	Payload, ton	ND	5.00
1.1.6	Gross load, ton	ND	6.25
1.2	Platform		
1.2.1	Material	ND	Undertermined metal ^b
1.2.2	Dimension, L × W × H, mm	ND	2930 × 1730 × 750
1.2.3	Ground clearance, mm	ND	330
1.2.4	Overhang (front), mm	ND	1655
1.2.5	Overhang (rear), mm	ND	1465
1.3	Pull bar		
1.3.1	Material	ND	Undertermined metal ^b
1.3.2	Length, mm	ND	2180
1.3.3	Thickness, mm	ND	115
1.4	Tires		
1.4.1	Tire specification		
1.4.1.1	Size, W × D, mm	ND	200 × 740
1.4.1.2	Ply rating	14	14 ^a
1.4.1.3	Inflation pressure, kg-f/m ²	74439.3	74439.3 ^a
1.4.2	Wheel base, mm	NA	NA
1.4.3	Wheel tread, mm	ND	2010
1.5	Tractor-trailer combination		
1.5.1	Overall length, mm	ND	9400
1.6	Safety/precautionary markings	ND	SMV emblem

^a The data were obtained for the tire markings. The test applicant did not provide complete machine specification sheet.

^b Material composition was not verified due to the unavailability of instrument on site.

Note: NA – Not Applicable (The trailer is a semi-trailer type), ND – No Data

RESULTS

Item		Data
1	Test conditions	
1.1	Location	Kabilang Bakood Sta. Rita, Guiguinto, Bulacan
1.2	Type of ground surface	Paved and bared dirt road
2	Payload test	
2.1	Paved road	
2.1.1	Load applied ^a , kg	6252
2.1.2	Traveling speed, kph	16.82
2.1.3	Braking distance, m	NA
2.1.4	Noise level, dB(A)	93.0
2.1.5	Fuel consumption of the tractor used, L/h	7.78
2.1.6	Operating time, h	3.00
2.2	Bare dirt road	
2.2.1	Load applied ^a , kg	6252
2.2.2	Traveling speed, kph	8.83
2.2.3	Noise level, dB(A)	94.2
2.1.4	Fuel consumption of the tractor used, L/h	NM ^b
2.1.5	Operating time, h	0.167
3	Parking brake test	
3.1	At 15° uphill	NA
3.2	At 15° downhill	NA
4	Other observations	None

^a Equal to 125% of the declared trailer's payload

^b The performance test is discontinued due to machine breakdown.

Note: NM – Not Measured, NA – Not Applicable (Parking brake test was not conducted).

OBSERVATIONS



Figure 1. Machine breakdown of SUPER STD-5 Agricultural Trailer during the performance test on bare dirt road.

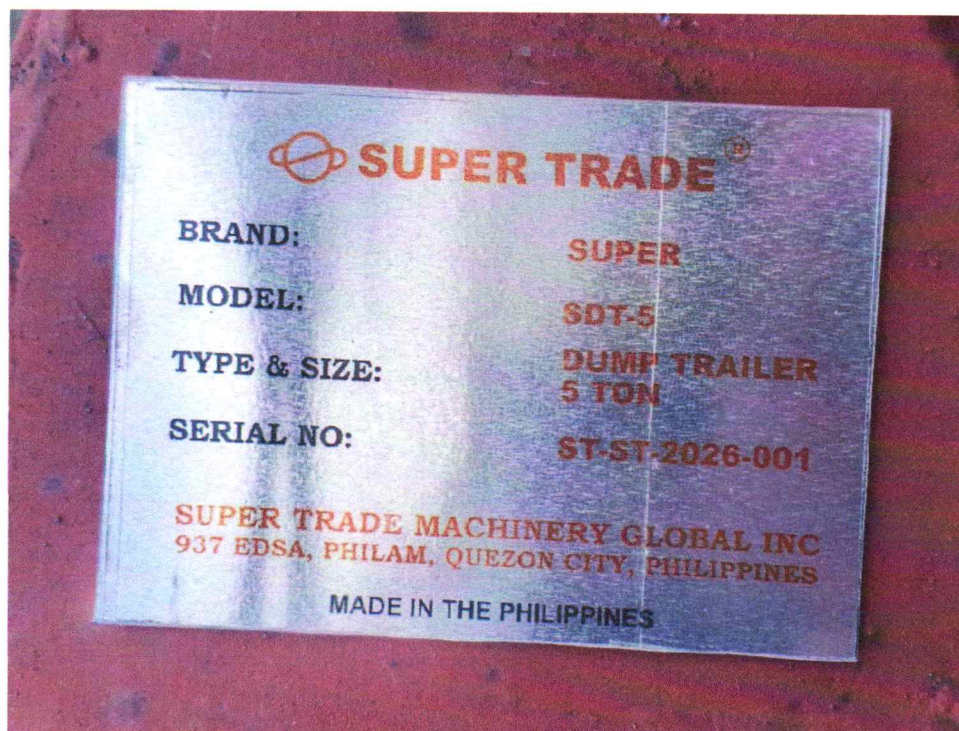
OBSERVATIONS (Cont'n)

Figure 2. Nameplate of the SUPER SDT-5.




Figure 3. Nameplate of the tractor used.

Tested by:


MONALIZA C. MONFERO

Test Engineer

Noted by:

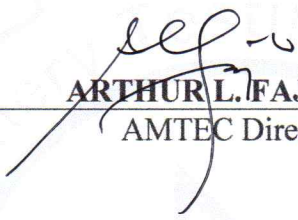
ARTHUR L. FAJARDO

AMTEC Director