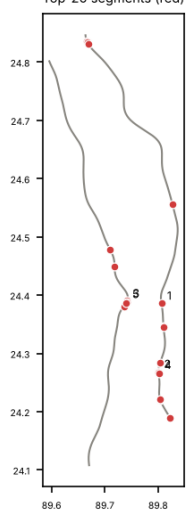


NadiNet weekly risk brief — Jamuna, Kazipur to Chauhali reach

Issued after the Sentinel-1 pass of **2023-09-22**. Horizon: next 28 days. Risk = calibrated probability that a 200 m bank segment loses at least 40 m of land.

Advisory decision support. The absence of an alert does not mean a bank is safe. Public warnings are issued under an official's authority.

#	Segment	Bank	Lat, Lon	Risk	Latest pass	Why (model reas	Top-20 segments (red) 
1	E-57500	East bank	24.3859, 89.8064	30%	+80 m	latest pass shows an outer bend / in	
2	E-70700	East bank	24.2688, 89.8009	25%	+30 m	Bank sits on an oi m in the last 4 we (unconfirmed)	
3	W-54100	West bank	24.3903, 89.7418	18%	+0 m	Little recent retre Bank sits on an oi	
4	E-70900	East bank	24.2670, 89.8010	18%	+30 m	Bank retreated 60 further 30 m (unc recess	
5	W-54300	West bank	24.3886, 89.7410	18%	+0 m	Bank retreated 10 outer bend / in a r	
6	E-01300	East bank	24.8356, 89.6664	18%	+20 m	Bank sits on an oi m in the last 12 w (unconfirmed)	
7	W-55300	West bank	24.3810, 89.7357	18%	+20 m	latest pass shows an outer bend / in	
8	E-68900	East bank	24.2847, 89.8037	18%	+40 m	River is falling aft 40 m (unconfirmed)	
9	W-54500	West bank	24.3870, 89.7401	11%	-140 m	Bank retreated 65 m in the last 12 weeks; Bank sits on an outer bend / in a recess	
10	E-76100	East bank	24.2204, 89.8041	11%	–	Bank sits on an outer bend / in a recess; River is falling after high water	
11	E-80100	East bank	24.1887, 89.8229	11%	+380 m	Bank retreated 10 m in the last 12 weeks; latest pass shows a further 380 m (unconfirmed); River is falling after high water	
12	E-75900	East bank	24.2221, 89.8035	11%	–	Bank sits on an outer bend / in a recess; Bank height about 0.7 m above the river (DEM)	
13	E-61900	East bank	24.3464, 89.8101	11%	+10 m	Lost 150 m of bank over the past year; Neighbouring segments retreated 155 m on average in 12 weeks	
14	E-71100	East bank	24.2652, 89.8012	10%	+20 m	Bank sits on an outer bend / in a recess; Bank retreated 70 m in the last 4 weeks; latest pass shows a further 20 m (unconfirmed)	
15	E-01500	East bank	24.8339, 89.6672	10%	+0 m	Bank sits on an outer bend / in a recess; Bank height about -0.2 m above the river (DEM)	
16	E-38100	East bank	24.5556, 89.8272	10%	+20 m	Bank retreated 40 m in the last 4 weeks; latest pass shows a further 20 m (unconfirmed); A 616 m-wide channel runs along the bank	
17	W-43500	West bank	24.4782, 89.7100	10%	+70 m	latest pass shows a further 70 m (unconfirmed); Bank sits on an outer bend / in a recess	
18	E-62100	East bank	24.3446, 89.8103	10%	+10 m	Lost 130 m of bank over the past year; A 620 m-wide channel runs along the bank	
19	W-46900	West bank	24.4489, 89.7184	10%	-370 m	Past-year history raises risk; Bank sits on an outer bend / in a recess	
20	E-01900	East bank	24.8307, 89.6691	9%	-30 m	Bank sits on an outer bend / in a recess; Bank height about -1.9 m above the river (DEM)	

Measured on 2023–2025 hindcasts: on average 42% of the top 20 segments lost at least the threshold within 28 days, versus 4% for 'it eroded recently' (persistence); difference +38.2% (95% CI +30.6% to +46.7%).

Tiers: **Watch** = in this top-20 list. **Warning** = high risk plus retreat on the latest pass; it reaches households only after an official approves it on the dashboard. Raw risk maps stay with officials and partners; public views are aggregated to union level.

Data: Copernicus Sentinel-1 GRD (ESA), descending track 150, ~05:56 local time; banks traced on 10 m water masks. Reasons describe what the model used, not proven causes. Segments not seen on the latest pass carry no forecast.