


NadiNet weekly risk brief — Jamuna, Kazipur to Chauhali reach

Issued after the Sentinel-1 pass of **2023-10-16**. Horizon: next 28 days. Risk = calibrated probability that a 200 m bank segment loses at least 40 m of land.

Advisory decision support. The absence of an alert does not mean a bank is safe. Public warnings are issued under an official's authority.

#	Segment	Bank	Lat, Lon	Risk	Latest pass	Why (model reason)
1	W-53300	West bank	24.3973, 89.7431	38%	+2380 m	latest pass shows on an outer bend
2	W-46900	West bank	24.4489, 89.7184	38%	+300 m	River stage is typical of high-erosion periods; River stage is typical of high-erosion periods
3	W-54700	West bank	24.3855, 89.7391	38%	+0 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
4	W-48900	West bank	24.4312, 89.7213	30%	-460 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
5	E-01900	East bank	24.8307, 89.6691	30%	-30 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
6	E-12500	East bank	24.7555, 89.7326	30%	+790 m	latest pass shows a further 790 m (unconfirmed); River stage is typical of high-erosion periods
7	E-12700	East bank	24.7537, 89.7333	30%	+710 m	latest pass shows a further 710 m (unconfirmed); River stage is typical of high-erosion periods
8	W-48700	West bank	24.4329, 89.7207	29%	-390 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
9	E-12300	East bank	24.7572, 89.7320	29%	+790 m	latest pass shows a further 790 m (unconfirmed); River stage is typical of high-erosion periods
10	W-53900	West bank	24.3920, 89.7425	29%	+0 m	Bank sits on an outer bend / in a recess; River stage is typical of high-erosion periods
11	W-54500	West bank	24.3870, 89.7401	29%	+0 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
12	E-12100	East bank	24.7588, 89.7312	29%	+870 m	latest pass shows a further 870 m (unconfirmed); River stage is typical of high-erosion periods
13	W-48500	West bank	24.4346, 89.7201	25%	-360 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
14	E-02100	East bank	24.8292, 89.6701	25%	+0 m	River stage is typical of high-erosion periods; Bank sits on an outer bend / in a recess
15	E-22100	East bank	24.6839, 89.7731	25%	+60 m	latest pass shows a further 60 m (unconfirmed); River stage is typical of high-erosion periods
16	W-54900	West bank	24.3840, 89.7380	18%	+10 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
17	W-48300	West bank	24.4364, 89.7196	18%	-380 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
18	W-55300	West bank	24.3810, 89.7357	18%	+20 m	latest pass shows a further 20 m (unconfirmed); Bank sits on an outer bend / in a recess
19	W-47900	West bank	24.4399, 89.7190	18%	-420 m	River stage is typical of high-erosion periods; Past-year history raises risk
20	E-11900	East bank	24.7605, 89.7304	18%	+940 m	latest pass shows a further 940 m (unconfirmed); Bank sits on an outer bend / in a recess

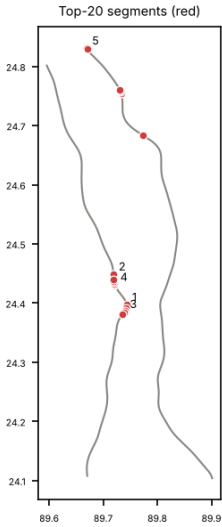

Measured on 2023–2025 hindcasts: on average 42% of the top 20 segments lost at least the threshold within 28 days, versus 4% for 'it eroded recently' (persistence); difference +38.2% (95% CI +30.6% to +46.7%).

Tiers: **Watch** = in this top-20 list. **Warning** = high risk plus retreat on the latest pass; it reaches households only after an official approves it on the dashboard. Raw risk maps stay with officials and partners; public views are aggregated to union level.

Data: Copernicus Sentinel-1 GRD (ESA), descending track 150, ~05:56 local time; banks traced on 10 m water masks. Reasons describe what the model used, not proven causes. Segments not seen on the latest pass carry no forecast.