


NadiNet weekly risk brief — Jamuna, Kazipur to Chauhali reach

Issued after the Sentinel-1 pass of **2024-12-09**. Horizon: next 28 days. Risk = calibrated probability that a 200 m bank segment loses at least 40 m of land.

Advisory decision support. The absence of an alert does not mean a bank is safe. Public warnings are issued under an official's authority.

#	Segment	Bank	Lat, Lon	Risk	Latest pass	Why (model reason)
1	E-64300	East bank	24.3249, 89.8128	29%	+110 m	latest pass shows is typical of high-erosion periods
2	W-43300	West bank	24.4798, 89.7091	25%	+150 m	latest pass shows is typical of high-erosion periods
3	E-72300	East bank	24.2544, 89.8024	25%	+170 m	Bank retreated 50 m in the last 4 weeks; latest pass shows a further 170 m (unconfirmed); River stage is typical of high-erosion periods
4	W-51900	West bank	24.4087, 89.7376	18%	+470 m	latest pass shows is typical of high-erosion periods
5	E-68700	East bank	24.2864, 89.8044	18%	+90 m	latest pass shows is typical of high-erosion periods
6	E-21100	East bank	24.6888, 89.7648	18%	—	Bank sits on an outer bend / in a recess; River stage is typical of high-erosion periods
7	W-78700	West bank	24.1764, 89.6909	18%	+50 m	latest pass shows is typical of high-erosion periods
8	E-72500	East bank	24.2526, 89.8026	18%	—	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
9	E-59700	East bank	24.3662, 89.8089	18%	+40 m	latest pass shows is typical of high-erosion periods
10	E-54100	East bank	24.4157, 89.8110	18%	+50 m	latest pass shows a further 50 m (unconfirmed); River stage is typical of high-erosion periods
11	E-71700	East bank	24.2598, 89.8018	11%	+130 m	Bank retreated 60 m in the last 4 weeks; latest pass shows a further 130 m (unconfirmed); Bank height about -0.9 m above the river (DEM)
12	W-43500	West bank	24.4782, 89.7100	11%	+10 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
13	E-46700	East bank	24.4793, 89.8327	11%	+20 m	River stage is typical of high-erosion periods; latest pass shows a further 20 m (unconfirmed)
14	W-83100	West bank	24.1401, 89.6734	11%	+30 m	latest pass shows a further 30 m (unconfirmed); Bank sits on an outer bend / in a recess
15	E-73300	East bank	24.2454, 89.8026	11%	+40 m	Bank retreated 20 m in the last 4 weeks; latest pass shows a further 40 m (unconfirmed); River stage is typical of high-erosion periods
16	E-72100	East bank	24.2562, 89.8023	11%	+30 m	Bank retreated 70 m in the last 4 weeks; latest pass shows a further 30 m (unconfirmed); Nearby segments are active
17	W-56100	West bank	24.3751, 89.7313	11%	+0 m	Bank sits on an outer bend / in a recess; River stage is typical of high-erosion periods
18	E-71500	East bank	24.2616, 89.8016	11%	+90 m	Bank retreated 20 m in the last 4 weeks; latest pass shows a further 90 m (unconfirmed); River stage is typical of high-erosion periods
19	W-56300	West bank	24.3735, 89.7303	11%	+0 m	Bank sits on an outer bend / in a recess; River stage is typical of high-erosion periods
20	E-34700	East bank	24.5852, 89.8182	11%	+10 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk

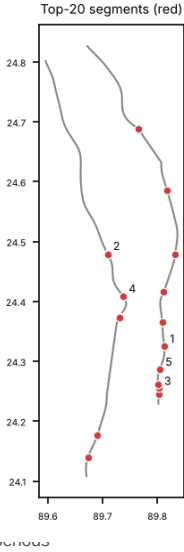

Measured on 2023–2025 hindcasts: on average 42% of the top 20 segments lost at least the threshold within 28 days, versus 4% for 'it eroded recently' (persistence); difference +38.2% (95% CI +30.6% to +46.7%).

Tiers: **Watch** = in this top-20 list. **Warning** = high risk plus retreat on the latest pass; it reaches households only after an official approves it on the dashboard. Raw risk maps stay with officials and partners; public views are aggregated to union level.

Data: Copernicus Sentinel-1 GRD (ESA), descending track 150, ~05:56 local time; banks traced on 10 m water masks. Reasons describe what the model used, not proven causes. Segments not seen on the latest pass carry no forecast.