


NadiNet weekly risk brief — Jamuna, Kazipur to Chauhali reach

Issued after the Sentinel-1 pass of **2025-10-29**. Horizon: next 28 days. Risk = calibrated probability that a 200 m bank segment loses at least 40 m of land.

Advisory decision support. The absence of an alert does not mean a bank is safe. Public warnings are issued under an official's authority.

#	Segment	Bank	Lat, Lon	Risk	Latest pass	Why (model reason)
1	W-49100	West bank	24.4295, 89.7221	30%	+1410 m	latest pass shows stage is typical of
2	W-51300	West bank	24.4131, 89.7341	29%	+670 m	River stage is typical shows a further 6
3	E-20300	East bank	24.6929, 89.7583	29%	+20 m	River stage is typical outer bend / in a r
4	E-55500	East bank	24.4038, 89.8063	25%	-20 m	River stage is typical outer bend / in a r
5	W-48300	West bank	24.4364, 89.7196	18%	+1430 m	latest pass shows stage is typical of
6	E-56500	East bank	24.3949, 89.8053	18%	+20 m	River stage is typical history raises risk
7	W-54300	West bank	24.3886, 89.7410	18%	-10 m	River stage is typical outer bend / in a r
8	W-53100	West bank	24.3991, 89.7428	18%	+0 m	Bank sits on an outer bend typical of high-erosion
9	E-56300	East bank	24.3967, 89.8053	18%	-20 m	River stage is typical outer bend / in a recess
10	E-20100	East bank	24.6939, 89.7567	18%	+10 m	River stage is typical of high-erosion periods; Bank sits on an outer bend / in a recess
11	W-52500	West bank	24.4042, 89.7408	18%	+30 m	Bank sits on an outer bend / in a recess; latest pass shows a further 30 m (unconfirmed)
12	W-49700	West bank	24.4247, 89.7248	18%	+660 m	latest pass shows a further 660 m (unconfirmed); River stage is typical of high-erosion periods
13	E-51700	East bank	24.4359, 89.8194	18%	+130 m	latest pass shows a further 130 m (unconfirmed); River stage is typical of high-erosion periods
14	E-51100	East bank	24.4411, 89.8212	18%	+80 m	latest pass shows a further 80 m (unconfirmed); River stage is typical of high-erosion periods
15	W-54100	West bank	24.3903, 89.7418	18%	+0 m	River stage is typical of high-erosion periods; Little recent retreat, but the recent pattern still raises risk
16	E-55700	East bank	24.4021, 89.8059	18%	-40 m	River stage is typical of high-erosion periods; Bank sits on an outer bend / in a recess
17	W-48900	West bank	24.4312, 89.7213	18%	+1400 m	Bank sits on an outer bend / in a recess; River stage is typical of high-erosion periods
18	W-29100	West bank	24.5985, 89.6603	18%	+150 m	latest pass shows a further 150 m (unconfirmed); River stage is typical of high-erosion periods
19	E-64700	East bank	24.3213, 89.8130	18%	-40 m	River stage is typical of high-erosion periods; Bank height about -2.9 m above the river (DEM)
20	E-68100	East bank	24.2915, 89.8065	18%	+100 m	latest pass shows a further 100 m (unconfirmed); River stage is typical of high-erosion periods

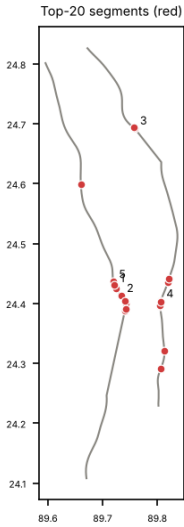

Measured on 2023–2025 hindcasts: on average 42% of the top 20 segments lost at least the threshold within 28 days, versus 4% for 'it eroded recently' (persistence); difference +38.2% (95% CI +30.6% to +46.7%).

Tiers: **Watch** = in this top-20 list. **Warning** = high risk plus retreat on the latest pass; it reaches households only after an official approves it on the dashboard. Raw risk maps stay with officials and partners; public views are aggregated to union level.

Data: Copernicus Sentinel-1 GRD (ESA), descending track 150, ~05:56 local time; banks traced on 10 m water masks. Reasons describe what the model used, not proven causes. Segments not seen on the latest pass carry no forecast.