



AGGARWAL KAMIKAZES

CUTTING & CORING LTD · GPR SCAN REPORT

123 Industrial Way, Burnaby BC V5A 1A1 · (604) 555-0199 · scans@aggarwalkamikazes.ca

PROJECT
AKCC-2026-0017

OPERATOR
D. Cunningham

DATE
2026-05-28

**BOTTOM
LINE**

2 of 3 cores cleared. Core B caution (relocate 75 mm S); Core C is a **no-go** over live conduit.

PROJECT INFORMATION

Site	1450 Industrial Way, Burnaby BC	Equipment	GSSI StructureScan Mini XT
Client	Pinnacle Structural Eng.	Slab type	200 mm two-way, post-tensioned
Structure	Level-2 parkade suspended deck	Operator	D. Cunningham
Scan date	2026-05-28	Project no.	AKCC-2026-0017

SCAN SUMMARY

Ground-penetrating radar survey performed on the level-2 suspended deck to locate embedded reinforcement, post-tension cables and electrical conduit prior to core drilling at three proposed locations. Top-mat rebar identified at **~45 mm cover** on **200 mm centres**; a single post-tension tendon crosses Grid B on a diagonal; an electrical conduit run was detected beneath Grid C. Cores were assessed against a **50 mm minimum standoff** to any marked target.

CORE CLEARANCE FINDINGS

CORE	SIZE	VERDICT	CLEARANCE & RECOMMENDATION
A	4"	SAFE	60 mm clear of all targets. Cleared to drill as marked.
B	6"	CAUTION	PT tendon within 25 mm — relocate 75 mm south and re-scan before drilling.
C	4"	NO-GO	Directly over conduit run. Do not drill ; redesign required.

SCAN LOCATION — GRID A (CORE A)

Grid A · Bay 1 mid-span

0.9 m × 0.9 m · depth scale 0-200 mm

0

100

200



■ Rebar — top mat, ~45 mm

■ Post-tension tendon

■ Conduit / no-scan zone

SAFE

Observation. Clear cone at the proposed core centre — no targets within 60 mm in any direction. Top mat consistent at ~45 mm cover. Safe to drill as marked.

SCAN LOCATION — GRID B (CORE B)


Grid B · Bay 2 column line

0.9 m × 0.9 m · depth scale 0-200 mm

0

100

200

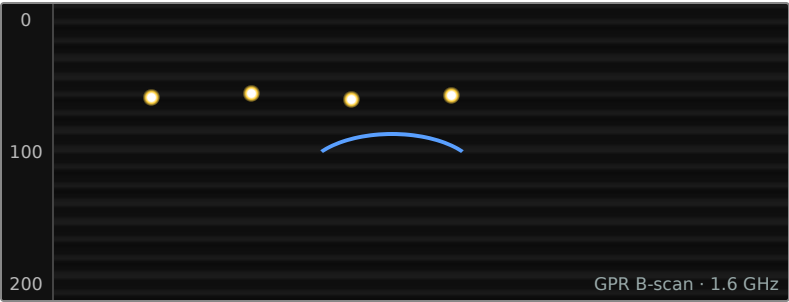

■ Rebar — top mat, ~45 mm

■ Post-tension tendon

■ Conduit / no-scan zone

CAUTION

Observation. Post-tension tendon crosses on a diagonal within 25 mm of the proposed centre. Relocate the core 75 mm south, clear of the tendon envelope, and re-scan before drilling.

SCAN LOCATION — GRID C (CORE C)


Grid C · Bay 2 wall line

0.9 m × 0.9 m · depth scale 0-200 mm

0

100

200

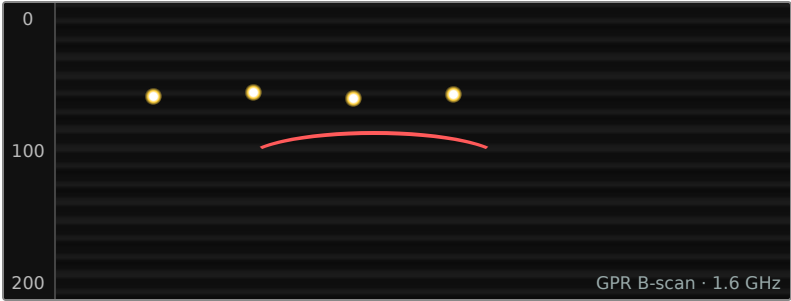

■ Rebar — top mat, ~45 mm

■ Post-tension tendon

■ Conduit / no-scan zone

NO-GO

Observation. Energised electrical conduit detected directly beneath the proposed centre at ~110 mm. No-go — do not drill at this location; refer back to the EOR for a redesigned core position.

METHODOLOGY & STANDARD NOTES

- 1. Survey performed with a GSSI StructureScan Mini XT (1.6 GHz) on orthogonal 50 mm line spacing.
- 2. Depths are estimates based on an assumed dielectric for cured concrete and are **±15%**.
- 3. Targets marked on the slab supersede this report where any discrepancy exists.
- 4. Clearances reference the marked grid origin; verify on site before cutting.

Limitations. GPR results are interpretive and depend on moisture, cover and congestion. Non-metallic and deeply embedded targets may not be detected. Aggarwal Kamikazes Cutting & Coring Ltd. accepts no liability for drilling outside the cleared zones described above. Report valid for the slab, locations and date stated.

SCANNED BY D. Cunningham · GPR Technician	DATE 2026-05-28
REVIEWED BY	PROJECT NO. AKCC-2026-0017