Highland / drawing reconciliation 04

13 candidates placed provisionally; 1 false repeat rejected; 2 footprint conflicts remain. The editable model now contains 189 opening records.

The three uploaded PDFs supply 19 sheets: site/floor/roof plans, exterior elevations/building sections, stair/core sheets and a lobby RCP. Printed date: 04-02-07. Handwritten ASI/RFI references do not include complete response records.



Native Cycles daylight image. This is an illustrative exterior study; measured jamb positions are provisional, complete components and context remain assumed. Not for construction or quantities.

Source PDF	Sheets
Site and floor plans	A1.01, A2.01-A2.08
Stairs and RCP	A6.01-A6.04, A7.51
Exterior elevations and sections	A3.01, A3.02, A3.11-A3.13

Complete PDFs are included in the editable archive. Exact file hashes and page mapping: source-inventory.json. The prior revision 03 movie is a separate earlier output.

Disposition of the 16 candidates

Accepted means visible in the elevation and placed provisionally using the plan. It does not confirm a scheduled size, installed location, sill/head or complete frame section.

ID	Floor / face	Disposition	Model opening
OPEN-01	P1 / south	Footprint conflict	Not added
OPEN-02	R1 / south	Provisional placement	south-R1-02
OPEN-03	R2 / south	Provisional placement	south-R2-02
OPEN-04	R2 / north	Provisional placement	north-R2-01
OPEN-05	R2 / north	Provisional placement	north-R2-06
OPEN-06	R3 / south	Provisional placement	south-R3-02
OPEN-07	R3 / north	Provisional placement	north-R3-01
OPEN-08	R3 / north	Provisional placement	north-R3-06
OPEN-09	R4 / south	Provisional placement	south-R4-02
OPEN-10	R4 / north	Provisional placement	north-R4-01
OPEN-11	R4 / north	Provisional placement	north-R4-06
OPEN-12	R5 / south	Provisional placement	south-R5-01
OPEN-13	R5 / south	Provisional placement	south-R5-02
OPEN-14	R5 / south	Footprint conflict	Not added
OPEN-15	R5 / north	Provisional placement	north-R5-06
OPEN-16	R5 / north	False R5 repeat	Not added


OPEN-01 / P1: A2.02 shows a different stepped residential enclosure from the inherited R1-based lower shell. Reconcile the complete P1 polygon and related openings together.


OPEN-14 / southeast R5: the plan jamb crosses the inherited return. Reconcile the local step, east elevation, slab and roof/coping above; clipping the window would conceal the conflict.

OPEN-16 / R5 north: no window appears at the repeated lower-floor MZ position. The actual R5 row has two MK windows farther east.

North rows / explicit residual differences

R2-R5 now contain six north openings per floor. Blue outlines below project the plan-governed model specification onto A3.02. The maximum horizontal center difference is 42.443 pixels on the inherited 1815-pixel overview raster. This is a diagnostic comparison, not an accuracy pass.

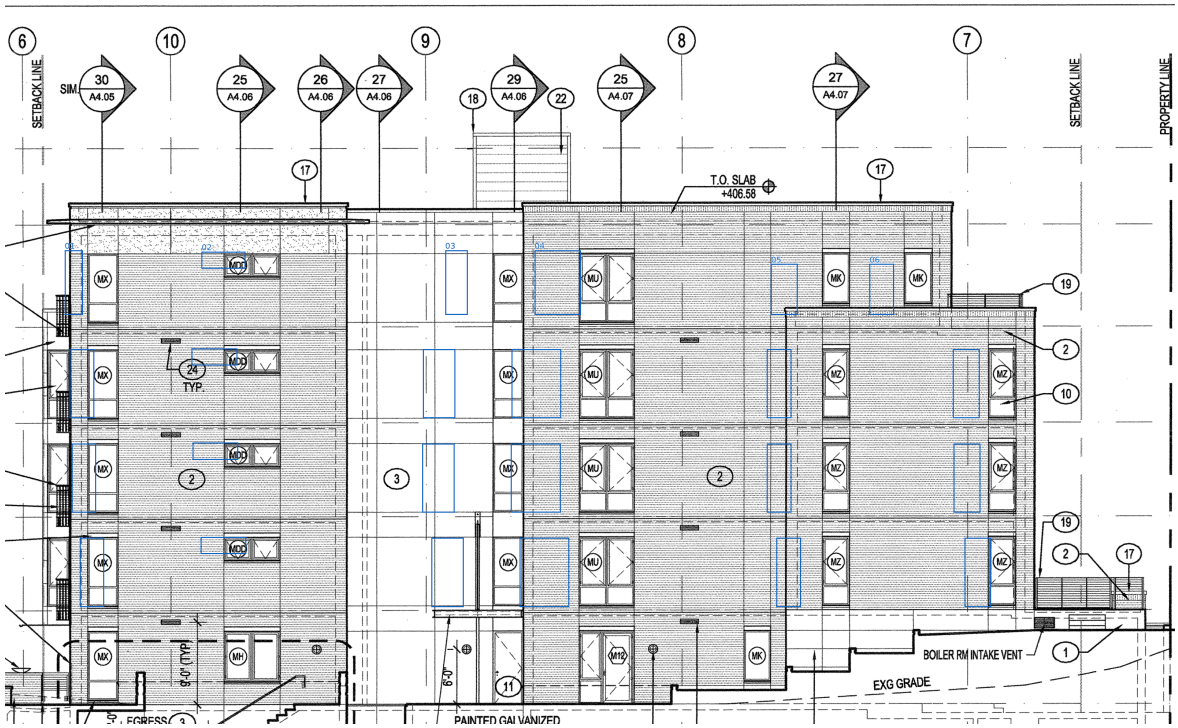

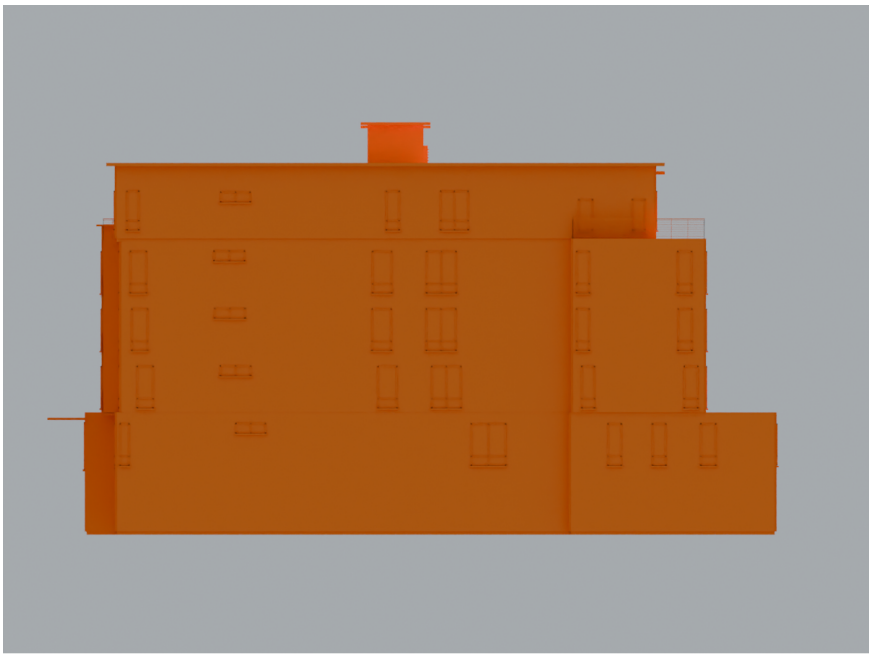


Revision 04 / north | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

The stair/MU pair still disagrees with the elevation projection. Simplified wall depth, plan/elevation registration and raster picks all affect this comparison. Keep the plan placements provisional pending detail/RFI/field reconciliation. The lower R1 north door/entry pattern remains outside this patch. Orange denotes assumed complete components.


South returns and retained footprint conflicts


R1-R4 column 02 is restored on its stepped return. Existing columns 03/04 move to the next two returns, and the unsupported column-03 recess/guard is removed. The restored openings no longer overlap inherited misplaced openings. Two R5 return windows are also added.

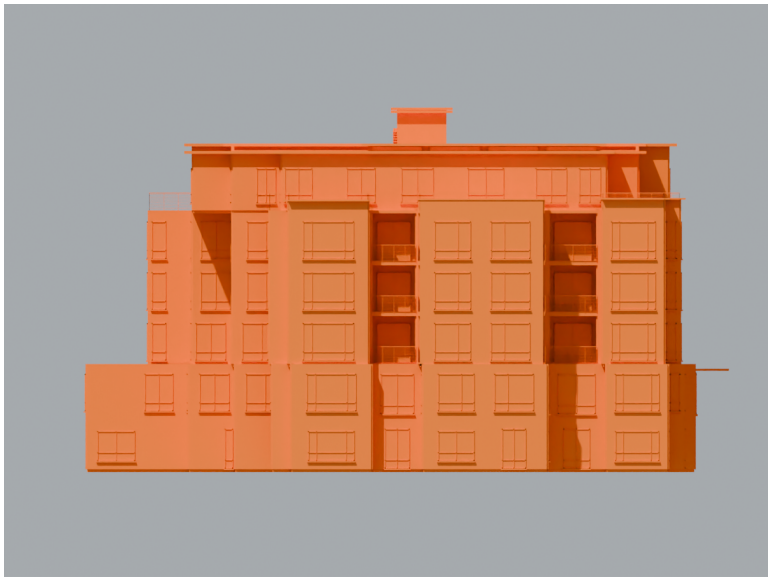

Revision 04 / south | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

The two remaining footprint conflicts have direct source evidence:

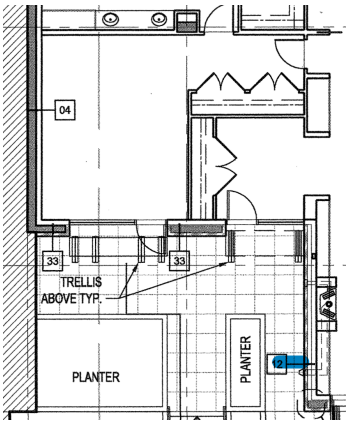

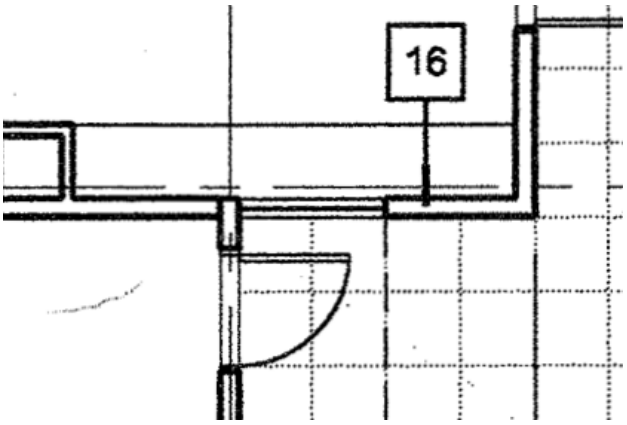

OPEN-01 / P1	OPEN-14 / southeast R5
A2.02 / trace the lower enclosure before adding its residential door.	A2.07 / reconcile the short return and the facade/roof geometry it supports.

Annotated plan jamb picks for all corrected floors are included under source-review/. Exact opening changes and retained IDs are recorded in change-ledger.json.

Verification and continuation

The saved native file passes the local geometry and portability checks. Four native provenance views and the source picks were inspected. The separate visual-review record binds the final images and report to exact hashes.

Check	Result
Opening records / remaining footprint conflicts	189 / 2
Architecture meshes / identical to revision 03	998 / 863
Corrected wall void overlaps	0
Footprint, six floor/grid controls and roof/terrace geometry	Unchanged
Native scenes / saved dusk camera	Daylight + Dusk / 432 frames checked
Packed images / GLB architecture	No external dependencies / all architecture exported
Existing render-workflow regression tests	11 passed locally

Each plan sheet was calibrated independently from its 16 ft 3 in, 27 ft 9 in, 27 ft 9 in and 31 ft 3 in grid spans. Source picks are provisional; floating-point readback precision is not drawing accuracy.

Floor	Own grid picks (0.6 raster)
R1	865.272, 952.968, 1104.384, 1254.072, 1422.768
R2	868.296, 957.288, 1107.840, 1258.608, 1427.736
R3	863.328, 951.456, 1103.304, 1252.992, 1422.336
R4	864.192, 951.024, 1103.520, 1253.424, 1421.472
R5	878.016, 965.928, 1117.344, 1266.600, 1435.080

Terrace and guard limits

Terrace-band heights remain provisional. The supplied A2.08 confirms the inherited top-elevation callouts but does not provide the referenced A4/A5 cornice, coping or exterior guard sections. A6 stair guards do not establish terrace guards. Finish products, context and landscape remain assumed.

Next work: reconcile the P1 enclosure and southeast R5 step from the now-available plans; audit R1 north entries; investigate the north projection differences. The window schedule, A4/A5 details, complete RFI responses and field verification are needed before dimensions or profiles can be confirmed.