Highland / drawing reconciliation 06

R5 enclosure, terrace arrangement and refreshed exterior studies

Completed in order: the remaining R5 enclosure and non-north openings; terrace edges, coping and guards; then whole-building review and fresh native day/dusk images. North stair/MU alignment and R1 north entries remain deferred at the owner's request.

Native Cycles daylight image. Plan XY is provisional; complete profiles, guards, sill/head dimensions and site context remain assumed. This is an illustrative coordination model, not a verified as-built or construction model.

Review	Result
Opening inventory	192; 15 original candidates provisionally placed, 1 false repeat rejected
R5 enclosure	14 vertices; 28 south/east/west openings rechecked; north preserved
Terraces	5 walking surfaces + gravel planter; 5 guard paths; 3 band paths
Source set	3 original PDFs / 19 sheets, preserved with exact hashes

Printed drawing date: 04-02-07. Complete ASI/RFI responses, window schedules and the referenced A4/A5 profiles were not supplied.

1 / R5 enclosure and openings

A2.07 separates the west terraces from enclosed rooms. The southwest steps now follow those room boundaries rather than enclosing the terraces. The long east line and south baseline follow the selected plan picks; both prior local tie-in residuals are zero against those picks. This does not establish source accuracy or resolve plan/elevation disagreements.

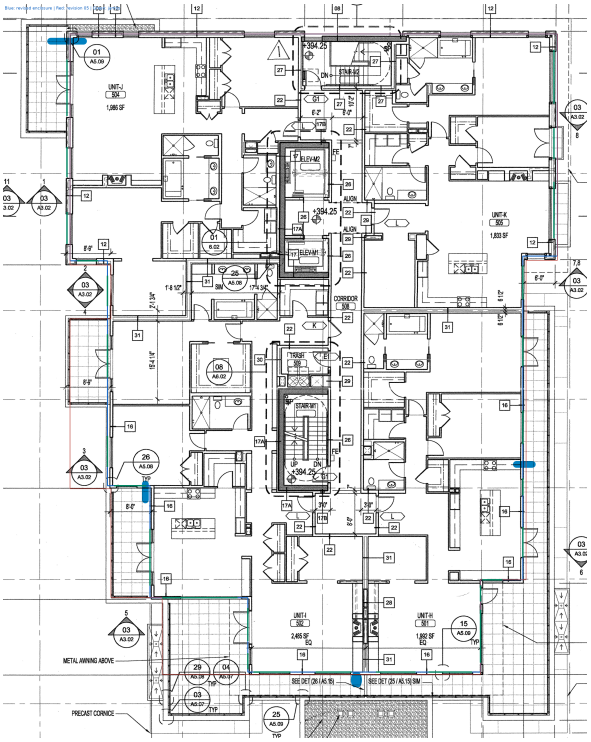

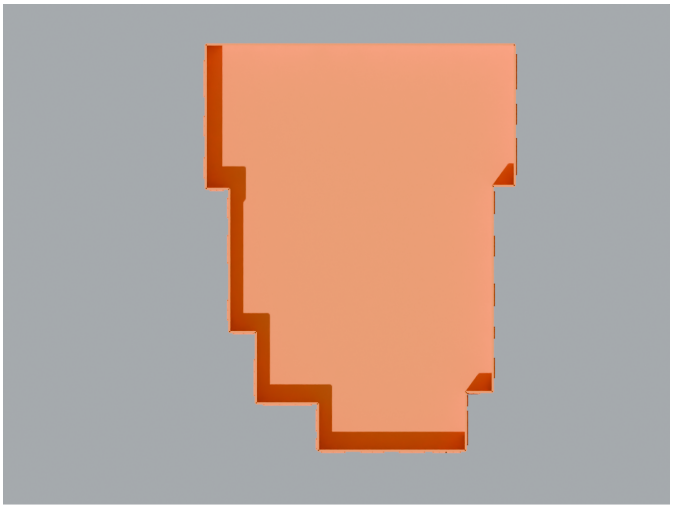

Left: calibrated plan and revised trace. Right: saved native R5 enclosure and openings only. Orange means complete components remain assumed; measured plan positions are provisional.

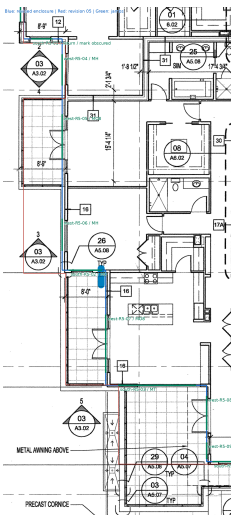

All 28 non-north R5 openings were assigned to their actual stepped wall segments, with full jamb spans. The southwest MT is a wide opening on the terrace return. The final south pair is MO/MJ: MJ corrects the prior MU transcription. Its contiguous records share one interface, removing the invented masonry gap; complete pane profiles remain assumed.

The six north R5 openings and north-facing wall are unchanged. Upper east/west lines tie into the preserved north endpoints; the retained source registration differences are listed on page 4.

2 / Terrace, guard and coping arrangement

The old broad terrace surface is replaced by five walking terraces and a separate south gravel planter. Exposed edges receive five open guard paths; room walls and glazing receive none. The east MR-window projection labeled as a cornice line above is not treated as another occupied terrace.

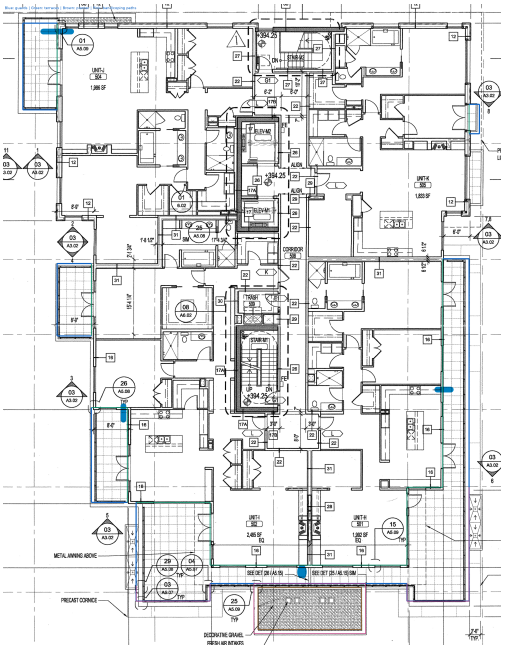

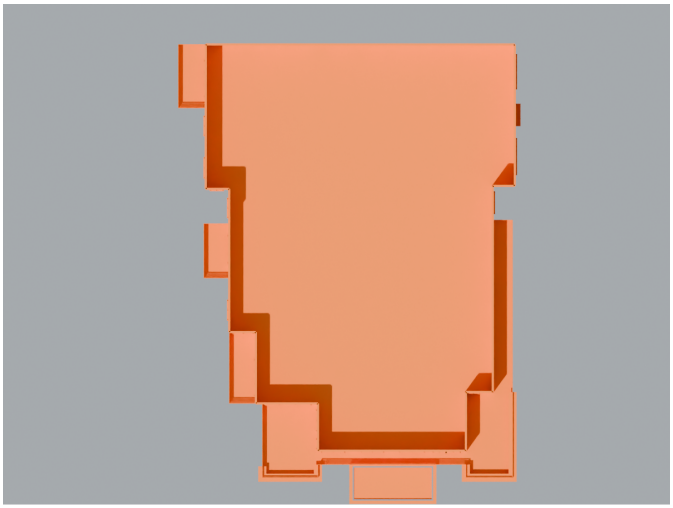

Revision 06 / terrace-plan | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

Source arrangement (left) and native terrace/enclosure plan (right). The south walking strip, gravel planter and projecting southwest/southeast bands are distinct. The middle-west and lower-west terraces now remain outside the room shell.

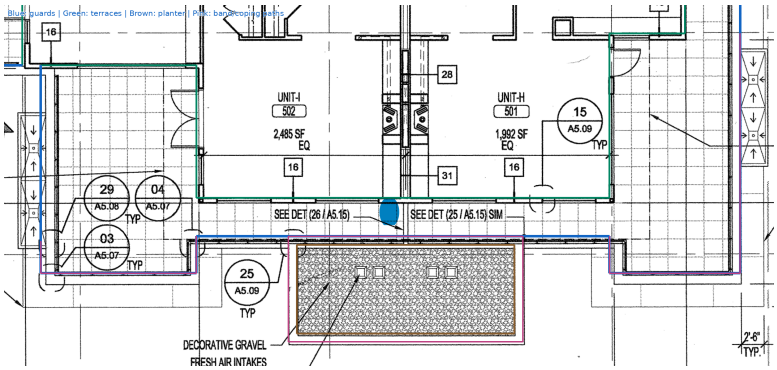

Component	Source / remaining assumption
Three band paths	26 / 28 / 30 in source-scaled top heights retained provisionally; complete profiles and construction assumed
Exterior guards	Arrangement provisional; representative 42 in height, posts, infill, connections and compliance unverified
South clerestory	Footprint re-registered to A2.08; 407.75 ft complete top retained; four glazing fields and cap sections assumed

The split roof plates, step closure and perimeter coping follow the corrected enclosure. North and south complete coping tops remain 407.75 ft and 406.25 ft. A6 stair guard details do not establish exterior terrace guard sections. Drainage, waterproofing and thresholds remain undeveloped.

Source differences / north deferred

Plan jambs govern provisional XY. Independent elevation projections retain the following diagnostic center differences; geometry has not been averaged between conflicting sources. These are overview-raster pixels, not a construction tolerance or an independent rendered-edge accuracy certificate.

Diagnostic	Maximum absolute center difference
R5 south	33.859 px
R5 east	14.744 px
R5 west	14.913 px
North R2-R5	42.443 px; unchanged and deferred

The preserved north tie-in differs from the selected A2.07 registration by +7.062 in at west X, +8.394 in at east X and -6.321 in at north Y. J-west and K-east-door terraces follow those same preserved wall endpoints.

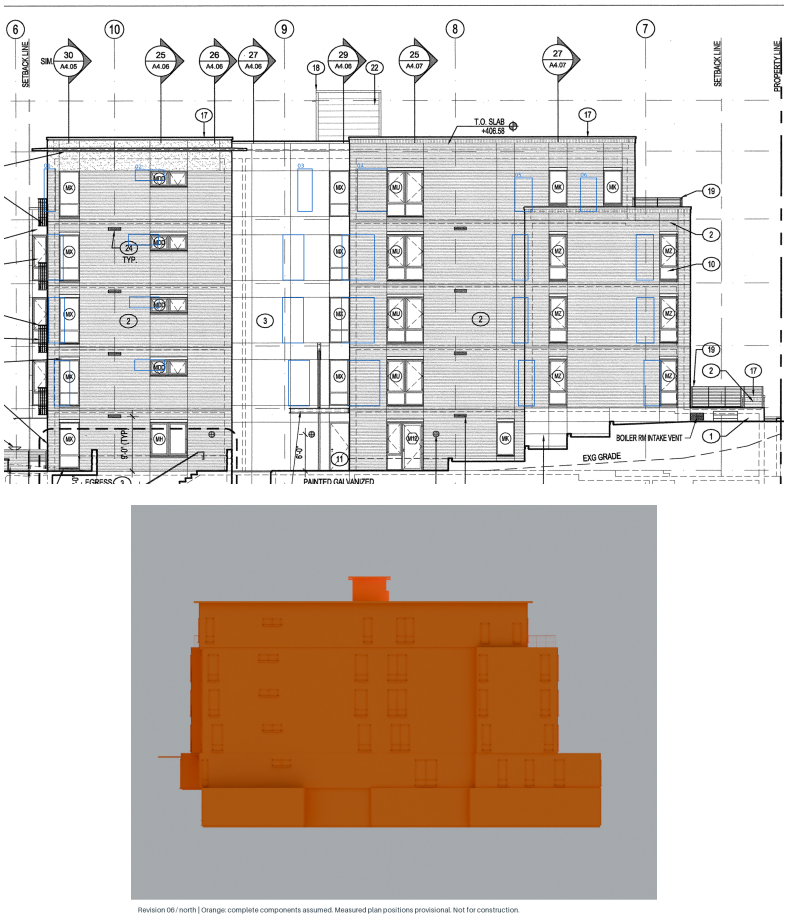

Revision 06 / north | Orange: complete components assumed. Measured plan positions provisional. Not for construction.

All 97 protected north meshes remain identical to revision 04. Six north openings per typical floor does not establish alignment. North stair/MU and R1 entry work remain deferred; their residuals and unaudited status remain explicit.

R5 source centers, projected centers and signed differences are in r5-elevation-comparison.json. The 24 north comparisons remain in elevation-comparison.json. The historical shell-reconciliation.json describes revision 05; r5-completion.json supersedes its remaining R5 footprint limits.

3 / Whole-building and dusk review

Ten fresh provenance views cover north, south, east, west, roof plan, isometric, southeast return, isolated R5 enclosure, southwest terraces and terrace plan. Apartment dressing was moved with the corrected non-north glazing, while retaining illustrative materials and lighting. The architectural inventory is unchanged by this presentation pass.

Fresh native Cycles dusk image, frame 217 of the existing 432-frame camera path. The complete camera path was checked for framing. This delivery includes stills, not a newly rendered film.

Saved dusk camera endpoints: frame 1 (left), frame 432 (right). The older revision 03 movie remains a separate earlier delivery.

Native readback	Result
Apartment dressing	432 objects across 44 openings; no north dressing refreshed
Presentation protection	Architecture hashes unchanged by dressing refresh
Source status	Rendered detail, room dressing, landscape and light behavior remain illustrative

Verification and handoff

Check	Result
Saved native inventory	960 architectural meshes; 624 unchanged from revision 03
Revision 05 protection	815 protected architecture hashes preserved, including P1 and lower stories
Opening voids / frame extents	192 records; 0 overlapping corrected voids; native frames read back without clipping
R5 stage protection	99 stage-1 core mesh hashes preserved through terrace and presentation work
Terrace intersections	0 surface-room overlaps; 0 guard centerlines inside rooms
Slabs / roof / coping	Actual slab outlines, areas and levels; split roof coverage; coping tops and joints checked
Native scenes / portability	Daylight + Dusk; all 432 camera frames checked; packed images; complete architecture in GLB
Workflow checks	11 render-workflow tests pass without skips; catalog resolves 5 shots

P1 remains as reconciled in revision 05: a separate A2.02 enclosure with fourteen openings, recessed garage gate and service door. The parking ramp, below-grade construction, open ventilation shaft and external trellises are outside this simplified enclosure scope.

Remaining development

The ordered R5 work is complete at provisional coordination level. Remaining decisions require window schedules, A4/A5 cornice/coping/guard profiles, complete ASI/RFI responses or installed-condition evidence. P1 ramp and below-grade details can be developed separately. North stair/MU and R1 entries remain deferred.

Exact inspected source, native review, still and report hashes are in visual-review.json. delivery-validation.json contains machine checks; stage1-validation.json and stage2-validation.json preserve intermediate gates. The editable archive includes original PDFs, the base native model, scripts, decisions and reproduction inputs. Floating-point agreement verifies the model follows its specification; it does not certify the raster measurements.

Sources: site-and-floor-plans.pdf (A1.01, A2.01-A2.08); exterior-elevations-and-sections.pdf (A3.01, A3.02, A3.11-A3.13); stairs-and-rcp.pdf (A6.01-A6.04, A7.51). See source-inventory.json for page mapping and exact source hashes.