

Mobil™

Unit ID: 1230

Asset ID: 51782510

Description: 982 m

Normal

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample ID: 25286289070

Service Level: Essential

Bottle ID: a037066909

Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Asset Class: Final Drive

Position: FRONT RIGHT

Manufacturer: CATERPILLAR

Model:

Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50

Sample Data & Trends

Sample Info	Report Status	Alert	Normal	Normal	Normal
	Sample ID	23075470054	23205189001	25059439024	25286289070
	Service Level	Essential	Essential	Essential	Essential
	Bottle ID	a022169730	a006228645	a033559366	a037066909
	Tested Lubricant	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBILTRANS HD 50	MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
	Sampled	08 Mar 2023	18 Jul 2023	03 Feb 2025	10 Sep 2025
	Reported	20 Mar 2023	26 Jul 2023	04 Mar 2025	14 Oct 2025
	Equipment Age	12462	12922	16304	17417
	Equipment UOM	Hours	Hours	Hours	Hours
	Oil Age				
	Make-up Volume				
	Oil Changed	No	No	Yes	No
	Filter Changed	No	No	Yes	No
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal
	Lubricant Rating	Alert	Normal	Normal	Normal
	Visc@100C (cSt)	10.5	16.6	16.7	16.6
	Oxidation (Ab/cm)	1	0	0	0
	Water (Vol.%)	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	5	0	0
	Al (Aluminum)	4	1	2	1
	Cr (Chromium)	1	0	0	0
	Cu (Copper)	25	5	3	2
	Fe (Iron)	107	16	23	14
	Mo (Molybdenum)	2	1	1	1
	Ni (Nickel)	0	0	0	0
	Pb (Lead)	0	0	0	0
	Sn (Tin)	0	2	0	0
Contaminant (ppm)	K (Potassium)	0	0	3	2
	Na (Sodium)	2	1	1	1
	Si (Silicon)	14	8	13	16
Additive (ppm)	B (Boron)	8	4	2	4
	Ba (Barium)	0	0	0	0
	Ca (Calcium)	2186	3298	3406	3499
	Mg (Magnesium)	27	15	19	15
	P (Phosphorus)	756	912	925	951
	Zn (Zinc)	885	1025	1079	1131

Viscosity

Date	Visc@100C (cSt)
08 Mar 2023	10.5
18 Jul 2023	16.6
03 Feb 2025	16.7
10 Sep 2025	16.6

Wear

Date	Ag	Al	Cr	Cu	Fe	Ni	Pb	Sn
08 Mar 2023	0	4	1	25	107	0	0	0
18 Jul 2023	5	1	0	5	16	0	0	2
03 Feb 2025	0	2	0	3	23	0	0	0
10 Sep 2025	0	1	0	2	14	0	0	0

Contaminants


Date	Na	K	Si
08 Mar 2023	2	0	14
18 Jul 2023	1	0	8
03 Feb 2025	1	3	13
10 Sep 2025	1	2	16

Results and comments of this analysis are advisory only. The validity of the data may be impaired by a non-representative sample or incorrect data. © 2016-2024 ExxonMobil. ExxonMobil and Mobil are trademarks or registered trademarks of ExxonMobil Corporation or one of its subsidiaries. Other trademarks shown are property of their respective owners.

1 of 2

Mobil™	Normal	
	Unit ID: 1230	Asset ID: 51782510
	Description: 982 m	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25286289070 Service Level: Essential Bottle ID: a037066909 Tested Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50	Asset Class: Final Drive Position: FRONT RIGHT Manufacturer: CATERPILLAR Model: Lubricant: MOBIL DELVAC MODERN OFF-HIGHWAY TRANS FLUID 50
Continued		

Physical Properties

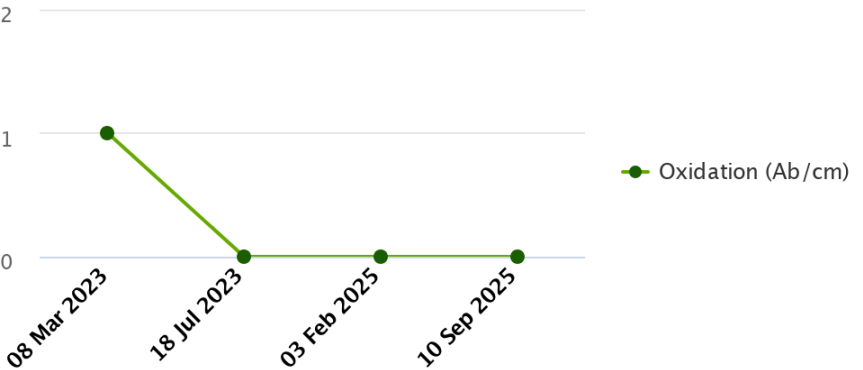

Recommendation/Comments

NO ACTION REQUIRED ON OIL OR EQUIPMENT. Results indicate that all levels are within acceptable ranges. Examine progressive changes and monitor results for changing trends. Sample at next scheduled interval. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 10 Sep 2025 3:18 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: