



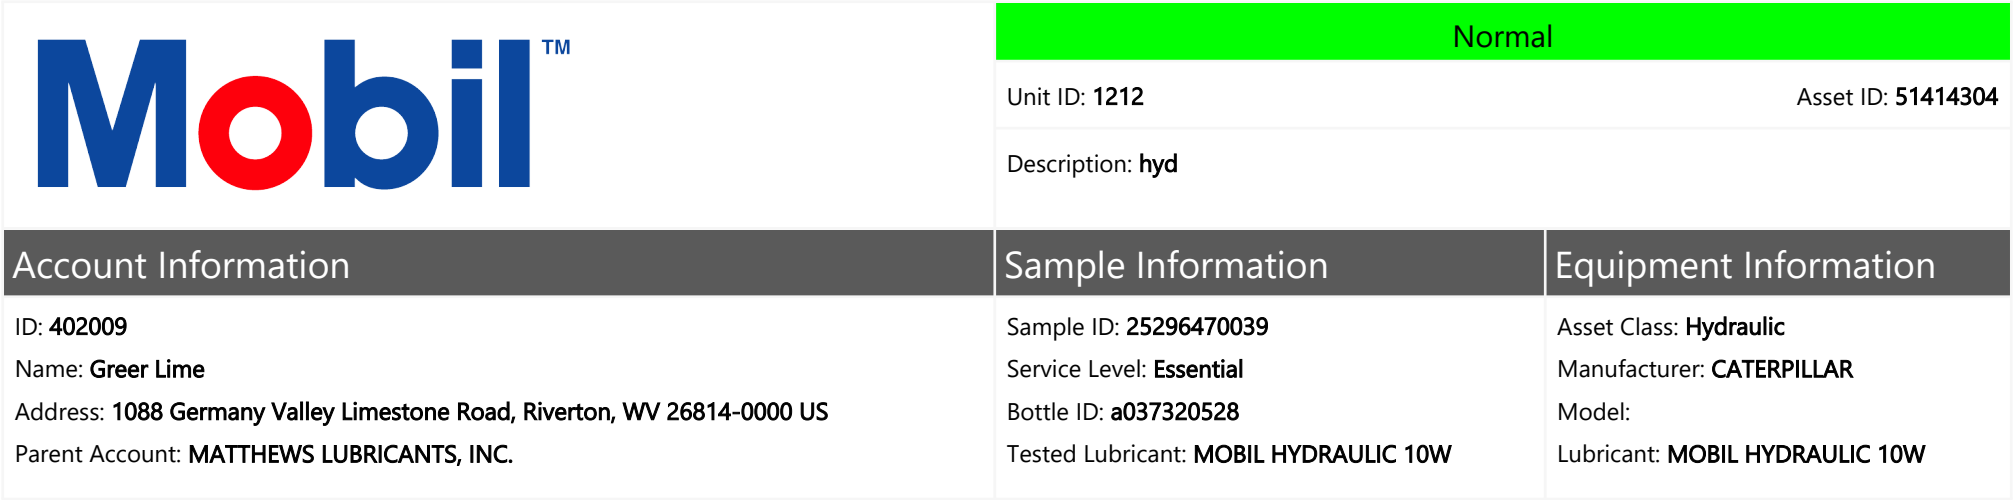

Sample Data & Trends

Sample Info	Report Status	Normal	Normal	Normal	Normal	Normal
	Sample ID	23163399069	23205380051	23264173072	24010131056	25296470039
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a022168782	a006489211	a004669241	a030135459	a037320528
	Tested Lubricant	MOBIL HYDRAULIC 10W	MOBIL HYDRAULIC 10W	MOBIL HYDRAULIC 10W	MOBIL HYDRAULIC 10W	MOBIL HYDRAULIC 10W
	Sampled	23 May 2023	19 Jul 2023	14 Sep 2023	04 Jan 2024	13 Oct 2025
	Reported	14 Jun 2023	25 Jul 2023	25 Sep 2023	15 Jan 2024	24 Oct 2025
	Equipment Age	9051	9469	9920	10738	15726
	Equipment UOM	Hours	Hours	Hours	Hours	Hours
	Oil Age					
	Make-up Volume					
	Oil Changed	No	No	No	No	No
	Filter Changed	Yes	Yes	No	Yes	Yes
	Lubricant	Contamination Rating	Normal	Normal	Normal	Normal
Equipment Rating		Normal	Normal	Normal	Normal	Normal
Lubricant Rating		Normal	Normal	Normal	Normal	Normal
Visc@100C (cSt)		6.2	6.2	6.2	6.2	6.0
Oxidation (Ab/cm)		0	0	0	0	0
Water (Vol.%)		NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	2	1	1	1	2
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	2	2	2	2	2
	Fe (Iron)	5	5	6	7	7
	Mo (Molybdenum)	1	2	1	1	1
	Ni (Nickel)	0	0	0	0	1
	Pb (Lead)	1	0	1	0	0
	Sn (Tin)	0	0	0	0	1
Contaminant (ppm)	K (Potassium)	0	2	1	1	2
	Na (Sodium)	1	0	2	2	1
	Si (Silicon)	7	6	6	6	9
Additive (ppm)	B (Boron)	3	1	3	2	3
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	2692	2675	2715	2795	3465
	Mg (Magnesium)	19	19	20	19	16
	P (Phosphorus)	1077	947	1046	940	1042
	Zn (Zinc)	1099	1067	1045	1079	1139

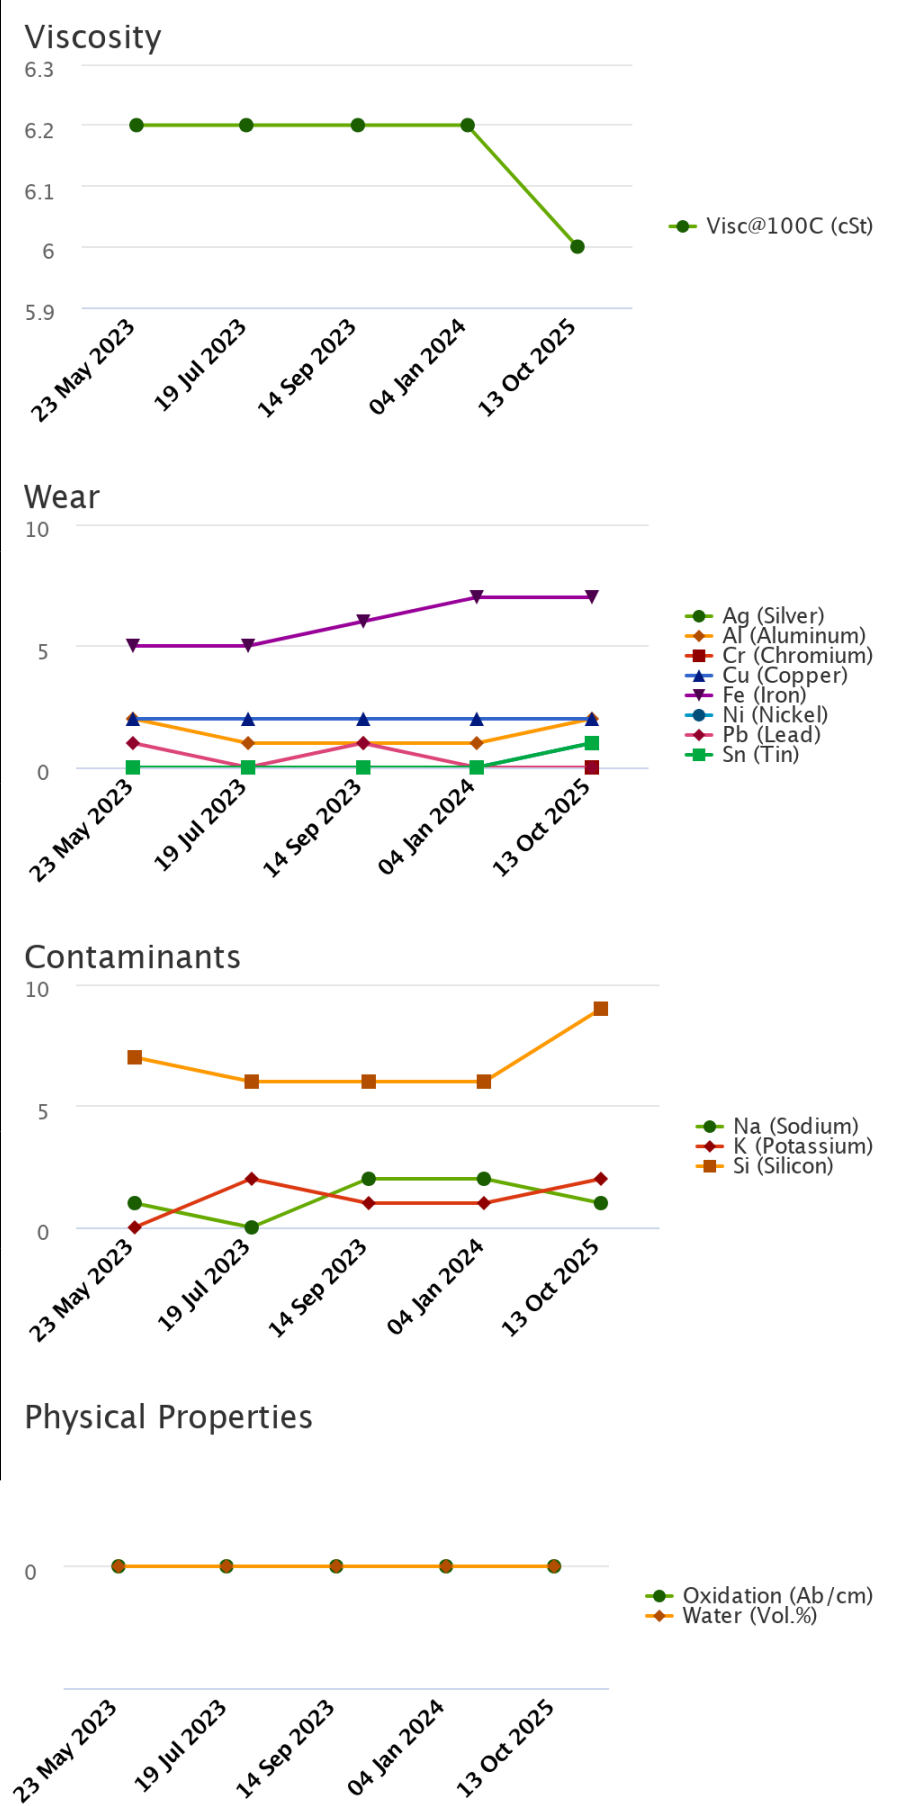

	Normal	
	Unit ID: 1212	Asset ID: 51414304
	Description: hyd	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25296470039 Service Level: Essential Bottle ID: a037320528 Tested Lubricant: MOBIL HYDRAULIC 10W	Asset Class: Hydraulic Manufacturer: CATERPILLAR Model: Lubricant: MOBIL HYDRAULIC 10W

Continued

Recommendation/Comments

NO ACTION REQUIRED ON OIL OR EQUIPMENT. Results indicate that all levels are within acceptable ranges. Examine progressive changes and monitor results for changing trends. Sample at next scheduled interval. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 13 Oct 2025 3:28 PM UTC - Josh Simmons - In Service Oil Sample Comments: Photo: