

MobilTM

Unit ID: 5-BM-1

Asset ID: 50074771

Description: Kiln 2 Ball Mill

Normal

Account Information

ID: 402009

Name: Greer Lime

Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US

Parent Account: MATTHEWS LUBRICANTS, INC.

Sample Information

Sample ID: 25308280025

Service Level: Essential

Bottle ID: a037321731

Tested Lubricant: MOBIL SHC 630

Equipment Information

Asset Class: Gear Drive





Manufacturer: FALK (REXNORD)

Model: 1090FC2

Lubricant: MOBIL SHC 630

Sample Data & Trends

Sample Info	Report Status	Alert	Normal	Normal	Normal	Normal
	Sample ID	24312210012	24330183028	25044280012	25147132043	25308280025
	Service Level	Essential	Essential	Essential	Essential	Essential
	Bottle ID	a033580163	a033580018	a033565328	a033683679	a037321731
	Tested Lubricant	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630	MOBIL SHC 630
	Sampled	26 Sep 2024	13 Nov 2024	03 Feb 2025	18 May 2025	22 Oct 2025
	Reported	11 Nov 2024	27 Nov 2024	15 Feb 2025	29 May 2025	06 Nov 2025
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed			Yes		
	Filter Changed					
Lubricant	Contamination Rating	Normal	Normal	Normal	Normal	Normal
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Alert	Normal	Normal	Normal	Normal
	Visc@40C (cSt)	266.8	223.0	213.0	230.1	224.1
	TAN (mg KOH/g)	0.42	0.42	0.42	0.40	0.42
	Water (Hot Plate)	NotDetected	NotDetected	NotDetected	NotDetected	NotDetected
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	2	0	0	0	0
	Cr (Chromium)	1	0	0	0	0
	Cu (Copper)	0	1	2	0	0
	Fe (Iron)	178	17	8	0	93
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	0	0	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	1	1	0	0	0
	Na (Sodium)	0	0	1	0	2
	Si (Silicon)	8	27	18	22	8
	B (Boron)	0	1	0	0	1
Additive (ppm)	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	10	33	0	5	2
	Mg (Magnesium)	1	1	0	0	0
	P (Phosphorus)	194	459	341	332	214
	Zn (Zinc)	4	30	1	0	1

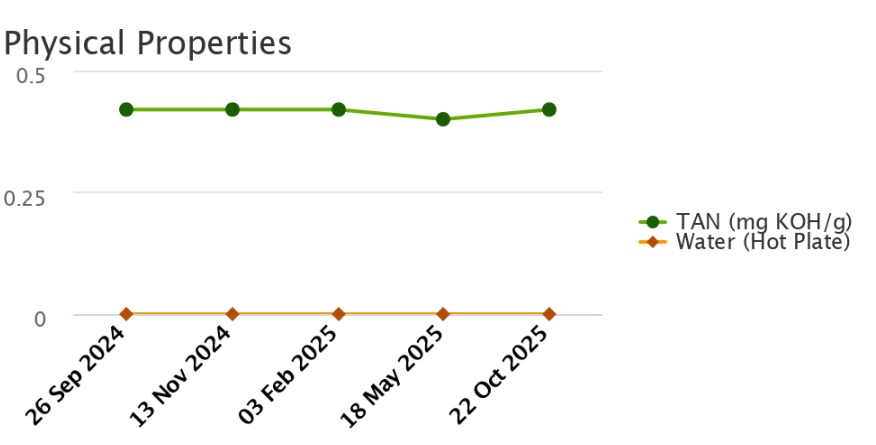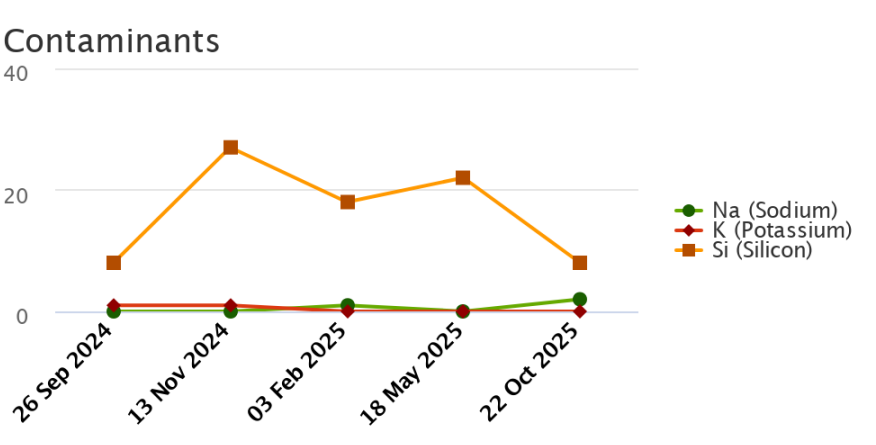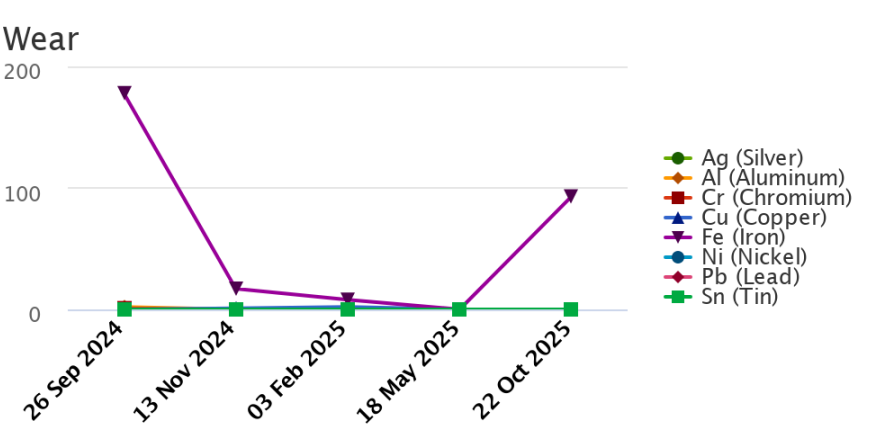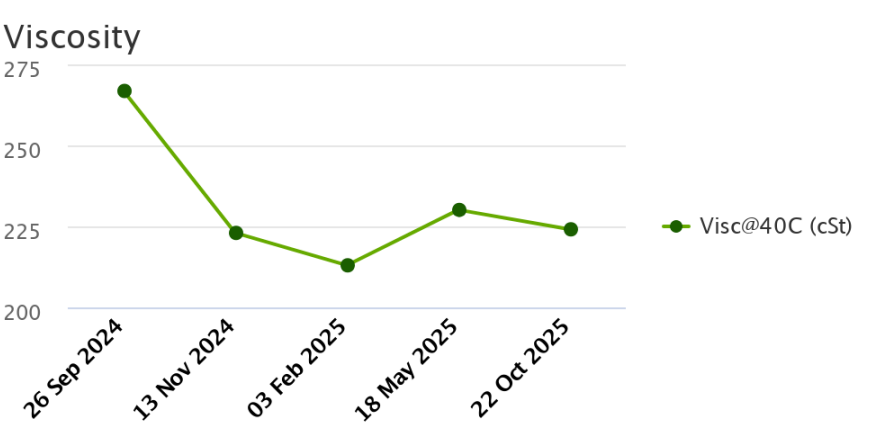

	Normal	
	Unit ID: 5-BM-1	Asset ID: 50074771
	Description: Kiln 2 Ball Mill	
Account Information	Sample Information	Equipment Information
ID: 402009 Name: Greer Lime Address: 1088 Germany Valley Limestone Road, Riverton, WV 26814-0000 US Parent Account: MATTHEWS LUBRICANTS, INC.	Sample ID: 25308280025 Service Level: Essential Bottle ID: a037321731 Tested Lubricant: MOBIL SHC 630	Asset Class: Gear Drive Manufacturer: FALK (REXNORD) Model: 1090FC2 Lubricant: MOBIL SHC 630

Continued

Recommendation/Comments

NO ACTION REQUIRED ON OIL OR EQUIPMENT. Results indicate that all levels are within acceptable ranges. Examine progressive changes and monitor results for changing trends. Sample at next scheduled interval. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- [22 Oct 2025 9:29 PM UTC - Brad Roy - In Service Oil Sample](#) Comments: Photo: