


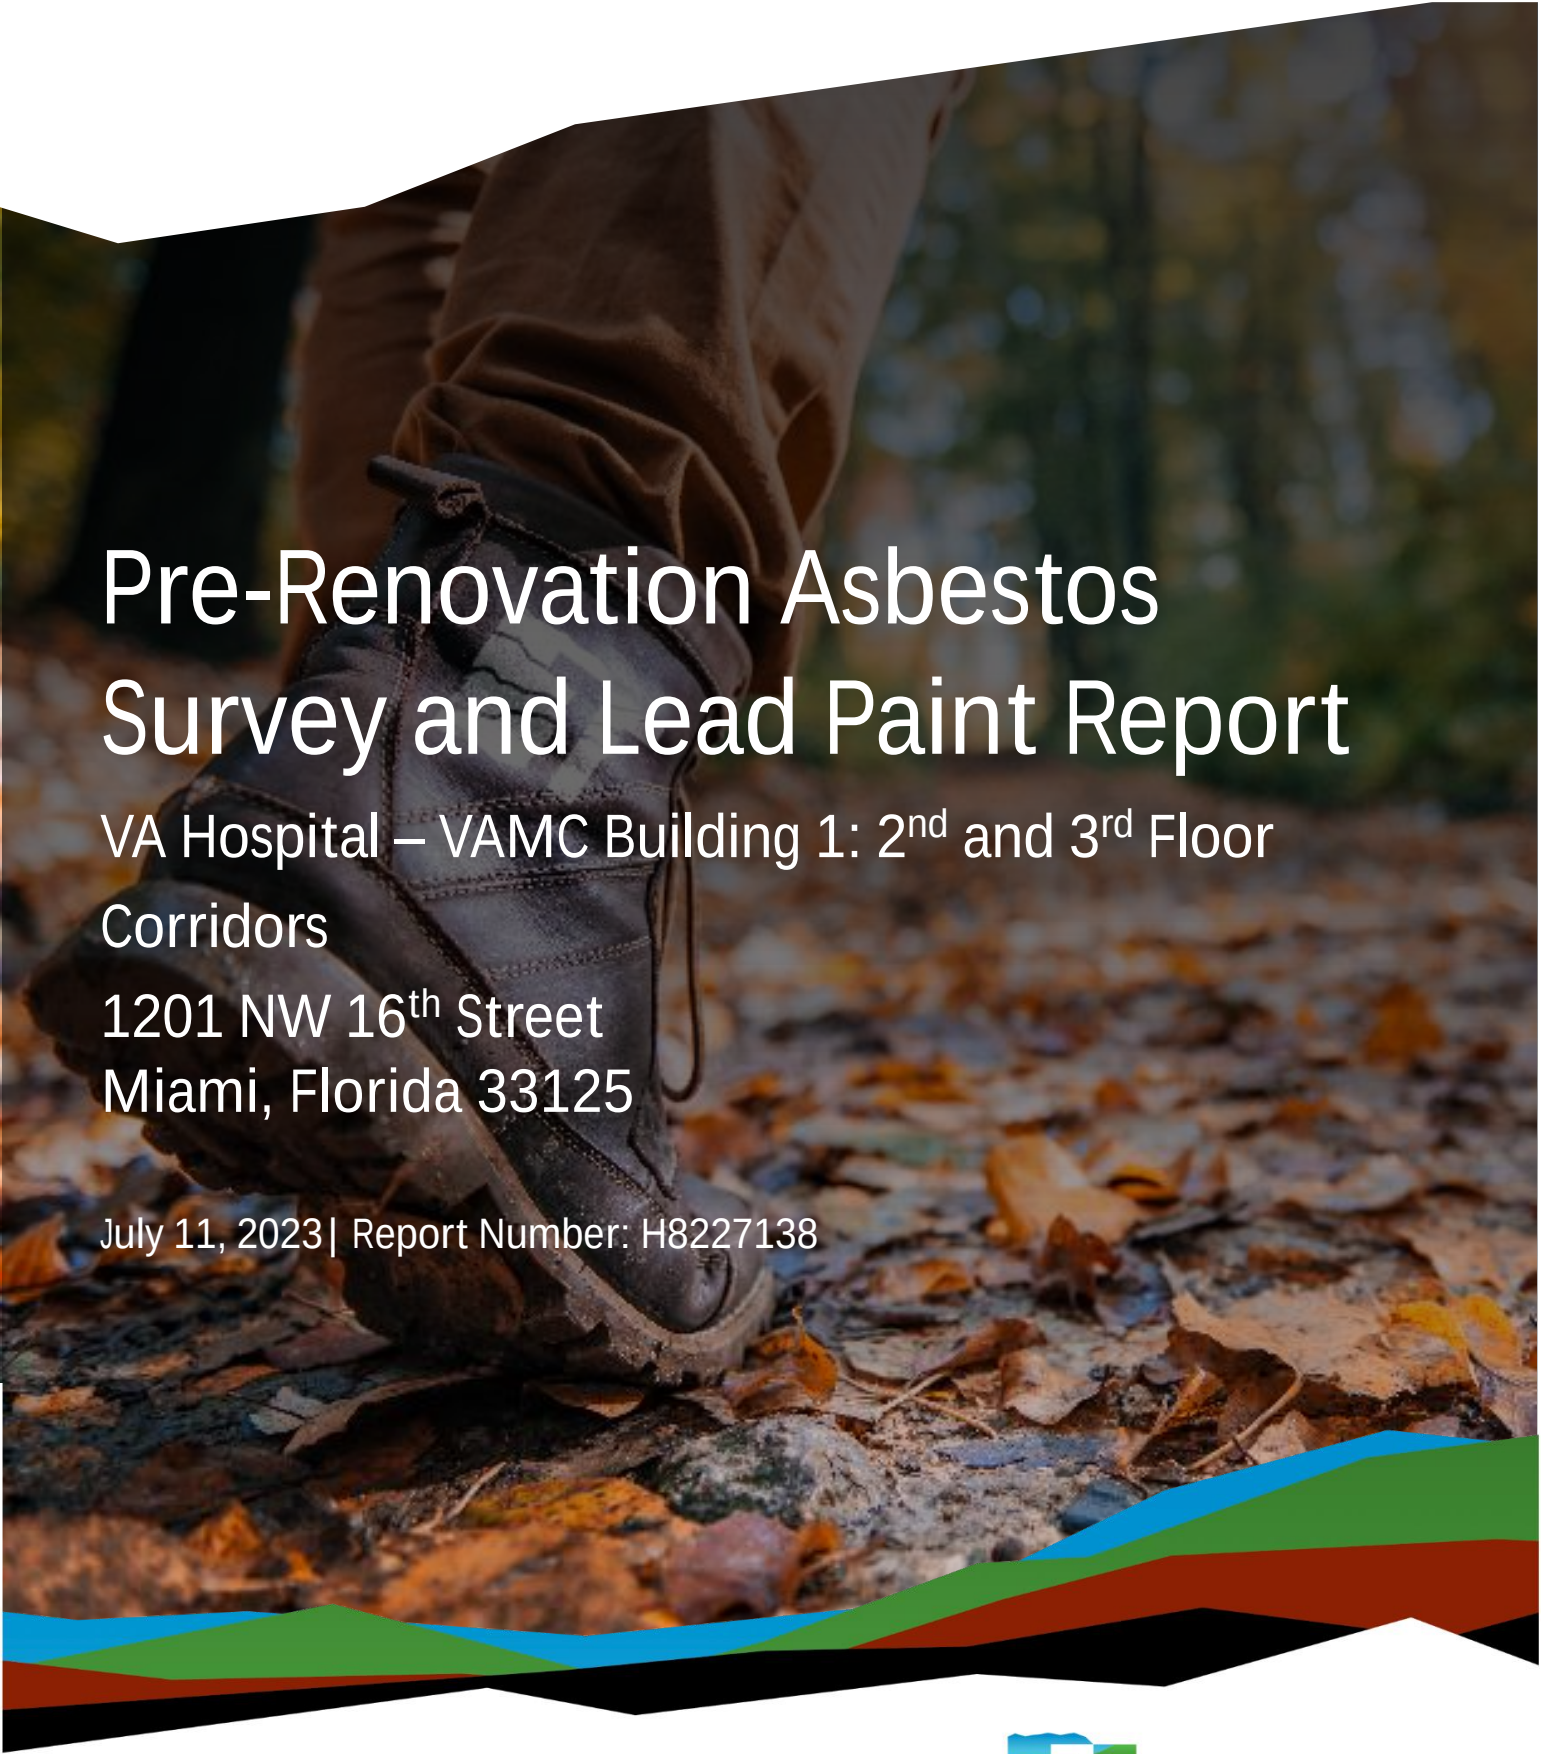

Pre-Renovation Asbestos Survey and Lead Paint Report

VA Hospital – VAMC Building 1: 2nd and 3rd Floor
Corridors

1201 NW 16th Street
Miami, Florida 33125

July 11, 2023 | Report Number: H8227138

5371 NW 33rd Avenue, Suite 201
Fort Lauderdale, Florida 33309
P (954) 741-8282



Nationwide
[Terracon.com](https://www.terracon.com)

- Facilities
- Environmental
- Geotechnical
- Materials



5371 NW 33rd Avenue, Ste 201
Ft. Lauderdale, FL 33309
P: (954) 741-8282
Terracon.com

July 11, 2023
RDC/John Poe Architects, LLLP
116 East 3rd Street
Dayton, Ohio 45402-2130

Attn: Mr. Jason Ross
P 800.362.1523
E jross@rdcjohnpoe.com

RE: Pre-Renovation Asbestos Survey and Lead Paint Report
VA Hospital – VAMC – Building 1: 2nd and 3rd Floor Corridors
1201 NW 16th Street
Miami, Florida
Terracon Project No. H8227138

Dear Mr. Ross,

Terracon Consultants, Inc. (Terracon) is pleased to submit the attached report to RDC/John Poe Architects, LLLP. The purpose of this report is to present the results of a pre-renovation asbestos and lead paint survey performed on June 7 and 8, 2023, at the above referenced location in Miami, Florida. This survey was conducted in general accordance with Terracon Proposal number PH8227138 dated January 23, 2023. We understand that this survey was requested due to the planned renovation of the second and third floor corridors of Building 1 of the hospital.

Based on the laboratory results, asbestos was detected in building materials assessed during our survey assessment. Please refer to the attached report for details.

Lead containing paint was detected in the samples taken during our survey assessment. Please refer to the attached report for details.

Terracon appreciates the opportunity to provide this service to RDC/John Poe Architects, LLLP. If you have any questions regarding this report, please contact us at 954.741.8282.

Sincerely,
[Terracon Consultants, Inc.](#)
Florida Asbestos Consulting Business License No. ZA337

A handwritten signature in blue ink, appearing to read 'Sergio A. Adasme'.

Sergio A. Adasme
Project Industrial Hygienist

A handwritten signature in blue ink, appearing to read 'Mark J. Fricke'.

Mark J. Fricke, CIH, CSP, LAC
Licensed Asbestos Consultant AX132

A handwritten signature in black ink, appearing to read 'Mitch Reiber'.

Mitch Reiber, PG, CIH
Principal
National Director

TABLE OF CONTENTS

	Page
1.0 Introduction	1
1.1 Project Objective	1
1.2 Reliance.....	1
2.0 Building Description.....	2
3.0 Field Activities.....	2
3.1 Asbestos.....	2
3.2 Lead Containing Paint	3
4.0 Regulatory Overview	3
4.1 Asbestos.....	3
4.2 Lead in Construction	4
5.0 Findings and Recommendations.....	5
5.1 Asbestos.....	5
5.2 Lead Containing Paint	7
6.0 General Comments.....	8

Appendices

Appendix A	Asbestos Sample Location Summary
Appendix B	Asbestos Analytical Laboratory Data
Appendix C	LCP Analytical Laboratory Data
Appendix D	Licenses and Certifications
Appendix E	Sample Location Diagram
Appendix F	Photographs

1.0 Introduction

Terracon Consultants, Inc. (Terracon) conducted a Pre-Renovation asbestos and lead paint survey on the 2nd and 3rd floors of the hospital Building 1 located at 1201 NW 16th Street Miami, Florida. The survey was conducted on June 7 and 8, 2023, by Asbestos Hazard Emergency Response Act (AHERA)-accredited asbestos inspectors working under the direction of a Florida Licensed Asbestos Consultant (FLAC). The surveys performed were conducted in general accordance with Terracon proposal PH8227138, dated January 23, 2023. The structure's components, as designated by the site representative, were surveyed and homogeneous areas of suspect asbestos-containing materials (ACM) were visually identified and documented. Additionally, Terracon obtained readily and safely accessible paint-chip samples from surfaces of the renovation areas to identify the presence and concentration of lead paint. Although reasonable effort was made to survey all accessible suspect materials, additional suspect but un-sampled materials could be located in walls, in voids, or in other concealed areas.

Suspect ACM samples were collected in general accordance with the sampling protocols outlined in EPA regulation 40 CFR 763 (AHERA). Asbestos samples were delivered to an accredited laboratory for analysis. Suspect ACM samples were analyzed by Polarized Light Microscopy.

Suspect lead-containing paint samples were obtained from representative coatings potentially containing lead. Lead paint samples were delivered to an accredited laboratory for analysis by Flame Atomic Absorption Spectrophotometry (EPA method SW846 7000B).

1.1 Project Objective

We understand this asbestos survey was requested due to the planned future renovation of the 2nd and 3rd floors of Building 1. EPA regulation 40 CFR 61, Subpart M, National Emission Standards for Hazardous Air Pollutants (NESHAP), prohibits the release of asbestos fibers to the atmosphere during renovation or demolition activities. The asbestos NESHAP requires that potentially regulated ACM (RACM) be identified, classified, and quantified prior to planned renovation or demolition activities.

In addition, suspect lead-containing paint (LCP) samples were obtained to identify potential lead exposure sources, regulated by the Occupational Safety and Health Administration (OSHA) 29 CFR 1926.62 and other applicable EPA regulations that could develop if lead-containing coatings are disturbed during planned renovation or demolition activities.

1.2 Reliance

This report is for the exclusive use of RDC/John Poe Architects, LLLP for the project being discussed. Reliance by any other party on this report is prohibited without written authorization of Terracon and RDC/John Poe Architects, LLLP. Reliance on this report by RDC/John Poe Architects, LLLP and all authorized parties will be subject to the terms, conditions, and limitations stated in the proposal, this report, and the existing agreement between RDC/John Poe Architects, LLLP and Terracon. The limitations of liability defined in Terracon's Agreement for Services is the aggregate limit of Terracon's liability to RDC/John Poe Architects, LLLP.

2.0 Building Description

The multi-story building construction date is unknown. The building materials consisted of stucco and stone exterior walls atop a concrete slab. Interior finishes of the 2nd and 3rd floor corridors of building 1 consisted of lay-in ceiling tiles, drywall systems with vinyl floor tile, vinyl sheet flooring, sand/epoxy flooring, and ceramic floor and wall tiles.

3.0 Field Activities

The survey was conducted by AHERA-accredited asbestos inspectors, Mr. Ryan Nanan and Mr. Marcello Meneses. The survey was conducted in general accordance with the sample collection protocols established in EPA regulation 40 CFR 763 (AHERA). An asbestos sample summary is included as Appendix A. Asbestos analytical laboratory data is included as Appendix B. Paint chip sampling for lead was conducted on observed painted surfaces located within the surveyed areas. Lead containing paint analytical laboratory data is included as Appendix C. Copies of the applicable licenses and certifications are included in Appendix D. A map of sample locations is attached as Appendix E.

3.1 Asbestos

Our survey activities began with visual observations of accessible interior areas to identify homogeneous areas of suspect ACM. A homogeneous area consists of building materials that appear similar throughout in terms of color, texture, and date of application. The assessment was conducted throughout visually accessible areas of the 2nd and 3rd floors of Building 1. Materials identified as glass, wood, metal, or rubber were not considered suspect ACM.

A physical assessment of each homogeneous area of suspect ACM was conducted to assess the friability and condition of the materials. A friable material is defined by the EPA as a material which can be crumbled, pulverized, or reduced to powder by hand pressure when dry. Friability was assessed by physically touching suspect materials.

Based on results of the visual observation, bulk samples of suspect ACM were collected in general accordance with AHERA sampling protocols. Random samples of suspect materials were collected in each homogeneous area. Samples were collected using wet methods as applicable to reduce the potential for fiber release. Samples were placed in sealable containers and labeled with unique sample numbers using an indelible marker.

A total of 126 bulk samples were collected from 36 homogeneous areas of suspect ACM during the survey. An asbestos sample location summary is included as Appendix A.

Bulk samples were submitted under chain of custody to Eurofins EPK Built Environment Testing, LLC (Eurofins EPK) in Ft. Lauderdale, Florida for analysis by PLM per EPA methodology EPA/600/R-93/116. The percentage of asbestos, where applicable, was determined by microscopic visual estimation. Eurofins EPK is accredited under the National Voluntary Laboratory Accreditation Program (NVLAP Accreditation No. 200738-0).

3.2 Lead Containing Paint

Terracon performed a visual assessment of the interior of the 2nd and 3rd floors of Building 1 to locate, and assess predominant painted surfaces for lead. Representative paint chip samples were chosen from each unique combination of paint color, component, and substrate.

A total of 16 paint chips samples were collected and submitted to Eurofins EPK of Tustin, California for analysis. The paint chips were analyzed by Flame Atomic Absorption Spectrometry (AAS) by NIOSH 7082 and EPA method 7000B Modified. Eurofins EPK is accredited under the Environmental Lead Laboratory Accreditation Program (AIHA-LAP, Accreditation No. 178697). Analytical laboratory data for LCP samples taken during this survey are provided in Appendix C.

4.0 Regulatory Overview

4.1 Asbestos

The asbestos NESHAP (40 CFR Part 61, Subpart M) regulates asbestos fiber emissions and asbestos waste disposal practices. It also requires the identification and classification of existing materials prior to demolition or renovation activities. Under NESHAP, ACM are classified as either friable, Category I non-friable or Category II non-friable ACM. Friable materials are those that, when dry, may be crumbled, pulverized, or reduced to powder by hand pressure. Category I non-friable ACM includes packings, gaskets, resilient floor coverings and asphalt roofing products containing more than 1% asbestos. Category II non-friable ACM are any non-friable materials other than non-friable Category I materials that contain more than 1% asbestos.

Friable ACM, Category I and Category II non-friable ACM which is in poor condition and has become friable or which will be subjected to drilling, sanding, grinding, cutting, or abrading and which could be crushed or pulverized during anticipated renovation or demolition activities are considered RACM.

The NESHAP regulations include an option for Friable materials or potential RACM that are found to contain less than 10% asbestos to be “point-counted” or analyzed by similar, advanced analytical methods, such as Transmission Electron Microscopy (TEM), to confirm the asbestos concentrations. If the additional “point-counting” or TEM analysis is not implemented then the materials are required to be categorized as ACM (>1% asbestos content) even if the initial, estimated laboratory results are reported “trace” or less than 1% (<1%) asbestos content.

In the State of Florida, asbestos activities are regulated by the Florida Department of Environmental Protection (FDEP), which is enforced locally by the Miami-Dade County Division of Environmental Resources Management, which is located at 701 NW 1st Court, Suite 400 Miami, FL 33324. RACM must be removed prior to renovation or demolition activities which will disturb the materials. The owner or operator must provide the FDEP with written notification of planned removal activities at least 10 working days prior to the commencement of asbestos abatement activities. Removal of ACM and/or RACM must be conducted by a State of Florida-licensed asbestos abatement contractor.

The OSHA Asbestos standard for construction (29 CFR 1926.1101) regulates workplace exposure to asbestos. The OSHA standard requires that employee exposure to airborne asbestos fibers be maintained below 0.1 asbestos fibers per cubic centimeter of air (0.1 f/cc) for an 8-hour time-weighted average (TWA) permissible exposure limit (PEL) and 1.0 f/cc over a 30-minute period known as an excursion limit (EL).

The OSHA standard classifies construction and maintenance activities which could disturb ACM and specifies work practices and precautions which employers must follow when engaging in each class of regulated work. In addition, OSHA requires that activities where workers disturb materials with even “trace” amounts of asbestos content (<1%) are still regulated and require compliance with certain elements of the regulation.

4.2 Lead in Construction

Lead is regulated by the EPA, HUD, FDEP and OSHA. The EPA and FDEP regulate lead use, removal, and disposal, and OSHA regulates lead exposure to workers. The EPA and HUD, with their small child-safety focus, define Lead-Based Paint (LBP) as paint, varnish, stain, or other applied coating that contains lead equal to or greater than 1.0 mg/cm², 5,000 ppm, or 0.5% by dry weight as determined by laboratory analysis.

However, for the purpose of the OSHA lead standard, with its focus on the safety/exposure of construction workers, paint-containing lead includes any detectable concentrations of metallic lead, all inorganic lead compounds, and organic lead soaps. A synopsis of the OSHA regulations (29 CFR 1926.62) and the applicability are as follows:

The OSHA Lead Standard for Construction (29 CFR 1926.62) applies to all construction work where an employee may be occupationally exposed to lead. All work related to construction, alteration, or repair (including painting and decorating) is included. The lead-in-construction standard applies to any detectable concentration of lead in paint, as even small concentrations of lead can result in unacceptable employee exposures depending upon on the method of removal and other workplace conditions. The OSHA standard requires employee exposure to airborne lead to be maintained below the PEL of 50 micrograms per cubic meter of air (ug/m³) over an 8-hour TWA.

Under this standard, construction includes, but is not limited to, the following:

- Demolition or salvage of structures where lead or materials containing lead are present
- Removal or encapsulation of materials containing lead
- New construction, alteration, repair, or renovation of structures, substrates, or portions containing lead, or materials containing lead
- Installation of products containing lead
- Lead contamination/emergency clean-up
- Transportation, disposal, storage, or containment of lead or materials containing lead on the site or location at which construction activities are performed
- Maintenance operations associated with construction activities described above

5.0 Findings and Recommendations

5.1 Asbestos

Laboratory analysis of materials collected during our survey confirmed that some of the materials sampled contained asbestos. The table below presents a comprehensive list of the asbestos-containing materials found within the corridors of the second and third floors. Material locations are displayed in further detail in the sample location diagram presented in Appendix E.

HA #	Material Description	Material Location(s)	Percent / Type Asbestos	Estimated Quantity*
3	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	2 nd Floor – W Side	<1% to 5% Chrysotile	6,900 ft ²
4	Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic	2 nd Floor – SW Side	5% Chrysotile	90 ft ²
8	Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue	2 nd Floor – N Side	2% Chrysotile	180 ft ²
27	Black Duct Mastic	Throughout 2 nd /3 rd Floors	5% Chrysotile	8,600 ft ²
29	12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – W Side	5% Chrysotile	2,300 ft ²
31	12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic	3 rd Floor - Center	5% Chrysotile	3,200 ft ²

HA #	Material Description	Material Location(s)	Percent / Type Asbestos	Estimated Quantity*
32	12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – S Side	2% Chrysotile	80 ft ²
34	12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic	3 rd Floor – E Side	3% Chrysotile	1,250 ft ²
36	White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – S Side	<1% to 2% Chrysotile	200 ft ²

*Quantities above are an estimate of visually identified materials

The results of this assessment should be communicated to the renovation contractor and other subcontractors working in the building and a copy of the survey should be on-site during renovation or demolition activities. In addition, a 10-day renovation/demolition notice will need to be sent to Miami-Dade County, Division of Environmental Resources Management. We recommend a call be made to (305) 372-6925 to confirm their regulatory requirements.

Any concealed building materials discovered during renovation activities not identified in this report, which are suspected to contain asbestos, should be sampled by a Florida Licensed Asbestos Consultant and analyzed by a NVLAP-accredited laboratory to confirm the presence or absence of asbestos prior to disturbing such materials. If the materials are found to contain asbestos, various regulations (EPA NESHAP, FDEP and OSHA) will apply. In addition, direct contact with the FDEP is recommended to confirm their actual regulatory requirements.

5.2 Lead-Containing Paint

Lead-containing paint was detected in some of the samples collected during this site inspection. The table below represents a list of sampled paints and the measurement of lead concentrations analyzed from each. A comprehensive report is displayed in the laboratory data presented in Appendix C.

Sample #	Description	Substrate	Lead Results (ppm)
L1	White on Drywall Wall	Drywall	< 40 ppm
L2	Cream on Metal Door Frame	Metal	41 ppm
L3	Red on Metal Door	Metal	130 ppm
L4	Cream on Metal Double Door	Metal	< 39 ppm
L5	Brown on Drywall	Drywall	< 39 ppm
L6	Brown on Concrete Wall	Concrete	< 39 ppm
L7	White on Concrete Wall	Concrete	< 39 ppm
L8	Grey on Concrete Wall	Concrete	< 40 ppm
L9	Grey on Metal Door Frame	Metal	45 ppm
L10	Blue on Concrete Wall	Concrete	< 40 ppm
L11	Yellow on Drywall	Drywall	< 40 ppm
L12	Dark Grey on Metal Door	Metal	< 56 ppm
L13	Dark Grey on Metal Door Frame	Metal	< 62 ppm
L14	Cream on Metal Door	Metal	< 57 ppm
L15	Cream on Metal Door Frame	Metal	< 99 ppm
L16	Red on Wooden Door	Wood	350 ppm

Bolded entries indicate concentrations of lead analyzed above the analytical method detection limit.

< = Below laboratory analytical method detection limit.

Any concealed building painted surfaces discovered during renovation activities not identified in this report which are suspected to contain lead, should be sampled, and analyzed.

The results of this assessment should be communicated to the renovation contractor and other subcontractors working in the building and a copy of the survey should be on-site during the renovation activities.

6.0 General Comments

It should be noted that suspect asbestos materials other than those identified during our survey may exist in locations outside of the designated surveyed areas. Should suspect materials other than those which were identified during this survey be uncovered prior to renovation activities, those materials should be assumed asbestos-containing, until sampling and analysis can confirm or refute their asbestos content.

Suspect LCP, other than those identified during the sampling, may also be present in the building. The LCP testing performed was not considered comprehensive in nature and the results are not intended to be used to determine lead hazards, develop abatement plans, or prepare detailed cost estimates for abatement. Suspect LCP which has not been specifically evaluated should be tested prior to disturbance of the material. If additional suspect LCP is identified during the demolition process, those materials should be assumed LCP until testing can be performed to determine whether lead is present in the paint.

The asbestos and LCP surveys were conducted in a manner consistent with the level of care and skill ordinarily exercised by members of the profession currently practicing under similar conditions in the same locale. The results, findings, conclusions, and recommendations expressed in this report are based on conditions observed during our survey of the building. The information contained in this report is relevant to the dates on which this survey was performed and should not be relied upon to represent conditions later.

This report has been prepared on behalf of and exclusively for use by the Client. for specific application to their project as discussed. This report is not a bidding document. Contractors or consultants reviewing this report must draw their own conclusions regarding further investigation or remediation deemed necessary. Terracon does not warrant the work of regulatory agencies, laboratories or other third parties supplying information which may have been used in the preparation of this report. No warranty, express or implied is made.

Appendix A

Asbestos Sample Location Summary



HA Number	Sample Number	Material Description	Sample Location	Lab Results
1	1A	Grey Sand/Epoxy Floor Coating	2 nd Floor - NW Side	ND
	1B		2 nd Floor - NW Side	
	1C		2 nd Floor - NW Side	
2	2A	Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic	2 nd Floor - NW Side	ND
	2B		2 nd Floor - NW Side	
	2C		2 nd Floor - NW Side	
3	3A	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	2 nd Floor – W Side	<1% to 5% Chrysotile
	3B		2 nd Floor – W Side	
	3C		2 nd Floor – W Side	
	3D		2 nd Floor – W Side	
	3E		2 nd Floor – W Side	
4	4A	Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic	2 nd Floor – SW Side	5% Chrysotile
	4B		2 nd Floor – SW Side	
	4C		2 nd Floor – SW Side	
5	5A	Purple/Pink Vinyl Floor Tile and Brown Mastic	2 nd Floor – SW Side	ND
	5B		2 nd Floor – SW Side	
	5C		2 nd Floor – SW Side	
6	6A	Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic	2 nd Floor – SW Side	ND
	6B		2 nd Floor – SW Side	
	6C		2 nd Floor – SW Side	
7	7A	Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic	2 nd Floor - N Side	ND
	7B		2 nd Floor - N Side	
	7C		2 nd Floor - N Side	
8	8A	Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue	2 nd Floor – N Side	2% Chrysotile
	8B		2 nd Floor – N Side	
	8C		2 nd Floor – N Side	
9	9A	Pink w/ Black Dots 12"x12" Vinyl Floor Tile w/ Yellow Glue	2 nd Floor - Center	ND
	9B		2 nd Floor - Center	
	9C		2 nd Floor - Center	
10	10A	Black Wood Patterned 4"x36" Vinyl Floor Tile w/ Yellow Glue	2 nd Floor - E Side	ND
	10B		2 nd Floor - E Side	
	10C		2 nd Floor - E Side	
11	11A	Brown/Grey Carpet and Clear Glue	2 nd Floor – SE Side	ND
	11B		2 nd Floor – SE Side	
	11C		2 nd Floor – SE Side	
12	12A	Grey w/ White Strips 12"x12" Vinyl Floor Tile w/ Black Mastic	2 nd Floor – SE Side	ND
	12B		2 nd Floor – SE Side	
	12C		2 nd Floor – SE Side	



HA Number	Sample Number	Material Description	Sample Location	Lab Results
13	13A	Brown Wood Patterned Vinyl Floor Sheeting w/ Clear Glue and Leveling Compound	2 nd Floor - Center	ND
	13B		2 nd Floor - Center	
	13C		2 nd Floor - Center	
14	14A	Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic	2 nd Floor - E Side	ND
	14B		2 nd Floor - NE Side	
	14C		2 nd Floor - SE Side	
	14D		2 nd Floor - S Side	
	14E		2 nd Floor - SW Side	
15	15A	Interior Partition Drywall w/ Joint Compound	2 nd Floor - E Side	ND
	15B		2 nd Floor - NE Side	
	15C		2 nd Floor - SE Side	
	15D		2 nd Floor - S Side	
	15E		2 nd Floor - SW Side	
16	16A	4" Brown Baseboard w/ Brown Glue	2 nd Floor - E Side	ND
	16B		2 nd Floor - Center	
	16C		2 nd Floor - NE Side	
17	17A	White 2'x2' Worm Ceiling Tile	2 nd Floor - Center	ND
	17B		2 nd Floor - NW Side	
	17C		2 nd Floor - Center	
	17D		2 nd Floor - SW Side	
	17E		2 nd Floor - SE Side	
	17F		3 rd Floor - NE Side	
	17G		3 rd Floor - Center	
	17H		3 rd Floor – W Side	
18	18A	White 2'x4' Large Worm Ceiling Tile	2 nd Floor - NE Side	ND
	18B		2 nd Floor - S Side	
	18C		2 nd Floor - SW Side	
19	19A	Blue/Brown Plastic Wall Sheeting w/ Glue	2 nd Floor - NE Side	ND
	19B		2 nd Floor - SE Side	
	19C		2 nd Floor - SW Side	
20	20A	Off-White Wallpaper w/ Yellow Glue	2 nd Floor - Center	ND
	20B		2 nd Floor - Center	
	20C		2 nd Floor - Center	
21	21A	Grey/Pink Wallpaper w/ Brown Glue	2 nd Floor - Center	ND
	21B		2 nd Floor – S Side	
	21C		2 nd Floor – SW Side	
	21D		3 rd Floor - N Side	
	21E		3 rd Floor - NE Side	

HA Number	Sample Number	Material Description	Sample Location	Lab Results
22	22A	White Duct Mastic	2 nd Floor - NE Side	ND
	22B		2 nd Floor - S Side	
	22C		2 nd Floor - NW Side	
	22D		2 nd Floor - SE Side	
	22E		2 nd Floor - NE Side	
23	23A	White Wrap Yellow Pipe Insulation	2 nd Floor - E Side	ND
	23B		2 nd Floor - E Side	
	23C		2 nd Floor - NE Side	
24	24A	Brown Mastic on Metal Duct	2 nd Floor - E Side	ND
	24B		2 nd Floor - SW Side	
	24C		2 nd Floor - E Side	
25	25A	Drywall Ceiling w/ Joint Compound	2 nd Floor - E Side	ND
	25B		2 nd Floor - E Side	
	25C		2 nd Floor - SE Side	
26	26A	4" Blue Baseboard w/ Brown Glue	2 nd Floor - SE Side	ND
	26B		2 nd Floor - SE Side	
	26C		2 nd Floor - SE Side	
27	27A	Black Duct Mastic	2 nd Floor - E Side	5% Chrysotile
	27B		2 nd Floor - Center Side	
	27C		2 nd Floor - SE Side	
	27D		3 rd Floor – Center	
	27E		3 rd Floor – W Side	
	27F		3 rd Floor – W Side	
28	28A	2'x2' Rough White Ceiling Tile	2 nd Floor - Center	ND
	28B		2 nd Floor - Center	
	28C		2 nd Floor - Center	
29	29A	12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – W Side	5% Chrysotile
	29B		3 rd Floor – W Side	
	29C		3 rd Floor – W Side	
30	30A	4" Pink Baseboard w/ Brown Glue	3 rd Floor – N Side	ND
	30B		3 rd Floor – W Side	
	30C		3 rd Floor – W Side	
31	31A	12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic	3 rd Floor - Center	5% Chrysotile
	31B		3 rd Floor - Center	
	31C		3 rd Floor - Center	
32	32A	12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – S Side	2% Chrysotile
	32B		3 rd Floor – S Side	
	32C		3 rd Floor – S Side	



HA Number	Sample Number	Material Description	Sample Location	Lab Results
33	33A	12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue	3 rd Floor – S Side	ND
	33B		3 rd Floor – S Side	
	33C		3 rd Floor – S Side	
34	34A	12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic	3 rd Floor – E Side	3% Chrysotile
	34B		3 rd Floor – E Side	
	34C		3 rd Floor – E Side	
35	35A	Cream Fiber Reinforced Plastic and Brown Glue	3 rd Floor – NE Side	ND
	35B		3 rd Floor – Center	
	35C		3 rd Floor – W Side	
36	36A	White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic	3 rd Floor – S Side	<1% to 2% Chrysotile
	36B		3 rd Floor – S Side	
	36C		3 rd Floor – S Side	

ND – None Detected

Appendix B

Asbestos Analytical Laboratory Data

Report for:

Mr. Sergio Adasme
Terracon - Fort Lauderdale, FL
5371 NW 33rd Ave.
Suite 201
Fort Lauderdale, FL 33309

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL
EML ID: 3289043

Approved by:



Approved Signatory
Balu Krishnan

Dates of Analysis:

Asbestos PLM: 06-13-2023 and 06-14-2023

Service SOPs: Asbestos PLM (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Total Samples Submitted: 126

Total Samples Analyzed: 126

Total Samples with Layer Asbestos Content > 1%: 32

Location: 1A, Grey Sand/Epoxy Floor Coating

Lab ID-Version‡: 15961225-1

Sample Layers	Asbestos Content
Gray Flooring	ND
Sample Composite Homogeneity: Good	

Location: 1B, Grey Sand/Epoxy Floor Coating

Lab ID-Version‡: 15961226-1

Sample Layers	Asbestos Content
Gray Flooring	ND
Sample Composite Homogeneity: Good	

Location: 1C, Grey Sand/Epoxy Floor Coating

Lab ID-Version‡: 15961227-1

Sample Layers	Asbestos Content
Gray Flooring	ND
Sample Composite Homogeneity: Good	

Location: 2A, Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961228-1

Sample Layers	Asbestos Content
Brown Floor Tile	ND
Brown Mastic	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 2B, Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961229-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 2C, Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961230-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 3A, Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961231-1

Sample Layers	Asbestos Content
Light Brown Floor Tile	< 1% Chrysotile
Brown Mastic	ND
Brown Floor Tile	< 1% Chrysotile
Black Mastic	5% Chrysotile
Sample Composite Homogeneity: Moderate	

Location: 3B, Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961232-1

Sample Layers	Asbestos Content
Light Brown Floor Tile	< 1% Chrysotile
Brown Mastic	ND
Brown Floor Tile	< 1% Chrysotile
Black Mastic	5% Chrysotile
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 3C, Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961233-1

Sample Layers	Asbestos Content
Light Brown Floor Tile	< 1% Chrysotile
Brown Mastic	ND
Brown Floor Tile	< 1% Chrysotile
Black Mastic	5% Chrysotile
Sample Composite Homogeneity: Moderate	

Location: 3D, Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961234-1

Sample Layers	Asbestos Content
Light Brown Floor Tile	< 1% Chrysotile
Brown Mastic	ND
Brown Floor Tile	< 1% Chrysotile
Black Mastic	5% Chrysotile
Sample Composite Homogeneity: Moderate	

Location: 3E, Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961235-1

Sample Layers	Asbestos Content
Light Brown Floor Tile	< 1% Chrysotile
Brown Mastic	ND
Brown Floor Tile	< 1% Chrysotile
Black Mastic	5% Chrysotile
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 4A, Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961236-1

Sample Layers	Asbestos Content
Gray Floor Tile	ND
Yellow Glue	ND
Light Gray Floor Tile	ND
Black Mastic	5% Chrysotile
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 4B, Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961237-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Light Gray Floor Tile	ND
Yellow Glue	ND
Gray Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 4C, Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961238-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Light Gray Floor Tile	ND
Yellow Glue	ND
Gray Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 5A, Purple/Pink Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961239-1

Sample Layers	Asbestos Content
Brown Mastic 2	ND
Pink Floor Tile	ND
Brown Mastic 1	ND
Purple Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 5B, Purple/Pink Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961240-1

Sample Layers	Asbestos Content
Brown Mastic 2	ND
Pink Floor Tile	ND
Brown Mastic 1	ND
Purple Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 5C, Purple/Pink Vinyl Floor Tile and Brown Mastic

Lab ID-Version‡: 15961241-1

Sample Layers	Asbestos Content
Brown Mastic 2	ND
Pink Floor Tile	ND
Brown Mastic 1	ND
Purple Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 6A, Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic

Lab ID-Version‡: 15961242-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Brown/Gray Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 6B, Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic

Lab ID-Version‡: 15961243-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Brown/Gray Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 6C, Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic

Lab ID-Version‡: 15961244-1

Sample Layers	Asbestos Content
Yellow Mastic	ND
Brown/Gray Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 7A, Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961245-1

Sample Layers	Asbestos Content
Black Mastic	ND
Light Brown Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 7B, Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961246-1

Sample Layers	Asbestos Content
Black Mastic	ND
Light Brown Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 7C, Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961247-1

Sample Layers	Asbestos Content
Black Mastic	ND
Light Brown Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 8A, Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue

Lab ID-Version‡: 15961248-1

Sample Layers	Asbestos Content
Brown Glue	ND
Black Mastic	2% Chrysotile
Gray/Black Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 8B, Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue

Lab ID-Version‡: 15961249-1

Sample Layers	Asbestos Content
Brown Glue	ND
Black Mastic	2% Chrysotile
Gray/Black Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 8C, Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue

Lab ID-Version‡: 15961250-1

Sample Layers	Asbestos Content
Brown Glue	ND
Black Mastic	2% Chrysotile
Gray/Black Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 9A, Pink w/ Black Dots 12"x12" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961251-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 9B, Pink w/ Black Dots 12"x12" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961252-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 9C, Pink w/ Black Dots 12"x12" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961253-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 10A, Black Wood Patterned 4"x36" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961254-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Black Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 10B, Black Wood Patterned 4"x36" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961255-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Black Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 10C, Black Wood Patterned 4"x36" Vinyl Floor Tile w/ Yellow Glue

Lab ID-Version‡: 15961256-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Black Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 11A, Brown/Grey Carpet and Clear Glue

Lab ID-Version‡: 15961257-1

Sample Layers	Asbestos Content
Transparent Glue	ND
Brown/Gray Carpet	ND
Composite Non-Asbestos Content:	45% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: 11B, Brown/Grey Carpet and Clear Glue

Lab ID-Version‡: 15961258-1

Sample Layers	Asbestos Content
Transparent Glue	ND
Brown/Gray Carpet	ND
Composite Non-Asbestos Content:	45% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: 11C, Brown/Grey Carpet and Clear Glue

Lab ID-Version‡: 15961259-1

Sample Layers	Asbestos Content
Transparent Glue	ND
Brown/Gray Carpet	ND
Composite Non-Asbestos Content:	45% Synthetic Fibers
Sample Composite Homogeneity:	Moderate

Location: 12A, Grey w/ White Strips 12" x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961260-1

Sample Layers	Asbestos Content
Black Mastic	ND
Gray Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 12B, Grey w/ White Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961261-1

Sample Layers	Asbestos Content
Black Mastic	ND
Gray Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 12C, Grey w/ White Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961262-1

Sample Layers	Asbestos Content
Black Mastic	ND
Gray Floor Tile	ND
Composite Non-Asbestos Content:	1% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 13A, Brown Wood Patterned Vinyl Floor Sheeting w/ Clear Glue and Leveling Compound

Lab ID-Version‡: 15961263-1

Sample Layers	Asbestos Content
Gray Leveling Compound	ND
White Fibrous Material (Mesh)	ND
Transparent Glue	ND
Brown Sheet Flooring	ND
Composite Non-Asbestos Content:	5% Nylon
Sample Composite Homogeneity:	Moderate

Location: 13B, Brown Wood Patterned Vinyl Floor Sheeting w/ Clear Glue and Leveling Compound

Lab ID-Version‡: 15961264-1

Sample Layers	Asbestos Content
Gray Leveling Compound	ND
White Fibrous Material (Mesh)	ND
Transparent Glue	ND
Brown Sheet Flooring	ND
Composite Non-Asbestos Content:	5% Nylon
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 13C, Brown Wood Patterned Vinyl Floor Sheeting w/ Clear Glue and Leveling Compound

Lab ID-Version‡: 15961265-1

Sample Layers	Asbestos Content
Gray Leveling Compound	ND
White Fibrous Material (Mesh)	ND
Transparent Glue	ND
Brown Sheet Flooring	ND
Composite Non-Asbestos Content:	5% Nylon
Sample Composite Homogeneity:	Moderate

Location: 14A, Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961266-1

Sample Layers	Asbestos Content
Black Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: 14B, Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961267-1

Sample Layers	Asbestos Content
Black Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: 14C, Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961268-1

Sample Layers	Asbestos Content
Black Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 14D, Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961269-1

Sample Layers	Asbestos Content
Black Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: 14E, Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961270-1

Sample Layers	Asbestos Content
Black Mastic	ND
Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: 15A, Interior Partition Drywall w/ Joint Compound

Lab ID-Version‡: 15961271-1

Sample Layers	Asbestos Content
White Joint Compound	ND
Cream Tape	ND
White Texture	ND
White Paint	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 15B, Interior Partition Drywall w/ Joint Compound

Lab ID-Version‡: 15961272-1

Sample Layers	Asbestos Content
White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
Cream Tape	ND
White Texture	ND
White Paint	ND
Composite Non-Asbestos Content:	15% Cellulose
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 15C, Interior Partition Drywall w/ Joint Compound

Lab ID-Version‡: 15961273-1

Sample Layers	Asbestos Content
White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
White Wallpaper	ND
White Paint	ND
Composite Non-Asbestos Content:	10% Cellulose 5% Cotton
Sample Composite Homogeneity:	Moderate

Location: 15D, Interior Partition Drywall w/ Joint Compound

Lab ID-Version‡: 15961274-1

Sample Layers	Asbestos Content
White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
White Paint	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 15E, Interior Partition Drywall w/ Joint Compound

Lab ID-Version‡: 15961275-1

Sample Layers	Asbestos Content
White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
White Paint	ND
Composite Non-Asbestos Content:	10% Cellulose
Sample Composite Homogeneity:	Moderate

Location: 16A, 4" Brown Baseboard w/ Brown Glue

Lab ID-Version‡: 15961276-1

Sample Layers	Asbestos Content
Brown Glue	ND
Brown Baseboard	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 16B, 4" Brown Baseboard w/ Brown Glue

Lab ID-Version‡: 15961277-1

Sample Layers	Asbestos Content
Brown Glue	ND
Brown Baseboard	ND
Sample Composite Homogeneity:	Moderate

Location: 16C, 4" Brown Baseboard w/ Brown Glue

Lab ID-Version‡: 15961278-1

Sample Layers	Asbestos Content
Brown Glue	ND
Brown Baseboard	ND
Sample Composite Homogeneity:	Moderate

Location: 17A, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961279-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 17B, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961280-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 17C, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961281-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 17D, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961282-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 17E, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961283-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 17F, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961284-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 17G, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961285-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 17H, White 2'x2' Worm Ceiling Tile

Lab ID-Version‡: 15961286-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	40% Cellulose 10% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 18A, White 2'x4' Large Worm Ceiling Tile

Lab ID-Version‡: 15961287-1

Sample Layers	Asbestos Content
White Coating	ND
Gray Ceiling Tile	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 18B, White 2'x4' Large Worm Ceiling Tile

Lab ID-Version‡: 15961288-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 18C, White 2'x4' Large Worm Ceiling Tile

Lab ID-Version‡: 15961289-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 19A, Blue/Brown Plastic Wall Sheeting w/ Glue

Lab ID-Version‡: 15961290-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Blue Non-Fibrous Material	ND
Sample Composite Homogeneity:	Moderate

Location: 19B, Blue/Brown Plastic Wall Sheeting w/ Glue

Lab ID-Version‡: 15961291-1

Sample Layers	Asbestos Content
White Texture	ND
White Paint	ND
Yellow Glue	ND
Blue Non-Fibrous Material	ND
Sample Composite Homogeneity:	Moderate

Location: 19C, Blue/Brown Plastic Wall Sheeting w/ Glue

Lab ID-Version‡: 15961292-1

Sample Layers	Asbestos Content
White Texture	ND
White Paint	ND
Yellow Glue	ND
Blue Non-Fibrous Material	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 20A, Off-White Wallpaper w/ Yellow Glue

Lab ID-Version‡: 15961293-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Off-White Wallpaper	ND
Composite Non-Asbestos Content:	5% Cotton 5% Nylon
Sample Composite Homogeneity:	Good

Location: 20B, Off-White Wallpaper w/ Yellow Glue

Lab ID-Version‡: 15961294-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Off-White Wallpaper	ND
Composite Non-Asbestos Content:	5% Cotton 5% Nylon
Sample Composite Homogeneity:	Good

Location: 20C, Off-White Wallpaper w/ Yellow Glue

Lab ID-Version‡: 15961295-1

Sample Layers	Asbestos Content
Yellow Glue	ND
Off-White Wallpaper	ND
Composite Non-Asbestos Content:	5% Cotton 5% Nylon
Sample Composite Homogeneity:	Good

Location: 21A, Grey/Pink Wallpaper w/ Brown Glue

Lab ID-Version‡: 15961296-1

Sample Layers	Asbestos Content
Brown Glue	ND
Gray Wallpaper	ND
Composite Non-Asbestos Content:	10% Cotton
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 21B, Grey/Pink Wallpaper w/ Brown Glue

Lab ID-Version‡: 15961297-1

Sample Layers	Asbestos Content
Brown Glue	ND
Gray Wallpaper	ND
Composite Non-Asbestos Content:	10% Cotton
Sample Composite Homogeneity:	Good

Location: 21C, Grey/Pink Wallpaper w/ Brown Glue

Lab ID-Version‡: 15961298-1

Sample Layers	Asbestos Content
Brown Glue	ND
Gray Wallpaper	ND
Composite Non-Asbestos Content:	10% Cotton
Sample Composite Homogeneity:	Good

Location: 21D, Grey/Pink Wallpaper w/ Brown Glue

Lab ID-Version‡: 15961299-1

Sample Layers	Asbestos Content
Brown Glue	ND
Gray Wallpaper	ND
Composite Non-Asbestos Content:	10% Cotton
Sample Composite Homogeneity:	Good

Location: 21E, Grey/Pink Wallpaper w/ Brown Glue

Lab ID-Version‡: 15961300-1

Sample Layers	Asbestos Content
Brown Glue	ND
Gray Wallpaper	ND
Composite Non-Asbestos Content:	10% Cotton
Sample Composite Homogeneity:	Good

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 22A, White Duct Mastic

Lab ID-Version‡: 15961301-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Tape	ND
White Mastic	ND
Composite Non-Asbestos Content:	10% Mineral Wool 5% Cellulose 5% Wollastonite 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 22B, White Duct Mastic

Lab ID-Version‡: 15961302-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Tape	ND
White Mastic	ND
Composite Non-Asbestos Content:	10% Mineral Wool 5% Cellulose 5% Wollastonite 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 22C, White Duct Mastic

Lab ID-Version‡: 15961303-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Tape	ND
White Mastic	ND
Composite Non-Asbestos Content:	10% Mineral Wool 5% Cellulose 5% Wollastonite 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 22D, White Duct Mastic

Lab ID-Version‡: 15961304-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Tape	ND
White Mastic	ND
Composite Non-Asbestos Content:	10% Mineral Wool 5% Cellulose 5% Wollastonite
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 22E, White Duct Mastic

Lab ID-Version‡: 15961305-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Tape	ND
White Mastic	ND
Composite Non-Asbestos Content:	10% Mineral Wool 5% Cellulose 5% Wollastonite
Sample Composite Homogeneity:	Moderate

Location: 23A, White Wrap Yellow Pipe Insulation

Lab ID-Version‡: 15961306-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
White Wrap	ND
Composite Non-Asbestos Content:	60% Mineral Wool 5% Cellulose 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 23B, White Wrap Yellow Pipe Insulation

Lab ID-Version‡: 15961307-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
White Wrap	ND
Composite Non-Asbestos Content:	60% Mineral Wool 5% Cellulose 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 23C, White Wrap Yellow Pipe Insulation

Lab ID-Version‡: 15961308-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
White Wrap	ND
Composite Non-Asbestos Content:	60% Mineral Wool 5% Cellulose 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 24A, Brown Mastic on Metal Duct

Lab ID-Version‡: 15961309-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Sample Composite Homogeneity:	Good

Location: 24B, Brown Mastic on Metal Duct

Lab ID-Version‡: 15961310-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Sample Composite Homogeneity:	Good

Location: 24C, Brown Mastic on Metal Duct

Lab ID-Version‡: 15961311-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Sample Composite Homogeneity:	Good

Location: 25A, Drywall Ceiling w/ Joint Compound

Lab ID-Version‡: 15961312-1

Sample Layers	Asbestos Content
Off-White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
White Paint	ND
Composite Non-Asbestos Content:	10% Cellulose 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 25B, Drywall Ceiling w/ Joint Compound

Lab ID-Version‡: 15961313-1

Sample Layers	Asbestos Content
Off-White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
Cream Tape	ND
White Texture	ND
White Paint	ND
Composite Non-Asbestos Content:	15% Cellulose 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 25C, Drywall Ceiling w/ Joint Compound

Lab ID-Version‡: 15961314-1

Sample Layers	Asbestos Content
Off-White Drywall	ND
Brown Paper	ND
White Joint Compound	ND
Cream Tape	ND
White Texture	ND
White Paint	ND
Composite Non-Asbestos Content:	15% Cellulose 1% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 26A, 4" Blue Baseboard w/ Brown Glue

Lab ID-Version‡: 15961315-1

Sample Layers	Asbestos Content
Brown Mastic	ND
Blue Baseboard	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 26B, 4" Blue Baseboard w/ Brown Glue

Lab ID-Version‡: 15961316-1

Sample Layers	Asbestos Content
White Texture	ND
White Paint	ND
Brown Mastic	ND
Blue Baseboard	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 26C, 4" Blue Baseboard w/ Brown Glue

Lab ID-Version‡: 15961317-1

Sample Layers	Asbestos Content
White Texture	ND
Brown Mastic	ND
Blue Baseboard	ND
Sample Composite Homogeneity: Moderate	

Location: 27A, Black Duct Mastic

Lab ID-Version‡: 15961318-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	10% Cellulose 2% Glass Fibers
Sample Composite Homogeneity: Moderate	

Location: 27B, Black Duct Mastic

Lab ID-Version‡: 15961319-1

Sample Layers	Asbestos Content
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	2% Cellulose
Sample Composite Homogeneity: Moderate	

Location: 27C, Black Duct Mastic

Lab ID-Version‡: 15961320-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	10% Cellulose 5% Mineral Wool 2% Glass Fibers
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 27D, Black Duct Mastic

Lab ID-Version‡: 15961321-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	10% Cellulose 3% Mineral Wool 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 27E, Black Duct Mastic

Lab ID-Version‡: 15961322-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	30% Mineral Wool 5% Cellulose 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 27F, Black Duct Mastic

Lab ID-Version‡: 15961323-1

Sample Layers	Asbestos Content
Yellow Insulation	ND
Silver Wrap	ND
Black Mastic	5% Chrysotile
Composite Non-Asbestos Content:	30% Mineral Wool 5% Cellulose 2% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 28A, 2'x2' Rough White Ceiling Tile

Lab ID-Version‡: 15961324-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 28B, 2'x2' Rough White Ceiling Tile

Lab ID-Version‡: 15961325-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 28C, 2'x2' Rough White Ceiling Tile

Lab ID-Version‡: 15961326-1

Sample Layers	Asbestos Content
Gray Ceiling Tile	ND
White Coating	ND
Composite Non-Asbestos Content:	30% Cellulose 20% Mineral Wool
Sample Composite Homogeneity:	Moderate

Location: 29A, 12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961327-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

Location: 29B, 12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961328-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 29C, 12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961329-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
White Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 30A, 4" Pink Baseboard w/ Brown Glue

Lab ID-Version‡: 15961330-1

Sample Layers	Asbestos Content
Brown Glue	ND
Pink Baseboard	ND
Sample Composite Homogeneity: Moderate	

Location: 30B, 4" Pink Baseboard w/ Brown Glue

Lab ID-Version‡: 15961331-1

Sample Layers	Asbestos Content
Brown Glue	ND
Pink Baseboard	ND
Sample Composite Homogeneity: Moderate	

Location: 30C, 4" Pink Baseboard w/ Brown Glue

Lab ID-Version‡: 15961332-1

Sample Layers	Asbestos Content
Brown Glue	ND
Pink Baseboard	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 31A, 12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961333-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 31B, 12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961334-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 31C, 12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic

Lab ID-Version‡: 15961335-1

Sample Layers	Asbestos Content
Black Mastic	5% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 32A, 12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961336-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	ND
Brown Glue	ND
Off-White Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 32B, 12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961337-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	ND
Brown Glue	ND
Off-White Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 32C, 12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961338-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	ND
Brown Glue	ND
Off-White Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 33A, 12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue

Lab ID-Version‡: 15961339-1

Sample Layers	Asbestos Content
Brown Glue 2	ND
Brown Floor Tile	ND
Brown Glue 1	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

**Location: 33B, 12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over
Brown 12"x12" Vinyl Floor Tile w/ Brown Glue**

Lab ID-Version‡: 15961340-1

Sample Layers	Asbestos Content
Brown Glue 2	ND
Brown Floor Tile	ND
Brown Glue 1	ND
Pink Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 33C, 12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue

Lab ID-Version‡: 15961341-1

Sample Layers	Asbestos Content
Brown Glue 2	ND
Brown Floor Tile	ND
Brown Glue 1	ND
Pink Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 34A, 12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961342-1

Sample Layers	Asbestos Content
Black Mastic	3% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Light Brown Floor Tile	ND
Sample Composite Homogeneity: Moderate	

Location: 34B, 12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961343-1

Sample Layers	Asbestos Content
Black Mastic	3% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Light Brown Floor Tile	ND
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 34C, 12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961344-1

Sample Layers	Asbestos Content
Black Mastic	3% Chrysotile
Blue Floor Tile	ND
Brown Glue	ND
Light Brown Floor Tile	ND
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 35A, Cream Fiber Reinforced Plastic and Brown Glue

Lab ID-Version‡: 15961345-1

Sample Layers	Asbestos Content
Brown Glue	ND
Cream Fiberglass Reinforced Plastic	ND
Composite Non-Asbestos Content:	30% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 35B, Cream Fiber Reinforced Plastic and Brown Glue

Lab ID-Version‡: 15961346-1

Sample Layers	Asbestos Content
Brown Glue	ND
Cream Fiberglass Reinforced Plastic	ND
Composite Non-Asbestos Content:	30% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 35C, Cream Fiber Reinforced Plastic and Brown Glue

Lab ID-Version‡: 15961347-1

Sample Layers	Asbestos Content
Brown Glue	ND
Cream Fiberglass Reinforced Plastic	ND
Composite Non-Asbestos Content:	30% Glass Fibers
Sample Composite Homogeneity:	Moderate

Location: 36A, White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961348-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	< 1% Chrysotile
Sample Composite Homogeneity:	Moderate

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: Terracon - Fort Lauderdale, FL
C/O: Mr. Sergio Adasme
Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3;
1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023
Date of Receipt: 06-13-2023
Date of Report: 06-14-2023

ASBESTOS PLM REPORT

Location: 36B, White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961349-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	< 1% Chrysotile
Sample Composite Homogeneity: Moderate	

Location: 36C, White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic

Lab ID-Version‡: 15961350-1

Sample Layers	Asbestos Content
Black Mastic	2% Chrysotile
White Floor Tile	< 1% Chrysotile
Sample Composite Homogeneity: Moderate	

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Terracon

Weather	Fog	Rain	Snow	Wind	Clear
None	☒	☒	☒	☒	
Light	☐	☐	☐	☐	☒
Moderate	☐	☐	☐	☐	
Heavy	☐	☐	☐	☐	

CONTACT INFORMATION	
Company:	Terracon - Fort Lauderdale, FL (16556)
Contact:	Sergio Adasme
Phone:	954-703-1865
	Address: 5371 NW 33rd Ave. Suite 201 Fort Lauderdale, FL 33309
	Special Instructions:

TURN AROUND TIME CODES (TAT)

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3		STD - Standard (DEFAULT) ND - Next Business Day SD - Same Business Day Rush WH - Weekend / Holiday
Project Description:	1201 NW 16th Street, Miami, FL		
Project Zip Code:	33125	Sampling Date & Time: 06/07/2023	
PO Number:	H8227138	Sampled By: RN/MM	

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
1A	Grey Sand/Epoxy Floor Coating	B	STD	N/A		
1B	Grey Sand/Epoxy Floor Coating	B	STD	N/A		
1C	Grey Sand/Epoxy Floor Coating	B	STD	N/A		
2A	Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
2B	Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
2C	Brown Line Pattern 12"x24" Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
3A	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
3B	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
3C	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
3D	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
3E	Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		

						REQUESTED SERVICES (Use checkboxes below)	
☒	☒	☒	☒	☒	☒	☒	Asbestos PLM
☐	☐	☐	☐	☐	☐	☐	Lead - Flame AA
☐	☐	☐	☐	☐	☐	☐	
☐	☐	☐	☐	☐	☐	☐	
☐	☐	☐	☐	☐	☐	☐	
☐	☐	☐	☐	☐	☐	☐	

RELINQUISHED BY

DATE & TIME

RECEIVED BY

DATE & TIME

P - Paint Chip sample

Marcello Meneses

6/13/2023 12:11 PM

AC

6/13/23 2:45

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.eurofnus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Doc. #1192, Rev 32, Revised 12/15/15 Page 1 of 1 DA

CHAIN OF CUSTODY
www.eurofinsus.com/Built



New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 * (866) 888-6653

Weather	Fog	Rain	Snow	Wind	Cle
None	☒	☒	☒	☒	☒
Light	☐	☐	☐	☐	☐
Moderate	☐	☐	☐	☐	☐
Heavy	☐	☐	☐	☐	☐

003289043

REQUESTED
SERVICES
(Use checkboxes
below)

CONTACT INFORMATION

Company:	Terracon - Fort Lauderdale, FL (16558)	Address:	5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309
Contact:	Sergio Adasme	Special Instructions:	
Phone:	954-703-1865		

PROJECT INFORMATION

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3	STD - Standard (DEFAULT)
Project Description:	1201 NW 16th Street, Miami, FL	ND - Next Business Day
Project Zip Code:	33125	SD - Same Business Day Rush
PO Number:	H8227138	WH - Weekend / Holiday
Sampling Date & Time:	06/07/2023	
Sampled By:	RN/MM	

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

TURN AROUND TIME CODES (TAT)

Sample ID	Description	Sample Type (Below)	TAT (Below)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
4A	Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic	B	STD	N/A		
4B	Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic	B	STD	N/A		
4C	Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic	B	STD	N/A		
5A	Purple/Pink Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
5B	Purple/Pink Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
5C	Purple/Pink Vinyl Floor Tile and Brown Mastic	B	STD	N/A		
6A	Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic	B	STD	N/A		
6B	Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic	B	STD	N/A		
6C	Grey/Brown 15"x15" Vinyl Floor Tile w/ Yellow Mastic	B	STD	N/A		
7A	Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
7B	Light Brown w/ White Spots 12"x12" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		

SAMPLE TYPE CODES

B - Bulk sample	P - Paint Chip sample	RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
		Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 2:45

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:
<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Terracon

Level	Weather			
	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐



003289043

003289043

REQUESTED SERVICES
(Use checkboxes below)

TURN AROUND TIME CODES (TAT)

STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

[illegible]

SAMPLE TYPE CODES

RELINQUISHED BY

DATE & TIME

RECEIVED BY

DATE & TIME

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: <https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms>

Terracon

Level	Weather			
	None	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐



003289043

PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Company:	Terracon - Fort Lauderdale, FL (16556)	Address: 5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309	
Contact:	Sergio Adasme	Special Instructions:	
Phone:	954-703-1865		
PROJECT INFORMATION			
Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3	TURN AROUND TIME CODES (TAT)	
Project Description:	1201 NW 16th Street, Miami, FL	STD - Standard (DEFAULT)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Zip Code:	33125	SD -Same Business Day Rush	
PO Number:	H8227138	WH - Weekend / Holiday	

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

SAMPLE TYPE CODES

RELINQUISHED BY

DATE & TIME

RECEIVED BY

DATE & TIME

B - Bulk sample	P - Paint Chip sample	Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 8:45

REQUESTED SERVICES
(Use checkboxes)

below)

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: <https://www.eurofinsus.com/environment-testing/bull-environmental-resources/sampling-guides-and-forms>.

Terracon

Weather	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐

below)

CONTACT INFORMATION	
Company:	Terracon - Fort Lauderdale, FL (16558)
Contact:	Sergio Adamsme
Phone:	954-703-1865
	Address: 5371 NW 33rd Ave. Suite 201 Fort Lauderdale, FL 33309
	Special Instructions:

TURN AROUND TIME CODES (TAT)

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3		STD - Standard (DEFAULT)
Project Description:	1201 NW 16th Street, Miami, FL		ND - Next Business Day
Project Zip Code:	33125	Sampling Date & Time: 06/07/2023	SD - Same Business Day Rush
PO Number:	H8227138	Sampled By: RN/MM	WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
14D	Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastik	B	STD	N/A		
14E	Brown w/ Large Brown Strips 12"x12" Vinyl Floor Tile w/ Black Mastik	B	STD	N/A		
15A	Interior Partition Drywall w/ Joint Compound	B	STD	N/A		
15B	Interior Partition Drywall w/ Joint Compound	B	STD	N/A		
15C	Interior Partition Drywall w/ Joint Compound	B	STD	N/A		
15D	Interior Partition Drywall w/ Joint Compound	B	STD	N/A		
15E	Interior Partition Drywall w/ Joint Compound	B	STD	N/A		
16A	4" Brown Baseboard w/ Brown Glue	B	STD	N/A		
16B	4" Brown Baseboard w/ Brown Glue	B	STD	N/A		
16C	4" Brown Baseboard w/ Brown Glue	B	STD	N/A		
17A	White 2"x2" Worm Ceiling Tile	B	STD	N/A		

[illegible]

SAMPLE TYPE CODES		RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
B - Bulk sample	P - Paint Chip sample	Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 2:45

Doc. #1192, Rev. 32, Revised 12/18/15, Page 1 of 1, OA

Terracon

Weather	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐

100

3 3289043

Company:	Terracon - Fort Lauderdale, FL (16558)	Address: 5371 NW 33rd Ave. Suite 201 Fort Lauderdale, FL 33309
Contact:	Sergio Adasme	Special Instructions:
Phone:	954-703-1865	

TURN AROUND TIME CODES (TAT)

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3		STD - Standard (DEFAULT)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	1201 NW 16th Street, Miami, FL		ND - Next Business Day	
Project Zip Code:	33125	Sampling Date & Time: 06/07/2023	SD - Same Business Day Rush	
PO Number:	H8227138	Sampled By: RN/MM	WH - Weekend / Holiday	

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
17B	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17C	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17D	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17E	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17F	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17G	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
17H	White 2'x2' Worm Ceiling Tile	B	STD	N/A		
18A	White 2'x4' Large Worm Ceiling Tile	B	STD	N/A		
18B	White 2'x4' Large Worm Ceiling Tile	B	STD	N/A		
18C	White 2'x4' Large Worm Ceiling Tile	B	STD	N/A		
19A	Blue/Brown Plastic Wall Sheeting w/ Glue	B	STD	N/A		

[illegible]

SAMPLE TYPE CODES		RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
B - Bulk sample	P - Paint Chip sample	Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 2:45

Doc. #1192, Row 32, Revised 12/18/15, Page 1 of 1, CA

Terracon

Weather	Level			
	None	Light	Moderate	Heavy
Fog	☒	☒	☒	☒
Rain	☒	☒	☒	☒
Snow	☒	☒	☒	☒
Wind	☒	☒	☒	☒

1. The first step is to identify the problem or question that needs to be addressed. This involves understanding the context and the specific requirements of the task.

2. Next, it is important to gather relevant information and data. This can be done through research, consultation with experts, or by analyzing existing resources.

3. Once the information is gathered, the next step is to develop a plan or strategy. This involves breaking down the problem into smaller, manageable parts and determining the best approach to solve each part.

4. After the plan is developed, the next step is to implement the solution. This involves putting the plan into action and monitoring the progress to ensure that the solution is effective.

5. Finally, it is important to evaluate the results of the solution. This involves comparing the actual outcomes with the expected results and identifying any areas for improvement.

CONTACT INFORMATION	
Company:	Terracon - Fort Lauderdale, FL (16558)
Contact:	Sergio Adasme
Phone:	954-703-1865
	Address: 5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309
	Special Instructions:

TURN AROUND TIME CODES (TAT)

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3			STD - Standard (DEFAULT)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.
Project Description:	1201 NW 16th Street, Miami, FL			ND - Next Business Day	
Project Zip Code:	33125	Sampling Date & Time:	06/07/2023	SD -Same Business Day Rush	
PO Number:	H8227138	Sampled By: RN/MM		WH - Weekend / Holiday	

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
19B	Blue/Brown Plastic Wall Sheeting w/ Glue	B	STD	N/A		
19C	Blue/Brown Plastic Wall Sheeting w/ Glue	B	STD	N/A		
20A	Off-White Wallpaper w/ Yellow Glue	B	STD	N/A		
20B	Off-White Wallpaper w/ Yellow Glue	B	STD	N/A		
20C	Off-White Wallpaper w/ Yellow Glue	B	STD	N/A		
21A	Grey/Pink Wallpaper w/ Brown Glue	B	STD	N/A		
21B	Grey/Pink Wallpaper w/ Brown Glue	B	STD	N/A		
21C	Grey/Pink Wallpaper w/ Brown Glue	B	STD	N/A		
21D	Grey/Pink Wallpaper w/ Brown Glue	B	STD	N/A		
21E	Grey/Pink Wallpaper w/ Brown Glue	B	STD	N/A		
22A	White Duct Mastic	B	STD	N/A		

[illegible]

DATE & TIME

6/13/23 2:45

<https://www.eurofinus.com/environment-testing/built-environment/resources/sampling-guides-and-forms>

Terracon

Weather	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐

003289043



PROJECT INFORMATION

TURN AROUND TIME CODES (TAT)

Company:	Terracon - Fort Lauderdale, FL (16558)		Address: 5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309	
Contact:	Sergio Adamsme		Special Instructions:	
Phone:	954-703-1865			
PROJECT INFORMATION				
Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3			TURN AROUND TIME CODES (TAT)
Project Description:	1201 NW 16th Street, Miami, FL			STD - Standard (DEFAULT)
Project Zip Code:	33125	Sampling Date & Time:	06/07/2023	ND - Next Business Day
PO Number:	H8227138	Sampled By:	RN/MM	SD - Same Business Day Rush
				WH - Weekend / Holiday
Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.				

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

**REQUESTED
SERVICES**
(Use checkboxes
below)

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
22B	White Duct Mastic	B	STD	N/A		
22C	White Duct Mastic	B	STD	N/A		
22D	White Duct Mastic	B	STD	N/A		
22E	White Duct Mastic	B	STD	N/A		
23A	White Wrap Yellow Pipe Insulation	B	STD	N/A		
23B	White Wrap Yellow Pipe Insulation	B	STD	N/A		
23C	White Wrap Yellow Pipe Insulation	B	STD	N/A		
24A	Brown Mastic on Metal Duct	B	STD	N/A		
24B	Brown Mastic on Metal Duct	B	STD	N/A		
24C	Brown Mastic on Metal Duct	B	STD	N/A		
25A	Drywall Ceiling w/ Joint Compound	B	STD	N/A		

[illegible]

SAMPLE TYPE CODES

RELINQUISHED BY

DATE & TIME

RECEIVED BY

DATE & TIME

SAMPLE TYPE CODES		RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
B - Bulk sample	P - Paint Chip sample	Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 2:45

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:

<https://www.euroinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms>

Terracon®

Weather	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐

003289043

REQUESTED SERVICES
(Use checkboxes below)

PROJECT INFORMATION

STD - Standard (DEFAULT)
ND - Next Business Day
SD - Same Business Day Rush
WH - Weekend / Holiday

needs.

[illegible]AC

Terracon

Weather	Fog	Rain	Snow	Wind
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐



003289043

003289043

REQUESTED SERVICES
(Use checkboxes below)

PROJECT INFORMATION	TURN AROUND TIME CODES (TAT)
---------------------	------------------------------

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

[illegible]

AC	6/13/23	2:45
----	---------	------

<https://www.euroinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms>

Terracon

Weather		Fog	Rain	Snow	Wind
None	☒	☒	☒	☒	
Light	☐	☐	☐	☐	
Moderate	☐	☐	☐	☐	
Heavy	☐	☐	☐	☐	

003289043



Company:	Terracon - Fort Lauderdale, FL (16558)	Address: 5371 NW 33rd Ave. Suite 201 Fort Lauderdale, FL 33309
Contact:	Sergio Adasme	
Phone:	954-703-1865	

TURN AROUND TIME CODES (TAT)

Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3		STD - Standard (DEFAULT)
Project Description:	1201 NW 16th Street, Miami, FL		ND - Next Business Day
Project Zip Code:	33125	Sampling Date & Time: 06/07/2023	SD - Same Business Day Rush
PO Number:	H8227138	Sampled By: RN/MMM	WH - Weekend / Holiday

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.

Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
31C	12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue	B	STD	N/A		
32A	9"x9" Vinyl Floor Tile and Black Mastic					
	12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
32B	12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
32C	12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
33A	12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue	B	STD	N/A		
33B	12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue	B	STD	N/A		
33C	12"x12" Pink Stone Patterned Vinyl Floor Tile w/ Brown Glue over Brown 12"x12" Vinyl Floor Tile w/ Brown Glue	B	STD	N/A		
34A	12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
34B	12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
34C	12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
35A	Cream Fiber Reinforced Plastic and Brown Glue	B	STD	N/A		

[illegible]

3 - Bulk sample	P - Paint Chip sample
-----------------	-----------------------

Marcello Meneses

6/13/2023 12:11 PM

AC

DATE & TIME

2.45

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at: <https://www.eurofinus.com/environment/testing/all/environmental-resources/sampling-guides-and-forms>.

CHAIN OF CUSTODY
www.eurofinsus.com/Built

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
Burlingame, CA: 111 Arza Blvd., Suite 122, Burlingame, CA 94010 * (866) 886-6653



Weather	Fog	Rain	Snow	V
None	☒	☒	☒	
Light	☐	☐	☐	
Moderate	☐	☐	☐	
Heavy	☐	☐	☐	

003289043

REQUESTED
SERVICES
(Use checkboxes
below)

CONTACT INFORMATION						
Company:	Terracon - Fort Lauderdale, FL (16558)	Address: 5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309				
Contact:	Sergio Adasme	Special Instructions:				
Phone:	954-703-1865					
PROJECT INFORMATION						
Project ID:	VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3					
Project Description:	1201 NW 16th Street, Miami, FL					
Project Zip Code:	33125	Sampling Date & Time:	06/07/2023			
PO Number:	H8227138	Sampled By:	RN/MM			
TURN AROUND TIME CODES (TAT)						
	STD - Standard (DEFAULT)	Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.				
	ND - Next Business Day					
	SD - Same Business Day Rush					
	WH - Weekend / Holiday					
Sample ID	Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
35B	Cream Fiber Reinforced Plastic and Brown Glue	B	STD	N/A		
35C	Cream Fiber Reinforced Plastic and Brown Glue	B	STD	N/A		
36A	White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
36B	White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
36C	White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic	B	STD	N/A		
L1	White on Drywall Wall	P	STD	N/A		
L2	Cream on Metal Door Frame	P	STD	N/A		
L3	Red on Metal Door	P	STD	N/A		
L4	Cream on Metal Double Door	P	STD	N/A		
L5	Brown on Drywall	P	STD	N/A		
L6	Brown on Concrete Wall	P	STD	N/A		

SAMPLE TYPE CODES		RELINQUISHED BY	DATE & TIME	RECEIVED BY	DATE & TIME
B - Bulk sample	P - Paint Chip sample	Marcello Meneses	6/13/2023 12:11 PM	AC	6/13/23 2:45

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:
<https://www.eurofinsus.com/environmental-testing/built-environment/resources/sampling-guides-and-forms/>

CHAIN OF CUSTODY
www.eurofinsus.com/Built

New Jersey: 3000 Lincoln Drive East, Suite A, Marlton, NJ 08053 * (866) 871-1984
Phoenix, AZ: 1501 West Knudsen Drive, Phoenix, AZ 85027 * (800) 651-4802
Burlingame, CA: 111 Anza Blvd., Suite 122, Burlingame, CA 94010 * (866) 888-6653



Weather	Fog	Rain	Snow	WI
None	☒	☒	☒	☒
Light	☐	☐	☐	☐
Moderate	☐	☐	☐	☐
Heavy	☐	☐	☐	☐



003289043

REQUESTED
SERVICES
(Use checkboxes
below)

Company: Terracon - Fort Lauderdale, FL (16558)		Address: 5371 NW 33rd Ave, Suite 201 Fort Lauderdale, FL 33309					
Contact: Sergio Adasme	Special Instructions:						
Phone: 954-703-1865							
PROJECT INFORMATION							
Project ID: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3							
Project Description: 1201 NW 16th Street, Miami, FL							
Project Zip Code: 33125	Sampling Date & Time: 06/07/2023						
PO Number: H8227138	Sampled By: RN/MM						
Sample ID		Description	Sample Type (Below)	TAT (Above)	Volume / Area (as applicable)	ISO Class (as applicable)	Notes (Time of day, Temp, RH, etc.)
L7		White on Concrete Wall	P	STD	N/A		
L8		Grey on Concrete Wall	P	STD	N/A		
L9		Grey on Metal Door Frame	P	STD	N/A		
L10		Blue on Concrete Wall	P	STD	N/A		
L11		Yellow on Drywall	P	STD	N/A		
L12		Dark Grey on Metal Door	P	STD	N/A		
L13		Dark Grey on Metal Door Frame	P	STD	N/A		
L14		Cream on Metal Door	P	STD	N/A		
L15		Cream on Metal Door Frame	P	STD	N/A		
L16		Red on Wooden Door	P	STD	N/A		
Rushes received after 2pm or on weekends, will be considered received the next business day. Please alert us in advance of weekend analysis needs.							
Asbestos PLM							
Lead - Flame AA							

SAMPLE TYPE CODES		RELINQUISHED BY		DATE & TIME		RECEIVED BY		DATE & TIME	
B - Bulk sample	P - Paint Chip sample	Marcello Meneses		6/13/2023 12:11 PM		AC		6/13/23 2:45	

By submitting this Chain of Custody, you agree to be bound by the terms and conditions set forth at:
<https://www.eurofinsus.com/environment-testing/built-environment/resources/sampling-guides-and-forms/>

Appendix C

LCP Analytical Laboratory Data

Report for:

Mr. Sergio Adasme
Terracon - Fort Lauderdale, FL
5371 NW 33rd Ave.
Suite 201
Fort Lauderdale, FL 33309

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-3; 1201 NW 16th Street, Miami, FL
EML ID: 3289043

Approved by:



Laboratory Manager
Danny Li

Dates of Analysis:

Lead - Flame AA: 06-20-2023

Service SOPs: Lead - Flame AA (EM-BC-S-8443)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. Due to the nature of the analyses performed, field blank correction of results is not applied. The results relate only to the samples as received and tested. Sample size, as it relates to Wipe samples only, is supplied by the client.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Eurofins EPK Built Environment Testing, LLC

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(800) 651-4802 www.eurofinsus.com/Built

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-20-2023

LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY

Location:	L1: White on Drywall Wall	L2: Cream on Metal Door Frame	L3: Red on Metal Door	L4: Cream on Metal Double Door
Comments (see below)	A	A	A	A
Lab ID-Version‡:	15961351-1	15961352-1	15961353-1	15961354-1
Analysis Date:	06/20/2023	06/20/2023	06/20/2023	06/20/2023
Sample type	Paint Chip sample	Paint Chip sample	Paint Chip sample	Paint Chip sample
Method*	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified
† Method Reporting Limit	40 ppm	40 ppm	110 ppm	39 ppm
Sample size	0.2528 grams	0.2505 grams	0.0941 grams	0.2550 grams
§ Total Lead Result	< 40 ppm	41 ppm	130 ppm	< 39 ppm

Comments: A) The relative percent difference of the matrix duplicate pair was above control limits. The laboratory control sample and matrix blank were both within control limits and validated the batch.

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA-LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins EPK Built Environment Testing, LLC

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(800) 651-4802 www.eurofinsus.com/Built

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-20-2023

LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY

Location:	L5: Brown on Drywall	L6: Brown on Concrete Wall	L7: White on Concrete Wall	L8: Grey on Concrete Wall
Comments (see below)	A	A	A	A
Lab ID-Version‡:	15961355-1	15961356-1	15961357-1	15961358-1
Analysis Date:	06/20/2023	06/20/2023	06/20/2023	06/20/2023
Sample type	Paint Chip sample	Paint Chip sample	Paint Chip sample	Paint Chip sample
Method*	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified
† Method Reporting Limit	39 ppm	39 ppm	39 ppm	40 ppm
Sample size	0.2586 grams	0.2567 grams	0.2555 grams	0.2523 grams
§ Total Lead Result	< 39 ppm	< 39 ppm	< 39 ppm	< 40 ppm

Comments: A) The relative percent difference of the matrix duplicate pair was above control limits. The laboratory control sample and matrix blank were both within control limits and validated the batch.

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA-LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins EPK Built Environment Testing, LLC

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(800) 651-4802 www.eurofinsus.com/Built

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-20-2023

LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY

Location:	L9: Grey on Metal Door Frame	L10: Blue on Concrete Wall	L11: Yellow on Drywall	L12: Dark Grey on Metal Door
Comments (see below)	A	A	A	A
Lab ID-Version‡:	15961359-1	15961360-1	15961361-1	15961362-1
Analysis Date:	06/20/2023	06/20/2023	06/20/2023	06/20/2023
Sample type	Paint Chip sample	Paint Chip sample	Paint Chip sample	Paint Chip sample
Method*	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified
† Method Reporting Limit	42 ppm	40 ppm	40 ppm	56 ppm
Sample size	0.2353 grams	0.2510 grams	0.2524 grams	0.1770 grams
§ Total Lead Result	45 ppm	< 40 ppm	< 40 ppm	< 56 ppm

Comments: A) The relative percent difference of the matrix duplicate pair was above control limits. The laboratory control sample and matrix blank were both within control limits and validated the batch.

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA-LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.

† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Eurofins EPK Built Environment Testing, LLC

2841 Dow Avenue, Suite 300, Tustin, CA 92780

(800) 651-4802 www.eurofinsus.com/Built

Client: Terracon - Fort Lauderdale, FL

C/O: Mr. Sergio Adasme

Re: VAMC - Renovate Corridors - Bldg. 1 - Floors 2-

3; 1201 NW 16th Street, Miami, FL

Date of Sampling: 06-07-2023

Date of Receipt: 06-13-2023

Date of Report: 06-20-2023

LEAD: FLAME ATOMIC ABSORPTION SPECTROMETRY

Location:	L13: Dark Grey on Metal Door Frame	L14: Cream on Metal Door	L15: Cream on Metal Door Frame	L16: Red on Wooden Door
Comments (see below)	A	A	A	A
Lab ID-Version‡:	15961363-1	15961364-1	15961365-1	15961366-1
Analysis Date:	06/20/2023	06/20/2023	06/20/2023	06/20/2023
Sample type	Paint Chip sample	Paint Chip sample	Paint Chip sample	Paint Chip sample
Method*	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified	NIOSH 7082 & EPA 7000B modified
† Method Reporting Limit	62 ppm	57 ppm	99 ppm	69 ppm
Sample size	0.1601 grams	0.1766 grams	0.1009 grams	0.1445 grams
§ Total Lead Result	< 62 ppm	< 57 ppm	< 99 ppm	350 ppm

Comments: A) The relative percent difference of the matrix duplicate pair was above control limits. The laboratory control sample and matrix blank were both within control limits and validated the batch.

Sample results have not been corrected for blank values.

Bulk samples are not covered under the AIHA-LAP, LLC service accreditation.

Wipe samples must meet ASTM E1792 criteria. Method Reporting Limits may not be valid for non-ASTM E1792 wipe samples.

*Sample preparation and analytical methods are based upon NIOSH 7082 and EPA 7000B.


† The Method Reporting Limit is the minimum concentration of Lead that the laboratory can confidently detect in the sample.

§ Total Lead Result has been rounded to two significant figures to reflect analytical precision.

‡ A "Version" indicated by -"x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".


Appendix D

Licenses and Certifications

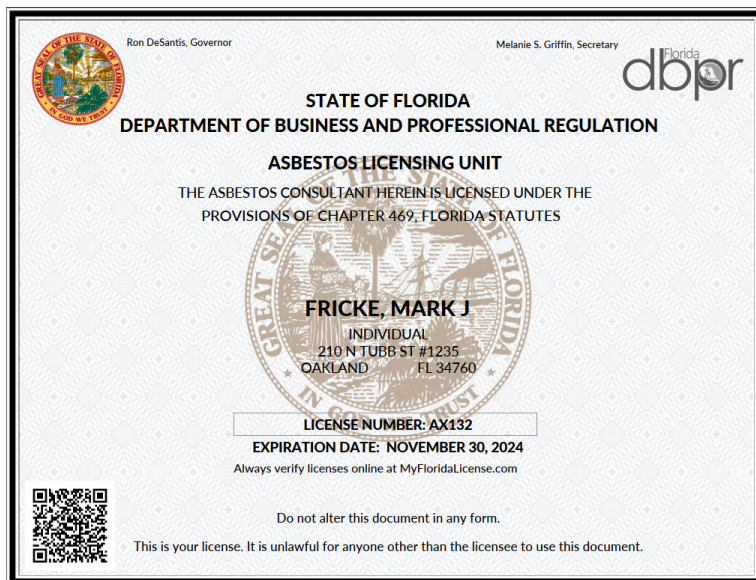

Appendix E

Sample Location Diagram

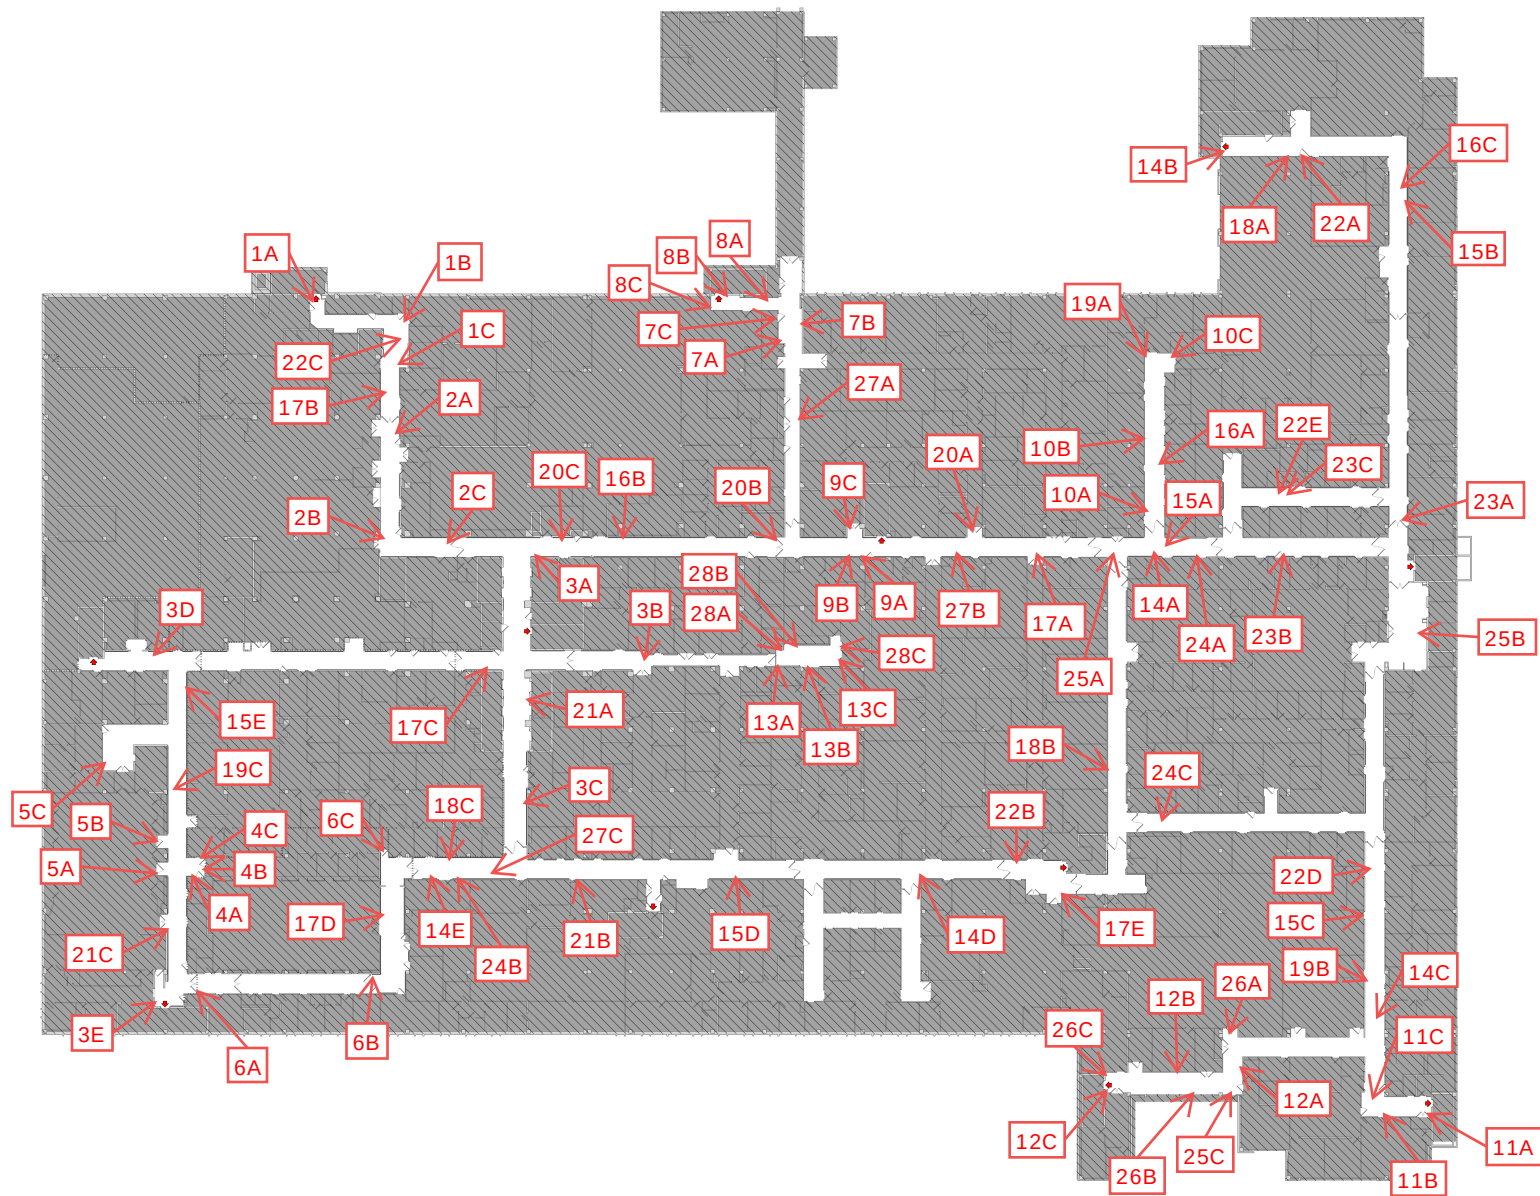

Second Floor Sample Location Diagram


Scale: Not to Scale

Project Number: H8227138



VAMC Building 1 - 2nd and 3rd Floor Corridors

1201 NW 16th Street
Miami, Florida

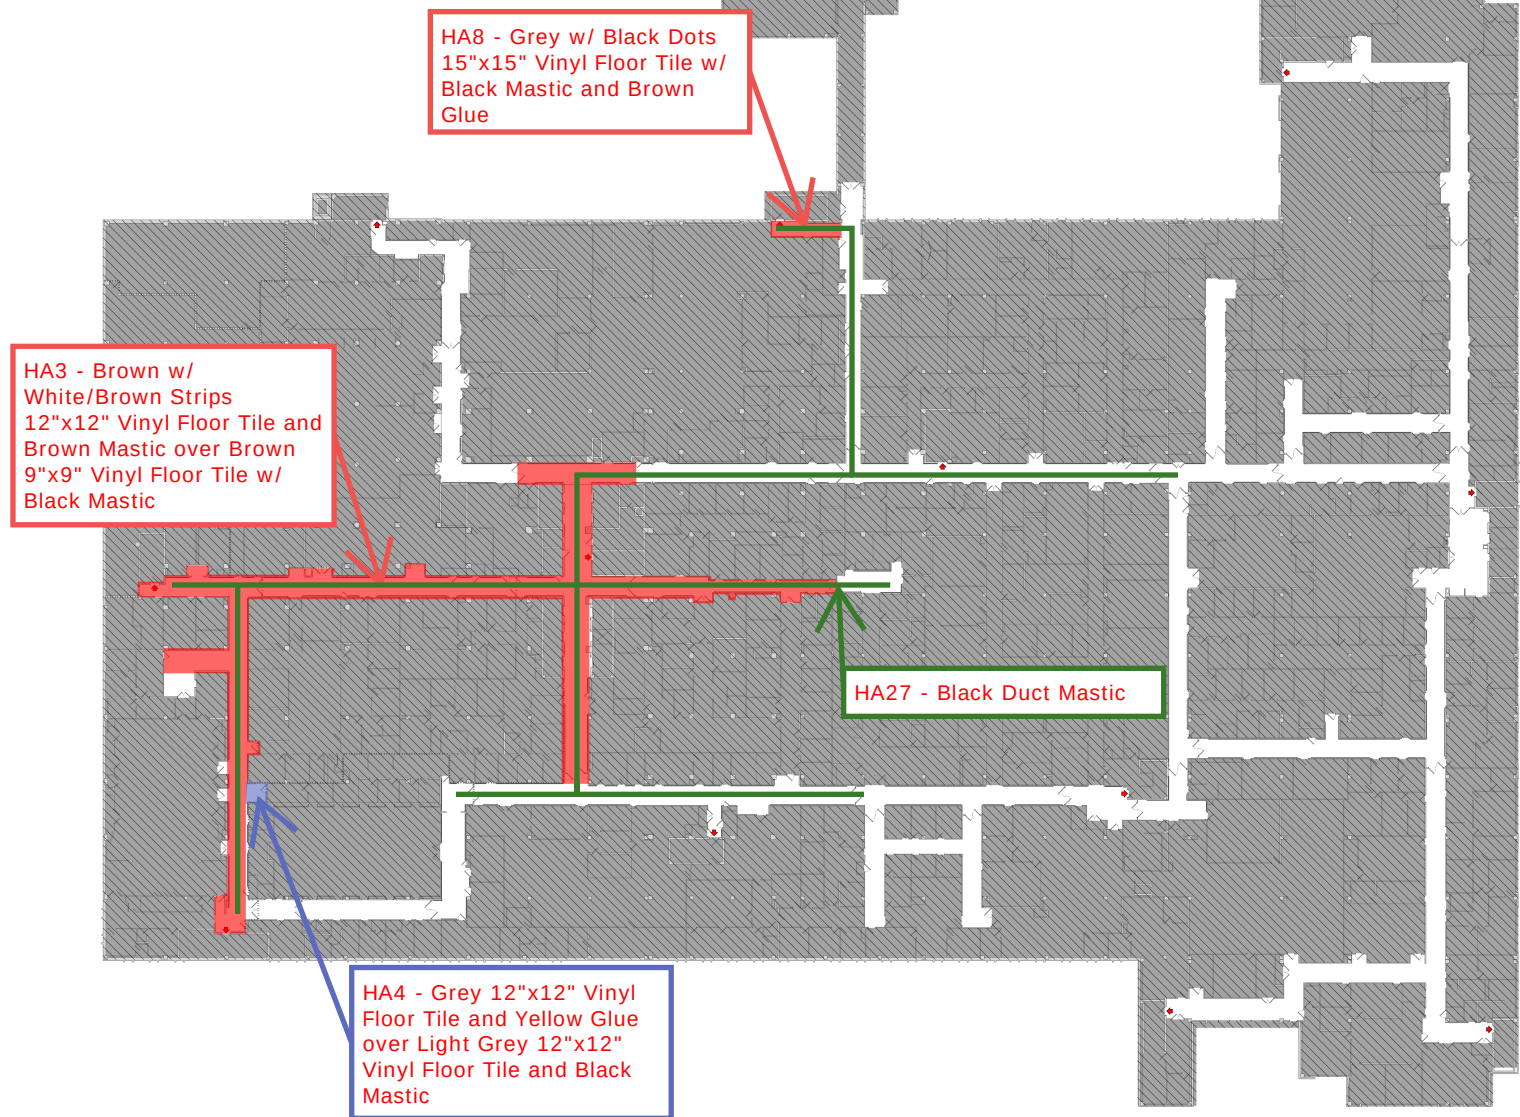

Second Floor Asbestos-Containing Material Diagram


Scale: Not to Scale

Project Number: H8227138



VAMC Building 1 - 2nd and 3rd Floor Corridors

1201 NW 16th Street
Miami, Florida

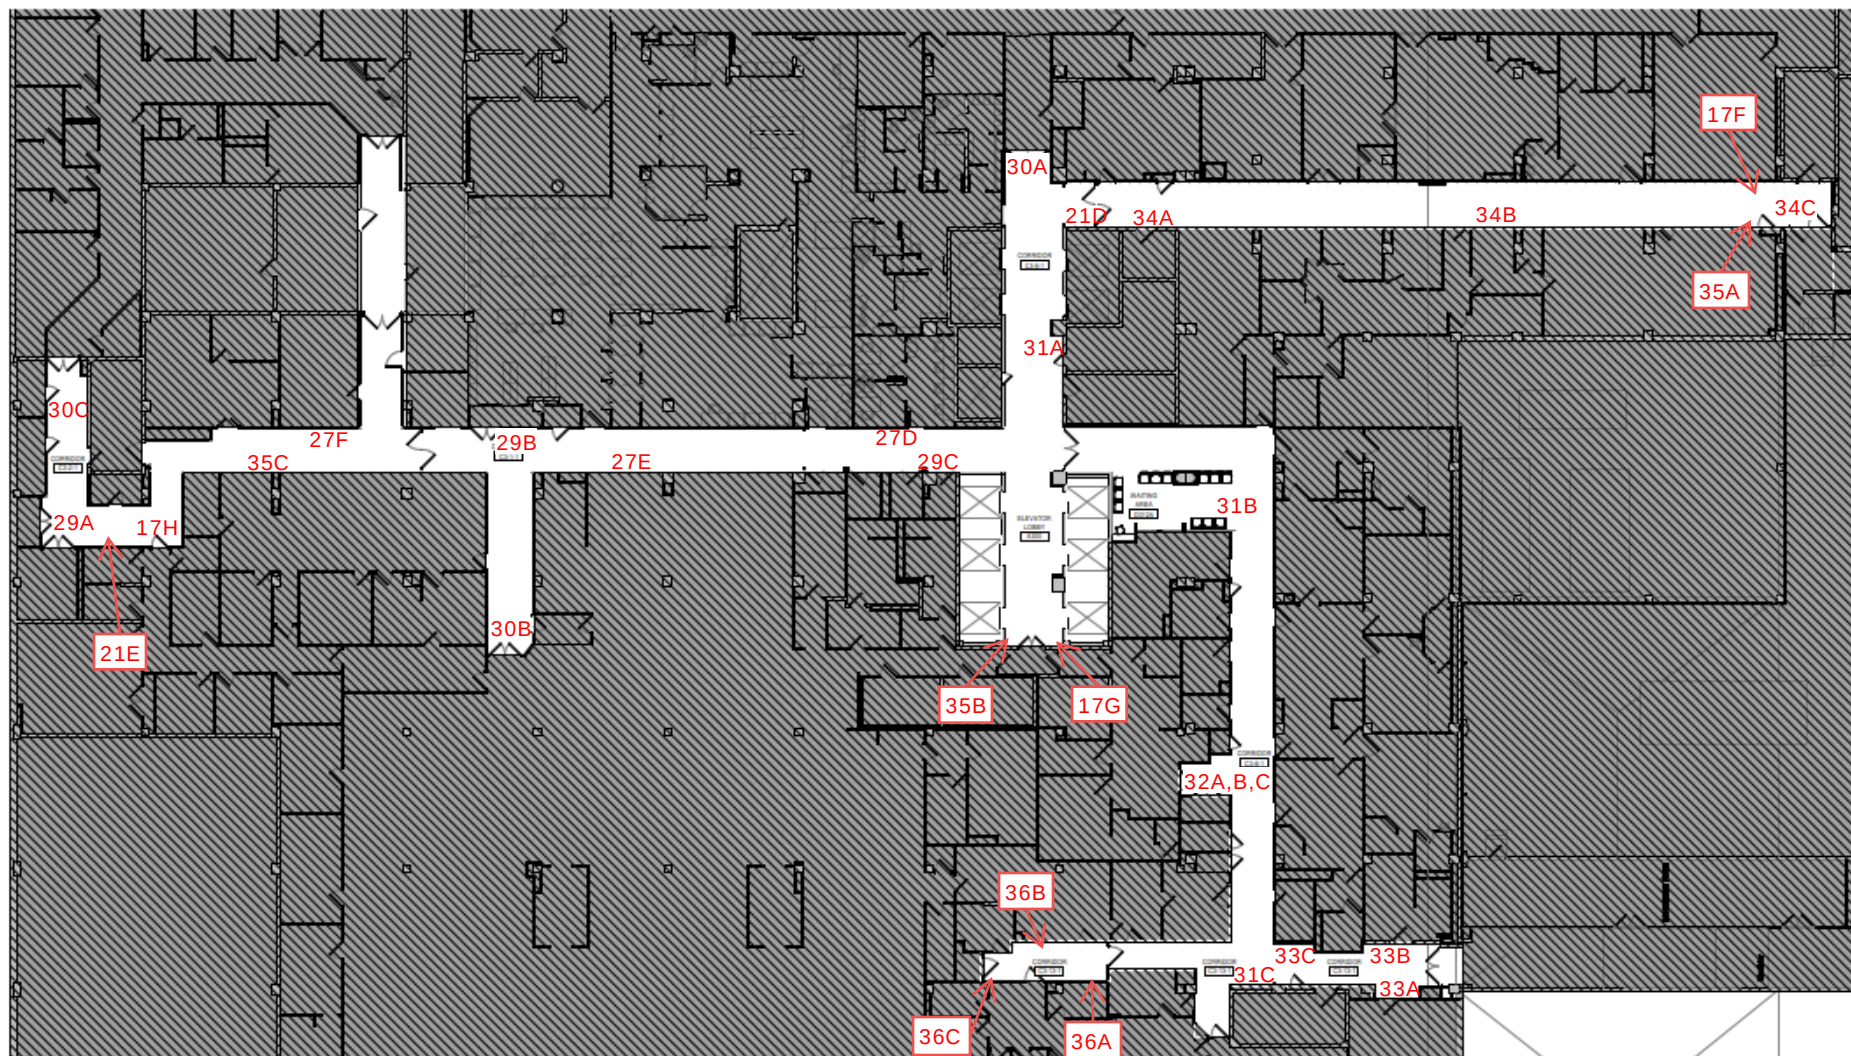

Third Floor Sample Location Diagram


Scale: Not to Scale

Project Number: H8227138



VAMC Building 1 - 2nd and 3rd Floor Corridors

1201 NW 16th Street
Miami, Florida

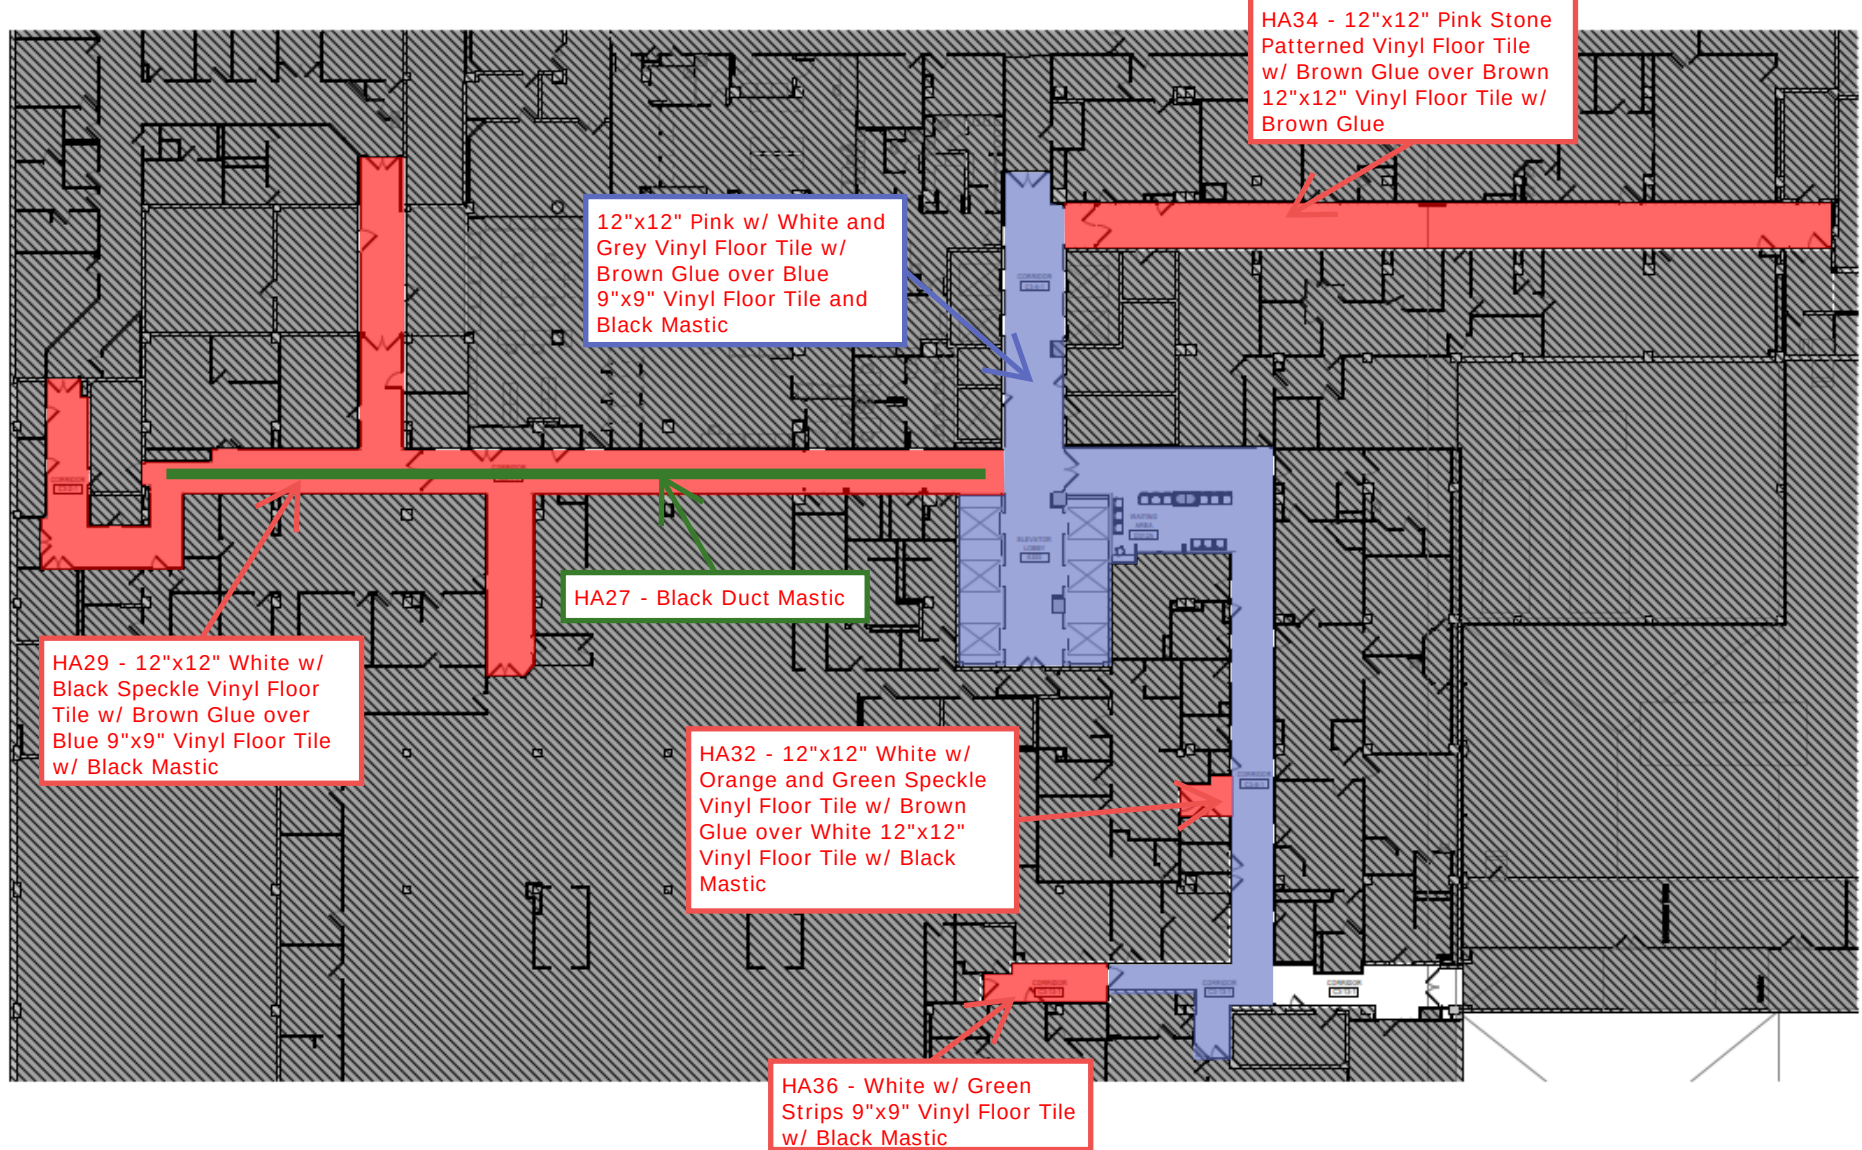

Third Floor Asbestos-Containing Material Diagram

Scale: Not to Scale

Project Number: H8227138



VAMC Building 1 - 2nd and 3rd Floor Corridors

1201 NW 16th Street
Miami, Florida

Appendix F

Photographs



Photo 1: HA-3 Brown w/ White/Brown Strips 12"x12" Vinyl Floor Tile and Brown Mastic over Brown 9"x9" Vinyl Floor Tile w/ Black Mastic



Photo 2: HA-4 Grey 12"x12" Vinyl Floor Tile and Yellow Glue over Light Grey 12"x12" Vinyl Floor Tile and Black Mastic



Photo 3: HA-3 Grey w/ Black Dots 15"x15" Vinyl Floor Tile w/ Black Mastic and Brown Glue

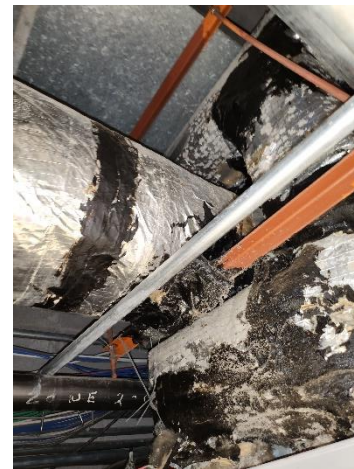


Photo 4: HA-27 Black Duct Mastic

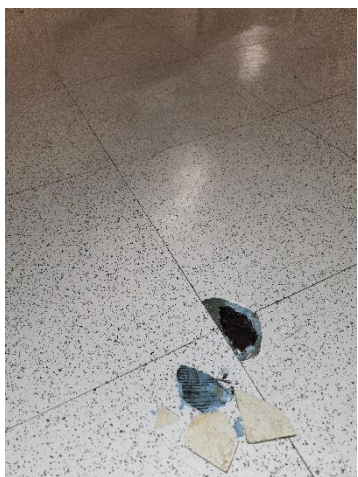


Photo 5: HA-29 12"x12" White w/ Black Speckle Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile w/ Black Mastic



Photo 6: HA-31 12"x12" Pink w/ White and Grey Vinyl Floor Tile w/ Brown Glue over Blue 9"x9" Vinyl Floor Tile and Black Mastic



Photo 7: HA-32 12"x12" White w/ Orange and Green Speckle Vinyl Floor Tile w/ Brown Glue over White 12"x12" Vinyl Floor Tile w/ Black Mastic



Photo 8: HA-34 12"x12" Light Brown w/ Dark Brown Speckle Vinyl Floor Tile w/ Brown Glue over Blue Vinyl Floor Tile w/ Black Mastic



Photo 9: HA-36 White w/ Green Strips 9"x9" Vinyl Floor Tile w/ Black Mastic



Photo 10: L2 Cream on Metal Door Frame



Photo 11: L3 Red on Metal Door



Photo 12: L9 Grey on Metal Door Frame



Photo 13: L16 Red on Wooden Door