UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Lite and Easy	**Date:**	02/05/2025
Site Address:	8-10 Naweena Road Regency Park	**Site Contact:**	Peter
		Phone:	0417782039
Customer PO #:		**Internal Job #:**	5395

Subject: Replace PT100 on lunch tool (12497.61) it is overheating and fix thread insert for knife

Equipment Type:	Serial Number:	Customer Line # (if applicable):
Trave 340		Line 1

Equipment condition:

Excellent Condition

Work Performed:

- Henry messaged me that they are having sealing issue with one of the lunch tools.
- The previous day the tool over heated and it was smoking. Henry said they did dry out the plug.
- After some checks we found that a piece of the red O-cord was missing on the top tool and that is why the film was not cutting correctly.
- Henry called me to info that they still having issue with the tool as it is melting the plastic.
- I arrange to go on site.
- Arrived on site and spoke to Henry and Peter.
- Stripped the tool and replaced the PT100 with a new one.
- While I was stripping the tool I found a lot of moisture in the plug and blue hose.
- After assembling the tool, I fixed a stripped out thread insert for one of the Knifes.
- Installed tool back into line and let it heat up.
- Motored heat up all good.
- Ran a bunch of empty trays to test sealing and tool. All good.
- Left tool for +- 20 min and then checked temp again and ran some more trays to make sure we do not have temperature creep.

Lot of sins of moisture in the plug. Water droplets were visible on the gland of the plug.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

GENERAL SERVICE REPORT

Lot of moisture in the vacuum gauge on the tool showing that the tool is getting exposed to water during the cleaning.

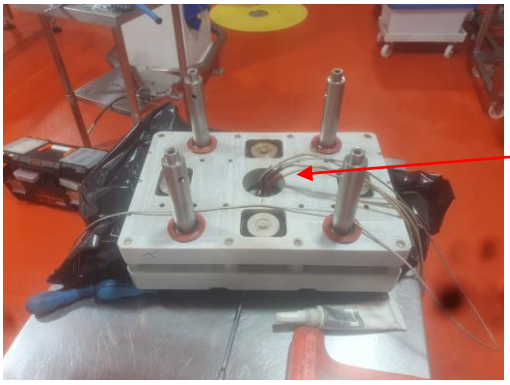

Stripped tool and replaced PT 100

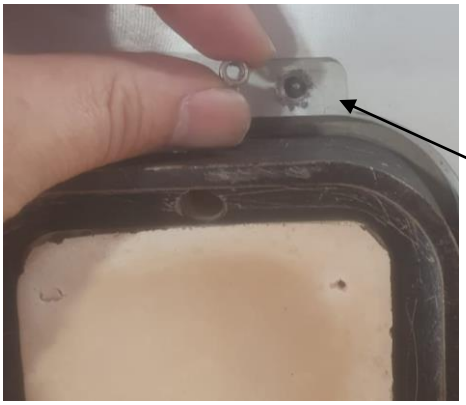

Fix knife thread insert

Inspect plug on machine. Plug insert is good condition also bent clips so it clips on tighter to the tool plug.

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Ran a bunch of trays to test tool.

SPARE PARTS USED				
Part Number:	**Description:**	**Qty:**	**Chargeable?**	
			Yes ☐	No☐
			Yes☐	No☐
			Yes☐	No☐

STATUS		
Machine Tested?	Yes☒	No☐
Comments: Ran empty trays		
Revisit Required?	Yes☐	No☐
Comments:		

RECOMMENDATIONS
Comments:

TECHNICIAN HOURS	David van der Merwe	
Time	**Start**	**Finish**
Travel To Site:	8:30	9:30
Onsite:	9:30	12:00
Travel From Site:	12:00	13:00
Remote assistance:		
Report writing:	14:00	14:30
Overnight stay	☐	
Overnight stay with flights	☐	

REPORT SIGN OFF			
	Print Name:	**Signature:**	**Date:**

UptimeEquip
Innovative Maintenance Support Program

SelectEquip
Flexible Innovative Packaging Systems

GENERAL SERVICE REPORT

Customer:	Peter	X _____	02/05/2025
Technician:	David		

Select Equip
7 Gatwick Road Bayswater North
Victoria 3153 Australia
Phone +61 (3) 8720 8400

Trading as Select Equip
Select Packaging Systems Pty Ltd ABN 59 087 731 520
spares@selectequip.com.au www.selectequip.com.au