


Site Blind Spot Report

Blind spot observed

Published Sep 5, 2026, 10:36 AM Contract v1

This report identifies blind spots under the stated simulation assumptions. It does not certify safety. No failure observed does not mean no failure exists.

Site and world

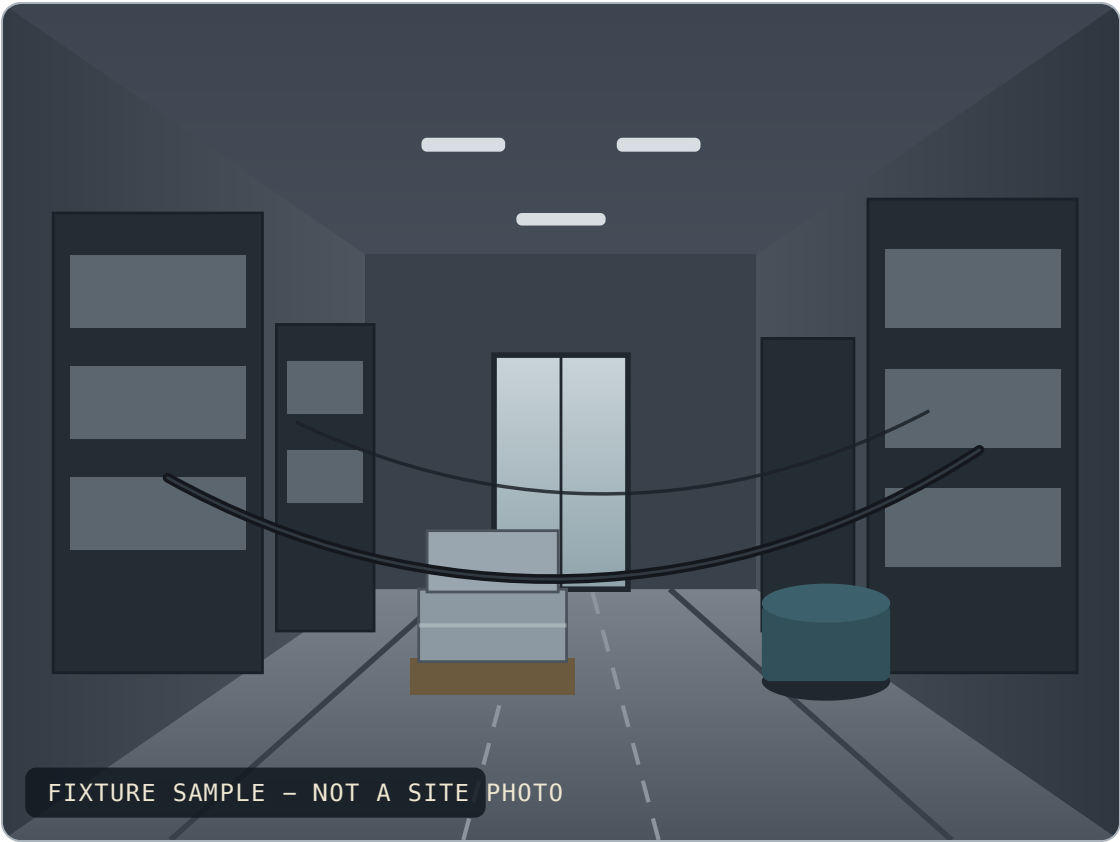

World	Intake Bay 3 (fixture sample) (v1)
Appearance asset	procedural · f1x7u5e0000000... · Sep 5, 2026, 10:00 AM
Collider asset	procedural · f1x7u5e0000000...
Preparation	183.0 s (cached before this session)
Scale source	operator reference · verified · reference "Marked floor lane width" 2.40 m (operator measured)
Scale correction	×1.020

Scale uncertainty	Scale corrected against an operator-measured reference (fixture). Residual splat reconstruction error still applies.
-------------------	--

Scenario

Instruction	“Inspect the intake bay drive lane for low cables and staged pallets before the night shift.” Preset parser
Platform	ground · r 0.35 m · h 0.42 m · 1.2 m/s · brake 1.5 m/s ² · latency 0.20 s · margin 0.30 m
Route	3 waypoints · seed 41 · scenario v1

- Kinematic ground platform with straight-line braking; no dynamics, slip, or controller model.
- World geometry from a generated reconstruction; positions are approximate.
- Hazard dimensions are authored envelopes with the stated evidence, not sensed values.

Sensor configuration

Preset	Baseline stereo · v1
Perception model	stereo-approx-fixture-1
Stereo raster	640 × 400 px · h-fov 69°
Working range	0.3 – 12.0 m · min target 2 px · dropout on

- Single forward-facing stereo pair; no side or rear coverage.
- Platform route, speed, and braking identical across presets (fixture).
- Passive-stereo approximation, not a calibrated physical sensor model.

Metrics

Hazard coverage	33.3% · 1/3 detected before the stop boundary (2 missed or late) · pass: diagnostic full route
False stops	0.0% · 0/2 stops were false · pass: reactive
Collisions	1
Near misses	0
Route completion	61%
Completion time	Not completed

Termination	Terminated by collision
Run	run-fixture-baseline · seed 41 · engine fixture-0 · client computed · completed Sep 5, 2026, 10:14 AM

Hazard findings (3)

Shrink-wrapped pallet stack (fixture stand-in)

Detected in time

[Seen in source photo](#) box 1.20 m × 1.40 m × 1.00 m · opaque · dimensions assumed

Staged pallet stack at the lane edge, matching the fixture photo.

First detection (route clearance)	First detection (camera depth)	Theoretical threshold (camera depth)
6.40 m	6.80 m	9.50 m

Required stopping distance
1.32 m

Large opaque volume produced dense stereo support well before the stop boundary (fixture data).

Sampling: raster

Suspended power cable - 12 mm (fixture)

Detected late

[Seen in source photo](#) cable ø 12 mm · dark matte · dimensions operator measured

Low sag crossing the drive lane; visible in the fixture source photo.

First detection (route clearance)	First detection (camera depth)	Theoretical threshold (camera depth)
0.82 m	1.08 m	1.62 m

Required stopping distance
1.32 m

12 mm sheath first crossed the 2 px support threshold at 0.82 m remaining; required stopping distance is 1.32 m at 1.2 m/s, so braking started too late (fixture data).

Sampling: raster

Overhead comms line - 6 mm (fixture)

Missed

Authored stress test cable ø 6 mm · dark matte · dimensions assumed

Authored stress test: thinner line at the same height band, not confirmed in the photo.

First detection (route clearance)	First detection (camera depth)	Theoretical threshold (camera depth)
Never detected on the tested trajectory	Not evaluated	0.94 m

Required stopping distance
1.32 m

6 mm line never exceeded the 2 px stereo support threshold anywhere on the tested trajectory (fixture data).

Sampling: raster

Scene evidence

No scene captures were attached to this run.

Limitations

- Fixture data: produced by the deterministic UI fixture bridge, not by a simulation run.
- World scale carries the stated calibration uncertainty; all ranges inherit it.
- Kinematic platform with straight-line braking; no dynamics, slip, or controller behavior.
- Passive-stereo approximation with a pixel-support threshold; not a physical sensor model.
- Hazards are authored envelopes; the comms line is an authored stress test, not photo-confirmed.
- Results apply to the tested route and configuration only.

This report identifies blind spots under the stated simulation assumptions. It does not certify safety. No failure observed does not mean no failure exists.

report rpt-fixture-0001 · scenario scn-fixture-01 v1 · world wr1-fixture-01 v1 · config v1