MATERIAL TESTING WORKS

Manggahan High school - Bobby C. Eusebio Building
Magsaysay Ave. Manggahan, Pasig City

NOVEMBER 2025

SB STRUC

A. INTRODUCTION

SBStruc Engineering conducted destructive testing, non-destructive testing, and foundation excavation on the existing **six-storey building, Manggahan High school - Bobby C. Eusebio Building**, located in **Magsaysay Ave. Manggahan, Pasig City**.

Manggahan High school - Bobby C. Eusebio Building

This work was undertaken solely to gather data and information on the existing building. Concrete core extraction and rebar extraction were performed to obtain samples for the determination of concrete and reinforcing steel properties, respectively. Non-destructive testing, including rebar scanning and rebound hammer testing, was also carried out to collect additional data on concrete characteristics, identify rebar sizes, and document the probable quantity and layout of reinforcement within the building's structural components. Chipping of selected portions of the existing slab was conducted to verify the existing reinforcement. Excavation works were conducted to gather data on the existing foundation.

B. DATA GATHERING FOR SUPERSTRUCTURE

B.1. Rebar Scanning

Rebar scanning was performed using non-destructive testing methods to determine the quantity, spacing, and approximate diameter of reinforcing steel bars embedded within the concrete elements. This activity was carried out to verify reinforcement detailing and support the structural assessment without causing damage to the members. A total of **twenty (20) rebar scan locations** were evaluated, and initial rebar data were recorded on site during the

scanning process. The compiled results for the selected structural members are presented in **Annex I**.

Figure B.1. REBAR SCANNING

B.2. Rebound Hammer Test

Non-destructive testing using the Rebound Hammer Test was conducted on selected structural members to assess the uniformity and relative quality of the in-situ concrete strength, as indicated by the measured Q-values. A total of **thirty-six (36) test locations** were evaluated and distributed across the structure. At each test location, ten (10) rebound hammer impacts were applied in accordance with standard testing procedures consistent with ASTM C805. The rebound numbers obtained were statistically analyzed, with mean values calculated for each structural member. A summary of the rebound number test results is presented in **Annex II**.

Figure B.2. REBOUND HAMMER TESTS

B.3. Concrete Core Extraction

Concrete core extraction was conducted on selected structural members to obtain representative samples of the building's in-situ concrete. A total of **fifteen (15) cores** were extracted. The specimens were used to assess concrete quality, including compressive strength and overall material condition. Compressive strength testing was performed in accordance with ASTM C42/C42M, and the corresponding results are presented in **Annex III**.

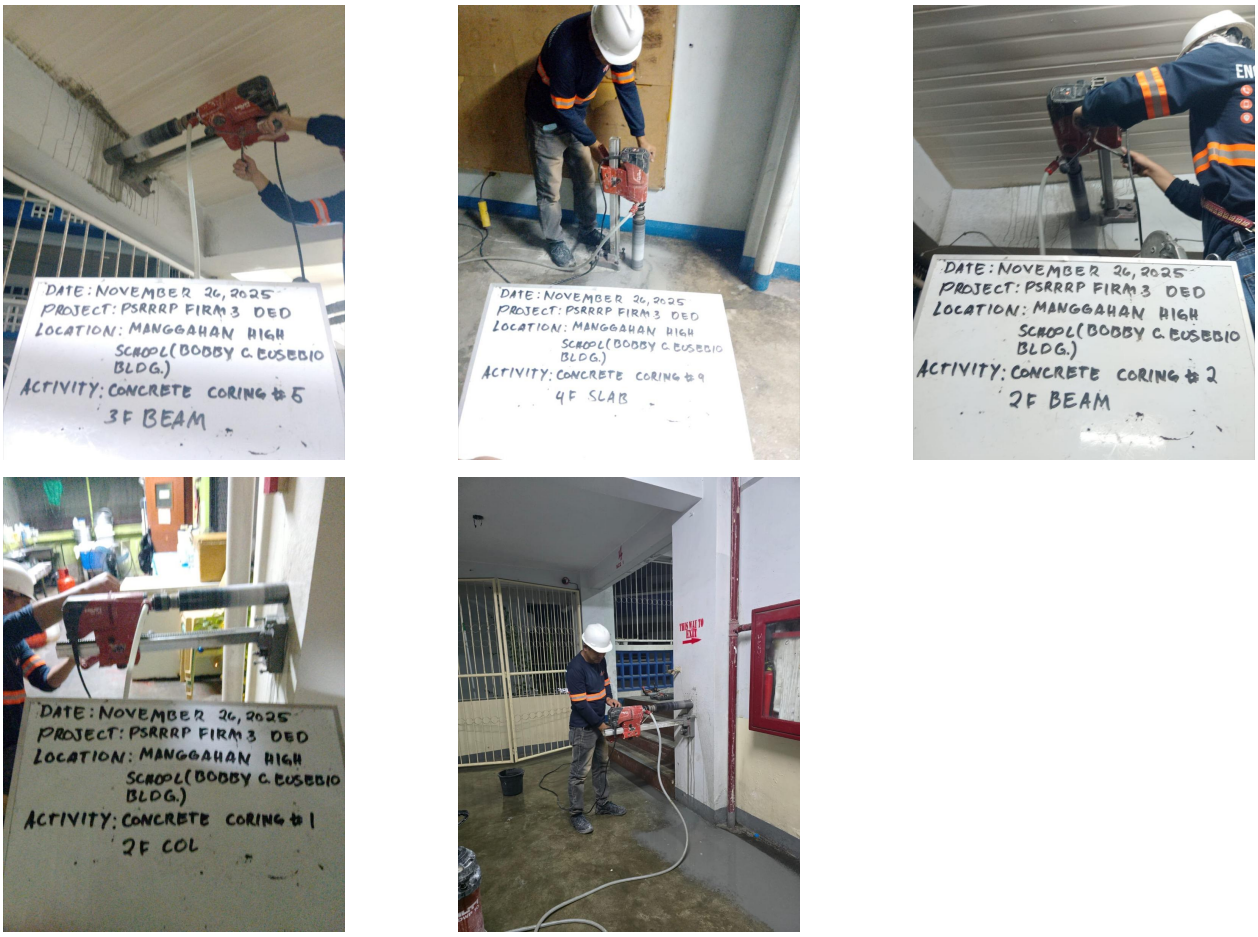

Figure B.3.1 Concrete Core Extraction

Figure B.3.2 Extracted Core Samples

B.4. Rebar Extraction

Rebar extraction was carried out on selected structural members to obtain representative reinforcement samples from the building's structural system. A total of **two (2) rebar samples** were extracted.

Figure B.4.1 Rebar Extraction

Figure B.4.2 Extracted Rebar Samples

The extracted rebars were evaluated to determine their material properties, including tensile strength. The tensile test results are presented in **Annex IV**.

B.5. Chipping of Existing Slab

Chipping of the existing slab at one selected location was conducted to verify the reinforcement size.

Figure B.5. Chipping of Existing Slab

B.6. Restoration Works

Following the completion of concrete coring, rebar extraction, and chipping of slab, reinstatement works were carried out to restore the affected structural elements and ensure continuity of structural performance. Structural components from which samples were extracted were restored to their original condition. Removed reinforcement was replaced with new rebars of equivalent diameter and grade to maintain structural capacity. Concrete that was chipped or removed during the verification and extraction process was reinstated using **SikaGrout®-212 PH** non-shrink grout, with proper bonding between existing and new concrete ensured through the application of **Sikadur®-752** structural adhesive.

Figure B.6. Restoration Works

Prepared by:

ENGR. CHRISTIAN Q. ATAD
LEAD STRUCTURAL INSPECTOR